MOVA BUILDING 22 JALAN KILANG SINGAPORE 159419

Claim Reference: TP

Assessment Number: CK132960

Version: MOVAAUTO/1

Date Calculated: 24/10/2018 05:54

Full Report - V1

Registration: SDL5141H

Printed: 24/10/2018 13:15

CD AUTO CHANGER

MEMORY PACKAGE

DIPPING MIRROR

SPARE WHEEL

HEADLAMP WASHERS

LEATHER STRG WHEEL

EQUIP CURLED MAPLE

H/DUTY ALTERNATOR

ALU WHEEL 8 J X 17

CLEAR COAT HARD

TWO COAT METALLIC

PARAMETER STEERING

Summary Information

Claim

Location: Singapore (SG) Currency: SGD

Printed by: Jacelyn Ooi Date of Incident: 21/10/2018
Authorisation Status: Interim Able to Authorise Repairs: TBA

Authorisation Status: Interim Able to Authorise Repairs: TBA Work Provider: AXA Insurance S'pore Pte Repairs Authorised: TBA

Ltd

Claim Reference: TP Estimated Repair Time:

Policy Number:
Other Reference:
Actual Repair Days:
Third Party:
Parts Ordered Date:
Insured Amount:
Under Warranty:
Hire Car End:

Under Warranty: Hire Car End: Warranty Expired: Vehicle Collected:

Vehicle Details

Vehicle Model Specs

Manufacturer: MERCEDES EQUIPMENT AVANTGARDE HEAVY DUTY COOLING
Model: E Class FROM VIN B296713 FOLDING DOOR MIRRORS

Sub Model: 200 KOMPRESSOR AUDIO SYSTEM 20 CC Model Sheet Number: 341 43 BI-XENON HEADLAMPS

Registration: SDL5141H LEATHER UPHOLSTERY Registration Month: ILLUM SUN VISORS

Registration Year: L/F MEMORY SEAT ADJ

VIN Number: WDB2110412B325979 KEYLESS GO
Odometer: Not Known EMISSION STD EURO 4

Odometer: Not Known EMISSION STE Colour: AUTO GEARBO

Colour: AUTO GEARBOX 5 SPEED Engine Number: TYRES 245/45 WR 17 Fuel Level: % EXTENDED FUEL TANK

MODEL 2008

PREPARE OFF VEHICLE

Vehicle Condition
Vehicle Status

Pre-Accident Condition: Severity of Impact: Steering: Vehicle Status on

Inspection:

Brakes Pedal Travel: Date of Inspection: 24/10/2018

Pre-Accident Damage:

Place of Inspection:

Tyres Condition:

Tread Depth LHF: Tread Depth RHF: Tread Depth RHR: Damage Areas: Tread Depth RHR: Direction of Impact:


Claim Reference: TP


Assessment Number: CK132960

Version: MOVAAUTO/1

Date Calculated: 24/10/2018 05:54

Full Report - V1 Registration: SDL5141H Printed: 24/10/2018 13:15

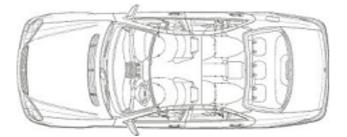

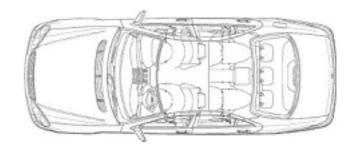

Addresses

Cost	Sun	nmary
------	-----	-------

Total Labour	\$526.50
Total Paint/Material	\$67.30
Total Parts	\$2,185.00
Excess:	TBA
Grand Total Exc GST:	\$2,778.80
7 % GST:	\$194.52
Grand Total Inc GST:	\$2,973.32

Repair Information

LABOUR	Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR
	Price / Dent - \$45 00 / HP

		Price/Dent =	= \$45.00/ AK
Repair /			
Guide Number	r Repair Details	WU	Cost Price (\$)
40-6500 01	ALIGNMENT CPL BEFORE REPAIR	7.0	31.50
40-6500 01	ALIGN VEHICLE CPL	7.0	31.50
40-4064 01	ADJUST FRONT AXLE TOE	2.0	9.00
40-6717 01	ADDITIONAL TO OPTICAL ALIGNMENT	6.0	27.00
	ADJUST R/FRONT AXLE HALF CAMBER/CASTER		
88-3956 01	RENEW R/F WING	15.0	67.50
	INCLUDES: R + R PARTITION CPL		
40-1580 01	R + R LEFT AND RIGHT FRONT WHEEL	3.0	13.50
40-2710 01	FIT R/F WHEEL	3.0	13.50
40-2125 ZAX	BALANCE WHEEL ASS WORK	2.0	9.00
33-2280 02	R + R RIGHT FRONT WHEEL HUB, RENEW RING	13.0	58.50
	SEAL (WHEEL REMOVED)		
	INCLUDES: R + R BRAKÉ CALIPER WITH		
	ATTACHED BRAKE HOSE		
1156	REPAIR R/UPP W-HOUSE S-MEMB	10.0*	45.00
0840	CHECK R/F W-HOUSE CVR FRT		
0842	CHECK R/F W-HOUSE CVR REAR		
7050	CHECK R/F UPP CONTROL ARM		
7072	CHECK R/F TENSION ROD		
7082	CHECK R/F STEERING KNUCKLE		
7088	CHECK R/F SHOCK ABSORBER		
7312	CHECK R/OUTER TIE ROD BALL		

LABOUR COST

Total Work Units	68.0	
Panel / Mechanical Labour	4.6HRS	\$207.00
Visual Alignment Labour	2.2 HRS	\$99.00
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	6.8HRS	\$306.00

Claim Reference: TP Full Report - V1
Assessment Number: CK132960 Registration: SDL5141H

Version: MOVAAUTO/1 Printed: 24/10/2018 13:15

Date Calculated: 24/10/2018 05:54

Paint Labour	4.9HRS	\$220.50
Total Labour	11.7HRS	\$526.50
lotal Labour	11./HKS	\$526.50

PAINT WORK Time Basis 10 WU =		s 10 WU = 1 HR. Price =	1 HR. Price = \$45.00/HR		
Guide Numl	ber Description	WU	Cost Price (\$)		
	- TWO COAT METALLIC				
	- PREPARE OFF VEHICLE				
742	R/F WING NEW PART PAINTING	11.0			
782	R/F WING MOULDING NEW PART PAINT K1R	3.0			
1156	R/UPP W-HOUSE S-MEMBSURFACE PAINT	5.0			
L	ABOUR COST - PAINT				
	TIME(PAINT)	19.0			
	Preparation Main Work Plastic	5.0			
	Preparation Main Work Metal	25.0			
	Preparation Work Multi Layer Paint	0.0			
	Total Work Units (10WU/HR)	49.0			
	Total Paintwork Labour	4.9HRS	\$220.50		
M	IATERIAL COST - PAINT		Cost Price		
	New Part Painting		\$23.74		
	New Part Painting - Plastic K1R		\$0.98		
	Material-Constant Main Work Metal		\$28.60		
	Surface-/Blend Paint		\$4.98		
	Material-Const Main Work Plastic		\$9.00		
	Total Excluding Pearlescent Uplift		\$67.30		
	Pearlescent Uplift @ 0.0%		\$0.00		
	Total Paint Material Cost		\$67.30		

PARTS

					Pric	ce Valid:	01/06/2015
Guide No	.Qty	Description	Part Number	Supplier		Bet.	Price (\$)
7202	1	R/F WHEEL ALLOY	211 401 3602		(0%	530.00 *
7132	1	R/F WHEEL HUB	230 330 0325			0%	850.00 *
742	1	R/F WING	211 880 1418		(0%	440.00*
786	1	R/F WING BADGE	211 817 4820			0%	35.00*
782	1	R/F WING MOULDING	211 690 2862 9999)		0%	45.00*
f: OEM Pa	rts		Sub Total				\$1,900.00
g: Origina	l		Mark Up Fro	m Cost	(15 %)		\$285.00
h: Second	hand		Sundry Parts	5	(Fixed)		\$0.00
p: Parallel			Total Parts				\$2,185.00

x: Exchange

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

	Total Extras	\$0.00
Final Calculation		·
Total Parts		\$2,185.00
Labour		
Total Panel/Mechanical	\$20	7.00
Total Paintwork	\$22	0.50
Total Visual Alignment work	\$99	9.00
Total Labour	·	\$526.50
Total Paint/Material Costs		\$67.30
Grand Total Excludes GST		\$2,778.80

Claim Reference: TP Full Report - V1

Assessment Number: CK132960 Registration: SDL5141H Version: MOVAAUTO/1 Printed: 24/10/2018 13:15

Date Calculated: 24/10/2018 05:54

GST @ 7 % \$194.52 Grand Total Includes GST \$2,973.32

Assessment Notes