

**COMFORTDELGRO  
ENGINEERING PTE LTD  
205 BRADDELL ROAD  
SINGAPORE  
579701**

**Claim Reference:**  
**Assessment Number: WW000497**  
**Version: COM-DGRO/1**  
**Date Calculated: 02/03/2019 03:58**

**Full Report - V1**  
**Registration: SJP3754K**  
**Printed: 02/03/2019 11:58**

---

### Summary Information

#### Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Toh Wee Ngo	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

---

### Vehicle Details

#### Vehicle

Manufacturer:	HONDA
Model:	City
Sub Model:	BASE MODEL
Model Sheet Number:	H2C 01
Registration:	SJP3754K
Registration Month:	
Registration Year:	
VIN Number:	
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

#### Model Specs

FROM MODEL 2009	AIR CONDITIONING
1.5 LTR 88KW	TWO COAT METALLIC
PREPARE OFF VEHICLE	

---

### Vehicle Condition

#### Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	22/11/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:		
Tread Depth LHF:	Tread Depth RHF:	
Tread Depth LHR:	Tread Depth RHR:	
Damage Areas:	Direction of Impact:	

**COMFORTDELGRO ENGINEERING PTE LTD**

Claim Reference:

Assessment Number: WW000497

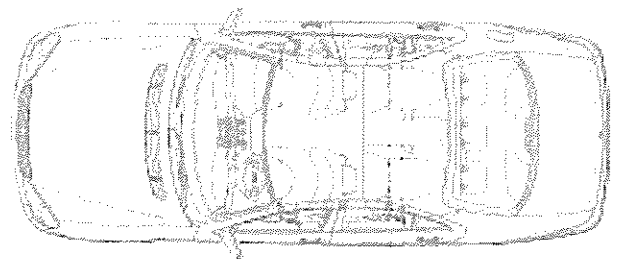
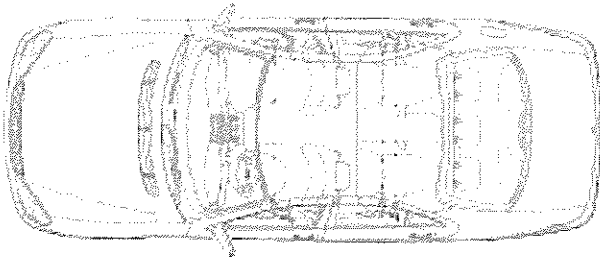
Version: COM-DGRO/1

Date Calculated: 02/03/2019 03:58

Full Report - V1

Registration: SJP3754K

Printed: 02/03/2019 11:58

**Addresses****Cost Summary**

Total Labour	\$436.50
Total Paint/Material	\$202.70
Total Parts	\$547.40
Total of Additional Costs	\$200.00
Excess:	TBA
Grand Total Exc GST:	\$1,386.60
7 % GST:	\$97.06
Grand Total Inc GST:	\$1,483.66

**Repair Information****LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR  
Price/Dent = \$45.00/HR

**Repair /****Guide Number Repair Details**

		WU	Cost Price (\$)
8111A5)	R + R REAR BUMPER	3.0	13.50
8111A5)	RENEW REAR BUMPER	1.0	4.50
823104)	R + R BOOT LID	3.0	13.50
823104)	RENEW BOOTLID	9.0	40.50
	(REMOVED)		
	INCLUDES: R + R INNER TAILLAMPS, NUMBER		
	PLATE, BADGE, NUMBER PLATE LAMPS AND		
	LOCK		

**LABOUR COST**

Total Work Units	16.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	1.6HRS	\$72.00
Paint Labour	8.1HRS	\$364.50
Total Labour	9.7HRS	\$436.50

**PAINT WORK**

Time Basis 10 WU = 1 HR. Price = \$45.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
2931	BOOTLID NEW PART PAINTING	15.0	
2583	REAR BUMPER NEW PART PAINT K1R	12.0	
3481	L/R WING SURFACE PAINT	7.0	
3482	R/R WING SURFACE PAINT	7.0	
3900	BOOTFLOOR SURFACE PAINT	10.0	

# COMFORTDELGRO ENGINEERING PTE LTD

Claim Reference:

Assessment Number: WW000497

Version: COM-DGRO/1

Date Calculated: 02/03/2019 03:58

Full Report - V1

Registration: SJP3754K

Printed: 02/03/2019 11:58

## LABOUR COST - PAINT

### TIME(PAINT)

Preparation Main Work Plastic

51.0

Preparation Main Work Metal

5.0

Preparation Work Multi Layer Paint

25.0

Total Work Units (10WU/HR)

0.0

Total Paintwork Labour

81.0

8.1HRS

\$364.50

## MATERIAL COST - PAINT

Cost Price

New Part Painting

\$42.31

New Part Painting - Plastic K1R

\$58.06

Material-Constant Main Work Metal

\$28.60

Surface-/Blend Paint

\$64.73

Material-Const Main Work Plastic

\$9.00

Total Excluding Pearlescent Uplift

\$202.70

Pearlescent Uplift @ 0.0%

\$0.00

Total Paint Material Cost

\$202.70

## PARTS

Guide No. Qty		Description	Part Number	Supplier	Bet.	Price (\$)
2583	1	REAR BUMPER	71501TM4H20ZZ		0%	140.00*
2650	4	RR BUMPER CLAMP KIT	91503SZ3003		0%	12.00*
2931	1	BOOTLID	68500TM4H00ZZ		0%	250.00*
2977	1	BOOTLID LOCK	74851SNBJ12		0%	30.00*
3013	1	BADGE HONDA	75701TM0000		0%	10.00*
3016	1	ENGINE BADGE	75725TM0T00		0%	12.00*
3017	1	BADGE CITY	75722TM4H00		0%	10.00*
1000	1	R BUMPER CLIPS	Renew		0%	12.00*
f: OEM Parts		Sub Total				\$476.00
g: Original		Mark Up From Cost		(15 %)		\$71.40
h: Secondhand		Sundry Parts		(Fixed)		\$0.00
p: Parallel		Total Parts				\$547.40
x: Exchange						

## NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

### Extras

Description	Betterment	Price
REVERSE SENSOR SPECIALIST	0%	\$200.00
Total Extras		\$200.00

## Final Calculation

Total Parts	\$547.40
Labour	
Total Panel/Mechanical	\$72.00
Total Paintwork	\$364.50
Total Labour	\$436.50
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$200.00
Total of Additional Costs	\$200.00
Total Paint/Material Costs	\$202.70
Grand Total Excludes GST	\$1,386.60
GST @ 7 %	\$97.06
Grand Total Includes GST	\$1,483.66

**COMFORTDELGRO ENGINEERING PTE LTD**

**Claim Reference:**

**Full Report - V1**

**Assessment Number: WW000497**

**Registration: SJP3754K**

**Version: COM-DGRO/1**

**Printed: 02/03/2019 11:58**

**Date Calculated: 02/03/2019 03:58**

---

**Assessment Notes**

---