

**COMFORTDELGRO  
ENGINEERING PTE LTD  
205 BRADDELL ROAD  
SINGAPORE  
579701**

**Claim Reference:**  
**Assessment Number: WW000497**  
**Version: COM-DGRO/1**  
**Date Calculated: 22/11/2018 08:21**

**Full Report - V1**  
**Registration: SJP3754K**  
**Printed: 22/11/2018 16:23**

### Summary Information

#### Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Toh Wee Ngo	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

### Vehicle Details

#### Vehicle

Manufacturer:	HONDA
Model:	City
Sub Model:	BASE MODEL
Model Sheet Number:	H2C 01
Registration:	SJP3754K
Registration Month:	
Registration Year:	
VIN Number:	
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

#### Model Specs

FROM MODEL 2009	AIR CONDITIONING
1.5 LTR 88KW	TWO COAT METALLIC
PREPARE OFF VEHICLE	

*Not Authorized*  
*Resurvey Begins*

*4-5 days*

### Vehicle Condition

#### Vehicle Status

Pre-Accident Condition:  
Steering:

Brakes Pedal Travel:  
Place of Inspection:  
Pre-Accident Damage:

Tyres Condition:  
Tread Depth LHF:  
Tread Depth LHR:  
Damage Areas:

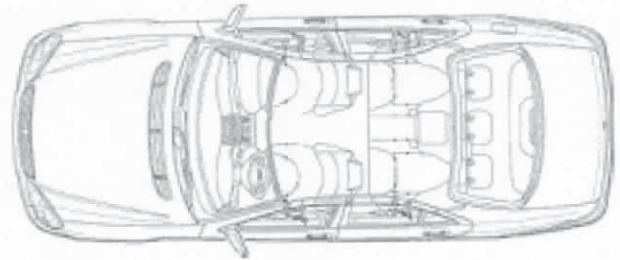
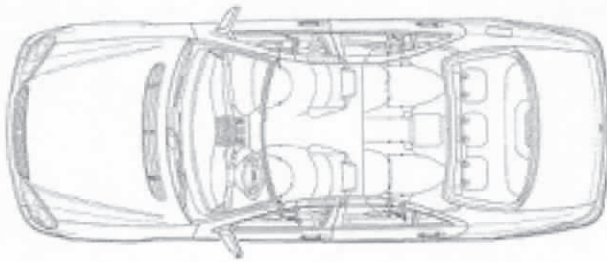
**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

**Severity of Impact:**  
**Vehicle Status on Inspection:**  
Acknowledged by Repairer  
Signature:  
Date:

Date of Inspection: 22/11/2018

Tread Depth RHF:  
Tread Depth RHR:  
Direction of Impact:

**COMFORTDELGRO ENGINEERING PTE LTD****Claim Reference:****Assessment Number: WW000497****Version: COM-DGRO/1****Date Calculated: 22/11/2018 08:21****Full Report - V1****Registration: SJP3754K****Printed: 22/11/2018 16:23****Addresses****Cost Summary**

Total Labour	\$823.50
Total Paint/Material	\$225.80
Total Parts	\$776.25
Total of Additional Costs	\$335.00
Excess:	TBA
Grand Total Exc GST:	\$2,160.55
7 % GST:	\$151.24
Grand Total Inc GST:	\$2,311.79

**Repair Information****LABOUR****Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR****Price/Dent = \$45.00/HR****Repair /****Guide Number Repair Details**

		<b>WU</b>	<b>Cost Price (\$)</b>
8111A5)	R + R REAR BUMPER	<b>3.0</b>	<b>13.50</b>
8111A5)	RENEW REAR BUMPER	<b>1.0</b>	<b>4.50</b>
8111B8)	R + R LEFT REAR OUTER BUMPER BRACKET	<b>2.0</b>	<b>9.00</b>
8111B9)	R + R RIGHT REAR OUTER BUMPER BRACKET	<b>2.0</b>	<b>9.00</b>
7141A0	R + R LEFT REAR TAILLAMP	<b>3.0</b>	<b>13.50</b>
7411A5	R + R RIGHT REAR TAILLAMP	<b>3.0</b>	<b>13.50</b>
823104)	R + R BOOT LID	<b>3.0</b>	<b>13.50</b>
823104)	RENEW BOOTLID	<b>9.0</b>	<b>40.50</b>
	(REMOVED)		
	INCLUDES: R + R INNER TAILLAMPS, NUMBER		
	PLATE, BADGE, NUMBER PLATE LAMPS AND		
	LOCK		
8231B6	R + R BOOTLID SEAL	<b>2.0</b>	<b>9.00</b>
8231A9	BOOTLID STRIKER	<b>2.0</b>	<b>9.00</b>
NO NUMBER	RENEW REAR END PANEL CPL	<b>45.0</b>	<b>202.50</b>
NO NUMBER	R + R BOOT FLOOR CARPET	<b>1.0</b>	<b>4.50</b>
8571C8	R + R L/BOOT COVER	<b>3.0</b>	<b>13.50</b>
8571C9	R + R R/BOOT COVER	<b>3.0</b>	<b>13.50</b>

**LABOUR COST****Total Work Units****82.0****Corrosion Protection External Labour****0.0HRS****0.00****Corrosion Protection Internal Labour****0.0HRS****0.00****Sub Total****8.2HRS****\$369.00****Paint Labour****10.1HRS****\$454.50****Total Labour****18.3HRS****\$823.50**



## COMFORTDELGRO ENGINEERING PTE LTD

Claim Reference:

Assessment Number: WW000497

Version: COM-DGRO/1

Date Calculated: 22/11/2018 08:21

Full Report - V1

Registration: SJP3754K

Printed: 22/11/2018 16:23

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$45.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
2711	REAR PANEL CPL NEW PART PAINTING	20.0	
2931	BOOTLID NEW PART PAINTING	15.0	
2583	REAR BUMPER NEW PART PAINT K1R	12.0	
3481	L/R WING SURFACE PAINT	7.0	
3482	R/R WING SURFACE PAINT	7.0	
3900	BOOTFLOOR SURFACE PAINT	10.0	
<b>LABOUR COST - PAINT</b>			
	<b>TIME(PAINT)</b>	<b>71.0</b>	
	Preparation Main Work Plastic	5.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Paint	0.0	
	<b>Total Work Units (10WU/HR)</b>	<b>101.0</b>	
	<b>Total Paintwork Labour</b>	<b>10.1HRS</b>	<b>\$454.50</b>
<b>MATERIAL COST - PAINT</b>			<b>Cost Price</b>
	New Part Painting		\$65.41
	New Part Painting - Plastic K1R		\$58.06
	Material-Constant Main Work Metal		\$28.60
	Surface-/Blend Paint		\$64.73
	Material-Const Main Work Plastic		\$9.00
	<b>Total Excluding Pearlescent Uplift</b>		<b>\$225.80</b>
	<b>Pearlescent Uplift @ 0.0%</b>		<b>\$0.00</b>
	<b>Total Paint Material Cost</b>		<b>\$225.80</b>

## PARTS

				Price Valid: 01/06/2015		
Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
2583	1	REAR BUMPER	71501TM4H20ZZ	Bu	0%	140.00* ✓
2619	1	L/R OUT BUMPER BRKT	71598TM0T00		0%	8.00* ?
2620	1	R/R OUT BUMPER BRKT	71593TM0T00		0%	8.00* ?
2650	4	RR BUMPER CLAMP KIT	91503SZ3003		0%	12.00* ✓
2711	1	REAR PANEL CPL	66100TM4H00ZZ		0%	130.00* ?
2931	1	BOOTLID	68500TM4H00ZZ		0%	250.00* ✓
2944	1	BOOTLID SEAL	74865TM0T00		0%	35.00* ?
2977	1	BOOTLID LOCK	74851SNBJ12		0%	35.00* ✓
3013	1	BADGE HONDA	75701TM0000		0%	10.00* ✓
3016	1	ENGINE BADGE	75725TM0T00		0%	12.00* ✓
3017	1	BADGE CITY	75722TM4H00		0%	10.00* ✓
4985	1	END PANEL TRIM	84640TM0T01ZA		0%	25.00* ?
f: OEM Parts		Sub Total				\$675.00
g: Original		Mark Up From Cost		(15 %)		\$101.25
h: Secondhand		Sundry Parts		(Fixed)		\$0.00
p: Parallel		<b>Total Parts</b>				<b>\$776.25</b>
x: Exchange						

## NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

## Extras

Description	Betterment	Price
R NO PLATE W SPECIALIST	0%	\$35.00 X
CASING		
REVERSE SENSOR SPECIALIST		\$200.00 ✓

**COMFORTDELGRO ENGINEERING PTE LTD****Claim Reference:****Assessment Number: WW000497****Version: COM-DGRO/1****Date Calculated: 22/11/2018 08:21****Full Report - V1****Registration: SJP3754K****Printed: 22/11/2018 16:23**

SET

Corr Prot Materials External

\$100.00 ?

**Total Extras****\$335.00****Final Calculation****Total Parts****\$776.25****Labour**

Total Panel/Mechanical

\$369.00

Total Paintwork

\$454.50

**Total Labour****\$823.50****Additional Costs**

Corr Prot Materials External

\$100.00

Cost of Specialist

\$235.00

**Total of Additional Costs****\$335.00****Total Paint/Material Costs****\$225.80****Grand Total Excludes GST****\$2,160.55**

GST @ 7 %

**\$151.24****Grand Total Includes GST****\$2,311.79****Assessment Notes**