# Charn's Customcraft 1010 Bukit Merah Lane 3 Singapore 159724

**Claim Reference: THIRD PARTY CLAIM** 

**Assessment Number: CC000029** 

**Version: CHARNCUS/1** 

**Summary Information** 

Date Calculated: 29/11/2018 08:03

Claim

Location: Singapore (SG) Currency: SGD

Date of Incident: Printed by: Sharon Lee

**Authorisation Status:** Interim Able to Authorise Repairs: TBA Work Provider: AXA Insurance S'pore Pte Repairs Authorised: **TBA** 

Ltd

THIRD PARTY CLAIM Claim Reference: Estimated Repair Time:

Ouote Due Date: Policy Number: Other Reference: Actual Repair Days: Third Party: Parts Ordered Date: **Insured Amount:** Hire Car Start: **Under Warranty:** Hire Car End: Vehicle Collected: Warranty Expired:

**Vehicle Details** 

Vehicle **Model Specs** 

FROM 03/2016 Manufacturer: **BMW** COMFORT PACKAGE Model: 4 Series AUTO AIR CON LED HEADLAMP Sub Model: 420I 2.0 LTR 135KW **ACTIVE PROTECTION** Model Sheet Number: 143 01 WHEELS 8J X 18 ALLOY **EU SPECIFIC** 

Registration: SKZ8670X TWO COAT METALLIC Registration Month:

Registration Year:

VIN Number: WBA3V12050P945211

Odometer: Not Known

Colour:

Engine Number:

**Vehicle Status** 

Fuel Level: %

**Vehicle Condition** 

Pre-Accident Condition: Severity of Impact:

Steering: Vehicle Status on Inspection:

Brakes Pedal Travel: Date of Inspection:

29/11/2018 Place of Inspection:

Pre-Accident Damage:

Tyres Condition: Tread Depth LHF: Tread Depth RHF: Tread Depth LHR: Tread Depth RHR: Damage Areas: Direction of Impact: **Full Report - V1** 

Registration: SKZ8670X

PREPARE OFF VEHICLE

Printed: 29/11/2018 16:03

#### **Charn's Customcraft**


Claim Reference: THIRD PARTY CLAIM


**Assessment Number: CC000029** 

**Version: CHARNCUS/1** 

Date Calculated: 29/11/2018 08:03



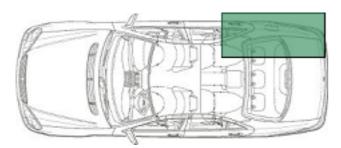

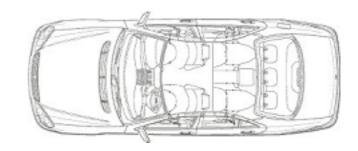

# **Addresses**

| <b>Cost Summary</b> | Cost | Summa | ry |
|---------------------|------|-------|----|
|---------------------|------|-------|----|

| Total Labour         | \$611.25 |
|----------------------|----------|
| Total Paint/Material | \$149.10 |
| Excess:              | TBA      |
| Grand Total Exc GST: | \$760.35 |
| 7 % GST:             | \$53.22  |
| Grand Total Inc GST: | \$813.57 |

**Repair Information** 

| LABOUR | Time Basis 12 WU = 1 HR. | Pric | e/CL 1 = | \$45.00 | /HR |
|--------|--------------------------|------|----------|---------|-----|
|        |                          |      |          |         |     |

**Price/Dent = \$45.00/HR** 

| Repair /  |                                 | 11166, 26116 | Ψ 1.01.00/ 111.t |
|-----------|---------------------------------|--------------|------------------|
| • •       | er Repair Details               | wu           | Cost Price (\$)  |
| NO NUMBER | ADD/TIME FOR MAIN WORK          | 1.0          | 3.75             |
| 32 00 590 | ELECTR SUSPENSION ALIGNMENT     | 16.0         | 60.00            |
|           | (WITHOUT ADJUSTMENT BEFORE REP) |              |                  |
| 1482      | REPAIR RIGHT FRONT DOOR         | 10.0*        | 37.50            |
| 2172      | REPAIR R/SILL PANELLING         | 5.0*         | 18.75            |
| 3482      | REPAIR R/R SIDE PANEL           | 5.0*         | 18.75            |
| LA        | BOUR COST                       |              |                  |
|           | Total Work Units                | 37.0         |                  |

| Total Work Units                     | 37.0           |                 |
|--------------------------------------|----------------|-----------------|
| Panel / Mechanical Labour            | 1.7HRS         | \$75.00         |
| Visual Alignment Labour              | 1.4 <b>HRS</b> | \$63.75         |
| Corrosion Protection External Labour | 0.0HRS         | 0.00            |
| Corrosion Protection Internal Labour | 0.0HRS         | 0.00            |
| Sub Total                            | 3.1HRS         | \$138.75        |
| Paint Labour                         | 10.5HRS        | \$472.50        |
| Total Labour                         | 13.6HRS        | <b>\$611.25</b> |

\*NOTE TIME BASIS = 12 WU / HOUR\*

| PAINT V | AINT WORK Time Basis 10 WU = 1 HR. Price = \$45.00 |      | e = \$45.00/HR  |
|---------|--|------|-----------------|
| Guide N | umber Description                                  | WU   | Cost Price (\$) |
|         | - EU SPECIFIC                                      |      |                 |
|         | - TWO COAT METALLIC                                |      |                 |
|         | - PREPARE OFF VEHICLE                              |      |                 |
| 1482    | RIGHT FRONT DOOR REPAIR PAINTING >50%              | 27.0 |                 |
| 3482    | R/R SIDE PANEL REPAIR PAINTING >50%                | 30.0 |                 |
| 9552    | R/R WHEEL REPAIR PAINTING >50%                     | 12.0 |                 |
| 2172    | R/SILL PANELLING SURFACE PAINT PLAST.              | 6.0  |                 |
|         | LABOUR COST - PAINT                                |      |                 |
|         | TIME(PAINT)  | 75.0 |                 |
|         | Preparation Main Work Plastic                      | 5.0  |                 |

# **Charn's Customcraft**

Claim Reference: THIRD PARTY CLAIM

**Assessment Number: CC000029** 

**Version: CHARNCUS/1** 

Date Calculated: 29/11/2018 08:03

Registration: SKZ8670X Printed: 29/11/2018 16:03

**Full Report - V1** 

\$0.00

| Preparation Main Work Metal        | 25.0    |            |
|------------------------------------|---------|------------|
| Preparation Work Multi Layer Paint | 0.0     |            |
| Total Work Units (10WU/HR)         | 105.0   |            |
| Total Paintwork Labour             | 10.5HRS | \$472.50   |
| MATERIAL COST - PAINT              |         | Cost Price |
| Surface Paint Plastic              |         | \$18.67    |
| Repair Painting                    |         | \$92.83    |
| Material-Const Main Work Plastic   |         | \$9.00     |
| Total Excluding Pearlescent Uplift |         | \$149.10   |
| Pearlescent Uplift @ 0.0%          |         | \$0.00     |
| Total Paint Material Cost          |         | \$149.10   |

## PARTS

|                          |             |          | Price Valid | : 01/05/2018 |
|--------------------------|-------------|----------|-------------|--------------|
| Guide No.Qty Description | Part Number | Supplier | Bet.        | Price (\$)   |
| f: OEM Parts             | Sub Total   |          |             | \$0.00       |
| g: Original              | Mark Up Fr  | om Cost  | (15 %)      | \$0.00       |
| h: Secondhand            | Total Part  | s        |             | \$0.00       |
| p: Parallel              |             |          |             | -            |

x: Exchange

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

**Total Extras** 

|          | \$0.00   |
|----------|----------|
|          |          |
| \$75.00  |          |
| \$472.50 |          |
| \$63.75  |          |
|          | \$611.25 |
|          | \$149.10 |
|          | \$760.35 |
|          | \$53.22  |
|          | \$813.57 |
| •        | \$472.50 |

## **Assessment Notes**