

ASS. REC. BY:

REF: CS/C1118021831/Dvd3ⁿ²

Special Instruction:

Suiveur: Bryen
Mehmen

ASSIGNMENT (Office)

From (Person): Catherine Thica

of: CFF

Date/Time: 4/12/18 @ 5:29pm

Estimated Cost:

Bill to:

OD WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: GZ 9469C

Insured: SKZ 6179L

at Workshop m/s: Teamwork

Tel: 68442475

of: 53 ubi Ave | # 01-24

Policy No: DMPCSN3001021801

Claim No: SNM18D05585

Sum Insured:

Excess:

Make of Veh:
(Client's Record)

D.O.A. 28/11/18

5/12/18

CA / REV / REP. / REV 24 HRS

cup

H.O.D. Endorsement:

Date/Time: 5:32pm @ 4/12/18

Person Contacted: Bryen

Vehicle IN OUT

Date/Time	Action/Instruction (✓) Estimate
	GZ 9469C - NA / MS618021579 / 24 DOA: 28/11/18
	SKZ 6179L - NA / MS618021579 / 24 DOA: 28/11/18


REF:

ASSIGNMENT

05E Nov 2021

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s: _____
 of: _____
 Insured: _____
 Policy No: _____
 Claims No: _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

Veh No: **GZ 9469 C** Yr Regn: **Nov 2006**
 Type: M.Car / M.Cycle / Bus / Van / Co / Taxi / Prime Mover /
 Truck / Trailer or
 Make: **Toyota Dyna** O/S: **2982**
 Colour: **White** A/C: Insured / Std / NI / NA
 Sp. Reading: **225842** T/Radio: Insured / Std / NI / NA
 Eng/No: **1KD1528817**
 C/No: **JTFAT35Y003000131**
 Gen. Cond: 3 / Fair / Poor / Burnt
 Steering: 3 / Jammed / Leaked / Burnt or
 Brake: 3 / Jammed / Leaked / Burnt or
 Modi: 3 Nil S/Rim / STD A/Rim or

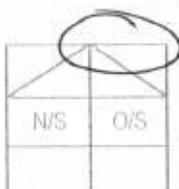

(Policy Condition)
 Remark: The veh had commenced its repair at the time of inspection.

Tyre Size: F: **195/75 R15**
 R: **155 R12C (double)**
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or **Yokohama**

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: **7** days Res: Yes or No
 Lum Sum: **20** % 3 Val: Yes or No
 CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____
 Vehicle: IN / OUT

Front Rear
 R/Bal: **5** mm R/Bal: **5/5** mm
 L/Bal: **5** mm L/Bal: **5/5** mm
 D.O.A. **28/11/2018** D.O.I. **05/12/2018**
 Survey held at **Tecmwork Punc ubi**
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
Front
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	Chanc Taping SKZ 6179L
	MV 20K LTA 14.4K HL 5.6K
11/3/19	Insured 2/5 5000 5000 - with 7 days of repair (Red)

RECEIVED 11 MAR 2019

Date/Time: File Pass to? : Preli. Report
 : Final Report
 Days Of Repair: **7**
 Resurvey No. of Trip: **2**
 Date/Time: File Return to? **11/3 - typist**
 Report Format: **merimen**
 Lump Sum / L.B. (\$) **5000**
 Add Fee: Site Insp (\$) Interview (\$) Tech. Invs (\$) Weekend (\$)
 Survey Fee: _____
 Transportation: _____
 Photos: _____
 Other: _____
 TOTAL: **220**

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	04 Dec 2018		04 Dec 2018 17:29 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured:	ANG AH TAY , ID: 51218228G								
Main Claimant:	Techtune								
Vehicle Reg. No.:	GZ9469C	Date of Loss:	28/11/2018 16:00 - :59						
Claim Type:	TP / SNM18D05585	Policy/Cover Note No.:	DMPCSN3001021801						
Vehicle Reg. No. (Insured):	SKZ6179L	Policy No. (Claimant):							
		Excess:	S\$0.00						
Repairer:	Teamwork Garage Pte Ltd (HQ) 53 Ubi Ave 1 #01-24, Paya Ubi Industrial Park, 408934 Ubi - Tel: 6844 2475								
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Catherine Thia]								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 13/12/2018]								
Adj Asg. Remarks:	ALREADY APPOINTED VIA EMAIL TODAY AT 5.19PM								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
There are no mail for this case.									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

> **Back to OneMotoring**

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Business
Owner ID:	1252C
Vehicle Details	
Vehicle No.:	GZ9469C
Vehicle to be Exported:	No
Intended Deregistration Date:	11 Mar 2019
Vehicle Make:	TOYOTA
Vehicle Model:	DYNA 150 MANUAL
Primary Colour:	White
Manufacturing Year:	2006
Engine No.:	1KD1528817
Chassis No.:	JTFAT35Y003000131
Maximum Power Output:	-
Open Market Value:	\$24,285.00
Original Registration Date:	30 Nov 2006
First Registration Date:	30 Nov 2006
Transfer Count:	1
Actual ARF Paid:	\$0.00
Intended PARF Rebate Details	
PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	29 Nov 2021
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	5
PQP Paid:	\$24,191.00
COE Rebate Amount:	\$13,143.00
Total Rebate Amount:	\$13,143.00
Message	
Please note that all future COE renewals for this vehicle can only be for a 5-year period, subject to the statutory lifespan (if applicable) of the vehicle.	

The information contained herein is correct as at 11 Mar 2019

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	29/11/2018 18:31
Date Of Accident	28/11/2018 16:10
Exact Location Of Accident	AMK AVE 3 TWDS HOUGANG
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	GZ9469C
Insured/Policyholder	
Name Of Registered Owner	TECHTUNE
Co Reg No	53191252C
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-89999999
Vehicle Particulars	
Manufacturer	TOYOTA
Model	DYNA 150 MANUAL
Exact Purpose for which vehicle was being used at time of accident	COMMERCIAL USE
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	COMMERCIAL VEHICLE
Insurance Company	
Name of Insurance Company	MSIG INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	NO
Policy Number	A29050172MKC
Cover Note Number	
Driver	
Name of Driver	CHEW KOK CHEANG (ZHOU GUOQIANG)
NRIC No	S7201160J
Date Of Birth	04/01/1972
Occupation	OUTDOOR
Date Of Driving Pass	17/07/1990
Driving Experience	28 YEARS AND 4 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-93363518
Fax Number	
Contact Number	OFFICE-93333518
EEmail Address	NOEMAIL

Address	BLK 866 YISHUN STREET 81 #11-57
Postcode	760866
Was driver an employee of the Insured's Company	YES
If No, Relationship of the Driver with the Insured	
Vehicle Registration Number of Driver's Own Vehicle	- - -
Insurance Company of Driver's Own Vehicle	- - -

General Information of the Accident

Type Of Accident	COLLISION - CROSS JUNCTION
Weather Conditions	CLEAR
Road Surface	WET

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	2
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO STATEMENT.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	VIDEO FOOTAGE WITH DRIVER
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SKZ6179L
Vehicle Make/Model/Colour	TOYOTA WISH
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

DETAILS OF INJURED PERSON 1

Name	CHEW KOK CHEANG (ZHOU GUOQIANG)
Approximate Age	
Injuries Sustain	BACK, NECK & FEET
Injured person in which vehicle?	GZ9469C
Were seat belts worn?	YES
Was this injured conveyed to hospital by ambulance?	NO
Address	
Postcode	

Accident Sketch Plan

- Please print and complete this form at the scene of the accident to record the details of the accident.
- Who Fills In:** This form should be completed by the policyholder or the designated driver.
- Information provided must be as accurate and complete as possible. Any willful misrepresentation or withholding of material facts may also constitute an offence to providing false information.
- The completion of this form by insurance companies is not an admission of policy liability on the part of the insurance company.
- Availability:** This form is available at the Police Traffic Control Room.
- The report will be forwarded by the Insurer of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application to interested parties.
- By the signatory of this report to the Insurer, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
- Consent under the Personal Data Protection Act (PDPA)
- I, the driver, acknowledge, agree and consent that:


- (a) the Insurer, the workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all Insurer(s) who have insured vehicle(s) involved in this accident (all Insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes").
- (b) all Insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
- (i) to all Insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulator, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

 Policyholder's Signature
 Date & Time

 Driver's Signature
 (if driver is not the policyholder)
 Date & Time

 Reporting Centre Personnel's Signature
 Name:
 NRIC/PIN No.:

Accident Sketch Plan

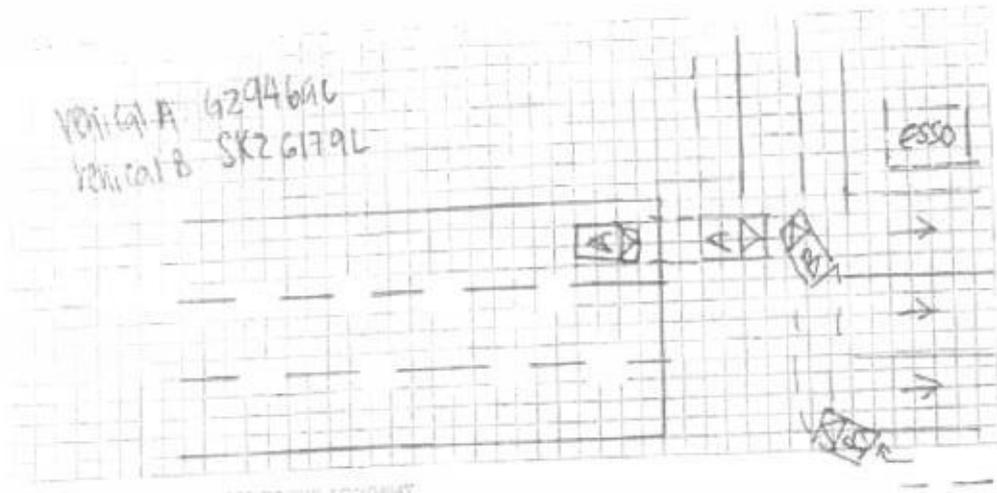

DESCRIBE THE CIRCUMSTANCES OF THE ACCIDENT

I was travelling along Argus Road towards
 Langney along straight. Traffic in my favour as I was
 approaching the junction Vehicle B from the opposite road suddenly
 crossed my path and collided into me

DECLARATION

I/We declare the foregoing particulars are true in every respect.


 Policyholder's Signature
 Date & Time:


 Driver's Signature
 (If driver is not the policyholder)
 Date & Time:


 Reporting Centre Personnel's Signature
 Name:
 NRIC/PIN No: 7



TeamWork Garage Pte Ltd
 53 Ubi Avenue 1 #01-23/24 Spore 408934
 Paya Ubi Industrial Park
 Tel : 6844 2475
 E-mail : claims@teamworkgarage.com
 Register number : 201015366H
 3RD PARTY CLAIM ESTIMATION

China Taiping Insurance (Singapore) Pte Ltd
 105 Cecil Street #19-00
 The Octagon
 Singapore 069534

Vehicle number	GZ9469C
Make / Model	TOYOTA/DYNA 150
Chassis number	JTFAT35Y003000131
Accident date	26 November 2018
Reference	1811-46

Qty Particulars Unit Price - SGD \$

Qty	Particulars	Unit Price - SGD \$
<u>PARTS REPLACEMENT - LIST ITEMS</u>		
1	FRONT BUMPER Denton	498.00 ✓
2	FRONT BUMPER BRACKET H/W	255.00 X
1	FRONT BUMPER REINFORCEMENT <i>2 ft</i>	382.00 ? ✓
2	FRONT HEADLAMP o/s broken n/s <i>mounting cross</i>	816.00 ? ✓
2	FRONT RH CORNER PANEL o/s Bnc n/s H/W	192.50 385.00 ✓
1	FRONT GRILLE broken	414.00 ✓
1	FRONT GRILLE EMBLEM HS	71.00 X
1	FRONT EMBLEM LOGO BT	85.00 ✓
1	FRONT PANEL Bnc	976.00 ✓
1	FRONT PANEL TOP GARNISH o/s broken	385.00 ✓
1	AIRCON CONDENSER H/W	701.00 X
1	AIRCON BLOWER <i>clock mounting</i>	1431.90 1971.00 ? ✓
1	RADIATOR H/W	1840.00 X
1	RADIATOR COWLING H/W	335.00 X
1	RADIATOR FAN ASSY H/W	185.00 X
1	RADIATOR TOP HOSE H/W	55.00 X
1	RADIATOR EXPANSION TANK H/W	135.00 X
1	POWER STEERING COOLING PIPE H/W	378.00 X
1	DASHBOARD ASSY H/W	1240.00 X
1	WIPER WASHER TANK H/W	207.00 X
1	FRONT RH DOOR PANEL <i>ft</i>	1493.00 ✓
1	RH DOOR PILLAR H/W	871.00 X
1	FRONT WINDSCREEN RUBBER H/W	149.00 ✓
		6822.40
		5116.80
		13827.00
	Less 25%	3456.75
	Subtotal	10370.25
	Balance C/F	10370.25
<u>PARTS REPLACEMENT - SPECIAL NETT ITEMS</u>		
	Balance B/F	10370.25
1 SET	FRONT BUMPER CLIP H/W	50.00 30/-
1 SET	FRONT GRILLE CLIP H/W	30.00 30/-
1	WINDSCREEN SEALANT H/W	150.00 40/-
1	COOLANT H/W	150.00 X
1	FRONT NUMBER PLATE WITH CASING <i>dislodged</i>	80.00 45/-
	Subtotal	460.00
	Balance C/F	10830.25

S/No	LABOUR AND MISCELLANEOUS CHARGES	
	Balance B/F	10830.25
1	CHECK FRONT WIRING AND LIGHTNING SYSTEM	70.00 30/-
2	REMOVE, RENEW CONDENSER AND TOP UP GAS	150.00 44
3	REMOVE, RENEW RADIATOR AND TOP UP COOLANT	150.00 44
4	REMOVE AND REFNEW DASHBOARD ASSY	600.00 44 150/-
5	REMOVE AND RENEW AIRCON BLOWER ASSY	300.00 ? 50/-
6	REMOVE AND REFIT FRONT WINDSCREEN ASSY	150.00 80/-
7	TRANSFER PARTS, ATTACHMENT FROM FRONT OLD DOOR TO NEW	200.00 40/-
8	PANEL BEATING ON AFFECTED AREAS	1600.00 800/-
9	SPRAY PAINTING ON AFFECTED AREAS	1500.00 800/-
10	APPLY ANTI RUST ON AFFECTED AREAS	150.00 40/-
	Subtotal	4870.00
	Grand total	15700.25
		7251.80
		4/S 5000/-

05/12/2018 @ 1045 hrs

W/A Arctm

4/Sun 7 days
 Ryan

2kk Auto Repair Unit.



Link Auto hence notify
 the Repairs of following:

- To resurvey before spray painting
- To do a full damage survey during resurvey
- Part prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal work (labor) is allowed
- Supplemental items must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date:

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CTI18021831/DVD3N2
Date: 12/03/2019

REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMPCSN3001021801
Claimant Vehicle No :	GZ9469C	Insured Vehicle No :	SKZ6179L
Date of Loss:	28/11/2018	Nature of Claim:	TP
		Claim No:	SNM18D05585

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	GZ9469C	Engine No:	1KD1528817
Make & Model:	TOYOTA DYNA 150, 3.0 D (M)	Chassis No:	JTFAT35Y003000131
Reg. Date:	30/11/2006 (Man. Year: 2006)	Odometer:	225842 km
Colour:	White		
Engine Capacity:	2982 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/75R15	Rear Tyre Size:	155 R12C (D)
Front Left Side:	Yokohama 5 mm	Rear Left Side:	Yokohama 5/5 mm
Front Right Side:	Yokohama 5 mm	Rear Right Side:	Yokohama 5/5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	10,830.25	5,261.80	5,568.45	51.42
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,870.00	1,990.00	2,880.00	59.14
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	15,700.25	7,251.80	8,448.45	53.81
Approved Total (Overridden) (S\$)		5,000.00		
	(S\$) 15,700.25	5,000.00	10,700.25	68.15
+ GST 7.00/7.00% (S\$)	1,099.02	350.00	749.02	68.15
Nett Amount (S\$)	16,799.27	5,350.00	11,449.27	68.15

INSPECTION

Date of Assignment:	04/12/2018	
Date Inspected:	05/12/2018 Inspected At:	Teamwork Garage Pte Ltd (HQ) 53 Ubi Ave 1 #01-24, Paya Ubi Industrial Park Singapore 408934

Estimated Period of Repair: 7.0 days

Adjuster: BRYAN TANI

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference	
Part Source:	(Last Synchronised: 12 Mar 2019)
Parts:	N/A TOYOTA DYNA 150 3.0 D (M) (Model not available in database)
Labour:	Repairer's (Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GZ9469C)
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Dented	498.00 FL	*498.00 FL
2	2		*FRONT BUMPER BRACKET	Not Necessary	255.00 FL	*- FL
3	1		*FRONT BUMPER REINFORCEMENT	Bent	382.00 FL	*382.00 FL
4	2		*FRONT HEADLAMP	Os Broken/Ns Mounting Cracked	816.00 FL	*816.00 FL
5	1		*FRONT RH CORNER PANEL	O/s Buckled/N/s Not Necessary	385.00 FL	*192.50 FL
6	1		*FRONT GRILLE	Broken	414.00 FL	*414.00 FL
7	1		*FRONT GRILLE EMBLEM	No such part	71.00 FL	*- FL
8	1		*FRONT EMBLEM LOGO	Bent	85.00 FL	*85.00 FL
9	1		*FRONT PANEL	Buckled	976.00 FL	*976.00 FL
10	1		*FRONT PANEL TOP GARNISH O/S	Broken	385.00 FL	*385.00 FL
11	1		*AIRCON CONDENSER	Not Necessary	701.00 FL	*- FL
12	1		*AIRCON BLOWER	Mounting Cracked	1,971.00 FL	*1,431.90 FL
13	1		*RADIATOR	Not Necessary	1,840.00 FL	*- FL
14	1		*RADIATOR COWLING	Not Necessary	335.00 FL	*- FL
15	1		*RADIATOR FAN ASSY	Not Necessary	185.00 FL	*- FL
16	1		*RADIATOR TOP HOSE	Not Necessary	55.00 FL	*- FL
17	1		*RADIATOR EXPANSION TANK	Not Necessary	135.00 FL	*- FL
18	1		*POWER STEERING COOLING PIPE	Not Necessary	378.00 FL	*- FL
19	1		*DASHBOARD ASSY	Not Necessary	1,240.00 FL	*- FL
20	1		*WIPER WASHER TANK	Not Necessary	207.00 FL	*- FL
21	1		*FRONT RH DOOR PANEL	Bent	1,493.00 FL	*1,493.00 FL
22	1		*RH DOOR PILLAR	Not Necessary	871.00 FL	*- FL
23	1		*FRONT WINDSCREEN RUBBER	Necessary	149.00 FL	*149.00 FL
24	1		*SET FRONT BUMPER CLIP	Necessary	50.00 FS	*30.00 FS
25	1		*SET FRONT GRILLE CLIP	Necessary	30.00 FS	*30.00 FS
26	1		*WINDSCREEN SEALANT	Necessary	150.00 FS	*40.00 FS
27	1		*COOLANT	Not Necessary	150.00 FS	*- FS
28	1		*FRONT NUMBER PLATE WITH CASING	Dislodged	80.00 FS	*45.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	14,287.00	6,967.40
- List Item Discount on L Items 25.00/25.00% (\$\$)	3,456.75	1,705.60
Total Parts (\$\$)	10,830.25	5,261.80

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	CHECK FRONT WIRING AND LIGHTING SYSTEM	New	70.00	30.00
2	REMOVE,RENEW CONDENSER AND TOP UP GAS	New	150.00	0.00
3	REMOVE,RENEW RADIATOR AND TOP UP COOLANT	New	150.00	0.00
4	REMOVE AND RENEW DASHBOARD ASSY	New	600.00	150.00
5	REMOVE AND RENEW AIRCON BLOWER ASSY	New	300.00	50.00
6	REMOVE AND REFIT FRONT WINDSCREEN ASSY	New	150.00	80.00
7	TRANSFER PARTS,ATTACHMENT FROM FRONT OLD DOOR TO NEW	New	200.00	40.00
8	PANEL BEATING ON AFFECTED AREAS	New	1,600.00	800.00
9	SPRAY PAINTING ON AFFECTED AREAS	New	1,500.00	800.00
10	APPLY ANTI RUST ON AFFECTED AREAS	New	150.00	40.00
Gross Labour Cost (\$\$)			4,870.00	1,990.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >