

ASS. REC. BY: _____ REF: CS3/III/8018650/Rbd371 Special Instruction: _____

Surveyor: Medmen Stanley Lai of II Date/Time: 25012019

Estimated Cost: _____ Bill to: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SMA 9103T Insured: SHC 8221R

at Workshop m/s: Kok Wang Car Tel: 9183 9633

of 1 Soon Lee St #06-40

Policy No: _____ Claim No: MCT18100731

Sum Insured: _____ Excess: _____

Make of Veh: _____ D.O.A. 09-10-2018

(Client's Record)

CA / REV / REP. / REV 24 HRS. WP: _____ H.O.D. Endorsement: _____

Date/Time: 15-10-2018 2:40pm Person Contacted: Mr. Kok Vehicle: IN BOUT

Date/Time	Action/Instruction (X) Estimate
	SMA 9103T - X
	SHC 8221R - (14 / 11 / 8000288 / Kwong) DA: 21/12/2018
	Diamond: 17/10/2018

Rasul,

pls see my remarks.

05/03/19 Submit L/S \$5,850/- @ 5 days
(\$ 2,650/. Red - 31%)

[Signature]
1/3/2019.

RECEIVED 05 MAR 2019

250410 = 260

DATE: 20/10/18

REF:

63614

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / P / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

SMA 9103T

at Workshop m/s

Kok Wah

of

1/200N Lee St #06-40

Insured:

11/PRS

Policy No:

Claims No:

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its

repair at the time of inspection.



Est. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res:

Yes or No

Lump Sum:

%

3 Val:

Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle IN / OUT

Veh No:

SMA 9103T

Yr Regn:

2018 JUN

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

TOYOTA C-HR Hybrid 1.8i c.c 1757

Colour:

Yellow

A/C:

Insured / Std / NI / NA

Sp Reading

20380

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

24X10 2111492

Gen. Cond: Good / Cap / Poor / Burnt

Steering: Order / Jammed / Leaked / Burnt or

Brake: Order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

215/60R17

R:

BS: DUR / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal:

6

mm

R/Bal:

6

mm

L/Bal:

6

mm

L/Bal:

6

mm

D.O.A:

9/10/18

D.O.I:

16/10/18

Survey held at

Kok Wah

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooltop or

FRONT

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Submit PRE report

RECEIVED 1 6 OCT 2018

Date/Time: File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time: File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

1

Survey Fee:

Transportation:

\$ + RS. \$

Photos:

Others:

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format :

PRE

Lump Sum / I.B.I. (\$

Catherine Chong (LKK Auto)

From: Stanley Lai <stanley.lai@iii.com.sg>
Sent: Friday, 25 January, 2019 11:23 AM
To: Admin-D (LKKAuto); 'sur@lkkauto.com'
Cc: Mekavathanan Sarangapani; Zuhaidah Samsuri
Subject: III REF: MCT18100231 | REQ PAPER SURVEY

Dear Sir/Mdm,

Rights granted in Merimen for the above LOD. Kindly proceed with the paper survey.

TP Veh No. : **SMA9103T**

Warmest regards,

Stanley Lai

Motor Claims Department

India International Insurance Pte Ltd

64 Cecil Street #04-02 IOB Building

Singapore 049711

Tel: 6347 6100 Ext 206 Fax: 6224 4174

S&P 'A-' rated Company



Kindly note that by submitting this claim to us, you are deemed to have agreed to us collecting, using, disclosing and processing your personal data, sharing your personal data with our service providers (located both inside and outside Singapore) and/or with other insurers in the general insurance industry, including the General Insurance Association of Singapore. This enables us to ensure proper processing, handling and/or dealing with your claim, which includes investigating the said claim, and complying with applicable laws. If you do not agree to the same, kindly let us know immediately.

DISCLAIMER:

This email is intended solely for the person to whom it has been addressed.

It may contain confidential and/or legally privileged information.

If you are not the person for whom this e-mail was intended, or if this e-mail has reached you by mistake, please delete it immediately and inform us of the error and also be hereby notified that any use, distribution, transmission, printing, copying or dissemination of this information in any way or in any manner is strictly prohibited and may be unlawful. Internet communications may not be entirely secure or accurate as information could be intercepted, corrupted, lost, delayed or contain viruses.

Therefore, we do not accept liability for any errors or omissions in the content of this message or any delay in delivery which may arise as a result of Internet transmission or any modification.

Print this email only if it is absolutely necessary and help in preservation of environment.

India International Insurance Pte Ltd.

Registration No. 198703792-K

MCT 18100231

	RESERVES			
	TPPD	PRESERVE	8,500 survey fees -	250.00
	TPPI	PRESERVE		
	UNINSURED LOSS	PRESERVE		
	SUBRO	PRESERVE		
	LPPN			
	INVESTIGATION FEE			
	SURVEY FEES			
	LEGAL FEES			
	OTHERS			
	FRAUD CHECK			
	UPLOAD TO MERIMEN			
	GRANT RIGHTS			

Rgst Surveyors for
Paper Survey.

Lal
16.1.19.

 *** FAX TX REPORT ***

TRANSMISSION OK

JOB NO. 4709
 DESTINATION ADDRESS 962922665
 SUBADDRESS
 DESTINATION ID
 ST. TIME 16/01 15:27
 TX/RX TIME 00' 21
 PGS. 1
 RESULT OK

FAXED
 16 JAN 2019
 MOTCLM DEPT.

Out Ref. : RSS/1810-4371 (KW) (PD)
 Your Ref. :

W: Natalie Ng
 E: natalie_ng@rssolomon.com

14 January 2019



R. S. SOLOMON LLC

Advocates & Solicitors | Commissioner for Oaths

India International Insurance Pte Ltd
 64 Cecil Street
 #04-05
 IOB Building
 Singapore 049711
 Attn: Motor Claims Dept

BY PDX: 8172
WITHOUT PREJUDICE

We are to receipt of your letter dated 15/01/2019 regarding the above matter.
 We shall conduct a thorough investigation into the facts and circumstances of the
 accident to establish a medical assessment on your claim which
 accordingly.

Our Ref: MCT18100231
 Name: Aida
 Date: 16-1-19
 India International Insurance Pte Ltd

Dear Sirs,

ACCIDENT INVOLVING SMA9103T & SHC8221R AT THE JUNCTION OF STEVENS ROAD AND BUKIT TIMAH ROAD ON 9TH OCTOBER 2018 AT ABOUT 0235 HOURS

We act for Sunrita Pte Ltd (our "Clients"), owners of vehicle registration no. SMA9103T and refer to the above-captioned matter.

2. We are instructed that you are the insurers of vehicle registration no. SHC8221R at the material time. We are further instructed that the aforesaid accident was caused solely by your insured driver's negligence in his driving, controlling and/or management of the said vehicle. As a result of the accident, our Clients' vehicle was damaged and they have been put to loss and expense, particulars of which are as follows:-

(a) Cost of Repairs	\$ 8,500.00
(b) Loss of use for 7 working days at \$120.00 per day (i.e. including two days for Pre-repair survey)	\$ 840.00
(c) Survey report fee	\$ 716.00
(d) GIA report & search fees	\$ 29.00
(e) LTA search fee	\$ 7.49
(f) Costs	\$ 800.00
(g) Transport, Xerox, postages & Other Incidentals	\$ 50.00
Total:	\$ 10,942.49

Out Ref. : RSS/1810-4371 (KW)(PD)

Your Ref. :

W: Natalie Ng

E : natalie_ng@rssolomon.com

14 January 2019

India International Insurance Pte Ltd

64 Cecil Street

#04-05

IOB Building

Singapore 049711

Attn: Motor Claims Dept



R. S. SOLOMON LLC

Advocates & Solicitors | Commissioner for Oaths

**BY PDX: 8172
WITHOUT PREJUDICE**

MCT18/00231
Aida
16-1-19

Dear Sirs,

ACCIDENT INVOLVING SMA9103T & SHC8221R AT THE JUNCTION OF STEVENS ROAD AND BUKIT TIMAH ROAD ON 9TH OCTOBER 2018 AT ABOUT 0235 HOURS

We act for Sunrita Pte Ltd (our "Clients"), owners of vehicle registration no. SMA9103T and refer to the above-captioned matter.

2. We are instructed that you are the insurers of vehicle registration no. SHC8221R at the material time. We are further instructed that the aforesaid accident was caused solely by your insured driver's negligence in his driving, controlling and/or management of the said vehicle. As a result of the accident, our Clients' vehicle was damaged and they have been put to loss and expense, particulars of which are as follows:-

(a) Cost of Repairs	\$ 8,500.00
(b) Loss of use for 7 working days at \$120.00 per day (i.e. including two days for Pre-repair survey)	\$ 840.00
(c) Survey report fee	\$ 716.00
(d) GIA report & search fees	\$ 29.00
(e) LTA search fee	\$ 7.49
(f) Costs	\$ 800.00
(g) Transport, Xerox, postages & Other Incidentals	\$ 50.00
Total:	<u>\$ 10,942.49</u>

3. We enclose herewith copies of the following documents in support of our Clients' claim:-

- Final Repair Bill No. KWC/SMA9103T/091018 from Kok Wang Car Grooming;
- Survey Report with Invoice No. NS-2018-432 from Absolute Appraisal Services Pte Ltd;
- GIA report lodged by our clients' driver;
- GIA report lodged by your insured driver with payment advice for search and report fees;
- LTA Search result with payment advice; and
- 96 coloured photographs depicting damages to our clients' vehicle registration No. SMA9103T.

...2

Our Ref. : RSS/1810-4371 (KW)(PD)

Your Ref. :

W : Natalie Ng

E : natalie_ng@rssolomon.com

14 January 2019



R. S. SOLOMON LLC

Advocates & Solicitors | Commissioner for Oaths

PAGE 2

4. **TAKE NOTICE** that unless we receive your acknowledgement of receipt to this letter and enclosures **within fourteen (14) days from the date hereof**, our Client will have no alternative but to commence proceedings against your insured and/or their driver without further notice to you.

Yours faithfully,

R. S. SOLOMON LLC

Advocates & Solicitors

Enc.

Cc **COMFORT TRANSPORTATION PTE LTD**

383 Sin Ming Drive

GAS Building

Singapore 575717

**BY CERTIFICATE OF POSTING
WITHOUT PREJUDICE**

Note to insured and/or the driver: No enclosures have been provided to you; should you require copies of the afore-mentioned enclosures, please contact our office.

TAKE NOTICE that if you have a counterclaim against our Clients arising out of the above-captioned accident, you are required to send us a letter giving full particulars of the counterclaim together with all relevant supporting documents within 8 weeks of you receiving this letter.

KOK WANG CAR GROOMING

No. 1 Soon Lee Street #06-40 Pioneer Centre Singapore 627605

Tel No.: +65 91839633 | Fax: +65 6694 4864

Date: 25th October 2018

Invoice No.: KWC/SMA9103T/091018

Messrs: Sunrita Private Limited Vehicle No.: SMA9103T

	Amount
FINAL REPAIR COST	\$8,500.00
(LUMP SUM)	

Total: \$8,500.00

DOLLARS SGD EIGHT THOUSAND FIVE HUNDRED ONLY



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722
Mobile: 9688-0413 Fax: 6266-7396
Email: absolute.app.svcs@gmail.com

Invoice

Customer: Sunrita Private Limited
C/o: 1 Soon Lee Street #06-40 Pioneer Centre
Singapore 627605

Date: 25.10.2018

Invoice No: NS-2018-432

Description		Amount
Vehicle No:	SMA9103T	
Make & Model:	Toyota C-HR Hybrid (A)	
Our reference:	AAS/2018/432	
Services rendered for appraiser / inspection report		
Survey Fee		
Photographs		
Transport Fees		
Re-inspection Fees		
SGD Dollar : Seven hundred and sixteen dollar only	Total:	SGD \$ 716.00

Notes:

All cheques payment should be crossed and made payment to "Absolute Appraisal Services Pte Ltd"

Please indicate our "Invoice No." on the reverse side of the cheque.

Please do not hesitate to contact us should you have any enquires.



Absolute Appraisal Services Pte Ltd



Vehicle Inspection Report

To: Sunrita Private Limited
C/o: 1 Soon Lee Street #06-40 Pioneer Centre
Singapore 627605

Date of report: 25.10.2018
Date of request: 09.10.2018
Date of inspection: 09.10.2018
Date of accident: 09.10.2018
Claim type: Third Party Claim

Report No: AAS/2018/432

Particulars of affected vehicle:

Registration no: SMA9103T
Make/Model: Toyota C-HR Hybrid (A)
Year of registration: 2018
Colour: Metallic Yellow

Odometer: 20379 km
Engine Capacity: 1797 cc
Engine no: 2ZR8399834
Chassis no: ZYX102111492

Condition of tires:

Front Left: 6mm
Make: Dunlop
Rear Left: 7mm
Make: Dunlop

Front Right: 6mm
Make: Dunlop
Rear Right: 7mm
Make: Dunlop

Type of road wheel: Alloy (The above represent the remaining life of the tire thread)

Pre-accident condition (Static tests only)

General Bodywork	: Good
Paintwork	: Good
Handbrake	: In order
Footbrake	: In order
Steering	: In order
Apparent engine modification	: Nil

The Assignment

The inspection was conducted at M/s. Kok Wang Car Grooming
1 Soon Lee Street #06-40 Pioneer Centre
Singapore 627605

(Subsequent inspection was conducted)

Assessment

Repairer's estimate:	\$ 13,953.40
Revised estimate:	\$ 10,639.85
Recommended reserve:	\$ 8,500.00 (Lump sum)

Estimated normal duration of repairs : 5 Working days



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722
Mobile: 9688-0413 Fax: 6266-7396
Email: absolute.app.svcs@gmail.com

Vehicle No: SMA9103T

Report No: AAS/2018/432

W/O PREJUDICE

Point of impact

At the RHF portion.

General description of damages

The RHF fender, RH headlamp, front bumper, front bumper lower spoiler, front grille, radiator support panels, etc.

Other parts were also found damaged. (See schedule for details)

Recommendation

The estimate cost of repair submitted by M/s Kok Wang Car Grooming as per schedule attached have been revise and scrutinize. We list the breakdown of our findings and recommendation as per attached.

Our adjusted amount for the cost of repair is SGD \$10,639.85

Conclusion

The repairer has agreed to undertake the repair at a lumpsum of SGD \$8,500.00

Under normal circumstances, the repair of the damaged vehicle should be completed within a reasonable period of 5 working days.

We have **Not Authorised** and/or instruction to the repairer to proceed with the repairs. This inspection was conducted entirely on a '**Without Prejudice**' basis.

We are pleased to advise that the inspection was carried out accordingly and hereby submit our appraisal report which includes 96 photographs.

Your Faithfully
Absolute Appraisal Services Pte Ltd



Nicky Seah
Automobile Appraiser
MSAAA / MSMCTA



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
 160 Sin Ming Drive #03-16 Sin Ming AutoCity (S) 575722
 Mobile: 9688-0413 Fax: 6266-7396
 Email: absolute.app.svcs@gmail.com

Vehicle No: SMA9103T
 Appraisal Schedule

Report No: AAS/2018/432

S/N	Parts Description	Qty	Condition		Repairer's Est	Revised Est
1	Front bumper	1	Dented		\$ 982.10	\$ 982.10
2	Front bumper lower spoiler	1	Dented/Grazed		\$ 494.20	\$ 494.20
3	Front bumper side grille RH	1	Missing		\$ 42.40	\$ 42.40
4	Front bumper mid grille	1	Grazed/Cut		\$ 87.40	\$ 87.40
5	Front bumper retainer LH/RH	2	RH Cracked	\$ 125.70	\$ 251.40	\$ 125.70
6	Front bumper sponge (upper)	1	Dented/Broken		\$ 89.80	\$ 89.80
7	Front bumper reinforcement (upper)	1	Dented/Torn		\$ 497.60	\$ 497.60
8	Front bumper reinforcement bracket LH/RH (upper)	2	RH Dented	\$ 175.00	\$ 350.00	\$ 175.00
9	Front bumper sponge (lower)	1	Dented/Broken		\$ 87.20	\$ 87.20
10	Front bumper reinforcement (lower)	1	Dented		\$ 284.70	\$ 284.70
11	Front bumper reinforcement bracket LH/RH (lower)	2	Serviceable	\$ 86.90	\$ 173.80	-
12	Front bumper fog lamp cover RH	1	Dented		\$ 89.20	\$ 89.20
13	Front bumper sensor harness	1	Torn		\$ 255.90	\$ 255.90
14	Front lower air deflector	1	Dented/Deformed		\$ 93.90	\$ 93.90
15	Front air deflector RH	1	Serviceable		\$ 63.20	-
16	Wiper washer tank	1	Dented		\$ 165.40	\$ 165.40
17	Wiper washer tank motor	1	Malfunctioned		\$ 242.70	\$ 242.70
18	RH headlamp	1	Broken		\$ 5,448.10	\$ 5,448.10
19	RH headlamp module	1	Serviceable		\$ 876.50	\$ 876.50
20	RHF fender	1	Dented/Distorted		\$ 814.70	\$ 814.70
21	RHF fender inner shield	1	Torn		\$ 236.70	\$ 236.70
22	RHF fender badge 'Hybrid'	1	Necessary		\$ 59.30	\$ 59.30
23	RHF fender moulding	1	Deformed/Grazed		\$ 163.70	\$ 163.70
24	Front grille emblem	1	Necessary		\$ 197.00	\$ 197.00
25	Front grille	1	Grazed/Cut		\$ 1,034.30	\$ 1,034.30
26	Front grille frame	1	Cracked		\$ 153.40	\$ 153.40
27	Front grille seal	1	Necessary		\$ 34.10	\$ 34.10
28	Front grille top cover	1	Serviceable		\$ 214.20	-
29	Radiator upper support RH	1	Dented/Distorted		\$ 185.30	\$ 185.30
30	Radiator upper support	1	Distorted/Repair		\$ 294.70	-
31	Radiator side support RH	1	Distorted/Repair		\$ 253.60	-
32	Radiator lower support	1	Distorted/Repair		\$ 294.70	-
				Total:	\$ 14,511.20	\$ 12,039.80
				-25%	\$ 3,627.80	\$ 3,009.95
				List total:	\$ 10,883.40	\$ 9,029.85
1	Front bumper clips	1set	Necessary		\$ 50.00	\$ 50.00

11,541.20
 25%
 8655.90

△\$ 5,448.10
 21.40
 △\$ 1,034.30
 439



ABSOLUTE APPRAISAL SERVICES PTE LTD LOSS ADJUSTERS & MOTOR APPRAISERS

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396

Email: absolute.app.svcs@gmail.com

Vehicle No: SMA9103T

Report No: AAS/2018/432

2	Front grille top cover clips	1set	Necessary	\$	20.00	\$	20.00
3	RHF fender inner shield clips	1set	Necessary	\$	30.00	\$	30.00
4	Radiator coolant	1	Not Necessary	\$	40.00		-

100

Special nett total: \$ 140.00 \$ 100.00

Parts Total: \$ 11,023.40 \$ 9,129.85

S/N Labour Description

1	Rust proofing on front affected & replacement panels.	Repairer's Est	Revised Est
		\$ 100.00	\$ 60.00 30
2	Check all lightings & wirings.	\$ 60.00	\$ 40.00
3	To remove & refit aircon condenser. Top up aircon gas.	\$ 150.00	-
4	To remove & refit radiator & cooling fans. Conduct cooling test.	\$ 120.00	-
5	To renew damaged wire harness, transfer front bumper sensors.	\$ 100.00	\$ 60.00
6	Spray painting on affected & replacement panels.	\$ 1,200.00	\$ 600.00 500
7	Renew front damaged parts. Re-align all affected area.	\$ 1,200.00	\$ 750.00 400

1060

Labour Total: \$ 2,930.00 \$ 1,510.00

Grand Total: \$ 13,953.40 \$ 10,639.85

The final adjusted lump sum amount is \$8,500.00

Under normal circumstances, the repair should be completed within a reasonable period of 5 working days.

96 Photographs were taken at the time of inspection.

8655.90

100.00

1060.00

9815.90

20%

7852.72

4/5-7850

5 days

Disclaimer: This report is intended for the exclusive use of the address solely in relation to the loss occurrence in which the assessed vehicle involved. No liability or responsibility whatsoever shall be held by Absolute Appraisal Service Pte Ltd for any reliance on this report by any third party.

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Company

Owner ID:

0361G

Vehicle Details

Vehicle No.:

SMA9103T

Vehicle to be Exported:

No

Intended Deregistration Date:

18 Oct 2018

Vehicle Make:

TOYOTA

Vehicle Model:

C-HR HYBRID 1.8S CVT

Primary Colour:

Yellow

Manufacturing Year:

2018

Engine No.:

2ZR8399834

Chassis No.:

ZYX102111492

Maximum Power Output:

90.0 kW (120 bhp)

Open Market Value:

\$27,410.00

Original Registration Date:

22 Jun 2018

First Registration Date:

22 Jun 2018

Transfer Count:

0

Actual ARF Paid:

\$10,374.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

21 Jun 2028

PARF Rebate Amount:

\$7,780.00

Intended COE Rebate Details

COE Expiry Date:

21 Jun 2028

COE Category:

B - Car above 1600cc or 97kW (130bhp)

COE Period(Years):

10

QP Paid:

\$33,900.00

COE Rebate Amount:

\$32,798.00

Total Rebate Amount:

\$40,578.00

The information contained herein is correct as at 18 Oct 2018

OK

MSD18132434 / STA INSPECTION PTE LTD - Boon Lay
ENTRY DATE & TIME: 12/10/2018 11:07
SUBMITTED BY: Woodward Richard Vincent

Your NCD will be affected due to late reporting
Actual e-Filing Submission Date & Time: 12/10/2018 11:29

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report in the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report 12/10/2018 11:07
Date Of Accident 09/10/2018 02:35
Exact Location Of Accident STEVEN ROAD / BUKIT TIMAH ROAD
Country/State of Loss SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number SMA9103T
Insured/Policyholder
Name Of Registered Owner SUNRITA PRIVATE LIMITED
Co Reg No NA
Email Address NOEMAIL
Mobile Phone No (LOCAL) +65-96677333
Alternative Phone No OFFICE-96677333

Vehicle Particulars

Manufacturer TOYOTA
Model CHR HYBRID
Exact Purpose for which vehicle was being used at time of accident WORK PURPOSE
Are you claiming under your own insurance policy for repair to your vehicle? NO
If No, Please state action to be taken THIRD PARTY
Vehicle Category PRIVATE HIRE

Insurance Company

Name of Insurance Company NTUC INCOME INSURANCE CO-OPERATIVE LTD
Type Of Coverage COMPREHENSIVE
Fleet Policy NO
Policy Number 5101654381
Cover Note Number

Driver

Name of Driver TAN CHEE KIONG
NRIC No S1286498C
Date Of Birth 24/03/1957
Occupation OUTDOOR
Date Of Driving Pass 11/09/1979
Driving Experience 38 YEARS AND 0 MONTHS
Gender MALE
Mobile Number (LOCAL) +65-96677333
Fax Number
Contact Number OFFICE-96677333
Email Address

Address BLK 52 COMMONWEALTH DRIVE #03-536
 Postcode 142052
 Was driver an employee of the Insured's Company NO
 If No, Relationship of the Driver with the Insured OTHER - HIRER
 Vehicle Registration Number of Driver's Own Vehicle -
 Vehicle -
 Insurance Company of Driver's Own Vehicle -

General Information of the Accident

Type Of Accident COLLISION - CROSS JUNCTION
 Weather Conditions DRIZZLING
 Road Surface WET

Other Information

Was any foreign vehicle involved in this accident? NO
 Number of vehicles involved in the accident 2
 Was any body injured in the Accident? NO
 Was any injured conveyed to hospital by ambulance? NO
 Was any other material or property damaged? YES
 I have been approached by unknown person(s) soliciting/offering accident claims assistance, NO
 Number of Passengers (including Driver) 1

Details of Police Action

Was the accident reported to the police? NO
 If Yes, Please state which Police Station
 Was notice of intended Prosecution given? NO
 If Yes, against whom?

Circumstances of Accident**REFER ATTACHED**

Are accident photos available for attachment? YES
 Was there any video captured by Car Camera? YES
 Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SHC8221R
 Vehicle Make/Model/Colour WBENZ -TAXI WHITE COLOR
 Details Of Properties RIGHT SIDE PORTION
 Vehicle Category TAXI
 Name of Driver TAY BOO SENG
 NRIC/Passport Number S1384408G
 Contact Number
 Address
 Postcode
 Insurance Company Name
 Nature Of Damage
 No. Of Passenger (including Driver)

SKETCH PLAN**IMPORTANT NOTICE**

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to reputate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.




Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/PIN No.:

12/10/2018

• SKETCH PLAN

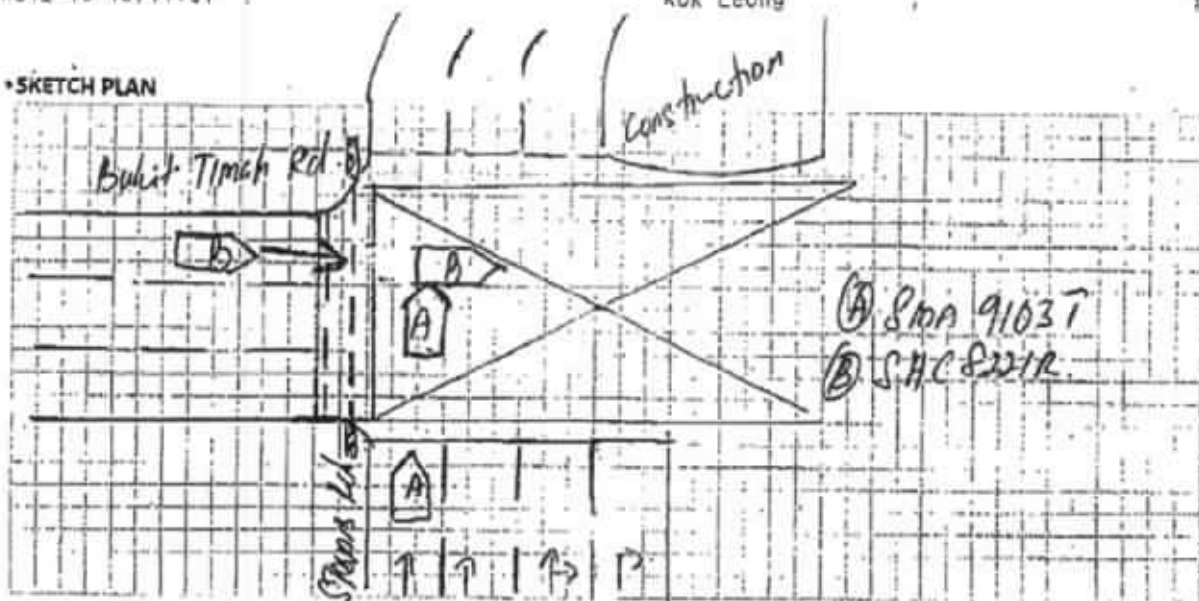

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Traffic light was green and I proceeded to drive. Suddenly a taxi, white mercedes drove straight and hit my vehicle going against the red light. No one was injured. I am filing this report for insurance claims.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:



Driver's Signature
(If driver is not the policyholder)

Reporting Centre Personnel's Signature
Name:

12/10/2018



RECORDS MANAGEMENT CENTRE

**GENERAL INSURANCE ASSOCIATION OF SINGAPORE
RECORDS MANAGEMENT CENTRE**

6 Raffles Quay #18-00, Singapore 048580
Phone: +65 6224 0010 Fax: +65 6224 0030
Operating Hours: Monday to Friday 9am to 5pm
GST Registration No: M400017735

SEARCH RESULTS

Our Ref No: GR-18-171014

Date of Request: 05/11/2018

Your Ref No: RSS/1810-4371 (KW)(PD)

R.S. SOLOMON LLC
Blk 184 Toa Payoh Central #02-354
Singapore 310184

Dear Sir/Madam,

Your Search Criteria:

Date of Accident: 09/10/2018

Place of Accident: STEVENS RD AND BUKIT TIMAH RD

Client Vehicle No: SMA9103T

With reference to your search criteria for the accident report, the following documents were found to closely match your search criteria:

REQ. VEHICLE	ACCIDENT LOCATION	ACCIDENT DATE
SHC8221R	BUKIT TIMAH RD TOWARDS STEVENS RD JUNCTION	09/10/2018 02:35

Thank You.

The images provided to you are taken from the original reports forwarded to the centre by the members of the General Insurance Association of Singapore and we take no responsibility for their accuracy or contents and shall be under no liability whatsoever for any loss or damage arising out of or in connection with the reports or their images.

This is a computer generated document and requires no signature.

**GENERAL INSURANCE ASSOCIATION OF SINGAPORE
RECORDS MANAGEMENT CENTRE**

6 Raffles Quay #18-00, Singapore 048580
Phone: +65 6224 0010 Fax: +65 6224 0030
Operating Hours: Monday to Friday 9am to 5pm
GST Registration No: M400017735

TAX INVOICE

Our Ref No: GR-18-171014

Date of Request: 05/11/2018

Your Ref No: RSS/1810-4371 (KW)(PD)

R.S. SOLOMON LLC
Blk 184 Toa Payoh Central #02-354
Singapore 310184

Dear Sir/Madam,

Your Search Criteria:

Date of Accident: 09/10/2018

Place of Accident: STEVENS RD AND BUKIT TIMAH RD

Client Vehicle No: SMA9103T

DESCRIPTION	AMOUNT (S\$)
E-File Search Fee (Public)	14.02
GST Amount	0.98
Total Amount Due (GST Inclusive)	15.00

Thank You.

This is a computer generated document and requires no signature.

For GIARMC Official use:

Date:

☒ GIRO ☐ Cash ☐ Cheque

**GENERAL INSURANCE ASSOCIATION OF SINGAPORE
RECORDS MANAGEMENT CENTRE**

6 Raffles Quay #18-00, Singapore 048580
Phone: +65 6224 0010 Fax: +65 6224 0030
Operating Hours: Monday to Friday 9am to 5pm
GST Registration No: M400017735

TAX INVOICE

Our Ref No: GR-18-171015

Date of Request: 05/11/2018

Your Ref No: RSS/1810-4371 (KW)(PD)

R.S. SOLOMON LLC
Blk 184 Toa Payoh Central #02-354
Singapore 310184

Dear Sir/Madam,

Date of Accident: 09/10/2018

Vehicle No: SMA9103T

Place of Accident: STEVEN ROAD / BUKIT TIMAH ROAD

Involving Vehicle No: SHC8221R

With reference to your application for the accident report, we have attached the following accident reports as requested:

DOCUMENTS	ACCIDENT LOCATION	PER DOC (S\$)	QTY	AMOUNT (S\$)
SHC8221R	STEVEN ROAD / BUKIT TIMAH ROAD	14.00	1	13.08
GST Amount				0.92
Total Amount Due (GST Inclusive)				14.00

The images provided to you are taken from the original reports forwarded to the centre by the members of the General Insurance Association of Singapore and we take no responsibility for their accuracy or contents and shall be under no liability whatsoever for any loss or damage arising out of or in connection with the reports or their images.

Thank You.

This is a computer generated document and requires no signature.

For GIARMC Official use:

Date:

☒ GIRO ☐ Cash ☐ Cheque

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT	
Date Of Report	09/10/2018 10:20
Date Of Accident	09/10/2018 02:35
Exact Location Of Accident	BUKIT TIMAH RD TOWARDS STEVENS RD JUNCTION
Country/State of Loss	SINGAPORE
DETAILS OF OWN VEHICLE	
Vehicle Registration Number	SHC8221R
Insured/Policyholder	
Name Of Registered Owner	COMFORT TRANSPORTATION PTE LTD
Vehicle Particulars	
Manufacturer	MERCEDES-BENZ
Model	E220
Vehicle Category	TAXI
Insurance Company	
Name of Insurance Company	INDIA INTERNATIONAL INSURANCE PTE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	MCOM0015
Cover Note Number	
Driver	
Name of Driver	TAY SOO SENG
NRIC No	S1384409G
Address	BLK 132 BEDOK RESERVOIR ROAD #06-1259
General Information of the Accident	
Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Other Information	
Was any foreign vehicle involved in this accident?	NO
Was any body injured in the Accident?	NO
Was any other material or property damaged?	YES
Number of Passengers (Including Driver)	1
Circumstances of Accident	
REFER ATTACHED * TYPE OF ACCIDENT :- HEAD TO SIDE	
Attachment(s)	
Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	-
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SMA9103T
Vehicle Make/Model/Colour	TOYOTA
Name of Driver	TAN CHEE KIONG
Insurance Company Name	

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all Insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

COPYRIGHT TRANSPORT & TRADING LTD
CO. REG. NO. 181 2218

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:


Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

GIA RMC SketchPlanForm_V3



SKETCH PLAN

A = SHC 8221R
B = SMA 910BT

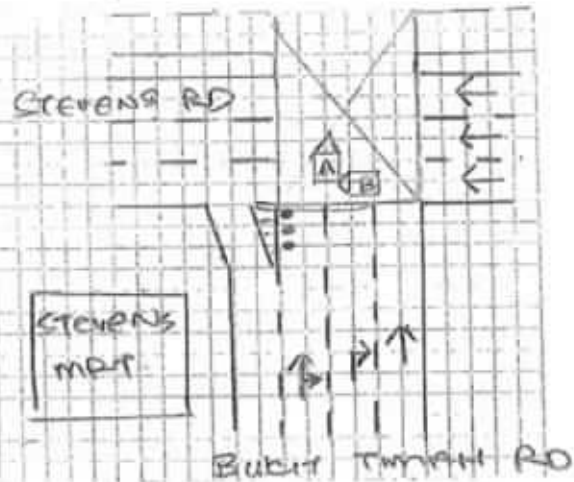

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Kindly refer statement as per attached.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

COMFORT TRANSPORTATION PTE LTD
CO. REG. NO. 199303521R

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

GV50MC (Vehicle) Form V3

Describe Circumstances of the Accident.

On 09/10/2018 @ about 02:35hrs, I was driving along Bukit Timah Rd towards Stevens Rd junction.

As I was driving towards the junction suddenly vehicle SMA9103T on right side collided onto my rear right. I was mistaken by the traffic light direction because of the construction site.

No passenger on board my taxi and no injury reported at the point of accident.

Dedication

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature/Date &
Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting
Centre Personnel

Accident Photo



Accident Photo



Accident Photo




Accident Photo



Accident Photo



Accident Photo

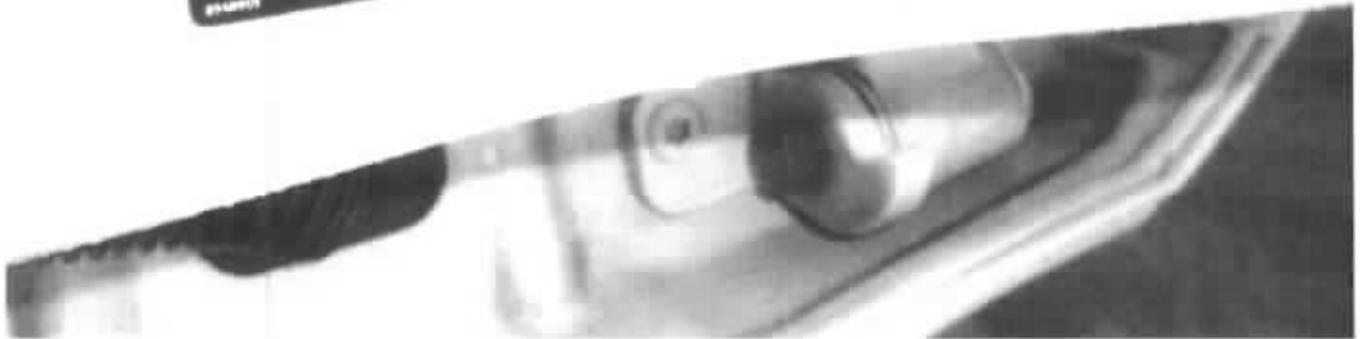


Accident Photo



SCENE



SCENE

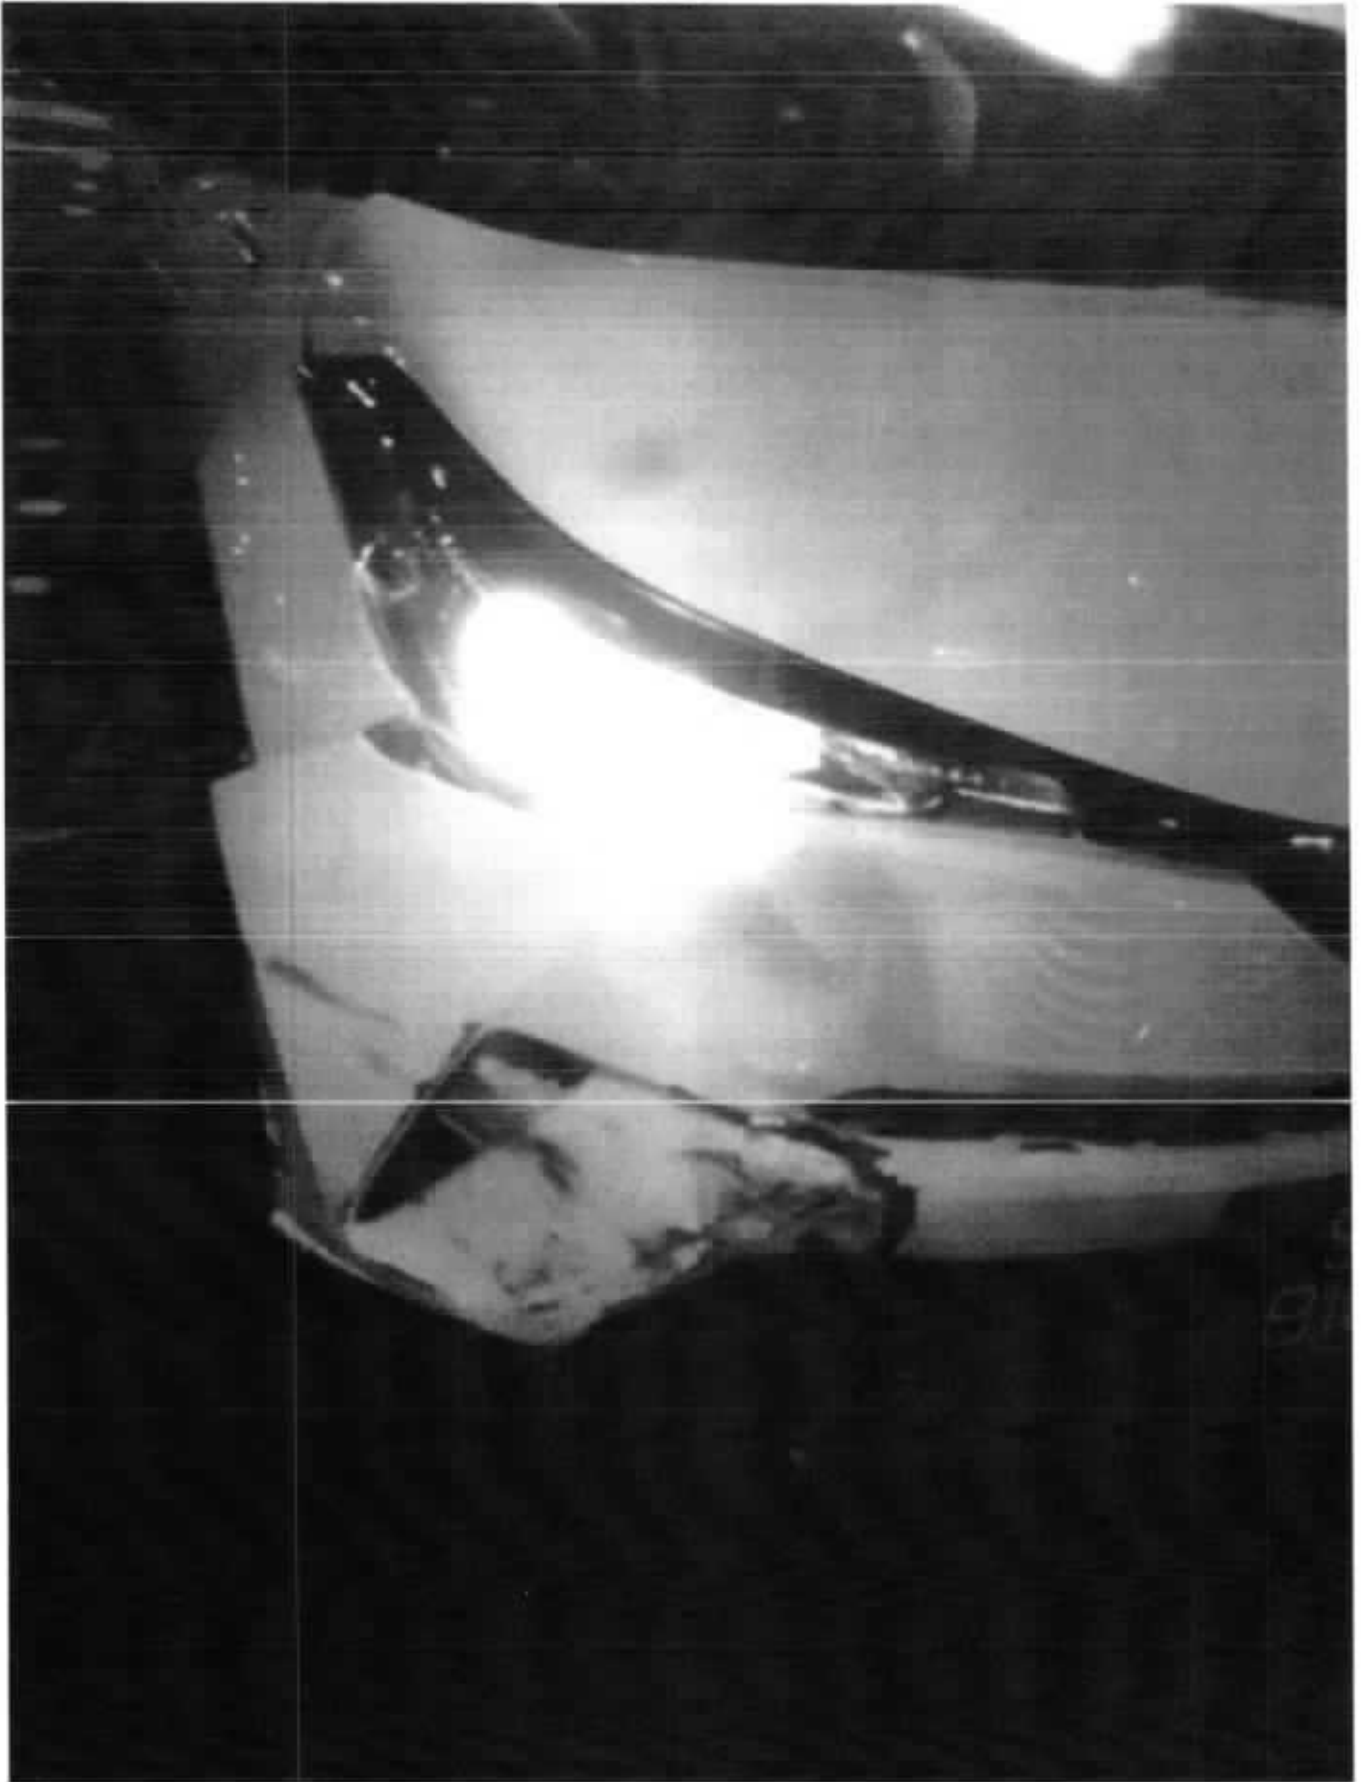

SCENE



SCENE



SCENE



SCENE



Enquire Vehicle & Owner Information (Vehicle No. SHC8221R As At 09 Oct 2018 / 02:35:00)**Law Firm Search Details**

Search Reason: Insurance claim in relation to traffic accident
Law Firm Case No.: 1810-4371 (KW)(PD)

Current Owner Details

Owner ID Type: Company
Owner ID: 199303821R
Owner Name: COMFORT TRANSPORTATION PTE LTD
Registered Address Type: Private Residential (Condo Apt or House) / Shopping / Office Complexes
Registered Block/House No.: 383
Registered Street Name: SIN MING DRIVE
Registered Unit No.: -
Registered Building Name: GAS BUILDING
Registered Postal Code: 575717

Current Vehicle Details

Vehicle No.: SHC8221R
Make Description/Model: MERCEDES BENZ / E220 BLUETEC
Insurance Company Name: INDIA INT'L INS PTE LTD

MOTORING



[View More](#)
[View More](#)
[View More](#)

Session Transaction History

Sl No	Asset Type	Asset ID	Asset Owner ID	Transaction Type	Transaction Amount (ID)	Log Date/Time
1	Vehicle	123456789	123456789	123456789	123456789	123456789

Please do not use this browser to access our website as it may result in different experience.



[Home](#)
[About](#)
[Contact Us](#)
[Privacy Policy](#)
[Terms of Service](#)
[FAQ](#)
[Help](#)
[Feedback](#)

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

INDIA INTERNATIONAL INSURANCE PL

Ref : CS3/III18018650/R1sd3e2-1

64 CECIL STREET
#05-02 IOB BUILDING SINGAPORE 049711

Date : 05-03-2019



Code : III2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHC 8221R	Veh. Inspected	SMA 9103T
Policy No.	MCOM0015	Coverage (\$)	0.00
Claim No.	MCT18100231	Excess (\$)	0.00
Assign From	STANLEY LAI	Assign Date	25/01/2019

2. Vehicle Particulars & Condition

Make & Model	TOYOTA C-HR 1.8 HYBRID S	c.c	1797
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	ZYX102111492	Colour	YELLOW
Odometer	20380	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	FAIR		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/60 R17	DUNLOP	6 mm
L/H Front Tyre	215/60 R17	DUNLOP	6 mm
R/H Rear Tyre	215/60 R17	DUNLOP	6 mm
L/H Rear Tyre	215/60 R17	DUNLOP	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION. DAMAGES SEE DETAILS.

5. General Information

Accident Date	09/10/2018	Inspection Date	16/10/2018
Survey held at	KOK WANG CAR GROOMING (HQ) 1 SOON LEE STREET #06-40 PIONEER CENTRE SINGAPORE 627605		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	5 Working Days
-------------------------------------	-----------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMA 9103T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	FRONT BUMPER	DENTED	982.10	982.10
1	FRONT BUMPER LOWER SPOILER	DENTED / GRAZED	494.20	494.20
1	FRONT BUMPER SIDE GRILLE RH	MISSING	42.40	42.40
1	FRONT BUMPER MID GRILLE	GRAZED / CUT	87.40	87.40
2	FRONT BUMPER RETAINER LH/RH	O/S CRACKED	251.40	125.70
1	FRONT BUMPER SPONGE (UPPER)	DENTED / BROKEN	89.80	89.80
1	FRONT BUMPER REINFORCEMENT (UPPER)	DENTED / TORN	497.60	497.60
2	FRONT BUMPER REINFORCEMENT BRACKET LH / RH (UPPER)	O/S DENTED	350.00	175.00
1	FRONT BUMPER SPONGE (LOWER)	DENTED / BROKEN	87.20	87.20
1	FRONT BUMPER REINFORCEMENT (LOWER)	DENTED	284.70	284.70
2	FRONT BUMPER REINFORCEMENT BRACKET LH / RH (LOWER)	SERVICEABLE	173.80	-
1	FRONT BUMPER FOG LAMP COVER RH	DENTED	89.20	89.20
1	FRONT BUMPER SENSOR HARNESS	SERVICEABLE	255.90	-
1	FRONT LOWER AIR DEFLECTOR	DENTED / DEFORMED	93.90	93.90
1	FRONT AIR DEFLECTOR RH	SERVICEABLE	63.20	-
1	WIPER WASHER TANK	DENTED	165.40	165.40
1	WIPER WASHER TANK MOTOR	NOT NECESSARY	242.70	-
1	RH HEADLAMP	BROKEN	5,448.10	2,821.40
1	RH HEADLAMP MODULE	SERVICEABLE	876.50	-
1	RHF FENDER	DENTED / DISTORTED	814.70	814.70
1	RHF FENDER INNER SHIELD	TORN	236.70	236.70
1	RHF FENDER BADGE 'HYBRID'	NECESSARY	59.30	59.30
1	RHF FENDER MOULDING	DEFORMED / GRAZED	163.70	163.70
1	FRONT GRILLE EMBLEM	NECESSARY	197.00	197.00
1	FRONT GRILLE	GRAZED / CUT	1,034.30	434.00
1	FRONT GRILLE FRAME	CRACKED	153.40	153.40
1	FRONT GRILLE SEAL	NECESSARY	34.10	34.10

Report Ref No. CS3/III18018650/R1sd3e2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607196R GST Reg. No. 19-9607196-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT GRILLE TOP COVER	SERVICEABLE	214.20	-
1	RADIATOR UPPER SUPPORT RH	DENTED / DISTORTED	185.30	185.30
1	RADIATOR UPPER SUPPORT	TO REPAIR SEE LABOUR	294.70	-
1	RADIATOR SIDE SUPPORT RH	TO REPAIR SEE LABOUR	253.60	-
1	RADIATOR LOWER SUPPORT	TO REPAIR SEE LABOUR	294.70	-
	LESS 25% DISCOUNT		-3,627.80	-2,078.55
			10,883.40	6,235.65
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	50.00	50.00
1	SET FRONT GRILLE TOP COVER CLIPS (SN)	NECESSARY	20.00	20.00
1	SET RHF FENDER INNER SHIELD CLIPS (SN)	NECESSARY	30.00	30.00
1	RADIATOR COOLANT (SN)	NOT NECESSARY	40.00	-
			140.00	100.00
	<u>LABOUR</u>			
	RUST PROOFING ON FRONT AFFECTED & REPLACEMENT PANELS.		100.00	30.00
	CHECK ALL LIGHTINGS & WIRINGS.		60.00	40.00
	TO REMOVE & REFIT AIRCON CONDENSER. TOP UP AIRCON GAS.	NOT NECESSARY	150.00	-
	TO REMOVE & REFIT RADIATOR & COOLING FANS. CONDUCT COOLING TEST.	NOT NECESSARY	120.00	-
	TO RENEW DAMAGED WIRE HARNESS, TRANSFER FRONT BUMPER SENSORS.		100.00	60.00
	SPRAY PAINTING ON AFFECTED & REPLACEMENT PANELS.		1,200.00	500.00
	RENEW FRONT DAMAGED PARTS. RE-ALIGN ALL AFFECTED AREA. INCLUSIVE OF THE REPAIR OF RADIATOR UPPER SUPPORT, RADIATOR SIDE SUPPORT RH AND RADIATOR LOWER SUPPORT.		1,200.00	400.00
			2,930.00	1,030.00
	GRAND TOTAL		13,953.40	7,365.65

Report Ref No. CS3/III18018650/R1sd3e2-1



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,850.00
---	--	--	----------

Report Ref No. CS3/III18018650/R1sd3e2-1

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.