

1057

REF: NS/INC19005789/NSd3s2
INC

CKE

Customer: NA2

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: SGG 1880A

Policy No. 5104045333 (28/9/2018-3/11/2019)

Claims No. MT/1038110-002


Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

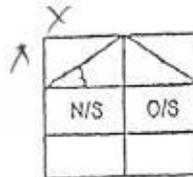

Bol. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Sec: _____ Consistent? : Yes or No

Est. Repairs: 4 days Res.: Yes or No

Lump Sum: _____ % J Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN/OUT

Veh No: SH 6453U Yr Regn: 9 JUN 2016

Type: M.Car/M.Cycle/BUS/Van/Lorry/(Taxi)/Prime Mover/

Truck/Trailer or

Make: HYUNDAI 140 c.o. 1,685

Colour: BLUE A/C: Insured/Std/NI/NA

Sp. Reading: 480,411 T/Radio: Insured/Std/NI/NA

Eng/No: _____

C/No: KMH28424MGN090111

Gen. Cond: Good/Fair/Poor/Burnt

Steering: Inorder/Jammed/Leaked/Burnt or

Brake: Inorder/Jammed/Leaked/Burnt or

Mod: Nil/S/Rim/STD/VRim or

Tyre Sz: F: 205/60 R16

R: 11

BS/DUN/EXNOVA/GY/FS/LIZA/MIC/OHTSU/PIR/SUMI/

TOYO/YOKO or WESTLAKE

Front R/Bal. 5 mm

Rear R/Bal. 6 mm

L/Bal. 5 mm

L/Bal. 6 mm

D.O.A. 29/3/19 U.O.I. 1/4/19

Survey held at CDGE LOYANG

Des. of Damages: FRONT

The UIC / Chassis frame / Body Structure affected due to collision

Date / Time	Action / Instruction
	SH 6453 U - CS/111 1302785/9m3xx DOA - 13/11/2013
	SGG 1880A - X
5/4/19	PINALIZED Lump sum REPAIR \$3700.00 (4 DAYS) (\$2,700.44. Red - 42%)

RECEIVED 9 APR 2019

Date/Time, File Pass to? 09/04/19 : Prelim Report

1) Typist : Final Report

Date/Time, File Return to?

2) _____

Report Format :

Lump Sum / I.B.I: (\$ 3,700/- 45)

Days Of Repair: 4

Resurvey No. of Trip: 2

Survey Fee: _____
Transportation: _____

Add Fee: : Site Insp (\$ _____) S+RS \$1

: Interview (\$ _____) Photos

: Tech. Invo (\$ _____) Other

: Weekend (\$ _____)

TOTAL

Denise Tay (LKKAuto)

From: MTCL@income.com.sg
Sent: Monday, 8 April 2019 2:57 PM
To: Denise Tay (LKKAuto)
Subject: FW: REQUEST CLAIM NUMBER

Hi Denise

We have registered the claim.
You may refer to table below:-

S/No	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle No.	Date of Accident	Time of Accident	Estimate	Tentative repair cost
1	MT/1038087-002	COMFORT TRANSPORTATION	SH 7351Z	SLN 9928Z	29/03/2019	14:45	5,475.32	2,800.00
2	MT/1039204-001	COMFORT TRANSPORTATION	SHC 8671A	SHD 1811D	1/4/2019	02:30	766.40	550.00
3	MT/1038399-002	CITYCAN PTE LTD	SHC 91B	SLJ 1025C	30/03/2019	12:00	1091.43	700.00
4	MT/1038110-002	COMFORT TRANSPORTATION	SH 6453U	SGG 1880A	29/3/2019	22:15	6400.44	3700.00
5	MT/1038538-002	COMFORT TRANSPORTATION	SHC 8572C	SLZ 9362S	02/04/2019	16:00	3,827.56	2850.00

Josephine Cheah
Snr Administrator, Motor Insurance
www.income.com.sg

 **income**
made different



At Income, we are 'In with You' on Performance, Growth, Innovation and Impact. These attributes reflect what we promise as an employer and what we want our people to exemplify.
Find out more at income.com.sg/careers

in with you!

From: Denise Tay (LKKAuto) [mailto:denisetay@lkkauto.com]
Sent: Monday, 8 April 2019 10:00 AM
To: mtreg <mtreg@income.com.sg>

eBaoTech

GeneralClaim

Hello, NAC_PAYA_UBI_800601

Change Language Change Password Log Out

My Desktop
Notice of Loss

Policy Query

Policy No.

Vehicle No.(For Motor)

Date of Accident

Certificate Number

Search

Select	Policy No.	Certificate Number	Policyholder Name	Policyholder NRIC	Product	Cover Type	Vehicle No.	Insured Object	Commence Date	Expiry Date
<input checked="" type="radio"/>	5104045333		LIM LI CHING	S7806380G	GPC	drive CLASSIC	SGG1880A	SGG1880A	28/09/2018	03/11/2019

Continue

COMFORTDELGRO

Date/Time: 30.03.2019 11:48

Page : 1

Team: ARC Repair TP(CLSO)1

JOB CARD

Sales Order:

JC NO: 305282875

OMER

IS

OMER NO.

ISS

(R)

(P)

OUNT CARD NO

COMFORT TRANSPORTATION PTE LTD
7010045
383 SIN MING DRIVE
Singapore SINGAPORE 575717
65508755


NTUC

REGN NO:	SH 6453U	MILEAGE
MAKE:	HYUNDAI	FUEL E 1/2 F
MODEL:	I-40	DATE/TIME IN 30.03.2019 08:55
YR OF MANU	09.06.2016	TARGET DATE
CHASSIS CODE	KMHLB41UMGU090111	COMPLETION DATE/TIME

JOB DESCRIPTION

Accident Date: 29.03.2019
NATURE: 3P 29.03.2019

S/NO LABOR CODE DESCRIPTION

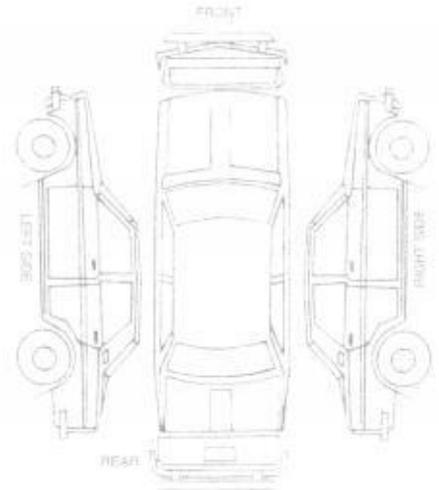

WORKED & PASSED OUT BY: _____

SERVICE ADVISOR

CUSTOMER'S SIGNATURE

Judgement Slip

No.: SH 6453U

LKE

[Signature]

Exit Pass

Vehicle No.: SH 6453U

Name of Service Advisor

Signature/Date

Name of Service Advisor

Date

Returned to Service Reception upon collection

To be kept by Security Guard

Shirley Hiew (LKK Auto)

From: Naz (LKKAuto) <Naz@lkkauto.com>
Sent: Friday, 5 April 2019 4:05 PM
To: Lim Kwok Eng
Cc: Roger How Keen Meng; Tan Pei Wei; Shirley Hiew (LKK Auto); SUR
Subject: Re: SH6453U FINALIZATION
Attachments: FINALIZED.pdf

Dear Mr Lim,

Finalized Lump Sum Repair \$3700 / 4 Repair Days subject to insurance approval.

Thank you.

Best Regards,

Naz | Technical Investigator

LKK Auto Consultants

Phone: 6841-2157 | Email: Naz@lkkauto.com | Fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Lim Kwok Eng <limke@cde.com.sg>
Sent: Thursday, 4 April 2019 6:29 PM
To: Naz (LKKAuto); Calvin Ang (LKKAuto)
Cc: Roger How Keen Meng; Tan Pei Wei
Subject: SH6453U finalize

Dear Naz,

Pls refer finalization form and ? item photo attachment, photo aft repair taken by Calvin.

Best Regards
Lim Kwok Eng

Taxi Crash Repairs / ComfortDelgro Engineering Pte Ltd
Tel: 6214-8355 / 6214-8156

This message and any attachments may contain confidential, privileged or proprietary information. If you are not the intended recipient, kindly notify us and delete this message and its attachments immediately, and please be advised that using, copying, distributing or disclosing any contents therein is not allowed. Statements pertaining to any matter outside our business are not to be taken as endorsed by ComfortDelGro Corporation Limited or its related companies. The comments/proposals provided are for discussion purposes only and are subject to approvals. Nothing herein shall constitute a binding agreement between the parties. Neither party shall be bound in any way to any term or condition except as agreed in a written agreement signed by the duly authorised representatives of both parties.

ComfortDelGro - a Green Office certified by the Singapore Environment Council - is committed to preserving the environment. We encourage you to print this only if necessary.

ComfortDelGro Engineering Pte Ltd [Registration No. 199506048W]

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	30/03/2019 09:57
Date Of Accident	29/03/2019 22:15
Exact Location Of Accident	CLEMENCEAU AVE NORTH TWDS NEWTON
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SH6453U
Insured/Policyholder	
Name Of Registered Owner	COMFORT TRANSPORTATION PTE LTD
Co Reg No	199303821R
Email Address	FLEETSAFETY@CDGTAXI.COM.SG
Mobile Phone No	
Alternative Phone No	OFFICE-65508768

Vehicle Particulars

Manufacturer	HYUNDAI
Model	I40
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	INDIA INTERNATIONAL INSURANCE PTE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	MCOM0015
Cover Note Number	

Driver

Name of Driver	TAN KENG HOCK
NRIC No	S1241475G
Date Of Birth	30/11/1957
Occupation	OUTDOOR
Date Of Driving Pass	01/07/1977
Driving Experience	41 YEARS AND 8 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-81269646
Fax Number	
Contact Number	
EMail Address	DANIELKH.TAN@YAHOO.COM.SG

Address	BLK 792 WOODLANDS AVENUE 6 #06-685
Postcode	730792
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - TAXI DRIVER
Vehicle Registration Number of Driver's Own Vehicle	-
Insurance Company of Driver's Own Vehicle	-

General Information of the Accident

Type Of Accident	SIDE SWIPE
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

PLS REFER TO ATTACHED / Type Of Accident : HEAD TO SIDE

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	-
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SGG1880A
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	LIM LI CHING
NRIC/Passport Number	S7806380G
Contact Number	98364880
Address	
Postcode	
Insurance Company Name	NTUC INCOME INSURANCE CO-OPERATIVE LTD
Nature Of Damage	FRT
No. Of Passenger (Including Driver)	

Sketch Plan Pg. 1

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

COMFORT TRANSPORTATION PTE LTD
CO. REG. NO. 199203621K

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

30/3/19
Jackson Heng
CSO



Sketch Plan Pg. 2



DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On 29/3/2019 at about 2215 hrs, I vehicle A was driving my taxi along Clemenceau North making a U turn. Vehicle B didn't stop at the stop line and he dash out from Cavenagh house collided onto vehicle A left front portion. No one was injured at that time.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

COMFORT TRANSPORTATION PTY LTD
CO. REG. NO. 105023019




Policyholder's Signature
Date & Time:




Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

38/3/19
Jackson H...
CSO Jackson

CMPTAC SketchPlanForm_V3

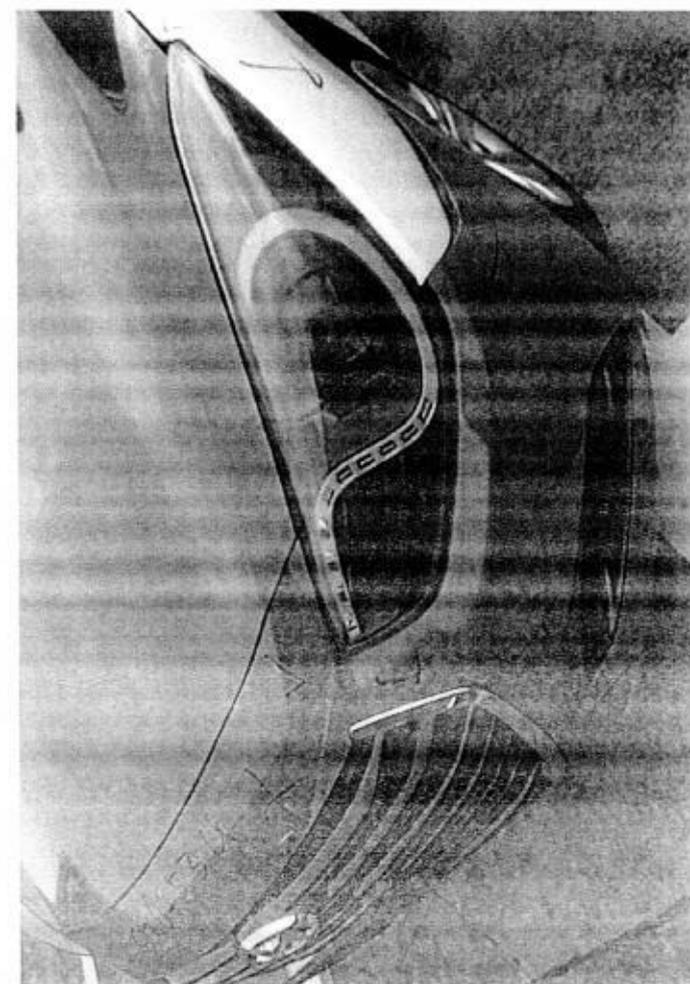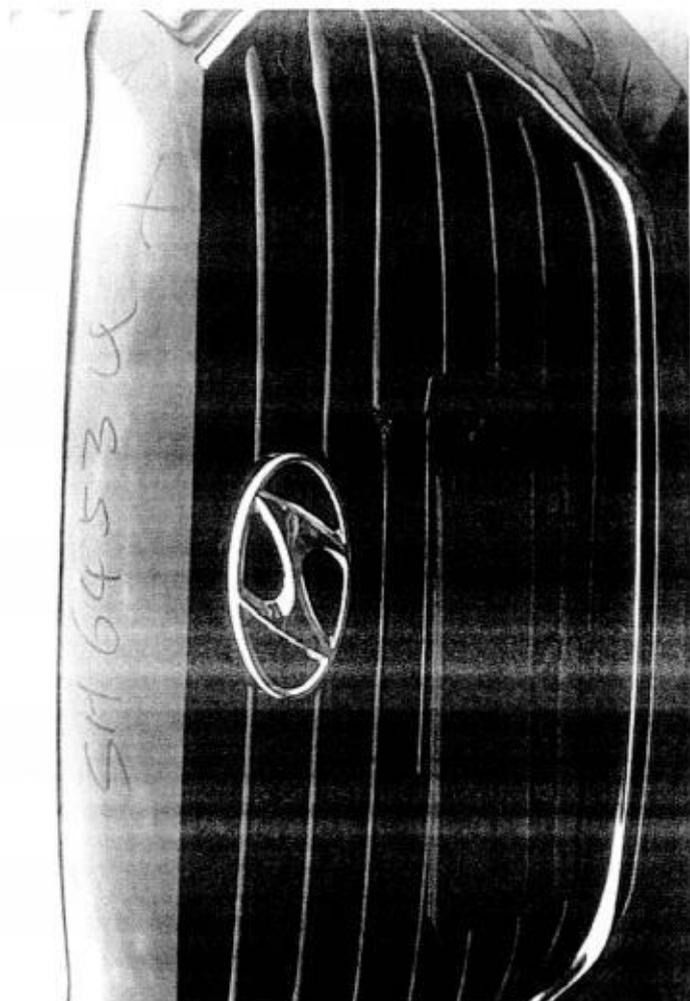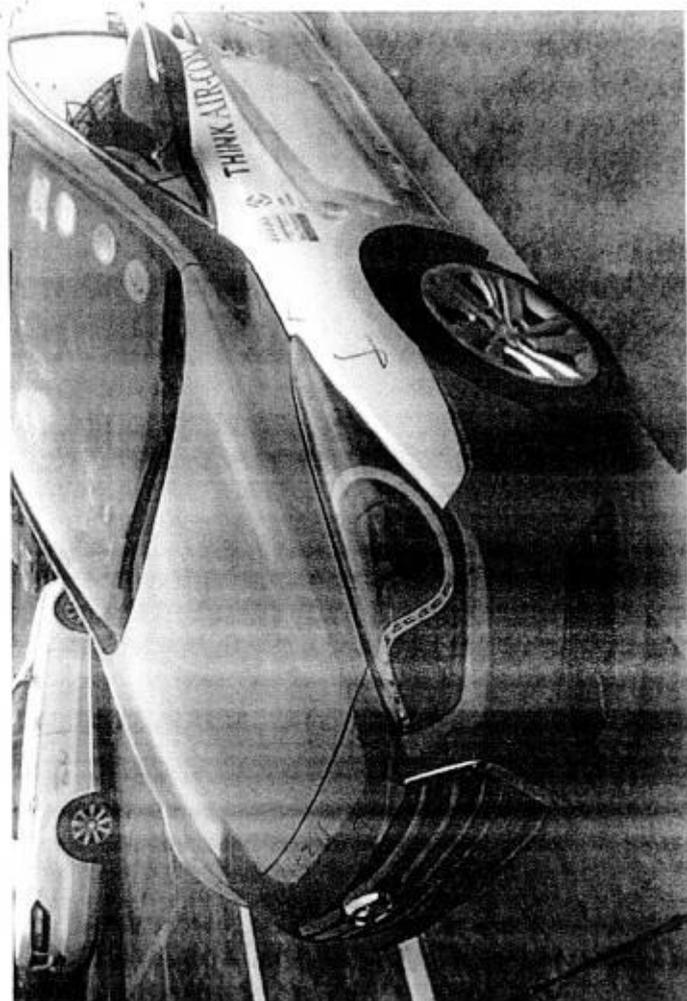

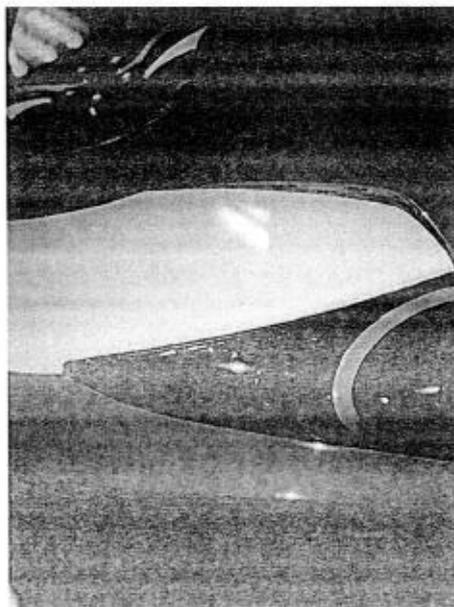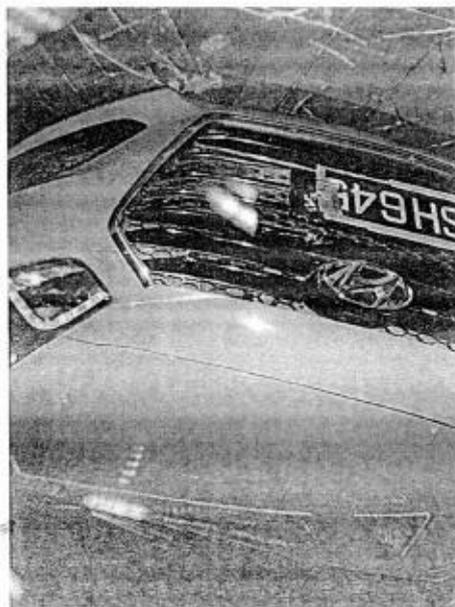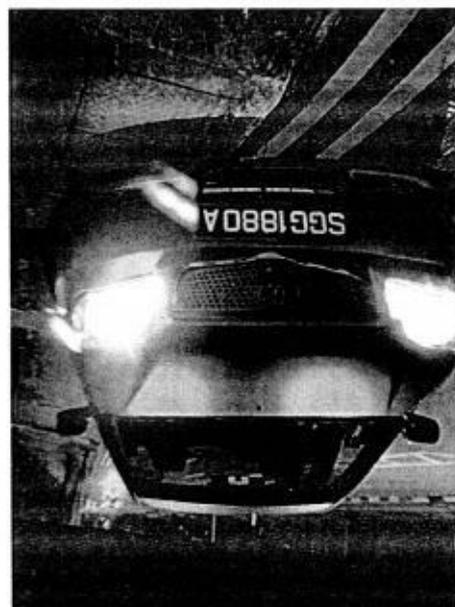

COMFORTDELGRO ENGINEERING PTE LTD

REPAIR ESTIMATE*

VEHICLE NO : SH 6453U

DATE 1/4/2019 11:17

MAKE :

MODEL : HYUNDAI i40

LK2

NETU C

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Radiator Grille			\$ 1,110.10
	Front Bumper Cover			\$ 1,052.20
	Front Bumper Sponge			\$ 99.20
	Front Bumper Reinforcement			\$ 402.10
	Front Bumper Bracket Top (LH/RH)		\$ 22.40	\$ 44.80
	Front Bumper Bracket (LH/RH)		\$ 24.60	\$ 49.20
	Headlamp Support Panel Assy			\$ 907.40
	Headlamp (LH)			\$ 1,388.00
	Front Fender (LH)			\$ 566.30
	SUB TOTAL			\$ 5,619.30
	LESS 20%			\$ 1,123.86
	DISCOUNTED TOTAL			\$ 4,495.44
	Front Number Plate			\$ 25.00
	Front No Plate Trim Cover			\$ 30.00
	Front Fender Advertisement Logo (LH)			\$ 100.00
				\$ 155.00
	Labour Charge			
	Panel Beating			\$ 1,000.00
	Spray Painting Charge			\$ 500.00
	Wiring			\$ 50.00
	Tuff Kote			\$ 50.00
	Remove/Refix Aircon & Refill Gas			\$ 150.00
	TOTAL LABOUR			\$ 1,750.00
	ESTIMATE TOTAL			\$ 6,400.44

✓CRK
?/CRK
?XSVL
?XSVL
?XSVL
?XSVL
XSVL?
/CRK
/DEF

Nett /MIS
Nett /CRK
Nett /NEC

LKK Authorised

the Report

- To repair
- To display
- Parts
- This
- No
- Sup

without Prejudice basis

must be **resurveyed and**

approval from **Insurance Company**

Acknowledged by Repairer

Signature:

Date:

600
/30
40
XNN

[Signature]
4/4/19
NAZ LKK
1/4/19 1640
LIS
40 days
CHECK ITEMS PHOTOS
AFTER REPAIR PHOTOS

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

COMFORTDELGRO ENGINEERING

ComfortDelGro Engineering Pte Ltd
59 Loyang Drive Singapore 508969
Fax: 6546 8156

Our Job Ref No : 305282875
Date : 04.04.19

FINALIZATION FORM

To : LKK
Attn : Mr NAZ
Vehicle Reg No. SH6453U CTPL

Fax :

29.03.19

The survey and estimates of the repairs of the above-mentioned vehicle are as follows:-

1. The repair job shall bill to: NTUC --- SGG1880A
2. The finalized amount shall be:
 - (a) Spare Parts after List discount _____
 - (b) Labour Charges _____
 - Total for Part-By-Part Repair Cost** _____
 - (c) Lumpsum Repair (if applicable)
Total for Lumpsum repair cost after Less: 20% \$3,700.00
Final Lumpsum Repair cost \$3,700.00

3. Estimated normal period for repairs: 4 working days.

4. We shall treat the above amount as Correct and Confirmed if there is no reply from you within 7 working days

5. Thank you for your assistance.

We confirm the estimates and finalized amount

Signature : 
Name : LIM KWOK ENG
Tel : 62148316
Fax : 65468156

Signature : 
Name : NAZ LKK
Date : 5/4/19

For Official Use Only

Item	Amount	Document Attached Yes or No	Confirm By (Signature)	Remarks
1. Rental Rate P/Day		YES		
2. Loss of Income Paid		NO		
3. Survey Fees				
4. LTA Search Fee	\$7.49			
5. Medical Fees (on behalf of driver, if applicable)				
6. Overrun				

Remarks:

COMFORTDELGRO ENGINEERING PTE LTD
REPAIR ESTIMATE*

VEHICLE NO : SH 6453U

DATE 1/4/2019 11:17

MAKE :

MODEL : HYUNDAI i40

LK2

NTUC

Qty	Parts Description/ Labour	Type	Unit Price	Amount	
	Radiator Grille			\$ 1,110.10	✓ CKK
	Front Bumper Cover		✓ CKK	\$ 1,052.20	? ✓ photo LK2
	Front Bumper Sponge			\$ 99.20	? ✓ Jackson
	Front Bumper Reinforcement			\$ 402.10	? ✓ SUV
	Front Bumper Bracket Top (LH/RH)	\$	22.40	\$ 44.80	? ✓ SUV
	Front Bumper Bracket (LH/RH)	\$	24.60	\$ 49.20	? ✓ SUV
	Headlamp Support Panel Assy		✓ CKK	\$ 907.40	✓ CKK?
	Headlamp (LH)			\$ 1,388.00	✓ CKK
	Front Fender (LH)		3,064.40	\$ 566.30	✓ DEF
		+ ?	1,052.20		
	SUB TOTAL		4,116.60	\$ 5,619.30	
	LESS 20%			\$ 1,123.86	
	DISCOUNTED TOTAL		- 20%	\$ 4,495.44	
			3,293.28		
	Front Number Plate		55	\$ 25.00	Nett / MIS
	Front No Plate Trim Cover		- 10%	\$ 30.00	Nett / CKK
	Front Fender Advertisement Logo (LH)		49.50	\$ 100.00	Nett / NEU
			+ 100.00		
			149.50	\$ 155.00	
	Labour Charge				
	Panel Beating			\$ 1,000.00	600
	Spray Painting Charge			\$ 500.00	✓
	Wiring		1,170	\$ 50.00	30
	Tuff Kote		4,612.78	\$ 50.00	40
	Remove/Refix Aircon & Refill Gas		- 20%	\$ 150.00	X NN
			3,690.22		
	TOTAL LABOUR			\$ 1,750.00	
	ESTIMATE TOTAL			\$ 6,400.44	
	<p>NAZ-CKK 1/4/19 1640 LIS \$3,700 40000 CHECK ITEMS PHOTOS AFTER REPAIR PHOTOS</p>				

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC19005789/Nsd3s2	
73 BRAS BASAH ROAD #05-01 NTUC TRADE UNION HOUSESINGAPORE 189556	Date: 12-04-2019
	Code: INC4



1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SGG 1880A	Veh. Inspected	SH 6453U
Policy No.	5104045333	Coverage (\$)	0.00
Claim No.	MT/1038110-002	Excess (\$)	0.00
Assign From		Assign Date	01/04/2019

2. Vehicle Particulars & Condition

Make & Model	HYUNDAI I40	c.c	1685
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	KMHLB41UMGU090111	Colour	BLUE
Odometer	480411	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	FAIR		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/60R16	WEST LAKE	5 mm
L/H Front Tyre	205/60R16	WEST LAKE	5 mm
R/H Rear Tyre	205/60R16	WEST LAKE	6 mm
L/H Rear Tyre	205/60R16	WEST LAKE	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION. DAMAGES SEE DETAILS.

5. General Information

Accident Date	29/03/2019	Inspection Date	01/04/2019
Survey held at	COMFORTDELGRO ENGINEERING PTE LTD 59 LOYANG DRIVE SINGAPORE 508969		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	4 Working Days
-------------------------------------	----------------



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SH 6453U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	RADIATOR GRILLE	CRACKED	1,110.10	1,110.10
1	FRONT BUMPER COVER	CRACKED	1,052.20	1,052.20
1	FRONT BUMPER SPONGE	SERVICEABLE	99.20	-
1	FRONT BUMPER REINFORCEMENT	SERVICEABLE	402.10	-
2	FRONT BUMPER BRACKET TOP (LH/RH) @ \$22.40	SERVICEABLE	44.80	-
2	FRONT BUMPER BRACKET (LH/RH) @ \$24.60	SERVICEABLE	49.20	-
1	HEADLAMP SUPPORT PANEL ASSY	SERVICEABLE	907.40	-
1	HEADLAMP (LH)	CRACKED	1,388.00	1,388.00
1	FRONT FENDER (LH)	DEFORMED	566.30	566.30
	LESS 20% DISCOUNT		-1,123.86	-823.32
			4,495.44	3,293.28
<u>NETT ITEMS</u>				
1	FRONT NUMBER PLATE (N)	MISSING	25.00	25.00
1	FRONT NO. PLATE TRIM COVER (N)	CRACKED	30.00	30.00
	LESS 10% DISCOUNT		-	-5.50
			55.00	49.50
<u>SPECIAL NETT ITEMS</u>				
1	FRONT FENDER ADVERTISEMENT LOGO (LH) (SN)	NECESSARY	100.00	100.00
			100.00	100.00
<u>LABOUR</u>				
	PANEL BEATING.		1,000.00	600.00
	SPRAY PAINTING CHARGE.		500.00	500.00
	WIRING.		50.00	30.00
	TUFF KOTE.		50.00	40.00
	REMOVE / REFIX AIRCON & REFILL GAS.	NOT NECESSARY	150.00	-
			1,750.00	1,170.00
GRAND TOTAL			6,400.44	4,612.78

Report Ref No. NS/INC19005789/Nsd3s2

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)			3,700.00
--	--	--	----------

Report Ref No. NS/INC19005789/Nsd3s2

MUHAMMAD NAZRIL BIN ABDULLAH

Automotive Assessor



K.K.LAU CPT(RET)

**BEng(Hons),B.Bus,MBA,PEng,PE,
MinstAEA,MASME,MIRTE**

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.