Byrreuur Touphi REF: AXI	A. 10636/71/9 - Su-oum
- Current	IGNMENT
4.455.65	1 01 × 9/1900 2018 A.1
From: Date:	Veh No: / / / YFRegn: / / /
Estimated Cost:	Type: M.Cor / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
OD (TP) WS / TP RES / OD RES / EVA / INV / MV	Track/Trailer or
To Inspect Vehicle No:	Make: Meucedes Benz C180 c.c 1595
at Workshop m/s	Colour J. L. A/C: Insured / Std / NI / NA
of	Sp.Reading 303 49. T/Radio: Insured / Std / NI / NA
Insured:	Eng/No:
Policy No.	C/No: WD 92050402R352644
Claims No.	Gen. Cond: Good / Fair / Poor / Burnt
Sum Insured: Excess:	Steering: Inorder/ Jammed / Leaked / Burnt or -
(Client's Record)	Brake: Inorder Jammed / Leaked / Burnt or
Make of Veh:	Modi: Nil / S/Rim / STD A/Rim or
	Tyre Size: F: 2x yorl 7.
(Policy Condition)	R:
Remark: The veh had commenced its N/S O/S	BS DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
repair at the time of inspection.	TOYO / YOKO or
Bal. or Market Value:	Front Rear
DAC Accident Rport: Consistent? : Yes or No	R/Bal. G mm R/Bal. G mm
GIA / PR Seen: Consistent? : Yes or No	L/Bal. 6 mm L/Bal. 6 mm
Est. Repairs: days Res.: Yes or No	D.O.A. D.O.I. 27/6/19
um Sum: % 3 Val.; Yes or No	Survey held at Sux Ah Tee
CA / REV / REP. / 24 HRS  Vehicle: IN / OUT	Des. of Damages : Frt / Rear / O/S / N/S / U/C / Rooftop or
Date: Person Contacted:	The U/C / Chassis frame / Body Structure affected due to collision.
Date / Time   Action / Instruction	
EST THE BOOK FRENCH CONTRACTOR OF THE CONTRACTOR	
ate/Time, File Pass to? : Preli. Report	Days Of Repair:
: Final Report	Resurvey No. of Trip: Survey Fee:
Date/Time, File Return to?	Transportation:
Add Fee	: Site Insp (\$ )s+Rs,si
	: Interview (\$ ) Photos
Report Format :	: Tech. Invs (\$ ) Others
ump Sum / I.B.I: (\$	:Weekend (\$
	TOTAL

Claim Reference:

Assessment number: SLX9490R-TP-AXA

Version: 1810

Date calculated: 27/06/2019 2:46 PM

(Amender)

**Full Report** Registration: SLX9490R Printed: 27/06/2019 2:46 PM

### Summary Information

Claim

Location: Printed by:

Claim Reference: Estimated Repair Time: Actual Repair Days:

Singapore (SG)

DARREN SNG

Work Provider: Currency: Date of Incident:

Hire Car Start: Hire Car End:

AXA Insurance Pte Ltd

SGD 21/02/18

#### Vehicle Details

Vehicle

Manufacturer: Model:

MERCEDES-BENZ C-CLASS (W205) C 180

Sub Model: Model Sheet Number:

03 AP 42 SLX9490R

Registration:

WDD2050402R352644

VIN number: Odometer:

**Model Specs** 

FR PRODUCTION START A/C THERMATIC

FRT COLLISION ALARM AUDIO 20 TOUCHPAD LED HEADLAMP

PASSENGER SEAT MEMOR STORAGE PACKAGE

KEYLESS GO

AMG SILL MOULDINGS **AUTOMATIC 9-SPEED** TYRES 225/50 WR 17 PEDESTRIAN PROTECT PREP MAP PILOT

EQUIPMENT AVANTGARDE EQUIPMENT AVANTGARDE MODEL 2018 MIRROR PACKAGE **KEYLESS IGNITION SYS** RADIO-CD/DVD LEATHER PAD ARTICO ELECTRIC BOOTLID HD COOLING

TYRE PRESSURE SENSOR WHEELS 7J X 17 ALLOY PRODUCT SOUTH AFRICA TWO COAT METALLIC

DIPPING MIRROR KEYLESS GO WIPER/RAIN SENSOR FOLDING REAR SEAT ALU MOULDINGS ILLUMINAT AMBIENTE ECO START/STOP AGILITY CONTR SUSPEN TYRE W/FLAT RUNNING

**ELECT FOLDING MIRROR** REARVIEW CAMERA INTERIOR LAMP PACK ELEC DRIVER SEAT MEM PARK ASSISTENT **BOOTLID SENSORS** AGILITY SELECT SWITC CRUISE CONTROL EXTENDED FUEL TANK CLEAR COAT HARD

Claim Reference:

Assessment number: SLX9490R-TP-AXA

Version: 1810

Date calculated: 27/06/2019 2:46 PM

Full Report Registration: SLX9490R Printed: 27/06/2019 2:46 PM


#### **Vehicle Condition**

**Vehicle Status** 

Pre-Accident Damage: Date of Inspection:

**Damage Areas** 

All Underbody

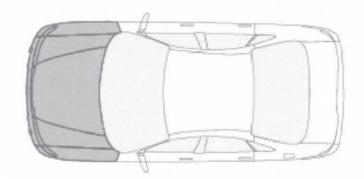

#### Labour

54-1011 01 SHORT TEST INCLUDES: CONNECT + DISCONNECT STAR DIAGNOSIS, PRINT DATA,	3.0	.00 SGD/h Price SGD 13.50
INCLUDES: CONNECT + DISCONNECT STAR DIAGNOSIS, PRINT DATA,	3.0	13.50
DELETE ERROR MEMORY		
54-0650 01 MAIN BOARD MAINTAINED (FOR CHECK AND DIAGNOSIS WORK)	1.0	4.50
60-3012 01 DETACH + REFIT L/F BUMPER	4.0	18.00
82-4710 01) R + R LEFT HEADLAMP (BUMPER REMOVED/DETACHED)	3.0	13.50
82-4886 01 ADDITIONAL TO RENEW HEADLAMP (VEHICLE WITH LED HEADLAMP)	3.0	13.50
54-0800 ZAX CHECK REARVIEW CAMERA	1.0	4.50
82-1120 01 ADJUST HEADLAMPS	5.0	22.50
0283 FRONT BUMPER COVER REPAIR	20.0*	90.00

**Claim Reference:** 

Full Report Registration: SLX9490R

Assessment number: SLX9490R-TP-AXA

Printed: 27/06/2019 2:46 PM

Version: 1810

Date calculated: 27/06/2019 2:46 PM

Labour Cost Panel / Mechanical Labour	Hrs 4.00	WU 40.0	180.00
Total of Labour	4.00	40.0	180.00

Paint Work	SYSTEM AZT	Time Basi	s 10WU/h
Code	Description - TWO COAT METALLIC	WU	Price SGD
	FRONT BUMPER COVER NEW PART PAINT K1R	11.0	
Paint Mater	ial Per Part		
Code	Description		Price SGD
0283	FRONT BUMPER COVER NEW PART PAINT K1R		54.61

Labour Cost - Paint Factor	45.00 SGD/h	Hrs	WU	Price SGD
Time Paint Preparation Comp. Work Plastic		0.90	11.0 9.0	40.50
Total	10 WU/h	2.00	20.0	90.00

Material Cost - Paint	Price SGD
New Part Painting - Plastic K1R	54.61
Material-constant Plastic	16.20
Total	70.81

### **Spare Parts**

Code	Description	Part Number	Supplier	prices as at 2015-06-01 Price SGD
0561	LEFT HEADLAMP ASSY	205 906 7503		1,380.00
f: OEM Parts n: Non-OEM Parts u: Used parts	Savings Subtotal Addition(+15.00%)			0.00 1,380.00 207.00
	Total	1		1,587.00

Claim Reference:

Full Report

Assessment number: SLX9490R-TP-AXA

Version: 1810 Date calculated: 27/06/2019 2:46 PM Registration: SLX9490R Printed: 27/06/2019 2:46 PM

### **Final Calculation**

	SGD	SGD
Parts Addition(+15.00%) Total Parts	1,380.00 207.00	1,587.00
Labour Time Base 10 WU/h Total 40.0 WU X 45.00 SGD/h Total of Labour	180.00	180.00
Paint Work Time Base 10 WU/h Labour Cost 20.0 WU X 45.00 SGD/h Material Cost Total Paint Including Material	90.00 70.81	160.81
Repair Cost Excludes GST  GST (+7.0%)  Repair Cost Included GST		1,927.81 134.95 2,062.76

#### Comments

\* - USER SUPPLIED DATA NN - NO MANUFACTURERS CODE EXISTS ) - WU PARTIAL INCL IN OTHER POSITIONS

### > Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID: Vehicle Details	3865G
Vehicle No.:	SLX9490R
Vehicle to be Exported:	No
Intended Deregistration Date:	19 Apr 2019
Vehicle Make:	MERCEDES BENZ
Vehicle Model:	C180 AVANTGARDE (R17 LED)
Primary Colour:	Blue
Manufacturing Year:	2017
Engine No.:	27491031203621
Chassis No.:	WDD2050402R352644
Maximum Power Output:	115.0 kW (154 bhp)
Open Market Value:	\$37,239.00
Original Registration Date:	19 Apr 2018
First Registration Date:	19 Apr 2018
Transfer Count:	0
Actual ARF Paid: Intended PARF Rebate Details	\$44,135.00
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	18 Apr 2028
PARF Rebate Amount: Intended COE Rebate Details	\$33,101.00
COE Expiry Date:	18 Apr 2028
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$37,010.00
COE Rebate Amount:	\$33,305.00
Total Rebate Amount:	\$66,406.00

The information contained herein is correct as at 17 Apr 2019