

MASS. REC. BY:

REF: CS/FCI 190119 (8/1A + 6/27)

Special Instruction:

Surveyor: Adnan

(WS)

ASSIGNMENT (Office)

From (Person): May chun of FCI Date/Time: 5:20pm 19/6/19

Estimated Cost: Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SLG 4947J Insured: SH 6860C

at Workshop n/s: Autolution Tel: 96 450084

of 19 ubi Road 4

Policy No: Claim No: D1900 3867 MFSH

Sum Insured: Excess:

Make of Veh: (Client's Record) D.O.A. 12/06/2019

CA / REV / REP. / REV 24HRS 1PS7 H.O.D. Endorsement:

Date/Time: 10:29am Person Contacted: Elmer Vehicle IN/OUT

Date/Time	Action/Instruction
	ishmall ✓
	SLG 4947C-X
	SH 6860C-COS/119/3017689/1920302 DVA: 22/1/203
24/6 @ 1:08pm	Revised via preli advise sent email
	Part by Part \$4102.44 (Red: 1543.20, 27%)

ASSIGNMENT

From: Date: 21.6.2019

Veh No: SLC4947J. Yr Regn: 2016, May

Estimated Cost

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

Truck / Trailer or

To inspect Vehicle No: SLC 4947J

Make: Nissan Note cc 1198

at Workshop n/s Automation Industrial

Colour: Grey. A/C: Insured / Std / NI / NA

of 19 Ubi Road 4

Sp.Reading: 38134 T/Radio: Insured / Std / NI / NA

Insured:

Eng/No:

Policy No.

C/No: JN1TAAE1220972290

Claims No.

Gen. Cond: Good / Fair / Poor / Burnt

Sum Insured: Excess:

Steering: In order / Jammed / Leaked / Burnt or

(Client's Record)

Brake: In order / Jammed / Leaked / Burnt or

Make of Veh: 11000 m

Modi: Nil / S/Rim / STD A/Rim or

(Policy Condition)

N/S	O/S

Remark: The veh had commenced its repair at the time of inspection.

Tyre Size: F: 185/65R15

R: 185/65R15

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Continental

Bal. or Market Value:

Front Rear

IDAC Accident Rpt: Consistent? : Yes or No

R/Bal. 06 mm

GIA / PR Seen: Consistent? : Yes or No

L/Bal. 06 mm

Est. Repairs: days Res.: Yes or No

D.O.A. D.O.I. 2/06/19

Lum Sum: % 3 Val: Yes or No

Survey held at: Tan Chany (Ubi).

CA / REV / REP. / 24 HRS

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Date: Person Contacted: Vehicle: IN / OUT

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

TP / 1st Cap

RECEIVED 04 SEP 2019

Date/Time, File Pass to?

: Prel. Report

Days Of Repair: 5

1) 419 Typist

: Final Report

Resurvey No. of Trip:

Date/Time, File Return to?

Survey Fee:

2)

Add Fee:  : Site Insp (\$)

Transportation:

Report Format:

TP

Lump Sum / (B.I) (\$) 4102.44

: Interview (\$)

S + RS, 24

: Tech. Inv (\$)

Photos:

: Weekend (\$)

Others:

TOTAL

140
50
50
27
267

**MOTOR SURVEY ASSIGNMENT**

<b>Date</b>	13-06-2019	<b>Our Ref No.</b> D19003867MFSH
<b>Accident Date</b>	12-06-2019	<b>Claim Type.</b> Third Party
<b>Insured Vehicle</b>	SH6860C	<b>Third Party Vehicle.</b> SLC4947C
<b>Survey Location</b>	19 UBI ROAD 4	
<b>Contact Person.</b>	ELMER ALFONSO	
<b>Contact No.</b>	67038691/ 96450084	<b>Fax No.</b> 0
<b>Survey Type</b>	WITHOUT PREJUDICE: WE ADMIT LIABILITY QUANTUM TO BE AGREED:	
<b>Appointed Surveyor</b>	LKK AUTO CONSULTANTS PTE LTD	
<b>Contact Person</b>	NA	<b>Fax No.</b> 68416315
<b>Contact Number.</b>	NA	

**FOR DIRECT SETTLEMENT**

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

**THIRD PARTY SURVEY REQUEST**

<b>Cc : Workshop</b>	AUTOLUTION INDUSTRIAL PTE LTD	<b>Attention.</b> NIL
<b>Cc : TP Solicitor</b>	NA	<b>TP Solicitor Fax No.</b> NA
<b>Officer Incharge</b>	MAY CHUA	

**IMPORTANT NOTE**

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.  
This is a computer generated letter, no signature required.

## Denise Tay (LKKAuto)

---

**From:** Denise Tay (LKKAuto)  
**Sent:** Monday, 24 June 2019 1:08 PM  
**To:** Admin-D (LKKAuto); 'CWS Motor Claims'; assignments  
**Cc:** 'May Chua Hui Chin'; SUR  
**Subject:** RE: SURVEY ASSESSMENT - D19003867MFSH/1  
**Attachments:** PRELI ADVISED SLC 4947J.pdf

Dear Sir/Madam,

Enclosed preliminary revised of vehicle **SLC 4947J**

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: [denisetay@lkkauto.com](mailto:denisetay@lkkauto.com) | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

---

**From:** Admin-D (LKKAuto)  
**Sent:** Thursday, 20 June 2019 10:31 AM  
**To:** 'CWS Motor Claims' <[cwsmotorclaims@msfirstcapital.com.sg](mailto:cwsmotorclaims@msfirstcapital.com.sg)>; assignments <[assignments@lkkauto.com](mailto:assignments@lkkauto.com)>  
**Cc:** 'May Chua Hui Chin' <[maychua@msfirstcapital.com.sg](mailto:maychua@msfirstcapital.com.sg)>; SUR <[sur@lkkauto.com](mailto:sur@lkkauto.com)>  
**Subject:** RE: SURVEY ASSESSMENT - D19003867MFSH/1

Dear Sir/Mdm,

Thank you for the assignment.

Please be informed that vehicle is not in the workshop, repairer will arrange.

Best Regards,

G.Nivitha | Admin

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: [assignments@lkkauto.com](mailto:assignments@lkkauto.com) | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

---

**From:** CWS Motor Claims [<mailto:cwsmotorclaims@msfirstcapital.com.sg>]  
**Sent:** Wednesday, 19 June 2019 5:19 PM  
**To:** [ASSIGNMENTS@LKKAUTO.COM](mailto:ASSIGNMENTS@LKKAUTO.COM)  
**Cc:** CWS Motor Claims <[cwsmotorclaims@msfirstcapital.com.sg](mailto:cwsmotorclaims@msfirstcapital.com.sg)>; May Chua Hui Chin <[maychua@msfirstcapital.com.sg](mailto:maychua@msfirstcapital.com.sg)>  
**Subject:** PRI: SURVEY ASSESSMENT - D19003867MFSH/1



Auto  
Consultants  
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: D19003867MFSH

Date: 24/06/2019

Our Ref: CS/FCI19010918/Atd3

The Motor Claims Department  
First Capital Insurance Ltd

Dear Sir/Madam,


INITIAL INSPECTION REPORT OF VEHICLE NO. SLC 49471

Please be informed that we had conducted the inspection of the abovementioned vehicle 24/06/2019 at the premises of M/s Autolution have the following to report: -

Workshop Estimate Amount	: S\$ <u>5,590.60</u>
Revised Estimate Amount	: S\$ <u>4,047.40</u>
"Check" Items Amount	: S\$ <u>478.08</u>
Market Value	: S\$ _____
LTA Reimbursement Value	: S\$ _____
Nett Value	: S\$ _____

Description of Damage:

The vehicle sustained damages at the Rear portion.

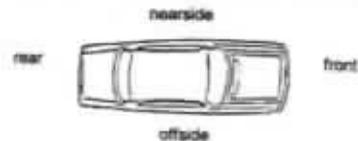

**Comments/ Present Status:**

Damages Consistent.

Yours faithfully

Adrian

Automotive Assessor

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	13/06/2019 16:08
Date Of Accident	12/06/2019 14:00
Exact Location Of Accident	TAMPINES AVE 12
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLC4947J
<b>Insured/Policyholder</b>	
Name Of Registered Owner	WONG GUO HAO,GABRIEL
NRIC No	S8603887J
Email Address	MOONFA11@HOTMAIL.COM
Mobile Phone No	(LOCAL) +65-91090168
Alternative Phone No	OFFICE-91090168

### Vehicle Particulars

Manufacturer	NISSAN
Model	NOTE-1.2 CVT (A)
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR

### Insurance Company

Name of Insurance Company	MSIG INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	A 29124160QMY
Cover Note Number	

### Driver

Name of Driver	WONG GUO HAO,GABRIEL
NRIC No	S8603887J
Date Of Birth	21/02/1986
Occupation	INDOOR
Date Of Driving Pass	06/03/2007
Driving Experience	12 YEARS AND 3 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-91090168
Fax Number	
Contact Number	OFFICE-91090168
Email Address	MOONFA11@HOTMAIL.COM

Address	APT BLK 604 ELIAS ROAD #08-216
Postcode	510604
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-

#### General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

#### Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

#### Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

SEE ATTACHED SKETCH PLAN AND PHOTO

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Was there any audio recorded?	NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SH6860C
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	TAXI
Name of Driver	
NRIC/Passport Number	
Contact Number	96706329
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Sketch Plan Pg. 1

SKETCH PLAN

IMPORTANT NOTICE


1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
  - (ii) for complying with requirements under any regulations, laws or court orders.

x   
 Policyholder's Signature  
 Date & Time:  
 13/4/19, 1555H

x   
 Driver's Signature  
 (If driver is not the policyholder)  
 Date & Time:  
 13/4/19, 1555H

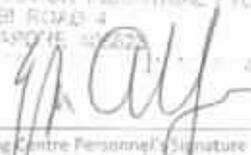AFORUM INDUSTRIAL PTE LTD  
 19 UBI ROAD #4  
 SINGAPORE 408722  
  
 Reporting Centre Personnel's Signature  
 Name: EMER AWOISO  
 NRIC/FIN No: G40224L

SKETCH PLAN



DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On 13 Jun 19 at around 1400H, I was driving my vehicle, a Nissan Note (SLC4947J) and was about to make a left turn onto Tampines Ave 12 (towards Pasir Ris). While I was turning, I noticed a man crossing the road on a PMD (green man was on). I immediately stopped to let him pass. However, I felt a bump at the rear of my car, which indicated that my car had been hit from behind.

I stopped my car at the side of the road at Tampines Ave 12, got out to assess the damage. The person who drove the vehicle that hit my car also stopped his car behind. Both of us got out to assess the damage.

I did not notice any injuries on him and he appeared to be walking normally. I also noticed that the bumper of my car was dented.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

*[Signature]*  
 Policyholder's Signature  
 Date & Time:  
 13/6/19, 1555H

*[Signature]*  
 Driver's Signature  
 (if driver is not the policyholder)  
 Date & Time:  
 13/6/19, 1555H

REPORTING CENTRE INDUSTRIAL PTE LTD  
 10, SUNGAI BUNDRAS ROAD  
 SINGAPORE 437872  
 TEL: 6342 8333 FAX: 6342 7277

*[Signature]*  
 Reporting Centre Personnel's Signature  
 Name: ELVER ANTONSO  
 NRIC No: G3162834L



MSIG Insurance (Singapore) Pte. Ltd.  
 4 Shenton Way, # 21-01, SGX Centre 2, Singapore 068807  
 Tel: +65 6827 7888, Fax: +65 6827 7800  
 Co. Reg. No. 200412212G, GST Reg. No. 20-0412212G

## Certificate of Insurance

ROAD TRANSPORT ACT 1987 (MALAYSIA)  
 THE MOTOR VEHICLES (THIRD-PARTY RISKS) RULES, 1959 (FEDERATION OF MALAYSIA)  
 THE MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) ACT (CAP. 189 OF THE REVISED EDITION)  
 (REPUBLIC OF SINGAPORE)  
 THE MOTOR VEHICLES (THIRD-PARTY RISK AND COMPENSATION) RULES, 1986 EDITION (REPUBLIC OF SINGAPORE)  
 OR ANY AMENDMENT, ACT OR ACTS PASSED IN SUBSTITUTION THEREOF.

Form <b>M.E.1</b> Individual Ownership	<b>MOTOR MAX PLUS</b> Comprehensive
Certificate No. <b>A 29124160 QMY</b>	<b>Excess: SGD500</b> <b>Windscreen Excess: SGD100</b>
<b>1. Index Mark and Registration Number of Vehicle</b> SLC4947J	
<b>2. Name of Policyholder</b> Wong Guo Hao Gabriel	
<b>3. Effective Date of the Commencement of Insurance for the purposes of the Act</b> 17/05/2019	
<b>4. Date of Expiry of Insurance</b> 16/05/2020	
<b>5. Persons or Classes of Persons entitled to drive*</b> Wong Guo Hao Gabriel Any other person provided he is driving on the Policyholder's order or with the Policyholder's permission. <small>* Provided that the person driving is permitted in accordance with the licensing or other laws or laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from driving the Motor Vehicle.</small>	
<b>6. Limitations as to use*</b> Use only for social domestic and pleasure purposes and for the Policyholder's business. The Policy does not cover use for hire or reward racing pace-making reliability trial speed-testing the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with the Motor Trade. <small>* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.</small>	
<b>PLEASE NOTE ALL CLAIMS RELATED REPAIR CAN BE CARRIED OUT AT ANY WORKSHOP OF YOUR CHOICE OR AT ANY MSIG AUTHORISED WORKSHOP LISTED IN THE ATTACHED.</b>	
This Certificate is not transferable to a new owner of the vehicle. If for any reason the Policy is terminated during its currency, the Certificate must be returned to the Insurer within 7 days of the termination or if the Certificate has been lost or destroyed, a Statutory Declaration to that effect must be made. Failure to comply with this obligation is an offence under the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189).	

I/WE HEREBY CERTIFY that the Policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia) or any Amendment, Act or Acts passed in substitution thereof.

MSIG Insurance (Singapore) Pte. Ltd.  
 Approved Insurers

  
 for Chief Executive Officer

REPUBLIC OF SINGAPORE  
IDENTITY CARD NO. **S8603887J**



Name  
**WONG GUO HAO, GABRIEL**  
黃國豪

Race  
CHINESE

Date of birth  
21-02-1986

Sex  
M

Country/Place of birth  
SINGAPORE

---

REPUBLIC OF SINGAPORE DRIVING LICENCE

Licence Number: **S8603887J**

Name  
**WONG GUO HAO, GABRIEL**

Valid From: 21 Feb 1986  
Valid Until: 06 Mar 2007

001482554K

5690001



001482554K  
S8603887J



Date of issue  
16-01-2017

ADDRESS  
APT BLK 804 ELIAS ROAD  
K08-216  
SINGAPORE 810804

---

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASSES:

CLASS DATE

Class 3 Motor Cars < 3000kg with < 7 passengers, exclusive of the driver; and other motor vehicles < 2000kg 06 Mar 2007

NP 425A



Licence No. S8603887J

Accident Photo



Accident Photo



REPUBLIC OF SINGAPORE  
 IDENTITY CARD NO. S8603887J



Name  
 WONG GUO HAO, GABRIEL

黄国豪

Race  
 CHINESE

Date of Birth  
 21-02-1986

Sex  
 M

Country/Place of Birth  
 SINGAPORE




REPUBLIC OF SINGAPORE DRIVING LICENCE

License Number S8603887J

Name  
 WONG GUO HAO, GABRIEL

Birth Date 21 Feb 1986

Issue Date 06 Mar 2007

001483554K




5690001

001483554K

0000 No. S8603887J

Date of Issue  
 16-01-2017

Address  
 APT BLK 604 ELIAS ROAD  
 #05-216  
 SINGAPORE 510604



YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(S)

Class	Description	PASS DATE
Class 2	Motor Cars <= 3000kg with <= 7 passengers, exclusive of the driver; and other motor vehicles <= 2500kg	06 Mar 2007

NP 426A

License No: S8603887J



## Certificate of Insurance

ROAD TRANSPORT ACT 1987 (MALAYSIA)  
THE MOTOR VEHICLES (THIRD-PARTY RISKS) RULES, 1959 (FEDERATION OF MALAYSIA)  
THE MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) ACT (CAP. 189 OF THE REVISED EDITION)  
(REPUBLIC OF SINGAPORE)  
THE MOTOR VEHICLES (THIRD-PARTY RISK AND COMPENSATION) RULES, 1996 EDITION (REPUBLIC OF SINGAPORE)  
OR ANY AMENDMENT, ACT OR ACTS PASSED IN SUBSTITUTION THEREOF.

Form M.X.1  
Individual Ownership

**MOTOR MAX PLUS**  
**Comprehensive**

Certificate No. A 29124160 QMY

Excess : SGD500  
Windscreen Excess : SGD100

1. Index Mark and Registration Number of Vehicle

SLC4947J

2. Name of Policyholder

Wong Guo Hao Gabriel

3. Effective Date of the Commencement of Insurance for the purposes of the Act

17/05/2019

4. Date of Expiry of Insurance

16/05/2020

5. Persons or Classes of Persons entitled to drive\*

Wong Guo Hao Gabriel

Any other person provided he is driving on the Policyholder's order or with the Policyholder's permission.

\* Provided that the person driving is permitted in accordance with the licensing or other laws or laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from driving the Motor Vehicle.

6. Limitations as to use\*

Use only for social domestic and pleasure purposes and for the Policyholder's business.

The Policy does not cover use for hire or reward racing pace-making reliability trial speed-testing the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with the Motor Trade.

\* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

**PLEASE NOTE ALL CLAIMS RELATED REPAIR CAN BE CARRIED OUT AT ANY WORKSHOP OF YOUR CHOICE OR AT ANY MSIG AUTHORISED WORKSHOP LISTED IN THE ATTACHED.**

This Certificate is not transferable to a new owner of the vehicle. If for any reason the Policy is terminated during its currency, the Certificate must be returned to the Insurer within 7 days of the termination or if the Certificate has been lost or destroyed, a Statutory Declaration to that effect must be made. Failure to comply with this obligation is an offence under the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189).

I/WE HEREBY CERTIFY that the Policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia) or any Amendment, Act or Acts passed in substitution thereof.

MSIG Insurance (Singapore) Pte. Ltd.  
Approved Insurers



for Chief Executive Officer

AUTOLITION INDUSTRIAL PTE. LTD.

ESTIMATE : ACCIDENT/BODY REPAIRS

REFERENCE : INS/IC/EA/0318/19

DATE : 13-JUN-2019

MS. FIRST CAPITAL INSURANCE LIMITED

36 ROBINSON ROAD

#16-01 CITY HOUSE

S(068877)

TEL : 65073848

FAX :

ATTN: MOTOR CLAIM DEPT

OWNER'S NAME : MR. WONG GUO HAO, GABRIEL

ADDRESS : BLK 604 ELIAS ROAD

#08-216

S(510604)

TELEPHONE NO : 91090168

TYPE OF CLAIM : DIRECT SETTLEMENT / THIRD PARTY CLAIM

POLICY NO : A 291243600MY

VEHICLE NO : SLC4947J

MODEL CODE : TDWARDZE12EDAY4072

MODEL/YEAR : NISSAN NOTE 1.2 BASE

ENGINE NO : HR121863368

CHASSIS NO : JN1TAAE1220972290

MILEAGE : 37815 KM

DATE IN : 13/06/2019

LIABILITY : 0.00

EXCESS CLAUSE : 0.00

ESTIMATE BY : ELMER

ACCIDENT DATE : 12/06/2019

9645 0084 elmer@fanChong.com

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE REGN NO SLC4947J

S/NO	JOB CODE	NATURE OF JOB	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATION
1	ZZ/001	LABOUR CHARGES TO REPAIR RR END PANEL, RENEW HATCHBACK DOOR AND RR BUMPER	1950.00	1170 ✓
2	ZZ/002	CHARGES TO SPRAY PAINTING SAME	750.00	✓ ✓
3	ZZ/003	APPLY SEALANT TO HATCHBACK DOOR AND RR WINDSCREEN GLASS	200.00	✓ ✓
4	ZZ/004	REMOVE AND INSTALL REAR WINDSCREEN GLASS	180.00	✓ ✓
5	ZZ/005	REMOVE AND INSTALL REVERSE CAMERA	250.00	✓ ✓
6	ZZ/006	REMOVE AND TRANSFER HATCHBACK DOOR MECHANISM	80.00	✓ ✓
7	ZZ/007	RENEW REVERSE SENSOR	55.00	✓ ✓
8	ZZ/008	REMOVE AND INSTALL BOTH RR COMBINATION LAMP TO FACILITATE RR BUMPER REPLACEMENT	48.00	✓ ✓
9	ZZ/009	SUPPLY REAR LICENSE PLATE		
TOTAL LABOUR CHARGES			3513.00	

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO SLD4947J

S/NO	PARTS DESCRIPTION	PARTS NUMBER	DAMAGED PARTS & PRICES		
			NETT	LIST	S/NETT REMARKS
1	CLIP RR BUMPER @ SGD \$ 1.20 EACH <i>new</i>	01553-10501	7.20	✓	✓
2	RH SIDE BRACKET RR BUMPER <i>new</i>	85220-3VADC	45.40	✓	✓
3	LH SIDE BRACKET RR BUMPER <i>new</i>	85221-3VADC	45.40	✓	✓
4	ENERGY ABSORBER RR BUMPER <i>?</i>	85090-3VADA	111.90	?	X <i>new</i>
5	STAY RR BUMPER @ SGD \$ 06.60 EACH <i>?</i>	H5212-1N3MA	173.20	?	X <i>new</i>
6	REAR W/SCREEN SEALANT <i>new</i>	SEALANT - 4			80.00 ✓
7	SENSOR-REVERSE <i>?</i>	SENSOR			250.00 ? X <i>new</i>
8	REAR BUMPER <i>Dented</i>	85022-3VADH	414.00	✓	✓
9	HATCHBACK DOOR GARNISH <i>Not New</i>	90810-3VASC	243.90	X	X
10	REAR WINDSCREEN GLASS MOLDING <i>new</i>	90374-3VADA	29.60	✓	✓
11	HATCHBACK DOOR <i>Dented</i>	K010M-3VAMA	976.40	✓	✓
12	REAR LICENCE PLATE <i>Not New</i>	RLP <i>*</i>			60.00 + X
13	SUNDRIES <i>new</i>	NPH <i>?</i>			<del>50.00</del> → 20. ✓
SUB TOTAL			2047.00	0.00	440.00
LESS DISCOUNT (NETT-20.00%, LIST-30.00%, S/NETT-.00%)			409.40	0.00	0.00
GRAND TOTAL			1637.60	0.00	440.00
OVERALL TOTAL			2077.60		

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED

SUMMARY OF ESTIMATE FOR VEHICLE RESN NO SLC4947J

TOTAL LABOUR CHARGES	3513.00
TOTAL SPARE PARTS CHARGES	2077.60
GRAND TOTAL	5590.60 *

5645.64

\* All charges do2 not include GST.

SURVEYOR'S PARTICULARS

NAME	: Admin King
SURVEYED DATE	: 21/06/19.
AUTHORIZED DATE	: Not authorized, as says
EXCESS CLAUSE	: 0.00
LIABILITY	: 0.00
REMARKS	:

**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
 Signature:  
 Date:

PLS NOTE : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges & spare parts in the process of repairs, we shall inform you accordingly.

[> Back to OneMotoring](#)

Land Transport Authority

10 Sin Ming Drive

Singapore 575701

GST Registration No. : M4-0006529-2

Print Date/Time : 13 Jun 2019 / 16:52:33

Receipt Date/Time : 13 Jun 2019 / 16:52:33

**Tax Invoice/Receipt**

Receipt No. : ITNET-00000-190613-002370

Previous Receipt No. :

S/N	Item Description/ Business Transaction Reference No.	Amount Before GST (S\$)	GST Amount (S\$)	Amount After GST (S\$)
Result of Insurance Enquiry - SH6860C				
As at 12 Jun 2019/14:00:00				
Insurance Co: MS FIRST CAPITAL INSURANCE LIMITED				
1	Insurance Enquiry - SH6860C Enquiry Fee 20190613165058528144	7.00	0.49	7.49
<i>SLC 4947J</i>				
<b>Sub-Total</b>		7.00	0.49	7.49
<b>Total Before Rounding</b>		7.00	0.49	7.49
<b>Rounding Difference</b>				0.04
<b>Total Amount Payable</b>				7.45
Paid By				
	20190613165120532	Direct Debit: eNETS Debit (Internet Banking)		7.45
Total				7.45
Cash Change				0.00
Tendered Amount				7.45
Excess Refundable Amount				0.00

THANK YOU AND HAVE A NICE DAY!

Please ensure that all payments to the Authority are good and promptly settled by the payment service provider / financial institution. Otherwise, the transaction and receipt is considered void and late fee may apply.

[Print Receipt](#)[OK](#)[Save as PDF](#)

REVOLUTION INDUSTRIAL PTE. LTD.

FINALIZED : ACCIDENT/BODY REPAIRS

REFERENCE : INS/IC/EA/0118/19

DATE : 13-JUN-2019

MS FIRST CAPITAL INSURANCE LIMITED

36 ROBINSON ROAD

#16-01 CITY HOUSE

S(058877)

TEL : 65073848

FAX :

ATTRIBUTE CLAIM DEPT

SUPERVISOR ADMIN

5 DAYS

OWNER'S NAME : MR WONG QUD HAO, GABRIEL

ADDRESS : BLK 604 ELIAS ROAD

#00-216

S(510604)

TELEPHONE NO : 91090168

TYPE OF CLAIM : DIRECT SETTLEMENT / THIRD PARTY CLAIM

POLICY NO : A 293241500MY

VEHICLE NO : SL04947J

MODEL CODE : 70M4R02E12EDAY4012

MODEL/YEAR : NISSAN NOTE 1.2 BASE

ENGINE NO : HR121863368

CHASSIS NO : JN1TAAE1220972890

RELEASE : 41046 KM

DATE IN : 13/06/2019

LIABILITY : 0.00

EXCESS CLAUSE : 0.00

ESTIMATE BY : ELNER

ACCIDENT DATE : 12/06/2019

LABOUR CHARGES FOR ACCIDENT VEHICLE REG NO: SL0947J

S/NO	JOB CODE	NATURE OF JOB	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATION
1	22/001	LABOR CHARGES TO REPAIR RR END PANEL,RENEW HATCHBACK DOOR AND RR BUMPER	1950.00	1170.00
2	22/002	CHARGES TO SPRAY PAINTING SAME	750.00	750.00
3	22/003	APPLY SEALANT TO HATCHBACK DOOR AND RR WINDSCREEN GLASS	200.00	200.00
4	22/004	REMOVE AND INSTALL REAR WINDSCREEN GLASS	180.00	180.00
5	22/005	REMOVE AND INSTALL REVERSE CAMERA	250.00	250.00
6	22/006	REMOVE AND TRANSFER HATCHBACK DOOR MEDIUMISH	80.00	80.00
7	22/007	BEND REVERSE SENSOR	55.00	55.00
8	22/008	REMOVE AND INSTALL BOTH RR COMBINATION LAMP TO FACILITATE RR BUMPER REPLACEMENT	48.00	48.00
9	22/009	SUPPLY REAR LICENSE PLATE		
TOTAL LABOUR CHARGES			3613.00	2733.00

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO SLD49K01

S/NO	PARTS DESCRIPTION	PARTS NUMBER	DAMAGED PARTS & PRICES			
			NETT	LIST	S/NETT	REMARKS
1	PLATE-LUGGAGE REAR GARNISH	84902-3VAD8	58.80			OK
2	CLIP RR BUMPER W SGD & 1.20 EACH	01553-10501	7.20			OK
3	RH SIDE BRACKET RR BUMPER	85220-3VAD0	45.40			OK
4	LH SIDE BRACKET RR BUMPER	85221-3VAD0	45.40			OK
5	REAR W/SCREEN SEALANT	SEALANT - 4			80.00	OK
6	SENSOR-REVERSE	SENSOR			250.00	X
7	REAR BUMPER	ES002-3VADH	414.00			OK
8	HATCHBACK DOOR GARNISH	91010-3VASC	243.90			X
9	REAR WINDSCREEN GLASS MOLDING	90074-3VAD0	25.60			OK
10	HATCHBACK DOOR	K010H-3VAD0	976.40			OK
11	REAR LICENCE PLATE	R.P			60.00	X
12	ENERGY ABSORBER RR BUMPER	85090-3VAD8	111.90			X
13	STAY RR BUMPER W SGD & 86.80 EACH	85212-3VAD8	173.20			X
14	SUNRISES	SPK			20.00	OK
SUB TOTAL			1586.80	0.00	100.00	
LESS DISCOUNT (NETT-50.00%, LIST-30.00%, S/NETT-0.00%)			317.35	0.00	0.00	
GRAND TOTAL			1269.44	0.00	100.00	
OVERALL TOTAL			1269.44			

LEGEND: REMARKS( OK ) = APPROVED, REMARKS( X ) = NOT APPROVED



**Autolution Industrial Pte Ltd**  
 Tan Chong Motor Sales Pte Ltd's Authorised Dealer  
 19 Ubi Road 4  
 Singapore 408623  
 Tel (65) 64909666 / 67036680  
 Fax (65) 68467483  
 Business Reg. No.: 199500071W

26/08/2019

INS/IC/EA/0318/19

MS FIRST CAPITAL INSURANCE LIMITED  
 36 ROBINSON ROAD  
 #16-01 CITY HOUSE  
 S( )  
 Attn : Motor Claim Manager  
 Claim Dept

Dear Sir

**SUPPLEMENTARY CLAIM**

REGN NO. : SLC4947J  
 CLAIM NO: INS/IC/EA/0318/19

Further to our claim INS/IC/EA/0318/19 we are submitting a supplementary claim for the below mentioned labour and part for the above mentioned case.

1	PARTS NEED TO CHANGE PLATE -LUGGAGE REAR GARNISH	<i>schud</i>	\$	68.80 NETT	(A) ✓
---	---	--------------	----	------------	-------

We trust the above supplementary claim will meet with your kind approval and we will forward to you the final repair bill together with the satisfaction note on completion repairs.

Yours faithfully  
**AUTOLUTION INDUSTRIAL PTE LTD**

*Elmer Alfonso*  
 ELMER ALFONSO  
 Insurance Claim Dept

**AUTOLUTION INDUSTRIAL PTE LTD**  
 19 UBI ROAD 4  
 SINGAPORE 408623  
 TEL: 3490 9553 FAX: 6846 7483

Cc: SURVEYOR ADRIAN

SUMMARY OF OVERALL CHARGES FOR VEHICLE REGN NO SLC4947J

NETT ITEM	1506.80
LESS 30.00%	-117.36
NETT AMOUNT	1389.44
LIST ITEM	0.00
LESS 30.00%	0.00
LIST AMOUNT	0.00
SPECIAL NETT ITEM	100.00
LESS 00%	0.00
SPECIAL NETT AMOUNT	100.00
TOTAL LABOUR CHARGES	2733.00
TOTAL SPARE PARTS CHARGES	1389.44
TOTAL CHARGES	4122.44
ACC 7 % GST	287.17
GRAND TOTAL	4409.61



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MS FIRST CAPITAL INSURANCE LTD		Ref : CS/FCI19010918/Atd3e2	
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Date : 04-09-2019	
		Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SH 6860C	Veh. Inspected	SLC 4947J
Policy No.		Coverage (\$)	0.00
Claim No.	D19003867MFSH	Excess (\$)	0.00
Assign From	MAY CHUA	Assign Date	19/06/2019
2. Vehicle Particulars & Condition			
Make & Model	NISSAN NOTE	c.c	1198
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	JN1TAAE12Z0972290	Colour	GREY
Odometer	38134	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	185/65 R15	CONTINENTAL	6 mm
L/H Front Tyre	185/65 R15	CONTINENTAL	6 mm
R/H Rear Tyre	185/65 R15	CONTINENTAL	6 mm
L/H Rear Tyre	185/65 R15	CONTINENTAL	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	12/06/2019	Inspection Date	21/06/2019
Survey held at	AUTOLUTION INDUSTRIAL PTE LTD 19 UBI ROAD 4 SINGAPORE 408623		
5a. Remarks			
A)DAMAGES CONSISTENT TO ACCIDENT REPORT. B)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. C)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		<b>5 Working Days</b>	



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLC 4947J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
6	CLIP RR BUMPER @\$1.20 (N)	NECESSARY	7.20	7.20
1	RH SIDE BRACKET RR BUMPER (N)	NECESSARY	45.40	45.40
1	LH SIDE BRACKET RR BUMPER (N)	NECESSARY	45.40	45.40
1	ENERGY ABSORBER RR BUMPER (N)	NOT NECESSARY	111.90	-
2	STAY RR BUMPER @\$86.60 (N)	NOT NECESSARY	173.20	-
1	REAR BUMPER (N)	DEFORMED	414.00	414.00
1	HATCHBACK DOOR GARNISH (N)	NOT NECESSARY	243.90	-
1	REAR WINDSCREEN GLASS MOULDING (N)	NECESSARY	29.60	29.60
1	HATCHBACK DOOR (N)	DENTED	976.40	976.40
1	PLATE-LUGGAGE REAR GARNISH (N)	DEFORMED	68.80	68.80
	LESS 20% DISCOUNT		-423.16	-317.38
			1,692.64	1,269.44
<b>SPECIAL NETT ITEMS</b>				
1	REAR W/SCREEN SEALANT (SN)	NECESSARY	80.00	80.00
1	SENSOR-REVERSE (SN)	NOT NECESSARY	250.00	-
1	REAR LICENCE PLATE (SN)	NOT NECESSARY	60.00	-
1	SUNDRIES (SN)	NECESSARY	50.00	20.00
			440.00	100.00
<b>LABOUR</b>				
	LABOR CHARGES TO REPAIR RR END PANEL, RENEW HATCH BACK DOOR AND RR BUMPER.		1,950.00	1,170.00
	CHARGES TO SPRAY PAINTING SAME.		750.00	750.00
	APPLY SEALANT TO HATCHBACK DOOR AND RR WINDSCREEN GLASS.		200.00	200.00
	REMOVE AND INSTALL REAR WINDSCREEN GLASS.		180.00	180.00
	REMOVE AND INSTALL REVERSE CAMERA.		250.00	250.00
	REMOVE AND TRANSFER HATCHBACK DOOR MECHANISM.		80.00	80.00
	RENEW REVERSE SENSOR.		55.00	55.00



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE AND INSTALL BOTH RR COMBINATION LAMP TO FACILITATE RR BUMPER REPLACEMENT.		48.00	48.00
			3,513.00	2,733.00
<b>GRAND TOTAL</b>			<b>5,645.64</b>	<b>4,102.44</b>
<b>RECOMMENDED COST OF REPAIRS</b>				<b>4,102.44</b>

Report Ref No. CS/FCI19010918/Atd3e2

ADRIAN LING WAI PING

B.Eng,AMSQE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.