

22/03/2003

ASS. REC. BY:

REF:

CS/INC19011260/G9d302

Special Instruction:

Surveyor: Amo ChungASSIGNMENT (Office)From (Person): Theresa Vimala

of

INC

Date/Time:

26/6/19 @ 9:17am

Estimated Cost:

Bill to:

OD / (IP) WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SLF 7216A

Insured:

SW 4678D

at Workshop in/s

Motor Image

Tel:

86113195 / Ismael 966893,3
Jia hui 6703815

of

19 lorong 8 toa payoh

Policy No:

Claim No:

MT/1050511-001

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

24/6/19

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

9:15am @ 25/6/19

Person Contacted:

Daniel

Vehicle

IN/OUT

Date/Time

Action/Instruction

Thought ✓SLF 7216A - X06/9/19 @ 2:37pm checked with Ismael, the owner only do OD recovery.06/9/19 Submit Prelim. report.

Surveys

Bul

REF:

NTUC


C2032R

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 OD ☒ TP/WS / TP RES / OD RES / EVA / INV / MV
 To inspect Vehicle No: _____
 at Workshop m/s Motor Image
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

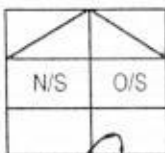

Bal. or Market Value: _____
 IDAC Accident Rpt.: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: 6 days Res.: Yes or No
 Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SUF7216A Yr Regn: 24 DEC 2014
 Type: ☒ M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or _____
 Make: Subaru Levorg C.C: 1998
 Colour: white A/C: Insured / Std / NI / NA
 Sp. Reading: 50870 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: VMG006897
 Gen. Cond: ☒ Good / Fair / Poor / Burnt
 Steering: ☒ In order / Jammed / Leaked / Burnt or
 Brake: ☒ In order / Jammed / Leaked / Burnt or
 Modi: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: 245/35ZR19
 R: 11
 BS / DUN / EXNOVA / GY / FS / LIZA / ☒ MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or _____
 Front: _____ Rear: _____
 R/Bal. 6 mm R/Bal. 6 mm
 L/Bal. 6 mm L/Bal. 6 mm
 D.O.A. _____ D.O.I. 26-06-19
 Survey held at W/S 10AM
 Des. of Damages: Frt / ☒ Rear / O/S / N/S / U/C / Rooftop or
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

RECEIVED 06 SEP 2019

Date/Time, File Pass to?

1) 06/9 10:15

Date/Time, File Return to?

2)

Report Format :

Lump Sum / I.B.I. (\$) _____

Days Of Repair:

Resurvey No. of Trip:

Add Fee: ☐ Site Insp (\$)

☐ Interview (\$)

☐ Tech. Invs (\$)

☐ Weekend (\$)

Survey Fee:

Transportation:

____ \$ + RS. ____ \$

Photos

Others

TOTAL

250

250

Nivitha (LKK Auto)

From: Theresa Vimala D/O Balagangadharan <thrsvim.bala@income.com.sg>
Sent: Thursday, 27 June 2019 8:25 AM
To: Admin-D (LKKAuto); assignments
Cc: SUR
Subject: RE: TP CASES FARMED OUT TO LKK ON 26/06/2019

Dear Nivitha

Details of OIC, etc, Thank you.

With Regards

Theresa Vimala
Senior Administrator
Motor Insurance
T +65 6430 7898
www.income.com.sg



At Income, we are 'In with You' on Performance, Growth, Innovation and Impact. These attributes reflect what we promise as an employer and what we want our people to exemplify.
Find out more at income.com.sg/careers

in with you

From: Admin-D (LKKAuto) [mailto:admin-d@lkkauto.com]
Sent: Wednesday, 26 June 2019 2:34 PM
To: Theresa Vimala D/O Balagangadharan <thrsvim.bala@income.com.sg>; assignments <assignments@lkkauto.com>
Cc: Thio Tse Kiat <tsekiat.thio@income.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: TP CASES FARMED OUT TO LKK ON 26/06/2019

Dear Theresa,

Thank you for the assignment.

Please be informed that SLJ 8914R and SJJ 808R (THIAM HENG HUAT) is not in the workshop) repairer will arrange.

Kindly assist to resend with full details.

Best Regards,

G.Nivitha | Admin

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Theresa Vimala D/O Balagangadharan [mailto:thrsvim.bala@income.com.sg]

Sent: Wednesday, 26 June 2019 9:17 AM

To: assignments <assignments@lkkauto.com>

Cc: Thio Tse Kiat <tsekiat.thio@income.com.sg>; Theresa Vimala D/O Balagangadharan <thrsvim.bala@income.com.sg>

Subject: FW: TP CASES FARMED OUT TO LKK ON 26/06/2019

:

Dear LKK,

Please assist to survey the following vehicles as per Clarence's instruction :- Thank you.

SN	OIC	Claim No.	Survey Date	Vehicle	WorkShop Name	WorkShop Address	WorkShop Contact	Survey Time	OI VEH	DOA	Additional Remarks
1	Jared	MT/1050511-001	26/6/2019	SIF7216A	MOTOR IMAGE ENTERPRISES PTE LTD	19 LORONG 8 TOA PAYOH SINGAPORE 319255	Sayedina Ali / 92992693		Sjw4678d	24/6	
2	David phua	MT/1050251-002	26/6/2019	SJ808R	THIAM HENG HUAT PTE LTD	176 SIN MING DRIVE #05-14 SIN MING AUTOCARE	Steven / 82636295		Sjk956m	22/6	
3	Muhd airwan	MT/1049959-002	26/6/2019	SJ8914R	THIAM HENG HUAT PTE LTD	176 SIN MING DRIVE #05-14 SIN MING AUTOCARE	Steven / 82636295		Gbd8552b	20/6	

With Regards

Theresa Vimala
Senior Administrator
Motor Insurance
T +65 6430 7898
www.income.com.sg

income
made different



in with you

At Income, we are 'In with You' on Performance, Growth, Innovation and Impact. These attributes reflect what we promise as an employer and what we want our people to exemplify. Find out more at Income.com.sg/careers

Disclaimer

This e-mail contains privileged or confidential information which is intended only for the use of the recipient(s) named above. If you have received this message in error, please notify the sender immediately and delete all copies of it. Thank you.



This email has been checked for viruses by AVG antivirus software.
www.avg.com

Disclaimer

This e-mail contains privileged or confidential information which is intended only for the use of the recipient(s) named above. If you have received this message in error, please notify the sender immediately and delete all copies of it. Thank you.

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	2032R
Vehicle Details	
Vehicle No.:	SLF7216A
Vehicle to be Exported:	No
Intended Deregistration Date:	27 Jun 2019
Vehicle Make:	SUBARU
Vehicle Model:	LEVORG AWD 2.0 GT-S A/T EYESIGHT
Primary Colour:	White
Manufacturing Year:	2014
Engine No.:	FA20915631
Chassis No.:	VMG006897
Maximum Power Output:	221.0 kW (296 bhp)
Open Market Value:	\$44,594.00
Original Registration Date:	24 Dec 2014
First Registration Date:	24 Dec 2014
Transfer Count:	1
Actual ARF Paid:	\$54,432.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	23 Dec 2024
PARF Rebate Amount:	\$40,824.00
Intended COE Rebate Details	
COE Expiry Date:	23 Dec 2024
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$74,389.00
COE Rebate Amount:	\$40,815.00
Total Rebate Amount:	\$81,639.00

The information contained herein is correct as at 27 Jun 2019

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	24/06/2019 16:07
Date Of Accident	24/06/2019 10:30
Exact Location Of Accident	TRAFFIC LIGHT @PENDING RD TOWARDS PETIR RD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLF7216A
Insured/Policyholder	
Name Of Registered Owner	MOTORIMAGE ENTERPRISES PTE LTD
Co Reg No	198702032R
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-92992693
Alternative Phone No	OFFICE-67038109

Vehicle Particulars

Manufacturer	SUBARU
Model	LEVORG 2.0 GT-S
Exact Purpose for which vehicle was being used at time of accident	WORK
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	
Cover Note Number	

Driver

Name of Driver	ERDY BIN ARIP
NRIC No	S7333947B
Date Of Birth	29/09/1973
Occupation	INDOOR
Date Of Driving Pass	07/01/2003
Driving Experience	16 YEARS AND 5 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-90601380
Fax Number	
Contact Number	
EMail Address	ERDY@MOTORIMAGE.NET

Address	1
Postcode	
Was driver an employee of the Insured's Company	YES
If No, Relationship of the Driver with the Insured	
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER ATTACHED STATEMENT

Attachment(s)


Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	UPLOAD LATER
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SJW4678D
Vehicle Make/Model/Colour	HYUNDAI ADVANTE BLACK
Details Of Properties	FRONT PORTION
Vehicle Category	PRIVATE CAR
Name of Driver	SIVA KUMAR PILLAY S/O RAMA KRISHNAN
NRIC/Passport Number	S8216197Z
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Accident Sketch Plan

SKETCH PLAN

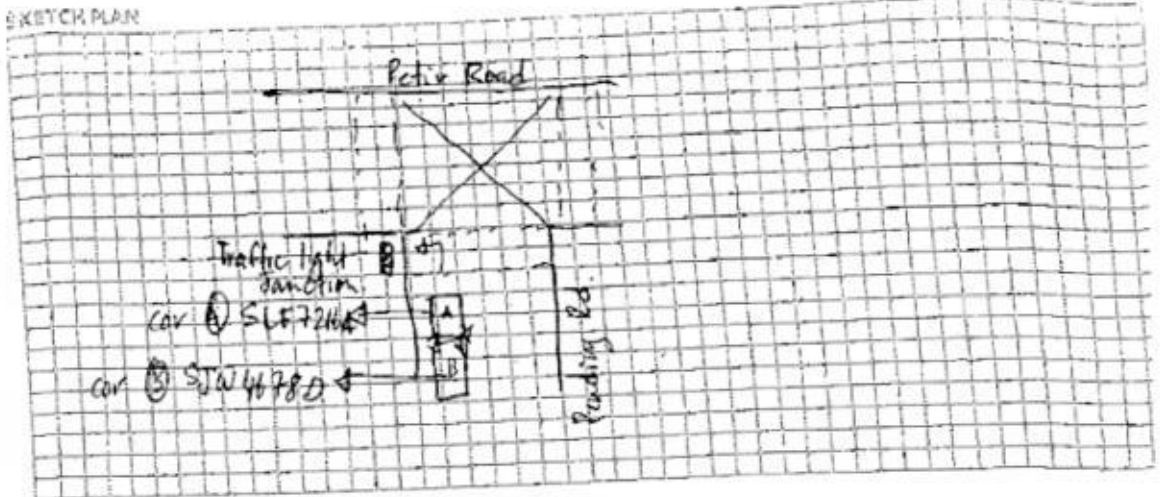

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On 24/6/19 @ 10.30am, I was stopping at traffic junction along Petir Rd while waiting traffic change to green and for me to turn right to make my way to office. Suddenly a Hyundai Avante black colour with reg. no SJW 4678D hit back portion of my car. My ~~back~~ ^{car} back portion involved quite bad damage with rear boot, rear bumper & etc. (refer photos attached). The other party mentioned their vehicle was a long term rental car. Both particular, hire and driver have been noted and taken for reporting purpose. (refer attached)

DECLARATION

I/We declare the foregoing particulars are true in every respect

Policyholder's Signature
Date & Time:

GIA/PMC SketchPlanForm_V3

Driver's Signature
(If driver is not the policyholder)
Date & Time: 11:45 am 24/6/17.

Reporting Centre Personnel's Signature
Name:
NRIC/TIN No.:

Common Statement

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service provider agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection investigation and management in present and all future claims.
- (e) the Information so collected under (d) above may be shared / disclosed:
- (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud; regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


Policyholder's Signature
Date & Time:


Driver's Signature
(If driver is not the policyholder)
Date & Time: 11:45am 24/6/17.


Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

MOTORIMAGE ENTERPRISES PTE. LTD.
19 LORONG 8, TOA PAYOH
SINGAPORE 319255

ESTIMATE : ACCIDENT/BODY REPAIRS
WORKSHOP : TOA PAYOH
CONTACT NO : 64730333
REFERENCE : INS/IC/CHI/0280/2019
DATE : 24-JUN-2019

NTUC CO-OPERATIVE INSURANCE COMMONWEALTH ENT.LTD.
73 BRAS BASAH ROAD
#05-01 NTUC TRADE UNION HOUSE
S(189556)
TEL : 65947060/67886616
FAX :
BOONC CHUAN

OWNER'S NAME : MOTOR IMAGE ENTERPRISES P/L
ADDRESS : 25, LENG KEE ROAD

S(159097)

TELEPHONE NO :

NTUC

TYPE OF CLAIM : THIRD PARTY CLAIM
POLICY NO : 1
VEHICLE NO : SLF7216A
MODEL CODE : LEVORG 2.0GT-S
MODEL/YEAR : LEVORG 2.0GT-S
ENGINE NO : FA20ESZH9A
CHASSIS NO : VMG006897
MILEAGE : 1 KM
DATE IN : 24/06/2019
LIABILITY : 0.00
EXCESS CLAUSE : 0.00
ESTIMATE BY : SAYEDINAH ALI**
ACCIDENT DATE : 24/06/2019

Print Date : 25/06/2019
Print Time : 10:23:08

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE REGN NO SLF7216A

S/NO	JOB CODE	NATURE OF JOB	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATION
1	TPCLAIM	CONDUCT BODYWORK REPAIR (THIRD PARTY CLAIM)		
2	ZZ/001	CONDUCT TP CLAIM NTUC. DATE 24/06/2019 TIME:1030HR TRAFFIC LIGHT JUNCTION OF PENDING & PETIR ROAD		
3	ZZ/002	REPAIR/REPLACE RR BUMPER, END PANEL, TAILGATE & FLOORPAN <i>560</i>	2240.00	1400 1400
4	ZZ/003	RESPRAY RR BUMPER, END PANEL, TAILGATE AND FLOORPAN <i>420</i>	1680.00	1260
5	ZZ/004	REMOVE/REFIX RR UNDERCARRIAGE TO FACILITATE REPAIR	900.00	X <i>5 NN</i>
6	ZZ/005	REMOVE/REFIX EXHAUST	150.00	X
7	ZZ/006	TRANSFER TAILGATE MECHANISM TO NEW TAILGATE	150.00	✓
8	ZZ/007	CONDUCT 4 WHEEL ALIGNMENT AFTER REPAIR	200.00	X <i>NN</i>
9	ZZ/008	REMOVE CARPET, TRIMS, SEATS AND GARNISH TO FACILITATE REPAIR	456.00	?
10	ZZ/009	REPLACE/REFIX REAR WINDSCREEN(NESS)	300.00	✓
11	ZZ/011	REMOVE/REFIX FUEL TANK TO FACILITATE REPAIR	200.00	X <i>NN</i>
12	ZZ/012	CONDUCT REAR LIGHTING TEST	50 5.00	30
13	ZZ/013	CONDUCT REAR PORTION ANTI RUST COATING AFTER REPAIR	580.00	X <i>NN</i>
14	ZZ/014	SUPPLY & INSTALL REVERSE SENSOR 2 EYES	300.00	✓
15	ZZ/015	SUNDRIES	100.00	20
16	ZZ/10	SUPPLY/INSTALL REAR WINDSCREEN TINTED FILM(NESS)	145.00	✓
TOTAL LABOUR CHARGES			7406.00	

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO SLF7216A

S/NO	PARTS DESCRIPTION	PARTS NUMBER	DAMAGED PARTS & PRICES			S/LIST REMARKS
			NETT	LIST	S/NETT	
1	FLOOR PAN R R CP WGN <i>Repair.</i>	52129VA0109P	360.00			
2	SKIRT COMPL R WGN ?	52401VA0019P	252.00			
3	BUMPER FACE R WGN <i>/ CRA</i>	57704VA031	540.00			
4	BRKT CORNER R WGNRH <i>X</i> <i>YNN</i>	57707VA090	18.00			
5	BRKT CORNER R WGNLH <i>X</i> <i>YNN</i>	57707VA100	18.00			
6	BRKT SD R WGN RH <i>/ YMC</i> (1)	57707VA130	21.60			
7	BRKT SD R WGN LH <i>/ YMC</i>	57707VA140	21.60			
8	COVER HOOK R WGN <i>/ Cut.</i>	57731VA180NN	7.20			
9	PANEL COMPL R GAT <i>/ BMC.</i>	60809VA0009P	803.30			
10	GLASS ASSY R G <i>/ K-L.</i>	63019VA000	799.20			
11	LATCH&ACT ASSY RG <i>/ BT</i>	63032VA000	216.00			
12	STRIKER R/G <i>X</i> <i>NN</i>	63264AG100	21.60			
13	WSTR DR R G <i>/ Twi.</i>	63516VA000	100.80			
14	DAM RUBBER <i>/ MC</i>	65245VA100	7.20			
15	REFLEX AY RH <i>X</i> <i>YNN</i>	84281FG000	21.60			
16	REFLEX ASSY LH <i>X</i> <i>YNN</i>	84281FG010	21.60			
17	LENS & BODY COMPLERH ?	84912VA041	425.00			
18	LENS & BODY COMPLELH ?	84912VA051	425.00			
19	GARNISH MLD SB AY6 ?	91111VA070	158.40			
20	ORNAMENT ASSY F SIX ?	91174SA181	68.40			
21	LETTER MK R STI <i>/</i>	93079VA040	39.60			
22	LETTER MK R <i>/ YMC</i>	93079VA060	39.60			
23	EDGE FLOOR R ASSY <i>X</i> <i>NN</i>	95073VA000VH	22.70			
24	CARGO STEP PANEL (RESIN) WITH LEVORG WORDING <i>/ PL.</i>	E775EVA000	420.00			
25	REAR UNDER SPOILER(E5610VA360) <i>/ Cut.</i>	SG517VA360	1830.00			
	<i>Back beam / BT (photo).</i>					

		DAMAGED PARTS & PRICES				
S/NO	PARTS DESCRIPTION	PARTS NUMBER	NETT	LIST	S/NETT	S/LIST REMARKS
SUB TOTAL			6658.40	0.00	0.00	0.00
LESS DISCOUNT (NETT-20 %)			1331.68	0.00	0.00	0.00
GRAND TOTAL			5326.72	0.00	0.00	0.00
OVERALL TOTAL			5326.72			

LEGEND: REMARKS(OK) = APPROVED, REMARKS(X) = NOT APPROVED

SUMMARY OF ESTIMATE FOR VEHICLE REGN NO SLF7216A

TOTAL LABOUR CHARGES	7406.00
TOTAL SPARE PARTS CHARGES	5326.72
GRAND TOTAL	12732.72 *

* All charges do2 not include GST.

SURVEYOR'S PARTICULARS

NAME :
SURVEYED DATE :
AUTHORIZED DATE :
EXCESS CLAUSE :
LIABILITY :
REMARKS :

Guo Qiang - 8288082
26/6/19

0.00
0.00

6-7 Days.

before paint photos.

PLS NOTE : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges & spare parts in the process of repairs, we shall inform you accordingly.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

12732.72



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

DAMAGE ASSESSMENT REPORT

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: CS/INC19011260/Gqd3e2
73 BRAS BASAH ROAD Date: 13-09-2019
#05-01 NTUC TRADE UNION HOUSESINGAPORE
189556



ATTN: JARED

Code: INC

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SJW 4678D	Veh. Inspected	SLF 7216A
Policy No.		Coverage (\$)	0.00
Claim No.	MT/1050511-001	Excess (\$)	0.00
Assign From	THERESA VIMALA	Assign Date	26/06/2019

2. Vehicle Particulars & Condition

Make & Model	SUBARU LEVORG	c.c	1998
Engine No.	HIDDEN	Year of Reg.	2014
Chassis No.	VMG006897	Colour	WHITE
Odometer	50870 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	245/35Z R19	MICHELIN	6 mm
L/H Front Tyre	245/35Z R19	MICHELIN	6 mm
R/H Rear Tyre	245/35Z R19	MICHELIN	6 mm
L/H Rear Tyre	245/35Z R19	MICHELIN	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	24/06/2019	Inspect Date / Time	26/06/2019 (10:00 AM)
Survey held at	MOTOR IMAGE ENTERPRISES PTE LTD 19 TOA PAYOH LORONG 8 SINGAPORE 319255		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	6 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLF 7216A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	FLOOR PAN R R CP WGN (N)	TO REPAIR SEE LABOUR	360.00	-
1	SKIRT COMPL R WGN (N)	* CHECK	252.00	-
1	BUMPER FACE R WGN (N)	CRACKED	540.00	540.00
1	BRKT CORNER R WGNRH (N)	NOT NECESSARY	18.00	-
1	BRKT CORNER R WGNLH (N)	NOT NECESSARY	18.00	-
1	BRKT SD R WGN RH (N)	NECESSARY	21.60	21.60
1	BRKT SD R WGN LH (N)	NECESSARY	21.60	21.60
1	COVER HOOK R WGN (N)	CUT	7.20	7.20
1	PANEL COMPL R GAT (N)	BUCKLED	803.30	803.30
1	GLASS ASSY R G (N)	NECESSARY	799.20	799.20
1	LATCH&ACT ASSY RG (N)	BENT	216.00	216.00
1	STRIKER R/G (N)	NOT NECESSARY	21.60	-
1	WSTR DR R G (N)	TWISTED	100.80	100.80
1	DAM RUBBER (N)	NECESSARY	7.20	7.20
1	REFLEX AY RH (N)	NOT NECESSARY	21.60	-
1	REFLEX ASSY LH (N)	NOT NECESSARY	21.60	-
1	LENS & BODY COMPLERH (N)	* CHECK	425.00	-
1	LENS & BODY COMPLELH (N)	* CHECK	425.00	-
1	GARNISH MLD SB AY6 (N)	* CHECK	158.40	-
1	ORNAMENT ASSY F SIX (N)	* CHECK	68.40	-
1	LETTER MK R STI (N)	NECESSARY	39.60	39.60
1	LETTER MK R (N)	NECESSARY	39.60	39.60
1	EDGE FLOOR R ASSY (N)	NOT NECESSARY	22.70	-
1	CARGO STEP PANEL (RESIN) WITH LEVORG WORDING (N)	DEFORMED	420.00	420.00
1	REAR UNDER SPOILER (E5610VA360) (N)	CUT	1,830.00	1,830.00
1	BACK BEAM (N) (NPA)	BENT	-	-
	LESS 20% DISCOUNT		-1,331.68	-969.22
			5,326.72	3,876.88

Report Ref No. CS/INC19011260/Gqd3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	SPECIAL NETT ITEMS			
1	SUNDRIES (SN)	NECESSARY	100.00	20.00
			100.00	20.00
	LABOUR			
	REPAIR / REPLACE RR BUMPER, END PANEL, TAILGATE & FLOORPAN. INCLUSIVE OF THE REPAIR OF FLOOR PAN R R CP WGN.		2,240.00	1,400.00
	RESPRAY RR BUMPER, END PANEL, TAILGATE AND FLOORPAN.		1,680.00	1,260.00
	REMOVE / REFIX RR UNDERCARRIAGE TO FACILITATE REPAIR.	NOT NECESSARY	900.00	-
	REMOVE / REFIX EXHAUST.	NOT NECESSARY	150.00	-
	TRANSFER TAILGATE MECHANISM TO NEW TAILGATE.		150.00	150.00
	CONDUCT 4 WHEEL ALIGNMENT AFTER REPAIR.	NOT NECESSARY	200.00	-
	REMOVE CARPET, TRIMS, SEATS AND GARNISH TO FACILITATE REPAIRS.	* CHECK	456.00	-
	REPLACE / REFIX REAR WINDSCREEN (NESS).		300.00	300.00
	REMOVE / REFIX FUEL TANK TO FACILITATE REPAIR.	NOT NECESSARY	200.00	-
	CONDUCT REAR LIGHTING TEST.		50.00	30.00
	CONDUCT REAR PORTION ANTI RUST COATING AFTER REPAIR.	NOT NECESSARY	580.00	-
	SUPPLY & INSTALL REVERSE SENSOR 2 EYES.		300.00	300.00
	SUPPLY / INSTALL REAR WINDSCREEN TINTED FILM (NESS).		145.00	145.00
			7,351.00	3,585.00
	GRAND TOTAL		12,777.72	7,481.88
	RECOMMENDED COST OF REPAIRS (REPAIR COST NOT CONCLUDE) (EXCLUDE CHECK ITEMS S\$1,519.04 NETT)			7,481.88

Report Ref No. CS/INC19011260/Gqd3e2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons), B.Bus, MBA, PEng, PE,
MinstAEA, MASME, MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.