

Smart
Claims

ASS REC BY: Surveys: RUSU | REF: CS/ASM/9011936/R1 SLDY | Special Instructions

ASSIGNMENT (Office)

From (Person): Kitty Teo of AXA Date/Time: 5/7/2019

Estimated Cost: _____ Bill to: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To inspect Vehicle No: SMD 5703Y Insured: _____

at Workshop m/s Sng Ah Tee Tel: 62686183

of Blk 3 Pioneer Rd North #01-18

Policy No: _____ Claim No: 59M016DM

Sum Insured: _____ Excess: 400

Make of Veh: _____ D.O.A. 8/3/2019

(Client's Record)

CA / REV / REP. / REV 24 HRS H.O.D. Endorsement: _____

Date/Time: _____ Person Contacted: _____ Vehicle IN / OUT

Date/Time	Action/Instruction
	SMD 5703Y X
	* comment consistency damages.
	damages is consistent to the report made
02/03/19	@ 10:56 am revised IA & requested authorize repair to kty via smart claim

ASS. REC. BY: P. J. Jones

REF

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MY
 To Inspect Vehicle No: SMD 57034
 at Workshop no: SNA AH TEE
 of PIONEER RD NORTH
 Insured: AXA
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: 400
 (Client's Record)
 Make of Vch: _____
 (Policy Condition)
 Remark: The veh had commenced its repair at the time of inspection.
 Bal. or Market Value: 109K
 IDAC Accident Rpt. Consistent? : Yes or No
 GIA / PR Seen: Consistent? : Yes or No
 Est. Repairs. days Res: Yes or No
 Lun Sum: % 3 Val: Yes or No
 CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____
 Vehicle: IN / OUT

N/S	O/S

Veh No: SMD 57034 Yr Regn: 2017 / 04
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or
 Make: SUMMIT LEVORAH 1.6GT c.c 1600
 Colour: BLACK A/C: Insured / Std / NI / NA
 Sp. Reading: 032737 T/Audio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: IF1UM4K55JG806440
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: Good / Jammed / Leaked / Burnt or
 Brake: Good / Jammed / Leaked / Burnt or
 Modi: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: 225/45 218
 R: _____
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHISU / PIR / SUMI /
 TOYO / YOKO or
 Front R/Bal. 6 mm Rear R/Bal. 6 mm
 L/Bal. 6 mm L/Bal. 6 mm
 D.O.A. 05/03/19 D.O.I. 05/07/19
 Survey held at SNA AH TEE
 Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or
FRS N/S
 (no UIC / Chassis frame / Body structure adjacent to collision)

Date / Time	Action / Instruction
<u>30/08/19</u>	<u>Completed r/p \$ 4,570.56 @ 4 days with Resur!</u> <u>(\$ 1,350.10 Res - 23%)</u> <u>J. Jones</u> <u>30/8/2019</u>

Date/Time, File Pass to? 30/08/19
 1) Typ 4
 : Prel. Report
 : Final Report

Days Of Repair: 4
 Resurvey No. of Trip: 1

Add Fee: Site Insp (\$)
 Interview (\$)
 Tech. Invs (\$)
 Weekend (\$)

Survey Fee:	<u>200</u>
Transportation:	
G + ICL :	
Photos	
Others	
TOTAL	<u>200</u>

Report Format :
 Lump Sum (L.B.): (\$ 4,570.56 /P)

◀ Service Request Details

Claim

S9M01GDM

Reference

None ✎

Loss Date

March 8, 2019

Report Date

Jul 5, 2019 9:48:00 AM

Request Date

July 5, 2019

Due Date

July 5, 2020

Vendor Name

LKK AUTO CONSULTANTS PTE LTD (OD)

Type of Loss

Own Damage

Services

Accelerated workshop survey

Actions

Next Step

Finish the work

Value In

Complete Work

More ▾

Vehicle Information

Incident Vehicle Registration #

SMD5703Y

EYEMATIC

LEVORG 1.6 GT-S

Service Address

...

Primary Contact/Insured

CHOO BENG HOOI

BLK 693C WOODLANDS AVENUE 6, #07-757, 733693, Singapore

alfred@divedevils.com

Claim Handler

TEO Kitty

6568804602

kitty.teo@axa.com.sg

Additional Instructions

W/S - SNG AH TEE X/S - \$400

[Messages](#)[Invoices](#)[History](#)[Documents](#)[Assessment](#)[Metrics](#)[Notes](#)

New Message

TYPE



SENT

7/5/19 10:52 AM

FROM

TEO Kitty

SUBJECT

PLEASE ADVISE IF DAMAGES IS CONSISTENT TO REPORT

BODY

.



> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	1123Z
Vehicle Details	
Vehicle No.:	SMD5703Y
Vehicle to be Exported:	No
Intended Deregistration Date:	11 Jul 2019
Vehicle Make:	SUBARU
Vehicle Model:	LEVORG 1.6GT-S AWD CVT
Primary Colour:	Grey
Manufacturing Year:	2017
Engine No.:	FB16CB05085
Chassis No.:	JF1VM4K55JG006440
Maximum Power Output:	125.0 kW (167 bhp)
Open Market Value:	\$23,649.00
Original Registration Date:	14 Oct 2017
First Registration Date:	14 Oct 2017
Transfer Count:	1
Actual ARF Paid:	\$25,109.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	13 Oct 2027
PARF Rebate Amount:	\$18,831.00
Intended COE Rebate Details	
COE Expiry Date:	13 Oct 2027
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$49,189.00
COE Rebate Amount:	\$40,607.00
Total Rebate Amount:	\$59,438.00

The information contained herein is correct as at 04 Jul 2019

OK

109,000
 59,438

 49,562
 8-7

Re: SMD5703Y - FINALISE

Shirley Hiew (LKK Auto)

Fri 30/8/2019 4:20 PM

To: Sharon Sng <sharon@sngahtee.com>

Cc: SUR <sur@lkkauto.com>

1 attachments (135 KB)

SMD5703Y - AUDATEX.pdf;

Hi Sharon,

Confirmed final fig of \$ 4,570.56 (part by part) @ 4 days of repairs before excess \$400/- & GST.

Final invoice and all supporting documents sent over to AXA Insurance Pte Ltd.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Sharon Sng <sharon@sngahtee.com>

Sent: Wednesday, 28 August 2019 3:51 PM

To: Rasul (LKKAuto) <Rasul@lkkauto.com>

Subject: RE: SMD5703Y - FINALISE

From: Rasul (LKKAuto)

Sent: Wednesday, August 28, 2019 10:58 AM

To: Sharon Sng <sharon@sngahtee.com>

Subject: RE: SMD5703Y - FINALISE

Hi sharon,

Kindly forward the resurvey before paint and check item damage photos


Best Regards,

Rasul | Assessor

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Rasul@lkkauto.com | fax: 6841-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

Public
Consultation
Phase 1&2*Save the Earth. Print only when necessary.*

From: Sharon Sng [<mailto:sharon@sngahtee.com>]
Sent: Thursday, 22 August, 2019 6:28 PM
To: Rasul (LKKAuto); SUR
Subject: SMD5703Y - FINALISE

Best Regards

Sharon Sng

SNG AH TEE MOTOR & PANEL SERVICE PTE LTD | BLK 3 PIONEER ROAD NORTH #01-18 SINGAPORE 628457
TEL: 62686183 (4LINES) | FAX: 62681429 | Find us at <http://www.sngahtee.com>



-Please note that all offer/acceptance is made without prejudice.-

Shirley Hiew (LKK Auto)

From: Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>
Sent: Monday, 8 July 2019 11:58 AM
To: 'Janice Chang'
Subject: FW: SMD 5703Y OD (AXA) DOA - 08/03/2019

From: Shirley Hiew (LKK Auto) [mailto:ShirleyHiew@lkkauto.com]
Sent: Monday, 8 July 2019 11:57 AM
To: 'janice@synahtee.com' <janice@synahtee.com>
Cc: 'Sharon Sng' <sharon@sngahtee.com>
Subject: SMD 5703Y OD (AXA) DOA - 08/03/2019

Dear Janice,

As instructed by our client, please proceed to repair the insured vehicle **SMD 5703Y (Excess \$ 400/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

◀ **Re:RE: PLEASE ADVISE IF DAMAGES IS CONSISTENT TO REPORT**

Type

🔔 Question

Message

Please authorise

Reply

 **RE: PLEASE ADVISE IF DAMAGES IS CONSISTENT TO REPORT**

Type

 Question

Message

IA uploaded. Damages consistent, repair cost economical. We have not authorize repair. Kindly inform the damages are consistent to the report. Thanks. From : Shirley Hiew

[Reply](#)



Immediate Advice

To : AXA Insurance Pte Ltd

Date: 08/07/2019

Survey Details:

Date of loss	8-Mar-19
Date of appointment	5-Jul-19
Date of survey	5-Jul-19
Location of survey	BLK 3 PIONEER ROAD NORTH, #01-18 SINGAPORE 628457

Vehicle Details:

Claim Type:	Own Damage
Vehicle number	SMD 5703Y
Make and Model	SUBARU LEVORG 1.6GT-S AWD CVT
Date of registration	14-Oct-17
Excess	\$400
Market Value	\$109,000
Parf Rebate	\$59,438
Nett Loss	\$49,562

Repair details:

Initial Estimate	5,856.16
------------------	----------

Proposed/Revised repair cost:

Parts	\$4,014.40
Check items (estimate)	\$896.50
Labour	\$713.16
Total	\$5,624.06
Lump Sum(if applicable)	\$

Number of days for repair	4 DAYS
---------------------------	---------------



Auto
Consultants
Pte Ltd

Company Registration No. T9667188R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (665) 62563561 FAX : (665) 62564313

Remarks:

DAMAGES CONSISTENT, REPAIR COST ECONOMICAL. WE HAVE NOT AUTHORIZE REPAIR. DAMAGES IS CONSISTENT TO REPORT.

Mandate:

Liability(TP)		%
Proposed repair cost		\$
Loss of use		\$ no. of days
Loss of rental		\$ no. of days
Loss of income		\$ no. of days
LTA search fees		\$
Others		\$
Proposed Total		#VALUE!

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	08/03/2019 12:36
Date Of Accident	08/03/2019 04:00
Exact Location Of Accident	BLK 693 WOODLANDS AVE 6 MSCP DECK 3B LOT 79
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMD5703Y
Insured/Policyholder	
Name Of Registered Owner	CHOO BENG HOOI
NRIC No	S7481123Z
Email Address	ALFRED@DIVEDEVILS.COM
Mobile Phone No	(LOCAL) +65-90079402
Alternative Phone No	HOME-63675964

Vehicle Particulars

Manufacturer	SUBARU
Model	LEVORG-1.6 GT-S AWD CVT (A)
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	GA406008
Cover Note Number	

Driver

Name of Driver	CHOO BENG HOOI
NRIC No	S7481123Z
Date Of Birth	11/04/1974
Occupation	INDOOR
Date Of Driving Pass	05/04/2005
Driving Experience	13 YEARS AND 11 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-90079402
Fax Number	
Contact Number	HOME-63675964
EMail Address	ALFRED@DIVEDEVILS.COM

Address	BLK 693C WOODLANDS AVE 6 #07-757
Postcode	733693
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	HIT AND RUN / VANDALISM / DAMAGED WHILST PARKED
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	3
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	0

Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Police Station Name	WOODLANDS EAST N.P.C
Police Station Address	ROAD: 3 WOODLANDS DRIVE 63 , POSTCODE: 737890 , COUNTRY: SINGAPORE
Police Station Contact	TEL NO. - FAX NO.
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

AS PER POLICE REPORT NO. T/20190308/2025.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SJZ5091Z
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	

No. Of Passenger (Including Driver)

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number SJM7752E

Vehicle Make/Model/Colour

Details Of Properties

Vehicle Category PRIVATE CAR

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.



 Policyholder's Signature
 Date & Time:



 Driver's Signature
 (if driver is not the policyholder)
 Date & Time:



 Reporting Centre Personnel's Signature
 Name:
 NRIC/FIN No.:

I AM AWARE THAT MY INSURER MAY HAVE A 14 DAYS TIMEFRAME FOR ME TO SUBMIT AN OWN DAMAGE CLAIM UNDER MY OWN POLICY. I WILL



**SINGAPORE
POLICE FORCE**



T/20190308/2025

Police Station Of Origin:
Woodlands East N.P.C.
3 Woodlands Drive 63 SINGAPORE 737890
Tel No: 1800-7679999

1 of 3

Report No. T/20190308/2025

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 08/03/2019 07:48		Vide Report No.:		Station Diary No.: 17	
Informant's Particulars					
Name of Informant: CHOO BENG HOI			Address: APT BLK 693C WOODLANDS AVENUE 6 #07-757 SINGAPORE 733693		
ID Type / ID No.: NRIC NO / S7461123Z			Contact No.: Home/Office: Mobile: 90079402		
Nationality: MALAYSIAN			Email:		
Sex: Male	Age: 44	Date of Birth: 11/04/1974	Type of Informant: Vehicle Owner		
Race: Chinese		Language: English		Institution / School Name:	
Occupation: SOLUTIONS ENGINEER		Driving Licence Information: Class: 2B,3 Date of Expiry:			

General Information of the Accident				
Type of Accident:	Non-Injury Hit and Run	Drink Drive: No	Date/Time of Accident: 08/03/2019 07:00	Type of Location: Car Park
Location: Along Road 1 WOODLANDS AVENUE 6 BLK 693 WOODLANDS AVE 6 MSCP				
Weather: Clear		Road Surface: Dry		Road Speed Limit:
Traffic Flow: One Way		Traffic Control: Not Controlled		Traffic Volume: No Traffic
Type of Collision: Moving Vehicle Against - Parked Vehicle				Anyone conveyed by ambulance: No

Details of Vehicle Involved						
Vehicle No	Type	Make	Model	Color	Condition	No. of Passenger
SMD5703Y	Car	SUBARU	LEVORG	Grey	Seriously Damaged	0

Details of Person Involved	
Any Pedestrian Involved: No	
No. of Pedestrians Injured: NIL	Use of Pedestrian Crossing: NA



**SINGAPORE
POLICE FORCE**



T/20190308/2025

Police Station Of Origin:
Woodlands East N.P.C.
3 Woodlands Drive 83 SINGAPORE 737890
Tel No: 1800-7679999

2 of 3

Report No. T/20190308/2025

CONTINUATION OF REPORT

Vehicle Owner:			
Name	CHOO BENG HOOI	ID No.	S7481123Z
Related Vehicle	SMD5703Y (Car)	Contact No.	90079402
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class. 2B,3 Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

Brief Details.

On 07/03/2019 at about 1730hrs, I parked my vehicle bearing registration number SMD5703Y at Blk 693 Woodlands Ave 6 MSCP, Deck 3b, lot 79. Everything was intact, nothing amiss.

On 08/03/2019 at about 0700hrs, I returned to my vehicle and discovered the front left portion damaged, believed to be involved in a hit and run.

I have since viewed my in vehicle camera which revealed that on 08/03/2019 at about 0401hrs, a vehicle, of unknown registration number (White Honda Airwave) had collided into my front left, the driver did not alight to make a check and later drove off.

I wish to state that I do not have any dispute with anyone and do not suspect anyone that may have done this.

I have since saved a copy of the incident footage.



**SINGAPORE
POLICE FORCE**



T/20190308/2025

Police Station Of Origin:
Woodlands East N.P.C.
3 Woodlands Drive 63 SINGAPORE 737890
Tel No: 1800-7679999

3 of 3
Report No. T/20190308/2025

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report: L / Sgt 2 TAN SWEE WEE AARON
Signature Of Interpreter: Not applicable
Officer In Charge Of Case: TP / HRT / Sr Staff Sgt TAN JEOK LENG Contact No: 65478144 SN 154

Signature Of Informant:
Date/Time: 08/03/2019 07:48
Classification Of Case:

Authentication Stamp
NP188
Singapore Police Force

Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North,
#01-18,
628457

Claim Reference: *S9M01GDM*
Assessment number: SMD5703Y - OD AXA
Version: 1810
Date calculated: 04/07/2019 5:27 PM

Full Report
Registration: SMD5703Y
Printed: 04/07/2019 5:27 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	AXA Insurance Pte Ltd
Printed by:	SNG AH TEE	Currency:	SGD
Claim Reference:		Date of Incident:	08/03/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	SUBARU
Model:	LEVORG (V10)
Sub Model:	LEVORG
Model Sheet Number:	62 42 80
Registration:	SMD5703Y
VIN number:	
Odometer:	

Model Specs

FROM 10/2015	2 ZONE AUTO AIR CON	OUTS MIRR HSG PAINT	FRONT PARKING SYSTEM
1.6 LTR 125 KW	4-DOOR	SILL COVERING	FRONT SILL COVER
TWO COAT METALLIC	PREPARE OFF VEHICLE		

Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North,
#01-18,
628457

Claim Reference:
 Assessment number: SMD5703Y - OD AXA
 Version: 1810
 Date calculated: 04/07/2019 5:27 PM

Full Report
 Registration: SMD5703Y
 Printed: 04/07/2019 5:27 PM


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
 Date of Inspection:

Damage Areas

All
 Underbody

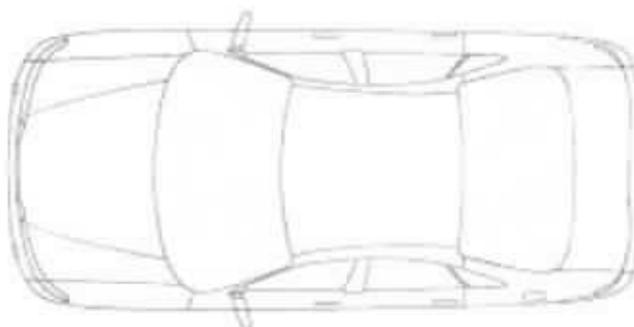

Labour

Code	Description	Time Base 10 WU/h	Price = 45.00 SGD/h	
			WU	Price SGD
EI0015R ZAX	R + R LEFT LOWER BEAM EXTENSION		2.0	9.00
LI0010R	R + R L/F FOGLAMP		3.0	13.50
LI0010R	R + R R/F FOGLAMP		3.0	13.50
LI0011R	ADD: ADJUST FRONT FOG LAMPS		2.0	9.00
EI0004R)	R + R FRONT BUMPER		2.0	9.00
NO NUMBER	R + R FRONT CROSSMEMBER		2.0	9.00
EI0004R)	RENEW FRONT BUMPER (REMOVED)		2.0	9.00
LI0002R)	R + R LEFT HEADLAMP		2.0	9.00
NO NUMBER	R + R L/HEADLAMP WASHER NOZZLE		2.0	9.00
NO NUMBER	R + R R/HEADLAMP WASHER NOZZLE		2.0	9.00
NO NUMBER	R + R L/F CENTRE PARKING AID SENSOR		1.0	4.50
NO NUMBER	R + R R/F CENTRE PARKING AID SENSOR		1.0	4.50
NO NUMBER	R + R L/F OUTER PARKING AID SENSOR		1.0	4.50
NO NUMBER	R + R R/F OUTER PARKING AID SENSOR		1.0	4.50
EB0002R)	R + R L/F WING		4.0	18.00
	INCLUDES: R + R WHEELHOUSE LINER AND			

Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North,
#01-18,
628457

Claim Reference:
 Assessment number: SMD5703Y - OD AXA
 Version: 1810
 Date calculated: 04/07/2019 5:27 PM

Full Report
 Registration: SMD5703Y
 Printed: 04/07/2019 5:27 PM

Code	Description	WU	Price SGD
LI0002A	WHEEL		
1019	ADJUST HEADLAMPS	2.0	9.00 ✓
1169	L/F PANEL SUPPORT REPAIR	5.0*	22.50 ✓
	L/WHEELHOUSE CVR PNL REPAIR	5.0*	22.50 ✓
Labour Cost		Hrs	WU
Panel / Mechanical Labour		4.20	42.0 189.00
Total of Labour			189.00

Paint	R+R LEFT FR WHEEL	1	4.50
	R+R LEFT FR WHEELHOUSE SHELL	2	9.00

Code	Description - TWO COAT METALLIC	WU	Price SGD
	FRT BUMPER SUPPORT SURFACE PAINT	5.0	
	L/F UPPER WING NEW PART PAINTING	10.0	
	FRONT BUMPER NEW PART PAINT K1R	14.0	
	L/F INNER SENSOR NEW PART PAINT K1R	3.0	
	R/F INNER SENSOR NEW PART PAINT K1R	3.0	
	L/F OUT PARK AID SEN NEW PART PAINT K1R	3.0	
	R/F OUT PARK AID SEN NEW PART PAINT K1R	3.0	
	L/H-LAMP WASHER LID NEW PART PAINT K1R	3.0	
	FRONT BUMPER COVER SURFACE PAINT PLAST.	3.0	
	L/F PANEL SUPPORT SURFACE PAINT	4.0	
	L/WHEELHOUSE CVR PNL SURFACE PAINT	4.0	

Paint Material Per Part

Code	Description	Price SGD
0340	FRT BUMPER SUPPORT SURFACE PAINT	4.98
0741	L/F UPPER WING NEW PART PAINTING	20.64
0281	FRONT BUMPER NEW PART PAINT K1R	68.39
0371	L/F INNER SENSOR NEW PART PAINT K1R	0.49
0372	R/F INNER SENSOR NEW PART PAINT K1R	0.49
0373	L/F OUT PARK AID SEN NEW PART PAINT K1R	0.49
0374	R/F OUT PARK AID SEN NEW PART PAINT K1R	0.49
0625	L/H-LAMP WASHER LID NEW PART PAINT K1R	0.49
0295	FRONT BUMPER COVER SURFACE PAINT PLAST.	0.37
1019	L/F PANEL SUPPORT SURFACE PAINT	3.74
1169	L/WHEELHOUSE CVR PNL SURFACE PAINT	3.49

Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North,
#01-18,
628457

Claim Reference:
 Assessment number: SMD5703Y - OD AXA
 Version: 1810
 Date calculated: 04/07/2019 5:27 PM

Full Report
 Registration: SMD5703Y
 Printed: 04/07/2019 5:27 PM

Labour Cost - Paint	Hrs	WU	Price SGD
Factor	45.00 SGD/h		
Time Paint		55.0	
Preparation Main Work Metal	2.50	25.0	112.50
Preparation Comp. Work Plastic	0.50	5.0	22.50
Total	10 WU/h	85.0	382.50

Material Cost - Paint	Price SGD
New Part Painting	20.64
New Part Painting - Plastic K1R	70.84
Surface-/Blend Paint	12.21
Surface Painting Plastic	0.37
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	141.66

Spare Parts

Code	Description	Part Number	Supplier	prices as at 2015-06-01	Price SGD
0281	FRONT BUMPER <i>le</i>	57702VA020		500 ✓	640.00 ✓
0289	FRT BUMPER GRILLE ?	57731VA080	? xsu	X	280.00 ✓
0293	L/F BUMPER GUIDE ?	57707VA030	? xsu	X	10.00 ✓
0299	L/F BUMPER COVER <i>MIS</i>	57731VA010			54.00 ✓
0321	L/F INN BUMPER BRKT <i>MIS</i>	57707VA011			36.00 ✓
0340	FRT BUMPER SUPPORT ?	57711VA0029P	? xsu	X	150.00 ✓
0350	FRT BUMPER CLAMP KIT	USE SINGLE PARTS <i>ne</i>			20.00 ✓
0351	CLIP FASTENING	909140062	X } <i>give</i>		0.00
0352	CLIP FASTENING	909140007	X }		0.00
0371	L/F INNER SENSOR	SEE GUIDE NO. 0376			
0372	R/F INNER SENSOR	SEE GUIDE NO. 0376			
0373	L/F OUT PARK AID SEN	SEE GUIDE NO. 0376			
0374	R/F OUT PARK AID SEN	SEE GUIDE NO. 0376			
0376	FRT PARKING AID SET	SECOVA2100	X <i>SVL</i>		0.00
0561	LEFT HEADLAMP ASSY	84001VA010	<i>SCA</i>	2630 ✓	2,800.00 ✓
0617	H/LAMP WASHER VALVE	86636VA011	? <i>CR</i>		45.00 ✓
0625	L/H-LAMP WASHER LID	86636VA030V2	<i>MIS</i>		54.00 ✓
0639	L/F FOG LAMP	84501AJ060	? <i>SVL</i>	X	330.00 ✓

Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North,
#01-18,
628457

Claim Reference:
 Assessment number: SMD5703Y - OD AXA
 Version: 1810
 Date calculated: 04/07/2019 5:27 PM

Full Report
 Registration: SMD5703Y
 Printed: 04/07/2019 5:27 PM

Code	Description	Part Number	Supplier	Price SGD
0741	L/F UPPER WING	57120VA0109P	X	140.00
0789	L/F WING CLAMP KIT	901810004	X	16.00
0843	L/F WHEELHOUSE COVER	59110VA010	X	55.00
f: OEM Parts				Savings 0.00
n: Non-OEM Parts				Subtotal 4,630.00
u: Used parts				Addition(+10.00%) 463.00
Total				5,093.00

Extras

Code	Description	Price SGD
1000	AIRCON GAS <i>see ✓</i>	50.00*
Total Extras		50.00

Final Calculation

	SGD	SGD
Parts		
Addition(+10.00%)	4,630.00	
Total Parts	463.00	5,093.00
Labour Time Base 10 WU/h		
Total 42.0 WU X 45.00 SGD/h	189.00	104.50
Total of Labour		189.00
Total Of Extras		50.00
Paint Work Time Base 10 WU/h		
Labour Cost 85.0 WU X 45.00 SGD/h	382.50	
Material Cost	141.66	
Total Paint Including Material		524.16
Repair Cost Excludes GST	5,920.66	5,856.16
GST (+7.0%)		409.93
Repair Cost Included GST		6,266.09

RASUL
Hp 90010068
4 3/4 days
P/P
05/07/19 @ 1710
EXCESS: 400
REVENUE
Reserve before part

5889.16

**Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North,
#01-18,
628457**

**Claim Reference:
Assessment number: SMD5703Y - OD AXA
Version: 1810
Date calculated: 04/07/2019 5:27 PM**

**Full Report
Registration: SMD5703Y
Printed: 04/07/2019 5:27 PM**

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

LKK Auto Consultants France notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during survey
- Parts prices are subject to confirmation
- Third party survey is on a "Written Authorised Request"
- No illegal modifications is allowed
- Supplementary documents (e.g. photos and
is subject to final approval - see LKK Auto Consultants France

Authorised by: _____
Signature: _____
Date: _____

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park, 51
Ubi Avenue 1
408933

Insurer Reference:
Repairer Reference: SMD5703Y - OD AXA
Date calculated: 30/08/2019 10:02 AM
Summary Information

Full Report
Registration: SMD5703Y
Printed: 30/08/2019 10:02 AM

Claim

Location:	Singapore (SG)	Work Provider:	AXA Insurance Pte Ltd
Printed by:	KK LAU	Currency:	SGD
Claim Reference:		Date of Incident:	08/03/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	SUBARU
Model:	LEVORG (V10)
Sub Model:	LEVORG
Model Sheet Number:	62 42 80
Registration:	SMD5703Y
VIN number:	
Odometer:	

Model Specs

FROM 10/2015	2 ZONE AUTO AIR CON	OUTS MIRR HSG PAINT	FRONT PARKING SYSTEM
1.6 LTR 125 KW	4-DOOR	SILL COVERING	FRONT SILL COVER
TWO COAT METALLIC	PREPARE OFF VEHICLE		


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All
Underbody

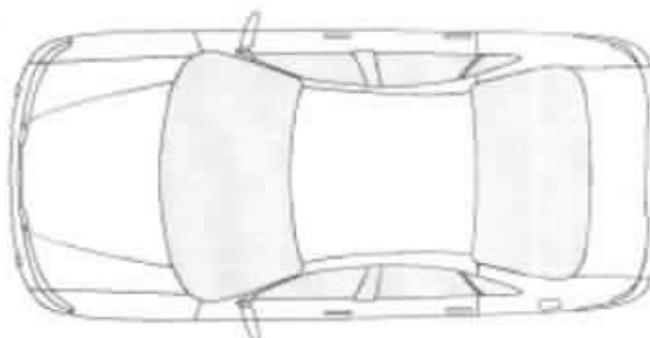

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park, 51
Ubi Avenue 1
408933

Insurer Reference:
 Repairer Reference: **SMD5703Y - OD AXA**
 Date calculated: **30/08/2019 10:02 AM**

Full Report
 Registration: **SMD5703Y**
 Printed: **30/08/2019 10:02 AM**

Labour

Code	Description	Time Base 10 WU/h	Price = 45.00 SGD/h	
			WU	Price SGD
NO NUMBER	R + R LEFT FRONT WHEEL		1.0	4.50
EI0007R)	R + R LEFT FRONT WHEELHOUSE SHELL		2.0	9.00
EI0004R	RENEW FRONT BUMPER		6.0	27.00
LI0002R)	R + R LEFT HEADLAMP		2.0	9.00
LI0002A	ADJUST HEADLAMPS		2.0	9.00
1019	L/F PANEL SUPPORT REPAIR		5.0*	22.50
1169	L/WHEELHOUSE CVR PNL REPAIR		5.0*	22.50
Labour Cost			Hrs	WU
Panel / Mechanical Labour			2.30	23.0
Total of Labour				103.50

Paint

Code	Description - TWO COAT METALLIC	SYSTEM AZT	Time Basis 10 WU/h	
			WU	Price SGD
	FRT BUMPER SUPPORT SURFACE PAINT		5.0	
	L/F UPPER WING NEW PART PAINTING		10.0	
	FRONT BUMPER NEW PART PAINT K1R		14.0	
	L/F INNER SENSOR NEW PART PAINT K1R		3.0	
	R/F INNER SENSOR NEW PART PAINT K1R		3.0	
	L/F OUT PARK AID SEN NEW PART PAINT K1R		3.0	
	R/F OUT PARK AID SEN NEW PART PAINT K1R		3.0	
	L/H-LAMP WASHER LID NEW PART PAINT K1R		3.0	
	FRONT BUMPER COVER SURFACE PAINT PLAST.		3.0	
	L/F PANEL SUPPORT SURFACE PAINT		4.0	
	L/WHEELHOUSE CVR PNL SURFACE PAINT		4.0	

Paint Material Per Part

Code	Description	Price SGD
0340	FRT BUMPER SUPPORT SURFACE PAINT	4.98
0741	L/F UPPER WING NEW PART PAINTING	20.64
0281	FRONT BUMPER NEW PART PAINT K1R	68.39
0371	L/F INNER SENSOR NEW PART PAINT K1R	0.49
0372	R/F INNER SENSOR NEW PART PAINT K1R	0.49
0373	L/F OUT PARK AID SEN NEW PART PAINT K1R	0.49
0374	R/F OUT PARK AID SEN NEW PART PAINT K1R	0.49
0625	L/H-LAMP WASHER LID NEW PART PAINT K1R	0.49
0295	FRONT BUMPER COVER SURFACE PAINT PLAST.	0.37
1019	L/F PANEL SUPPORT SURFACE PAINT	3.74

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park, 51
Ubi Avenue 1
408933

Insurer Reference:
 Repairer Reference: SMD5703Y - OD AXA
 Date calculated: 30/08/2019 10:02 AM
 Paint Material Per Part

Full Report
 Registration: SMD5703Y
 Printed: 30/08/2019 10:02 AM

Code	Description	Price SGD
1169	L/WHEELHOUSE CVR PNL SURFACE PAINT	3.49

Labour Cost - Paint	Hrs	WU	Price SGD
Factor	45.00 SGD/h		
Time Paint		55.0	
Preparation Main Work Metal	2.50	25.0	112.50
Preparation Comp. Work Plastic	0.50	5.0	22.50
Total	10 WU/h	85.0	382.50

Material Cost - Paint	Price SGD
New Part Painting	20.64
New Part Painting - Plastic K1R	70.84
Surface-/Blend Paint	12.21
Surface Painting Plastic	0.37
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	141.66

Spare Parts

Code	Description	Part Number	Supplier	prices as at 2015-06-01	Price SGD
0281	FRONT BUMPER	57702VA020			500.00
0299	L/F BUMPER COVER	57731VA010			54.00
0321	L/F INN BUMPER BRKT	57707VA011			36.00
0350	FRT BUMPER CLAMP KIT	USE SINGLE PARTS			20.00
0351	CLIP FASTENING	909140062			0.00
0352	CLIP FASTENING	909140007			0.00
0371	L/F INNER SENSOR	SEE GUIDE NO. 0376			
0372	R/F INNER SENSOR	SEE GUIDE NO. 0376			
0373	L/F OUT PARK AID SEN	SEE GUIDE NO. 0376			
0374	R/F OUT PARK AID SEN	SEE GUIDE NO. 0376			
0376	FRT PARKING AID SET	SECOVA2100			0.00
0561	LEFT HEADLAMP ASSY	84001VA010			2,830.00
0617	H/LAMP WASHER VALVE	86636VA011			45.00
0625	L/H-LAMP WASHER LID	86636VA030V2			54.00

f: OEM Parts
 n: Non-OEM Parts
 u: Used parts
 Audatex System Using Manufacturer Times

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park, 51
Ubi Avenue 1
408933

Insurer Reference:
 Repairer Reference: SMD5703Y - OD AXA
 Date calculated: 30/08/2019 10:02 AM

Full Report
 Registration: SMD5703Y
 Printed: 30/08/2019 10:02 AM

Savings	0.00
Subtotal	3,539.00
Addition(+10.00%)	353.90
Total	3,892.90

Extras

Code	Description	Price SGD
1000	AIR CON GAS	50.00*
	Total Extras	50.00

Final Calculation

	SGD	SGD
Parts	3,539.00	
Addition(+10.00%)	353.90	
Total Parts		3,892.90
Labour Time Base 10 WU/h		
Total 23.0 WU X 45.00 SGD/h	103.50	
Total of Labour		103.50
Total Of Extras		50.00
Paint Work Time Base 10 WU/h		
Labour Cost 85.0 WU X 45.00 SGD/h	382.50	
Material Cost	141.66	
Total Paint Including Material		524.16
Repair Cost Excludes GST		4,570.56
GST (+7.0%)		319.94
Repair Cost Included GST		4,890.50
Deductions (Excludes GST)		
Deduction For Excess	-400.00	
Total Of Deductions (Excludes GST)		-400.00
Grand Total Excludes GST		4,170.56
GST (+7.0%)		291.94
Grand Total Included GST		4,462.50

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park, 51
Ubi Avenue 1
408933

Insurer Reference:
Repairer Reference: SMD5703Y - OD AXA
Date calculated: 30/08/2019 10:02 AM

Full Report
Registration: SMD5703Y
Printed: 30/08/2019 10:02 AM

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

Author	Date	Text
sngahtee	22/08/2019 6:27 PM	ATTN: RASUL

Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North, #01-18,
628457

Insurer Reference:
Repairer Reference: SMD5703Y - OD AXA
Date calculated: 22/08/2019 6:24 PM

Full Report
Registration: SMD5703Y
Printed: 22/08/2019 6:24 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	AXA Insurance Pte Ltd
Printed by:	SNG AH TEE	Currency:	SGD
Claim Reference:		Date of Incident:	08/03/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	SUBARU
Model:	LEVORG (V10)
Sub Model:	LEVORG
Model Sheet Number:	62 42 80
Registration:	SMD5703Y
VIN number:	
Odometer:	

Model Specs

FROM 10/2015	2 ZONE AUTO AIR CON	OUTS MIRR HSG PAINT	FRONT PARKING SYSTEM
1.6 LTR 125 KW	4-DOOR	SILL COVERING	FRONT SILL COVER
TWO COAT METALLIC	PREPARE OFF VEHICLE		


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All
Underbody

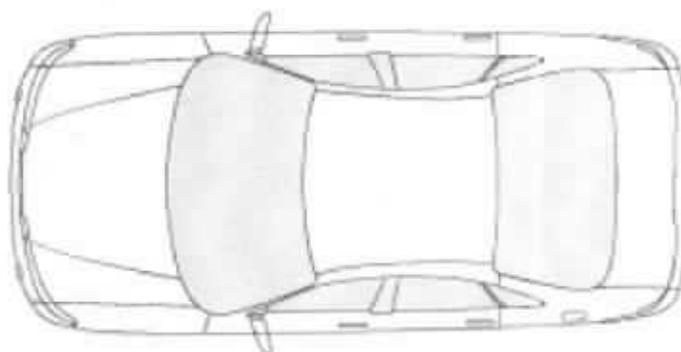

Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North, #01-18,
628457

Insurer Reference:
 Repairer Reference: SMD5703Y - OD AXA
 Date calculated: 22/08/2019 6:24 PM

Full Report
 Registration: SMD5703Y
 Printed: 22/08/2019 6:24 PM

Labour

Code	Description	Time Base 10 WU/h	Price = 45.00 SGD/h	
			WU	Price SGD
NO NUMBER	R + R LEFT FRONT WHEEL		1.0	4.50
EI0007R)	R + R LEFT FRONT WHEELHOUSE SHELL		2.0	9.00
EI0004R	RENEW FRONT BUMPER		6.0	27.00
LI0002R)	R + R LEFT HEADLAMP		2.0	9.00
LI0002A	ADJUST HEADLAMPS		2.0	9.00
1019	L/F PANEL SUPPORT REPAIR		5.0*	22.50
1169	L/WHEELHOUSE CVR PNL REPAIR		5.0*	22.50
Labour Cost			Hrs	WU
Panel / Mechanical Labour			2.30	23.0
Total of Labour				103.50

Paint

Code	Description - TWO COAT METALLIC	SYSTEM AZT	Time Basis 10 WU/h	
			WU	Price SGD
	FRT BUMPER SUPPORT SURFACE PAINT		5.0	
	L/F UPPER WING NEW PART PAINTING		10.0	
	FRONT BUMPER NEW PART PAINT K1R		14.0	
	L/F INNER SENSOR NEW PART PAINT K1R		3.0	
	R/F INNER SENSOR NEW PART PAINT K1R		3.0	
	L/F OUT PARK AID SEN NEW PART PAINT K1R		3.0	
	R/F OUT PARK AID SEN NEW PART PAINT K1R		3.0	
	L/H-LAMP WASHER LID NEW PART PAINT K1R		3.0	
	FRONT BUMPER COVER SURFACE PAINT PLAST.		3.0	
	L/F PANEL SUPPORT SURFACE PAINT		4.0	
	L/WHEELHOUSE CVR PNL SURFACE PAINT		4.0	

Paint Material Per Part

Code	Description	Price SGD
0340	FRT BUMPER SUPPORT SURFACE PAINT	4.95
0741	L/F UPPER WING NEW PART PAINTING	20.60
0281	FRONT BUMPER NEW PART PAINT K1R	68.30
0371	L/F INNER SENSOR NEW PART PAINT K1R	0.45
0372	R/F INNER SENSOR NEW PART PAINT K1R	0.45
0373	L/F OUT PARK AID SEN NEW PART PAINT K1R	0.45
0374	R/F OUT PARK AID SEN NEW PART PAINT K1R	0.45
0625	L/H-LAMP WASHER LID NEW PART PAINT K1R	0.45
0295	FRONT BUMPER COVER SURFACE PAINT PLAST.	0.30
1019	L/F PANEL SUPPORT SURFACE PAINT	3.75

Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North, #01-18,
628457

Insurer Reference:
 Repairer Reference: **SMD5703Y - OD AXA**
 Date calculated: **22/08/2019 6:24 PM**

Full Report
Registration: SMD5703Y
Printed: 22/08/2019 6:24 PM

Paint Material Per Part

Code	Description	Price SGD
1169	L/WHEELHOUSE CVR PNL SURFACE PAINT	3.49

Labour Cost - Paint

Factor	45.00 SGD/h	Hrs	WU	Price SGD
Time Paint			55.0	
Preparation Main Work Metal		2.50	25.0	112.50
Preparation Comp. Work Plastic		0.50	5.0	22.50
Total	10 WU/h	8.50	85.0	382.50

Material Cost - Paint

	Price SGD
New Part Painting	20.64
New Part Painting - Plastic K1R	70.84
Surface-/Blend Paint	12.21
Surface Painting Plastic	0.37
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	141.66

Spare Parts

Code	Description	Part Number	Supplier	prices as at 2015-06-01	Price SGD
0281	FRONT BUMPER	57702VA020			500.00
0299	L/F BUMPER COVER	57731VA010			54.00
0321	L/F INN BUMPER BRKT	57707VA011			36.00
0350	FRT BUMPER CLAMP KIT	USE SINGLE PARTS			20.00
0351	CLIP FASTENING	909140062			0.00
0352	CLIP FASTENING	909140007			0.00
0371	L/F INNER SENSOR	SEE GUIDE NO. 0376			
0372	R/F INNER SENSOR	SEE GUIDE NO. 0376			
0373	L/F OUT PARK AID SEN	SEE GUIDE NO. 0376			
0374	R/F OUT PARK AID SEN	SEE GUIDE NO. 0376			
0376	FRT PARKING AID SET	SECOVA2100			0.00
0561	LEFT HEADLAMP ASSY	84001VA010			2,830.00
0617	H/LAMP WASHER VALVE	86636VA011			45.00
0625	L/H-LAMP WASHER LID	86636VA030V2			54.00

f: OEM Parts

n: Non-OEM Parts

u: Used parts

Audatex System Using Manufacturer Times

Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North, #01-18,
628457

Insurer Reference:
 Repairer Reference: SMD5703Y - OD AXA
 Date calculated: 22/08/2019 6:24 PM

Full Report
 Registration: SMD5703Y
 Printed: 22/08/2019 6:24 PM

Savings	0.00
Subtotal	3,539.00
Addition(+10.00%)	353.90
Total	3,892.90

Extras

Code	Description	Price SGD
1000	AIRCON GAS	50.00
	Total Extras	50.00

Final Calculation

	SGD	SGD
Parts	3,539.00	
Addition(+10.00%)	353.90	
Total Parts		3,892.90
Labour Time Base 10 WU/h		
Total 23.0 WU X 45.00 SGD/h	103.50	
Total of Labour		103.50
Total Of Extras		50.00
Paint Work Time Base 10 WU/h		
Labour Cost 85.0 WU X 45.00 SGD/h	382.50	
Material Cost	141.66	
Total Paint Including Material		524.16
Repair Cost Excludes GST		4,570.56
GST (+7.0%)		319.90
Repair Cost Included GST		4,890.46

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:
48A SUNGEI KADUT AVE SINGAPORE 729672
TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg
GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

WINDSCREEN GLASS
Dept Direct: 9417 9791 / 9746 9638



Dept Direct: 6308 9810 Dept Direct: 6308 9811 Dept Direct: 9417 9792



Dept Direct: 9417 9794 Dept Direct: 9417 9795 Dept Direct: 9417 9796 Dept Direct: 9417 9797

Wiper blade: NWB (Nippon Wiper blades), Silper (Made in Korea),
Forch (Made in Germany)
Spark plug: Nippon Denso, NGK (Made in Japan)

SNG AH TEE MOTOR & PANEL SERVICE PTE LTD
BLK 03 #01-18 PIONEER ROAD NOR
SPORE 628457
CHENG PAGER :94008212

TEL : 62686183 9624964 FAX : 62681429
ATTN : SHARON / JOYCE/JANICE/ SAMANTHA

TAX INVOICE : AR201907-08140
DATE : 15/07/2019
CUSTOMER ID : SNG001
VEH REG. NO. : SMD5703Y
TERMS : 30 days
PO NO. :
PAGE NO. : Page 1 of 1
CURR. : SGD

SQ STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
✓ S86636-VA011 VM4	HEAD LAMP NOZZLE LH #617	PA PL1-C1-06A	1	45.00	45.00

total \$ 3539.00

SUB-TOTAL : 45.00
ADD GST 7.00 % 3.15

E. & O.E TOTAL AMOUNT SGD : 48.15

[P] 15/07/2019 17:11:20

[E] 15/07/2019 5:11:01PM

Goods Sold are not refundable for Cash.
Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive: CHEN



This is computer generated document.

No signature is required.

Goods Received in Good Order

Wong

Signature / Co Stamp / Date

ORIGINAL

日美汽車私人有限公司 JAE AUTO PTE LTD

Bik 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

60 JALAN LAM HUAT #B1-05/06 CARROS CENTRE
SINGAPORE 737869 TEL: 63625226 FAX: 63626977

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

WINDSCREEN GLASS
Dept Direct: 6417 8791 / 6748 9628



Wiper blade: NWB (Nippon Wiper blade), Siliper (Made in Korea),
Forch (Made in Germany)
Spark plug: Nippon Denso, NGK (Made In Japan)

SNG AH TEE MOTOR & PANEL SERVICE PTE LTD
3LK 03 #01-18 PIONEER ROAD NOR
SPORE 628457
CHENG PAGER :94008212

TEL : 62686183 9624964 FAX : 62681429
ATTN : SHARON / JOYCE/JANICE/ SAMANTHA

TAX INVOICE : AR201907-04683
DATE : 09/07/2019
CUSTOMER ID : SNG001
VEH REG. NO. : SMD5703Y
TERMS : 30 days
PO NO. :
PAGE NO. : Page 1 of 1
CURR. : SGD

SQ STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
1. S90914-0007 LEG 99 BL5 SJG	CLIP #350	U1 HL2-N7-B	10	2.00	20.00
2. S57702-VA110	FRT BUMPER #281	U1 SUPPLIER	1	500.00	500.00
3. S57731-VA450	FRT FOG LAMP COVER LH #299	U1 SUPPLIER	1	54.00	54.00
4. S57707-VA230	BRACKET HEADLAMP LH #321	U1 SUPPLIER	1	36.00	36.00
5. S86636-VA050W6	NOZZLE COVER LH #625	U1 SUPPLIER	1	54.00	54.00

SUB-TOTAL : 664.00
ADD GST 7.00 % 46.48

E. & O.E TOTAL AMOUNT SGD : 710.48

09/07/2019 9:55:29AM

[E] 09/07/2019 9:45:43AM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive : CHEN



This is computer generated document.
No signature is required.

Goods Received in Good Order

Signature / Co Stamp / Date

ORIGINAL

日美汽車私人有限公司 JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:
60 JALAN LAM HUAT #B1-05/06 CARROS CENTRE
SINGAPORE 737869 TEL: 63625226 FAX: 63626977

Email: jaeauto@pacific.net.sg
GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

WINDSHIELD GLASS
Dept Direct: 6417 9791 / 6749 9939



Wiper blade: NWB (Nippon Wiper blade), Siliper (Made in Korea),
Forch (Made in Germany)
Spark plug: Nippon Denso, NGK (Made In Japan)

SNG AH TEE MOTOR & PANEL SERVICE PTE LTD
BLK 03 #01-18 PIONEER ROAD NOR
SPORE 628457
CHENG PAGER :94008212

TEL : 62686183 9624964 FAX : 62681429
ATTN : SHARON / JOYCE/JANICE/ SAMANTHA

TAX INVOICE : AR201907-08908
DATE : 17/07/2019
CUSTOMER ID : SNG001
VEH REG. NO. : SMD5703Y
TERMS : 30 days
PO NO. :
PAGE NO. : Page 1 of 1
CURR. : SGD

SQ STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
1. S84002-VA170	HEAD LAMP LH #561	U1 SUPPLIER	1	2830.00	2,830.00

SUB-TOTAL : 2,830.00
ADD GST 7.00 % 198.10

E. & O.E TOTAL AMOUNT SGD : 3,028.10

17/07/2019 9:41:58AM

[E] 17/07/2019 9:41:41AM

Goods Sold are not refundable for Cash.
Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive : CHEN

This is computer generated document.

No signature is required.



Goods Received in Good Order

Signature / Co Stamp / Date

ORIGINAL