

23802701

ASS. REC. NY

REP: CS/AGI 19012557/P43 ^{N2}

Special Instructions

Assigner: Bryan

ASSIGNMENT (Office)

From (Person): Ivy Rattila of AAI Date/Time: 16/7/2019

Estimated Cost: Bill to:

OD / TP / PWS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SHD 7169K Insured: STV 4273T

at Workshop w/s Chumi Motor Tel: 65427162

of 10 AMC #03-19.

Policy No: Claim No: C10002502 JM

Sum Insured: Excess:

Make of Veh: (Client's Record) D.O.A 14/7/2019.

CA / REV / REP. / REV 24 HRS H.O.D. Endowment:

Date/Time: 16/7 Person Contacted: Lynn Vehicle: IN OUT

Date/Time	Action/Instruction
	1-307916 (✓)
	SHD 7169K X
	STV 4273T X

ASSIGNMENT

OB NOV 2024

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop n/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

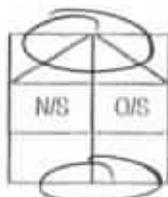
(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its

repair at the time of inspection.



Est. or Market Value: _____

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 11 days Res: Yes or No

Lum Sum: 20 % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SHD 7169 K Yr Regn: 2016, NOV

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Hyundai I40 c.c 1685

Colour: Blue A/C: Insured / Std / NI / NA

Sp. Reading: 454094 T/Radio: Insured / Std / NI / NA

Eng/No: D4FDGU625131

C/No: KMHLB41UMHU096385

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Insured / Jammed / Leaked / Burnt or

Brake: Insured / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/60R16

R: - 11 -

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Davanti

Front Rear

R/Bal. 5' mm R/Bal. 5' mm

L/Bal. 5' mm L/Bal. 5' mm

D.O.A. 14/07/2019 D.O.I. 17/07/2019

Survey held at Chynni AMK

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

Front 4 Rev

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Arnd 7 General SSV 4273T

6/9/19 Jmanu 2/S 200001 - with 11 days of rev (Red 17,484.50, 4690)

RECEIVED 06 SEP 2019

Date/Time, File Pass to?

: Prol. Report

1)

: Final Report

Date/Time, File Return to?

2) 6/9 - typist

Days Of Repair: 11

Resurvey No. of Trip: 2

Add Fee:

: Site Insp (\$)

: Interview (\$)

: Tech. Invs (\$)

: Weekend (\$)

Survey Fee:

Transportation:

D + RD, \$)

Photos

Others

TOTAL

450

Report Format: TP

Lump Sum / I.B.I: (\$ 20,000p)

Nivitha (LKK Auto)

From: Ivy Ratilla <ivy.r@budgetdirect.com.sg>
Sent: Tuesday, 16 July 2019 3:08 PM
To: Chunni Motor; Admin-D (LKKAuto)
Cc: Claims; Julie Mangubat; sur@lkkauto.com
Subject: RE: TPPD Survey: Claim ref:C10003502/JM || OI- SJV4273T (black) TP- SHD7169K || Est:\$35981.30 || Chunni Motor

Hi Team,

We would like to arrange TP Survey for SHD7169K. Please see attached file for reference.

They have chosen Mr. Mohammed Rasul to survey the vehicle.

Kindly confirm.

Regards,

Ivy Ratilla
Executive, Claims Admin

T +65 6540 2185
F +65 6725 0853
E ivy.r@budgetdirect.com.sg



Customer Care +65 6221 2111
Claims +65 6221 2199
Claims (Int.) +65 6540 2199

190 Clemenceau Avenue, #03-01
Singapore Shopping Centre
Singapore
239924
budgetdirect.com.sg

auto  general

Veh In

Auto & General Insurance (Singapore) Pte. Limited (Co. Reg. No. 201626103G) trading as **Budget Direct Insurance**.

This email is sent by Auto & General (SEA) Services Pte. Limited or a related body corporate (Auto & General) and is for the intended addressee. The views expressed in this email and attachments (email) reflect the views of the stated author but may not reflect views of Auto & General. This email is confidential and subject to copyright. It may be privileged. If you are not the intended addressee, confidentiality and privilege have not been waived and any use, interference with, or disclosure of this email is unauthorised.

This email is sent by Auto & General (SEA) Services Pte. Limited or a related body corporate (Auto & General) and is for the intended addressee. The views expressed in this email and attachments (email) reflect the views of the

stated author but may not reflect views of Auto & General. This email is confidential and subject to copyright. It may be privileged. If you are not the intended addressee, confidentiality and privilege have not been waived and any use, interference with, or disclosure of this email is unauthorised.

From: Chunni Motor <chunnimotor@gmail.com>
Sent: Tuesday, 16 July 2019 10:44 AM
To: Ivy Ratilla <ivy.r@budgetdirect.com.sg>
Cc: Claims <claims@budgetdirect.com.sg>; Julie Mangubat <julle.m@budgetdirect.com.sg>
Subject: Re: Accident involving veh no: SHD 7169K & SJV 4273T on 14.07.19 || C10003502

Dear Sir,

We appoint LKK Auto Consultants P/L (Rasul)

Thank you

Regards,
Chunni Motor Work P/L

From: Chunni Motor <chunnimotor@gmail.com>
Sent: Monday, 15 July 2019 3:49 PM
To: Claims <claims@budgetdirect.com.sg>
Subject: Accident involving veh no: SHD 7169K & SJV 4273T on 14.07.19

Dear Sir/Mdm,

We refer the above mentioned matter.

We enclosed herewith the relevant documents for your necessary action.

In line with the new protocol, kindly provide us with the list of surveyors on your panel for assessment of the damaged accident taxi involved.

Kindly survey at AMK Autopoint, Soon Hock Motor,#01-05/06.

Should you have any queries, please do not hesitate to contact Ms Lynn or Ms Irene at 65425119 or 6542 7162

Thank you for your kind assistance.

This email is sent by Auto & General (SEA) Services Pte. Limited or a related body corporate (Auto & General) and is for the intended addressee. The views expressed in this email and attachments (email) reflect the views of the stated author but may not reflect views of Auto & General. This email is confidential and subject to copyright. It may be privileged. If you are not the intended addressee, confidentiality and privilege have not been waived and any use, interference with, or disclosure of this email is unauthorised.

This email is sent by Auto & General (SEA) Services Pte. Limited or a related body corporate (Auto & General) and is for the intended addressee. The views expressed in this email and attachments (email) reflect the views of the stated author but may not reflect views of Auto & General. This email is confidential and subject to copyright. It may be privileged. If you are not the intended addressee, confidentiality and privilege have not been waived and any use, interference with, or disclosure of this email is unauthorised.

This email is sent by Auto & General (SEA) Services Pte. Limited or a related body corporate (Auto & General) and is for the intended addressee. The views expressed in this email and attachments (email) reflect the views of the stated author but may not reflect views of Auto & General. This email is confidential and subject to copyright. It may be privileged. If you are not the intended addressee, confidentiality and privilege have not been waived and any use, interference with, or disclosure of this email is unauthorised.

MCD619082213 / ConfortDelGro Engineering Pte Ltd - Loyalng
 ENTRY DATE & TIME: 15/07/2019 14:13
 SUBMITTED BY: Janet Lim Siang Gek

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	15/07/2019 14:13
Date Of Accident	14/07/2019 18:20
Exact Location Of Accident	BUKIT PANJANG RD BEFORE BKE SLIP ROAD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHD7169K
Insured/Policyholder	
Name Of Registered Owner	COMFORT TRANSPORTATION PTE LTD
Co Reg No	199303821R
Email Address	FLEETSAFETY@CDGTAXI.COM.SG
Mobile Phone No	
Alternative Phone No	OFFICE-65508768
Vehicle Particulars	
Manufacturer	HYUNDAI
Model	I40
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI
Insurance Company	
Name of Insurance Company	MS FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-18088936MFSH
Cover Note Number	
Driver	
Name of Driver	TAN YEW CHUAN
NRIC No	S1287868J
Date Of Birth	16/07/1958
Occupation	OUTDOOR
Date Of Driving Pass	29/10/1979
Driving Experience	39 YEARS AND 8 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-94896776
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address BLK 227 PENDING ROAD
#04-221

Postcode 670227

Was driver an employee of the Insured's Company NO

If No, Relationship of the Driver with the Insured OTHER - TAXI DRIVER

Vehicle Registration Number of Driver's Own Vehicle -
-
-

Insurance Company of Driver's Own Vehicle -
-
-

General Information of the Accident

Type Of Accident CHAIN COLLISION

Weather Conditions CLEAR

Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO

Number of vehicles (including own vehicle) involved in the accident 3

Was any body injured in the Accident? YES

Was any injured conveyed to hospital by ambulance? NO

Was any other material or property damaged? YES

I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO

Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? YES

If Yes, Please state which Police Station

Police Station Name JURONG WEST NEIGHBOURHOOD POLICE CENTRE

Police Station Address ROAD: 700 CORPORATION ROAD , POSTCODE: 649818 , COUNTRY: SINGAPORE

Police Station Contact TEL NO: 1800-2689999 - FAX NO: 62672438

Was notice of intended Prosecution given? NO

If Yes, against whom?

Circumstances of Accident

REFER POLICE REPORT NO: T/20190715/2004

Attachment(s)

Are accident photos available for attachment? YES

Was there any video captured by Car Camera? YES

Remarks/ Reasons: -

Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SJV4273T

Vehicle Make/Model/Colour KIA

Details Of Properties

Vehicle Category PRIVATE CAR

Name of Driver ANG SWEE CHYE

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name
Nature Of Damage FRONT
No. Of Passenger (Including Driver)

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number SGR5656Y
Vehicle Make/Model/Colour SUBARU
Details Of Properties
Vehicle Category PRIVATE CAR
Name of Driver HO YANG KAO
NRIC/Passport Number
Contact Number
Address
Postcode
Insurance Company Name
Nature Of Damage REAR
No. Of Passenger (Including Driver)

DETAILS OF INJURED PERSON 1

Name TAN YEW CHUAN
Approximate Age
Injuries Sustain NECK AND LEG
Injured person in which vehicle? SHD7169K
Were seat belts worn? YES
Was this injured conveyed to hospital by ambulance? NO
Address
Postcode

SKETCH PLAN**IMPORTANT NOTICE**

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My Insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mall packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

COMFORT TRANSPORTATION PTE LTD
CO. REG. NO. 199303821R

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time: 15.07.2019
@ 12:00 hrs

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

From:

To:65426039

16/07/2019 12:27

#128 P.001/004


**SINGAPORE
POLICE FORCE**


T/20190715/2004

Police Station Of Origin:
Jurong West N.P.C
700 Corporation Road SINGAPORE 649818
Tel No: 1800-2689999

1 of 4

Report No. T/20190715/2004

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 15/07/2019 00:56		Vide Report No.:		Station Diary No.: 14	
Informant's Particulars					
Name of Informant: TAN YEW CHUAN			Address: APT BLK 227 PENDING ROAD #04-221 SINGAPORE 670227		
ID Type / ID No.: NRIC NO / S1287868J			Contact No.: Home/Office: Mobile: 94896776		
Nationality: SINGAPORE CITIZEN			Email:		
Sex: Male	Age: 60	Date of Birth: 16/07/1958	Type of Informant: Driver		
Race: Chinese			Language: Mandarin		Institution / School Name:
Occupation: TAXI DRIVER			Driving Licence Information: Class: 2B,3,4,5		Date of Expiry:

General Information of the Accident					
Type of Accident:	Injury Others	Drink Drive: No	Date/Time of Accident: 14/07/2019 18:20	Type of Location:	
Location: Along Road 1 BUKIT PANJANG ROAD Before BKE slip road					
Weather: Clear		Road Surface: Dry		Road Speed Limit:	
Traffic Flow:		Traffic Control: Not Controlled		Traffic Volume: Moderate	
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: No	

Details of Vehicle Involved						
Vehicle No.	Type	Make	Model	Color	Condition	No. of Passenger
SGR5656Y	Car	SUBARU	FORESTER 2.0I-L CVT AWD SR	Brown	Slightly Damaged	1
SHD7169K	Car	HYUNDAI	I40 1.7 CRDI F/L AT ABS AIRBAG 4DR	Blue	Slightly Damaged	0
SJV4273T	Car	KIA	RIO 1.4L M/T ABS AIRBAG 2WD 5DR	Black	Slightly Damaged	1



**SINGAPORE
POLICE FORCE**



T/20190715/2004

Police Station Of Origin:
Jurong West N.P.C
700 Corporation Road SINGAPORE 649818
Tel No: 1800-2689999

2 of 4

Report No. T/20190715/2004

CONTINUATION OF REPORT

Details of Person Involved			
Any Pedestrian Involved: No			
No. of Pedestrians Injured: NIL		Use of Pedestrian Crossing: NA	
Driver			
Name	Ho Yang Kao	ID No.	S1741521B
Related Vehicle	SGR5656Y (Car)	Contact No.	NIL
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL
Driver			
Name	TAN YEW CHUAN	ID No.	S1287868J
Related Vehicle	SHD7169K (Car)	Contact No.	94896776
Hospital/Clinic	ACCESS MEDICAL JURONG WEST	Class of Driving Licence & Expiry Date	Class: 2B,3,4,5 Date of Expiry: NIL
Date Treatment	14/07/2019	Date Discharge	14/07/2019
No. of Days granted Medical Leave	05	Degree of Injury	Slight
Driver			
Name	Ang Swee Chye	ID No.	S7036814E
Related Vehicle	SJV4273T (Car)	Contact No.	NIL
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

Brief Details.

On 14 July 2019 at about 1820hrs while driving the company's taxi along Bukit Panjang Road towards the slip road into BKE, a car bearing registration number, SJV4273T, hit onto the rear of my vehicle. The impact had caused me to hit the rear of a car bearing registration number SGR5656Y, which was in front of my vehicle. We stopped, made a check on the vehicles and exchanged particulars. Nobody called for police or ambulance. The taxi I was driving had deep dents the front grill was detached from the vehicle. The taxi's rear has dents too. I was unable to drive the taxi due to its damages and had the taxi towed by the towtruck company. A witness who was in a vehicle in front of the car I had hit, assisted me. He drove me home and I went to a clinic for medical checkup on my own. I received 05 days of Medical Leave

From:

To:65426039

15/07/2019 12:29

#128 P.003/004



**SINGAPORE
POLICE FORCE**



T/20190715/2004

Police Station Of Origin:
Jurong West N.P.C
700 Corporation Road SINGAPORE 649818
Tel No: 1800-2689999

3 of 4

Report No. T/20190715/2004

CONTINUATION OF REPORT

dated from 14 July 2019 to 18 July 2019. The witness then fetched me and bring me to Jurong West NPC to lodge a police report.



**SINGAPORE
POLICE FORCE**



T/20190715/2004

Police Station Of Origin:
Jurong West N.P.C
700 Corporation Road SINGAPORE 649818
Tel No: 1800-2689999

4 of 4



Report No. T/20190715/2004

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report: J / Sgt 2 NUR SYAHIRAH BINTE MOHAMED SALLEH <i>RS</i>	Signature Of Informant: 
Signature Of Interpreter: Not applicable	Date/Time: 15/07/2019 00:56
Officer In Charge Of Case: TP / AEIT / SI MOHAMAD ZULFAZDLI BIN ABDULLAH Contact No.: 65476204	Classification Of Case: SN 126
Authentication Stamp NP168 	

CHUNNI MOTOR WORK PTE LTD

REPAIR ESTIMATE*

VEHICLE NO : SHD 7169K

DATE : 15.07.2009

MAKE :

TEL : 6542 5119

MODEL : HYUNDAI i40

FAX : 6542 6039

Auto & General

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Bonnet <i>SVC</i>			\$ 2,265.90
	Bonnet Rubber (LH) <i>SVC</i>			\$ 12.40
	Bonnet Rubber (RH) <i>SVC</i>			\$ 12.40
	Bonnet Hinge (LH/RH) <i>NH</i>	\$	41.00	\$ 82.00
	Bonnet Lock <i>St</i>			\$ 36.90
	Bonnet Insulator <i>SVC</i>			\$ 196.50
	Bonnet Insulator Clips <i>NH</i>			\$ 8.40
	Radiator Grille <i>broken</i>			\$ 1,110.10
	Radiator Grille H Emblem <i>broken</i>			\$ 120.30
	Front Bumper Cover <i>broken</i>			\$ 1,052.20
	Front Bumper Sponge <i>broken</i>			\$ 99.20
	Front Bumper Reinforcement <i>St</i> <i>Dented</i>			\$ 402.10
	Front Bumper Bracket Top (LH/RH) <i>NH</i>	\$	22.40	\$ 44.80
	Front Bumper Bracket (LH/RH) <i>NH</i>	\$	24.60	\$ 49.20
	Headlamp Support Top Cover <i>dented</i>			\$ 222.60
	Headlamp Support Panel Assy <i>St</i>			\$ 907.40
	Headlamp (LH/RH) <i>cracked</i>	\$	1,388.00	\$ 2,776.00
	Radiator <i>St</i>			\$ 698.30
	Radiator Fan Blade, Cowling, Motor Assy <i>broken</i>			\$ 792.95
	Radiator Bracket (RH/LH) <i>NH</i>	\$	6.50	\$ 13.00
	Radiator Hose Upper <i>dented</i>			\$ 105.80
	Radiator Hose Lower <i>NH</i>			\$ 52.70
	Radiator Guard <i>broken</i>	\$	20.00	\$ 40.00
	Horn Unit (LH/RH) <i>broken</i>	\$	73.80	\$ 147.60
	Horn Wire <i>broken</i> <i>socket</i>			\$ 156.50
	Front Fender (RH) <i>Dented</i>			\$ 663.00
	Front Fender Shield (RH) <i>NH</i>			\$ 174.90
	Front Fender Retainer <i>NH</i>			\$ 24.60
	Air Cleaner Assy <i>St</i> <i>broken</i>			\$ 118.60
	Air Duct <i>broken</i>			\$ 134.60
	Air Flow Sensor <i>broken</i>			\$ 502.20
	Air Cleaner Bottom Assy <i>NH</i>			\$ 325.00
	Aircon Condenser <i>St</i>			\$ 927.50
	Aircon Compressor <i>NH</i>			\$ 2,578.00
	Wiper Container <i>NH</i>			\$ 61.90
	Wiper Container Motor <i>NH</i>			\$ 75.00
	Inter Cooler <i>St</i>			\$ 1,032.50
	Inter Cooler Mounting (2 PCS) <i>NH</i>			\$ 25.90
	Hose B To Inter Cooler <i>NH</i>			\$ 229.70
	Hose C To Inter Cooler Inlet <i>NH</i>			\$ 294.50
	Pipe To Inter Cooler <i>NH</i>			\$ 167.05
	Pipe To Inter Cooler Outlet <i>NH</i>			\$ 244.55
	Wiring-Engine <i>St</i> <i>socket</i> <i>broken</i>			\$ 3,326.00
	Wiring-ECM <i>NH</i>			\$ 3,243.00

17638.25

14110.60

Handwritten checkmarks and 'X' marks in the right margin of the table, indicating the status of each item.

SHD 7169K

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Boot Lid Comfort Logo & Tel No. Sticker <i>N/C</i>			\$ 30.00
	Rear Bumper Reverse Sensor <i>Down</i>			\$ 135.70
	Rear Bumper Advertisement Logo <i>N/C</i>			\$ 50.00
	Rear Fender Advertisement Logo (LH/RH) <i>N/C</i>		\$ 100.00	\$ 200.00
			<i>415.70</i>	\$ 415.70
	Labour Charge			
	Panel Beating			\$ 1,000.00
	Spray Painting Charge			\$ 750.00
	Wiring Charge			\$ 50.00
	Tuff Kote			\$ 50.00
	Remove/Refix Reverse Sensor			\$ 120.00
	Remove/Refix Exhaust Pipe			\$ 300.00
			<i>1370.00</i>	
	TOTAL LABOUR			\$ 2,270.00
	ESTIMATE TOTAL			\$ 35,981.30
				<i>37,484.50</i>
	<i>17/07/19 @ 1000hrs</i>			<i>25169.02</i>
	<i>N/A Auction</i>			<i>Supp 1503.20</i>
	<i>2/From 11 days</i>			<i>26672.22</i>
	<i>nyan</i>			<i>4/20000/-</i>
	<i>2 KK Auto</i>			

Nett ✓
 Nett ✓
 Nett ✓
 Nett ✓
 600/-
 600/-
 30/-
 40/-
 40/-
 60/-

LKK Auto Consultants hence notify the Repairer of the following:
 • To resurvey before/after spray painting
 • To display damaged part(s) during resurvey
 • Parts prices are subject to confirmation
 • Third party survey is on a "Without Prejudice" basis
 • No illegal modification(s) is allowed
 • Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company
 Acknowledged by Repairer
 Signature:
 Date:

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

CHUNNI MOTOR WORK PTE LTD**REPAIR ESTIMATE***

VEHICLE NO : SHD 7169K (Supplementary)

DATE : 18.07.2019

MAKE :

TEL : 6542 5119

MODEL : HYUNDAI i40

FAX : 6542 6039

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Solenoid Valve <i>broken</i>			\$ 585.40
	Air Cleaner Hose <i>torn</i>			\$ 351.00
	Radiator Upper Hose Support Bracket <i>broken</i>			\$ 128.00
	Actuator <i>broken</i>			\$ 814.60
				SUB TOTAL
				\$ 1,879.00
				LESS 20%
				\$ 375.80
				DISCOUNTED TOTAL
				\$ 1,503.20
	<p>18/07/2019</p> <p><i>[Signature]</i></p> <p>2kk hock</p> <p><i>[Signature]</i></p>			
<p>This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.</p>				



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
AUTO & GENERAL INSURANCE (S) PL		Ref : CS/AGI19012557/Dvf3n2	
(BUDGET DIRECT INSURANCE) 190 CLEMENCEAU AVENUE #03-01 SINGAPORE SHOPPING CENTRESINGAPORE 239924		Date : 10-09-2019	
		Code : AGI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SJV 4273T	Veh. Inspected	SHD 7169K
Policy No.		Coverage (\$)	0.00
Claim No.	C10003502/JM	Excess (\$)	0.00
Assign From	IVY RATILLA	Assign Date	18/07/2019
2. Vehicle Particulars & Condition			
Make & Model	HYUNDAI I40	c.c	1685
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	KMHLB41UMHU096385	Colour	BLUE
Odometer	454094	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	205/60 R16	DAVANTI	5 mm
L/H Front Tyre	205/60 R16	DAVANTI	5 mm
R/H Rear Tyre	205/60 R16	DAVANTI	5 mm
L/H Rear Tyre	205/60 R16	DAVANTI	5 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	14/07/2019	Inspection Date	17/07/2019
Survey held at	CHUNNI MOTOR WORK PTE LTD BLK 10 ANG MO KIO IND, PARK 2A, #03-19 AMK AUTOPOINT SINGAPORE 568047.		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		11 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 7169K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	BONNET	BUCKLED	2,265.90	2,265.90
1	BONNET RUBBER (LH)	SERVICEABLE	12.40	-
1	BONNET RUBBER (RH)	SERVICEABLE	12.40	-
2	BONNET HINGE (LH/RH) @\$41.00	NOT NECESSARY	82.00	-
1	BONNET LOCK	BENT	36.90	36.90
1	BONNET INSULATOR	SERVICEABLE	196.50	-
1	BONNET INSULATOR CLIPS	NOT NECESSARY	8.40	-
1	RADIATOR GRILLE	BROKEN	1,110.10	1,110.10
1	RADIATOR GRILLE H EMBLEM	BROKEN	120.30	120.30
1	FRONT BUMPER COVER	BROKEN	1,052.20	1,052.20
1	FRONT BUMPER SPONGE	BROKEN	99.20	99.20
1	FRONT BUMPER REINFORCEMENT	BENT / DENTED	402.10	402.10
2	FRONT BUMPER BRACKET TOP (LH/RH) @\$22.40	NOT NECESSARY	44.80	-
2	FRONT BUMPER BRACKET (LH/RH) @\$24.60	NOT NECESSARY	49.20	-
1	HEADLAMP SUPPORT TOP COVER	DEFORMED	222.60	222.60
1	HEADLAMP SUPPORT PANEL ASSY	BENT	907.40	907.40
2	HEADLAMP (LH/RH) @\$1388.00	MOUNTING BROKEN	2,776.00	2,776.00
1	RADIATOR	BENT	698.30	698.30
1	RADIATOR FAN BLADE,COWLING,MOTOR ASSY	BROKEN	792.95	792.95
2	RADIATOR BRACKET (RH/LH) @\$6.50	NOT NECESSARY	13.00	-
1	RADIATOR HOSE UPPER	DEFORMED	105.80	105.80
1	RADIATOR HOSE LOWER	NOT NECESSARY	52.70	-
2	RADIATOR GUARD @\$20.00	BROKEN	40.00	40.00
2	HORN UNIT (LH/RH) @\$73.80	BROKEN	147.60	147.60
1	HORN WIRE	SOCKET BROKEN	156.50	156.50
1	FRONT FENDER (RH)	DENTED	663.00	663.00
1	FRONT FENDER SHIELD (RH)	NOT NECESSARY	174.90	-
1	FRONT FENDER RETAINER	NOT NECESSARY	24.60	-
1	AIR CLEANER ASSY	BROKEN	118.60	118.60
1	AIR DUCT	BROKEN	134.60	134.60
1	AIR FLOW SENSOR	BROKEN	502.20	502.20
1	AIR CLEANER BOTTOM ASSY	NOT NECESSARY	325.00	-
1	AIRCON CONDENSER	BENT	927.50	927.50

Report Ref No. CS/AGI19012557/Dvf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No. 2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	AIRCON COMPRESSOR	NOT NECESSARY	2,578.00	-
1	WIPER CONTAINER	NOT NECESSARY	61.90	-
1	WIPER CONTAINER MOTOR	NOT NECESSARY	75.00	-
1	INTER COOLER	BENT	1,032.50	1,032.50
1	INTER COOLER MOUNTING (2 PCS)	NOT NECESSARY	25.90	-
1	HOSE B TO INTER COOLER	NOT NECESSARY	229.70	-
1	HOSE C TO INTER COOLER INLET	NOT NECESSARY	294.50	-
1	PIPE TO INTER COOLER	NOT NECESSARY	167.05	-
1	PIPE TO INTER COOLER OUTLET	NOT NECESSARY	244.55	-
1	WIRING-ENGINE	SOCKET BROKEN	3,326.00	3,326.00
1	WIRING-ECM	NOT NECESSARY	3,243.00	-
1	BOOT LID	BENT	2,174.90	2,174.90
1	BOOT LID LOCK UPPER	DAMAGED	102.60	102.60
1	BOOT LID LOCK LOWER	NOT NECESSARY	31.70	-
1	BOOT LID "H" EMBLEM	NECESSARY	28.70	28.70
1	BOOT LID CRDI PLATE	NECESSARY	27.90	27.90
2	BOOT LID LAMP (LH/RH) @\$565.60	CRACKED	1,131.20	1,131.20
1	BOOT LID TRIMBOARD	TORN	116.40	116.40
10	BOOT LID TRIMBOARD CLIPS	NECESSARY	11.00	11.00
1	BOOTLID MOULDING	NOT NECESSARY	85.00	-
1	BOOTLID I40 EMBLEM	NOT NECESSARY	27.90	-
1	BOOTLID LOWER GARNISH	NOT NECESSARY	227.90	-
1	REAR BUMPER	DISTORTED	553.00	553.00
1	REAR BUMPER REINFORCEMENT	CRACKED	428.40	428.40
2	REAR BUMPER REINFORCEMENT BRACKET (LH/RH) @\$80.30	NOT NECESSARY	160.60	-
10	REAR BUMPER CLIP	NECESSARY	22.00	22.00
2	REAR BUMPER BRACKET @\$35.60	NOT NECESSARY	71.20	-
1	REAR BUMPER SPONGE	TORN	118.40	118.40
1	REAR BUMPER UNDER COVER	DISTORTED	228.00	228.00
2	TAIL LAMP (LH/RH) @\$697.80	CRACKED	1,395.60	1,395.60
1	REAR PANEL	DENTED	526.70	526.70
1	REAR PANEL GARNISH	MOUNTING BENT	57.70	57.70
1	REAR PANEL LOWER PANEL	DENTED	495.50	495.50
2	EXHAUST PIPE INSULATOR @\$58.55	NOT NECESSARY	117.10	-
2	EXHAUST SILENCER @\$967.70	BENT	1,935.40	1,935.40

Report Ref No. CS/AGI19012557/Dvf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No. 3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	EXHAUST PIPE HANGER @\$58.55	NOT NECESSARY	117.10	-
1	EXHAUST PIPE CENTRE	NOT NECESSARY	730.10	-
1	SOLENOID VALVE (ADDITIONAL)	BROKEN	585.40	585.40
1	AIR CLEANER HOSE (ADDITIONAL)	TORN	351.00	351.00
1	RADIATOR UPPER HOSE SUPPORT BRACKET (ADDITIONAL)	BROKEN	128.00	128.00
1	ACTUATOR (ADDITIONAL)	BROKEN	814.60	814.60
	LESS 20% DISCOUNT		-7,670.95	-5,774.13
			30,683.80	23,096.52
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NUMBER PLATE (SN)	NOT NECESSARY	25.00	-
1	FRONT NO PLATE TRIM COVER (SN)	NOT NECESSARY	30.00	-
1	FRONT FENDER ADVERTISEMENT LOGO (RH)(SN)	NECESSARY	100.00	100.00
1	BOOT LID COMFORT LOGO & TEL NO STICKER (SN)	NECESSARY	30.00	30.00
1	REAR BUMPER REVERSE SENSOR (SN)	DAMAGED	135.70	135.70
1	REAR BUMPER ADVERTISEMENT LOGO (SN)	NECESSARY	50.00	50.00
2	REAR FENDER ADVERTISEMENT LOGO (LH/RH) @\$100.00 (SN)	NECESSARY	200.00	200.00
			570.70	515.70
	<u>LABOUR</u>			
	PANEL BEATING.		2,800.00	1,300.00
	SPRAY PAINTING CHARGE.		1,500.00	1,100.00
	WIRING CHARGE.		100.00	60.00
	TUFF KOTE.		100.00	70.00
	TOWING CHARGE.	NOT NECESSARY	50.00	-
	REMOVE/REFIX AIRCON & REFILL GAS.		150.00	80.00
	REMOVE/REFIX DASHBOARD.		450.00	150.00
	REMOVE/REFIX FUSE BOX.		180.00	50.00
	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE.		480.00	150.00
	REMOVE/REFIX REVERSE SENSOR.		120.00	40.00
	REMOVE/REFIX EXHAUST PIPE.		300.00	60.00
			6,230.00	3,060.00
GRAND TOTAL			37,484.50	26,672.22
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				20,000.00



Report Ref No. CS/AGI19012557/Dvf3n2

ANG BRYAN TANI

Automotive Assessor / Investigator

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.