

ASS. REC. BY:

REF:

CS/III 19013723/K19d36

Special Instruction:

Surveyor: KALVIN

Meinman

From (Person):

Gabriel wee

of

III

Date/Time:

6/8/19 @ 9.01am

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SHC 2314X

Insured:

at Workshop m/s

Comfortdelgro

Tel:

6214 8898

of

59 Laying Drive

Policy No:

Claim No:

MCT19080095

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

04/08/2019

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

9.22am @ 6/8/19

Person Contacted:

Mr. Lim

Vehicle IN / OUT

| Date/Time | Action/Instruction |
|------------------|---------------------------------------|
| | Reimburse ✓ FIRE CASE (Investigation) |
| | SHA 2314X |
| 07/8/19 @ 1.30pm | Revert to Gabriel wee via Meinman. |
| 13/8/19 | Submit Total Loss Report - Unsafe. |
| | |
| | |
| | |

(08/11/13)

REF:

Surveyor: Kalvin

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop n/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: REV

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

| | |
|-----|-----|
| | |
| N/S | O/S |
| | |

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SHC 2314X Yr Regn: 8/Mar 2018

Type: M.Car / M.Cycle / Bus / Van / Lorry / T/B / Prime Mover /

Truck / Trailer or

Make: Hyundai Tucson C.C. 1560Colour: Blue A/C: Insured / Std / NI / NASp. Reading: 103857 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: KMHC 85 / CUK 115220Gen. Cond: Good / ~~Fair~~ / Poor / BurntSteering: Inorder / 6 / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD / 6 / Rim orTyre Size: F: 195/65R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Puratum

Front: _____ Rear: _____

R/Bal. Burnt mm R/Bal. 8 mmL/Bal. 8 mm L/Bal. 8 mmD.O.A. 4/8/19 D.O.I. 6/8/19Survey held at CPGE (Loyang)

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

o/s B/L

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

check book entry
unrecorded to Reps
Recommend scrap.

RECEIVED 13 AUG 2019

Vehicle not safe to rep. Chassis ~~has~~ sustain heat damage.
exposed to high heat.
structural integrity affected.

Date/Time, File Pass to?

☐ : Preli. Report13/8/18 KLASS☐ : Final Report

Date/Time, File Return to?

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: ☐ : Site InspSurvey Fee: 450 x 11

Transportation: _____

L.S. + RS. \$1

Others: SCDF \$170.00
report

08/08/19

631

Nivitha (LKK Auto)

From: Gabriel Wee <Gabriel@iii.com.sg>
Sent: Tuesday, 6 August 2019 9:01 AM
To: 'sur@lkkauto.com'; Admin-D (LKKAuto)
Cc: Pooi Chin Han Daniel; Doris Lim Puay Noi
Subject: RE: (FIRE CASE) - MCT19080095 SHC2314X DOA: 04/08/2019

Dear Sir / Mdm,

Please conduct a survey on OD vehicle SHC2314X and let us have your report urgently.

This claim will be handled by Daniel.

*Kindly upload this survey request email to merimen.

Thank You.

Best Regards,
Gabriel Wee



64 Cecil Street; #05 - IOB Building
Singapore 049711
Tel: 6347 6100, Ext – 248

From: Doris Lim Puay Noi [mailto:doris_lim@cdgtaxi.com.sg]
Sent: Monday, August 05, 2019 5:06 PM
To: Pooi Chin Han Daniel <danielpooi@iii.com.sg>
Cc: Sundari Nagarajan - III <sundari@iii.com.sg>; Mekavathanan Sarangapani <mekavathanan@iii.com.sg>; Christine Tay Siew Hway <christine_tay@cdgtaxi.com.sg>; Lim Tien Siong <limts@cdge.com.sg>; Tan Pei Wei <tanpw@cdge.com.sg>; Roger How Keen Meng <rogerhow@cdge.com.sg>; Hannah Lim Mei Jiao <hannah_lim@cdgtaxi.com.sg>
Subject: (FIRE CASE) - MCT19080095 SHC2314X DOA: 04/08/2019
Importance: High

Dear Daniel

Pls assist to appoint surveyor for the above matter.

Taxi is grounded at 59 Loyang Drive.

Kindly contact Mr Lim@ 62148398 if you need any other information.

Thank you.

Regards
Doris Lim
Fleet Safety Department
Comfort Transportation Pte Ltd / Citycab Pte Ltd
Hotline: 6550 8768 / DID: 6550 8606 / Fax: 6453 0491

" Think Safety. Drive Safely."

This message and any attachments may contain confidential, privileged or proprietary information. If you are not the intended recipient, kindly notify us and delete this message and its attachments immediately, and please be advised that using, copying, distributing or disclosing any contents therein is not allowed. Statements pertaining to any matter outside our business are not to be taken as endorsed by ComfortDelGro Corporation Limited or its related companies. The comments/proposals provided are for discussion purposes only and are subject to approvals. Nothing herein shall constitute a binding agreement between the parties. Neither party shall be bound in any way to any term or condition except as agreed in a written agreement signed by the duly authorised representatives of both parties.

ComfortDelGro - a Green Office certified by the Singapore Environment Council - is committed to preserving the environment. We encourage you to print this only if necessary.

CityCab Pte Ltd Registration No. 199502839G

Comfort Transportation Pte Ltd [Registration No. 199303821R]

This email is intended solely for the person to whom it has been addressed. It may contain confidential and/or legally privileged information. If you are not the person for whom this e-mail was intended, or if this e-mail has reached you by mistake, please delete it immediately and inform us of the error and also be hereby notified that any use, distribution, transmission, printing, copying or dissemination of this information in any way or in any manner is strictly prohibited and may be unlawful. Internet communications may not be entirely secure or accurate as information could be intercepted, corrupted, lost, delayed or contain viruses. Therefore, we do not accept liability for any errors or omissions in the content of this message or any delay in delivery which may arise as a result of Internet transmission or any modification.



SINGAPORE CIVIL DEFENCE FORCE
91 UBI AVENUE 4
SINGAPORE 408827
TELEPHONE: 6280 0000
GST REG NO: MG-8400000-5

TAX INVOICE/RECEIPT

Name : DENISE TAY
Address : BLK 51 UBI 51 ubi ave 1 #01-25
#01-25
Singapore 408933

Receipt No : 5652449724046737003041
Date/Time : 08/08/2019 14:14
eService ID : FR2019080803573

| S/No | Payment Mode | Description | Reference No | Net Amount | GST (7% GST) | Gross Amount |
|------|--------------|-------------|-----------------|------------|--------------------------|-----------------|
| 1 | Credit Card | Fire Report | FR2019080803573 | 170.00 | 0.00 | 170.00 |
| | | | | | Total Amount (SGD) | 170.00 |

REMARKS:

Date and Time [04/08/2019 21:15] - Location of Fire [4015 ANG MO KIO INDUSTRIAL PARK 1]

Note: This is a computer generated receipt. No signature is required. Receipt is void if payment is dishonoured.

Fire Report Application

Your request for the Fire Report has been confirmed and the amount of SGD170.00 will be deducted from your account. You will receive the report within 8 working days upon completion of investigations. Please quote the following transaction number when making enquiries.

 Download Tax Invoice/Receipt

Transaction Number: FR2019080803573

Date/Time: 08/08/2019 14:14

| INCIDENT DETAILS | | | | | |
|--------------------------|--|---------------------|-------------|--------|-------------|
| Date and Time | 04/08/2019 21:15 | | | | |
| Location of Fire | 4015 ANG MO KIO INDUSTRIAL PARK 1 | | | | |
| Fire Involved | TAXI MOTOR CAR SHC2314X | | | | |
| REQUESTOR DETAILS | | | | | |
| Requestor Type | Insurance Companies | | | | |
| Requestor ID Type | Singapore Pink | Requestor ID | S8724548I | | |
| Name of Applicant | DENISE TAY | | | | |
| Company Name | LKK Auto Consultants Pte Ltd | | | | |
| Company UEN | | | | | |
| Company Reference Number | CS/III19013723/K1qd3 | | | | |
| CONTACT DETAILS | | | | | |
| Mode of Collection | Email | | | | |
| Main Contact No. | 62563561 | Office No. | | | |
| Handphone No. | | Fax No. | | | |
| Email Address | sur@lkkauto.com | | | | |
| Address | Block No. | BLK 51 UBI | Floor No. | 01 | Unit No. 25 |
| | Street Name | 51 ubi ave 1 #01-25 | | | |
| | Building Name | | Postal Code | 408933 | |
| PAYMENT DETAILS | | | | | |
| Payment Mode | Credit/Debit Card | | | | |
| EP Reference No. | 5652449724046737003041 | | | | |
| PSi Reference No. | b16ab3a7-94af-4f07-b120-b881e580feeb | | | | |
| Total Fees | SGD170.00 | | | | |

Denise Tay (LKKAuto)

From: Bryan Ang (LKKAuto)
Sent: Thursday, 8 August 2019 10:33 AM
To: Lalitha Krishnan - III; Shiau Chan (LKKAuto)
Cc: Mekavathanan Sarangapani; Pooi Chin Han Daniel; Gabriel Wee; SUR
Subject: RE: India Ref : MCT19080095 - Damage to IV SHC2314X by Fire on 4.8.2019

Dear Shiau Chan

Please close file and submit total loss report with the BV and LTA rebate etc.

Please also apply for the SCDF fire report.

Our ref: CS/III19013723/K1qd3

Best Regards,

Bryan Ang

LKK Auto Consultants Pte Ltd

phone: 6256-3561 | email: bryanang@lkkauto.com | fax: 6741-4108

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Lalitha Krishnan - III <lalitha@iii.com.sg>

Sent: Thursday, 8 August 2019 10:21 AM

To: Bryan Ang (LKKAuto) <bryanang@lkkauto.com>

Cc: Mekavathanan Sarangapani <mekavathanan@iii.com.sg>; Pooi Chin Han Daniel <danielpooi@iii.com.sg>; Gabriel Wee <Gabriel@iii.com.sg>

Subject: India Ref : MCT19080095 - Damage to IV SHC2314X by Fire on 4.8.2019

URGENT

Dear Bryan

We refer to the above matter.

We refer to your preliminary report on above vehicle and note that the vehicle is beyond economical repairs and also unsafe to repair vehicle as chassis has been exposed to high heat.

Please let us have following details on urgent basis.

1. SCDF report
2. Your final report
3. Age of vehicle
4. Salvage value of vehicle

Best Regards

Lalitha Krishnan

Motor Claims Department

India International Insurance Pte Ltd

64 Cecil Street, #04/#05 IOB Building, Singapore 049711

DID: 6347 6139 Fax: 6224 4174

Note: This document has not been finalised.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: India International Insurance Pte Ltd
64 Cecil Street
#04-00 IOB Building
Singapore 049711

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Pooi Chin Han Daniel

Date: 07 Aug 2019

Preliminary Advice

| | | | |
|--------------------|---|-------------------------|--------------|
| Vehicle No | : SHC2314X | Accident Date | : 04/08/2019 |
| Make | : HYUNDAI IONIQ HYBRID | Policy No. | : MCOM0015 |
| Assignment Date | : 06/08/2019 | Excess | : S\$0.00 |
| Date of Inspection | : 06/08/2019 | Est. Duration of Repair | : 8.00 |
| Inspection At | : COMFORTDELGRO ENGINEERING PTE LTD (LOYANG) 59 LOYANG DRIVE SINGAPORE 508969 | | |

Point of Impact / General Description of Damages

The vehicle sustained impact / damages o/s body and parts claimed are consistent to the accident.

| | | |
|-----------------------------|------|-----------|
| Repairer's Estimate (Gross) | :S\$ | 57,224.28 |
| Revised Amount | :S\$ | 12,314.04 |
| Check Items (Estimated) | :S\$ | 18,837.36 |
| Total | :S\$ | 31,151.40 |

| | | |
|-----------------|------|--|
| Lump Sum Repair | :S\$ | |
|-----------------|------|--|

Total Loss Consideration

| | | |
|-------------------|------|-----------|
| New for Old Value | :S\$ | |
| Book Value (est) | :S\$ | 66,310.02 |
| COE / PARF Rebate | :S\$ | 30,452.00 |
| Salvage Value | :S\$ | |
| Margin for Repair | :S\$ | 35,858.02 |

Remarks

- () The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- (X) The vehicle is unsafe to be repaired, chassis exposed to high heat. Structural integrity affected.
- () Other comments :

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

| Vehicle Owner Particulars | |
|---|--------------------------------------|
| Owner ID Type: | Company |
| Owner ID: | 821R |
| Vehicle Details | |
| Vehicle No.: | SHC2314X |
| Vehicle to be Exported: | No |
| Intended Deregistration Date: | 06 Aug 2019 |
| Vehicle Make: | HYUNDAI |
| Vehicle Model: | AE IONIQ HEV 1.6 DCT |
| Primary Colour: | Blue |
| Manufacturing Year: | 2018 |
| Engine No.: | G4LEJU112152 |
| Chassis No.: | KMHC851CVKU115220 |
| Maximum Power Output: | 103.6 kW (138 bhp) |
| Open Market Value: | \$24,937.00 |
| Original Registration Date: | 08 Nov 2018 |
| First Registration Date: | 08 Nov 2018 |
| Transfer Count: | 0 |
| Actual ARF Paid: | \$11,912.00 |
| Intended PARF Rebate Details | |
| PARF Eligibility: | Yes |
| PARF Eligibility Expiry Date: | 07 Nov 2026 |
| PARF Rebate Amount: | \$8,934.00 |
| Intended COE Rebate Details | |
| COE Expiry Date: | 07 Nov 2026 |
| COE Category: | A - Car up to 1600cc & 97kW (130bhp) |
| COE Period(Years): | 8 |
| PQP Paid: | \$23,736.00 |
| COE Rebate Amount: | \$21,518.00 |
| Total Rebate Amount: | \$30,452.00 |
| Message | |
| Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier. | |

The information contained herein is correct as at 06 Aug 2019

OK

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle****Vehicle Owner Particulars**

| | |
|----------------|---------|
| Owner ID Type: | Company |
| Owner ID: | 821R |

Vehicle Details

| | |
|-------------------------------|----------------------|
| Vehicle No.: | SHC2314X |
| Vehicle to be Exported: | Yes |
| Intended Deregistration Date: | 06 Aug 2019 |
| Vehicle Make: | HYUNDAI |
| Vehicle Model: | AE IONIQ HEV 1.6 DCT |
| Primary Colour: | Blue |
| Manufacturing Year: | 2018 |
| Engine No.: | G4LEJU112152 |
| Chassis No.: | KMHC851CVKU115220 |
| Maximum Power Output: | 103.6 kW (138 bhp) |
| Open Market Value: | \$24,937.00 |
| Original Registration Date: | 08 Nov 2018 |
| First Registration Date: | 08 Nov 2018 |
| Transfer Count: | 0 |
| Actual ARF Paid: | \$11,912.00 |

Intended PARF Rebate Details

| | |
|-------------------------------|-------------|
| PARF Eligibility: | Yes |
| PARF Eligibility Expiry Date: | 07 Nov 2026 |
| PARF Rebate Amount: | \$8,934.00 |

Intended COE Rebate Details

| | |
|-----------------------------|--------------------------------------|
| COE Expiry Date: | 07 Nov 2026 |
| COE Category: | A - Car up to 1600cc & 97kW (130bhp) |
| COE Period(Years): | 8 |
| PQP Paid: | \$23,736.00 |
| COE Rebate Amount: | \$18,988.00 |
| Total Rebate Amount: | \$27,922.00 |

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 06 Aug 2019

OK

SHC 2314X

$$\textcircled{1} \text{ Cost of taxi} = 71235.26$$

$$\text{AKF 75\%} = 18702.75$$

$$\text{Depreciation} = (71235.26 - 18702.75) \div 96$$
$$= 547.21$$

$$\textcircled{2} \text{ Book value} = (547.21 \times 87) + 18702.75$$
$$= 66310.02$$

$$\textcircled{3} \text{ Net value} = 66310.02 - 27922$$
$$= \$38388.02$$

Comfort Transportation PL
Vehicle INV for Fleet Safety Division
AS AT 31.07.2019

| | | |
|----------------|---|----------------------|
| Co. Code | : | CTPL |
| Licence Pl. No | : | SEK2314X |
| Old Asset. No | : | |
| Vel. Model | : | Hyundai Ioniq Hybrid |
| Reg. Date | : | 08.11.2018 |
| Cap. Date | : | 08.11.2018 |
| Accident. Date | : | 04.08.2019 |
| Web. Age | : | 009 |

| | |
|----------------|----------------------|
| Model | Hyundai Ioniq Hybrid |
| Reg. Date | 08.11.2018 |
| Cap. Date | 08.11.2018 |
| Accident. Date | 04.08.2019 |
| Web. Age | 009 |

| Asset No | PA No | Bal. Dep. Mths | Per. Mth. Dep | Bal. Dep. Value | Asset Description 1 | Cost | Up. Acc. Dep | Cur. Year Dep | Accum. Dep | Net Book Value | Scrap value/Estimated P&H Refund |
|-------------|-------|----------------|---------------|-----------------|---|-----------|--------------|---------------|------------|----------------|----------------------------------|
| | | | \$ | \$ | | \$ | \$ | \$ | \$ | \$ | \$ |
| 12073000 | 0 | 081 | 337.54 | 27,340.74 | SH2314X H1H 08.11.2018 BASIC QEST W AIRGUN | 30,380.00 | 686.20- | 2,363.93- | 3,048.13- | 27,331.87 | 1.00 |
| 12073000 | 1 | 081 | 55.41 | 4,468.21 | SH2314X H1H 08.11.2018 INKJET DUTY 200MM/524937 | 4,987.26 | 110.83- | 387.90- | 498.73- | 4,488.53 | 0.00 |
| 12073000 | 2 | 081 | 52.94 | 4,288.14 | SH2314X H1H 08.11.2018 AFP X80WS24937-CENSS15K | 11,912.00 | 105.89- | 379.61- | 476.50- | 11,435.50 | 7,147.00 |
| 12073000 | 3 | 081 | 263.73 | 21,362.13 | SH2314X H1H 08.11.2018 QES 803 | 23,736.00 | 527.47- | 1,846.13- | 2,373.60- | 21,362.40 | 0.00 |
| 10073000 | 4 | 000 | 0.00 | 0.00 | SH2314X H1H 08.11.2018 QES TUP TUP | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 12073000 | 5 | 081 | 0.00 | 0.00 | SH2314X H1H 08.11.2018 AIR CONDITIONER | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 12073000 | 6 | 081 | 0.00 | 0.00 | SH2314X H1H 08.11.2018 PRINTER DIGITAL THERMAL | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 10073000 | 7 | 081 | 0.00 | 0.00 | SH2314X H1H 08.11.2018 TACHIMETER DIGITAL F1 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 12073000 | 8 | 081 | 2.44 | 197.64 | SH2314X H1H 08.11.2018 VEH 903 FEE | 220.00 | 4.89- | 17.11- | 22.00- | 198.00 | 0.00 |
| | | | 712.06 | 57,676.86 | | 71,235.26 | 1,435.28- | 4,983.58- | 6,418.96- | 64,816.30 | |
| COE Vehicle | | | 263.73 | 21,362.13 | Vehicle : Without T/M & COE | 47,499.26 | 907.81- | 3,137.55- | 4,045.36- | 43,453.90 | |
| | | | 448.33 | 36,314.73 | Vehicle : Without T/M With COE Tachimeter | 71,235.26 | 1,435.28- | 4,983.58- | 6,418.96- | 64,816.30 | |
| | | | 712.06 | 57,676.86 | | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | |

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

| | |
|----------------------------|-----------------------------------|
| Date Of Report | 05/08/2019 15:53 |
| Date Of Accident | 04/08/2019 21:15 |
| Exact Location Of Accident | 4015 ANG MO KIO INDUSTRIAL PARK 1 |
| Country/State of Loss | SINGAPORE |

DETAILS OF OWN VEHICLE

| | |
|-----------------------------|--------------------------------|
| Vehicle Registration Number | SHC2314X |
| Insured/Policyholder | |
| Name Of Registered Owner | COMFORT TRANSPORTATION PTE LTD |
| Co Reg No | 199303821R |
| Email Address | FLEETSAFETY@CDGTAXI.COM.SG |
| Mobile Phone No | |
| Alternative Phone No | OFFICE-65508768 |

Vehicle Particulars

| | |
|--------------|---------|
| Manufacturer | HYUNDAI |
| Model | IONIQ |

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? YES

If No, Please state action to be taken

| | |
|------------------|------|
| Vehicle Category | TAXI |
|------------------|------|

Insurance Company

| | |
|---------------------------|---------------------------------------|
| Name of Insurance Company | INDIA INTERNATIONAL INSURANCE PTE LTD |
| Type Of Coverage | THIRD PARTY FIRE AND/OR THEFT |
| Fleet Policy | YES |
| Policy Number | MCOM0015 |
| Cover Note Number | |

Driver

| | |
|----------------------|-----------------------|
| Name of Driver | TEO CHIU PENG |
| NRIC No | S1822403H |
| Date Of Birth | 02/02/1967 |
| Occupation | OUTDOOR |
| Date Of Driving Pass | 08/07/1987 |
| Driving Experience | 32 YEARS AND 0 MONTHS |
| Gender | MALE |
| Mobile Number | (LOCAL) +65-91130618 |
| Fax Number | |
| Contact Number | |
| EMail Address | NOEMAIL |

| | |
|---|---------------------------------------|
| Address | BLK 419 ANG MO KIO AVENUE 10 #03-1085 |
| Postcode | 560419 |
| Was driver an employee of the Insured's Company | NO |
| If No, Relationship of the Driver with the Insured | OTHER - TAXI DRIVER |
| Vehicle Registration Number of Driver's Own Vehicle | - |
| | - |
| | - |
| Insurance Company of Driver's Own Vehicle | - |
| | - |
| | - |

General Information of the Accident

| | |
|--------------------|------------------------------|
| Type Of Accident | FIRE, EXPLOSION OR LIGHTNING |
| Weather Conditions | CLEAR |
| Road Surface | DRY |

Other Information

| | |
|---|----|
| Was any foreign vehicle involved in this accident? | NO |
| Number of vehicles (including own vehicle) involved in the accident | 1 |
| Was any body injured in the Accident? | NO |
| Was any injured conveyed to hospital by ambulance? | |
| Was any other material or property damaged? | NO |
| I have been approached by unknown person(s) soliciting/offering accident claims assistance. | NO |
| Number of Passengers (Including Driver) | 0 |

Details of Police Action

| | |
|---|--------------|
| Was the accident reported to the police? | YES |
| If Yes, Please state which Police Station | |
| POLICE STATION NAME [OTHER] | ROCHOR N.P.C |
| Was notice of intended Prosecution given? | NO |
| If Yes, against whom? | |

Circumstances of Accident

PLS REFER TO ATTACHED / POLICE REPORT : A/20190805/2006

Attachment(s)

| | |
|---|-----|
| Are accident photos available for attachment? | YES |
| Was there any video captured by Car Camera? | YES |
| Remarks/ Reasons: | - |
| Was there any audio recorded? | NO |

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all Insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all Insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


COMFORT TRANSPORTATION PTE LTD
CO. REG. NO. 199303821R

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/PIN No.:

SKETCH PLAN

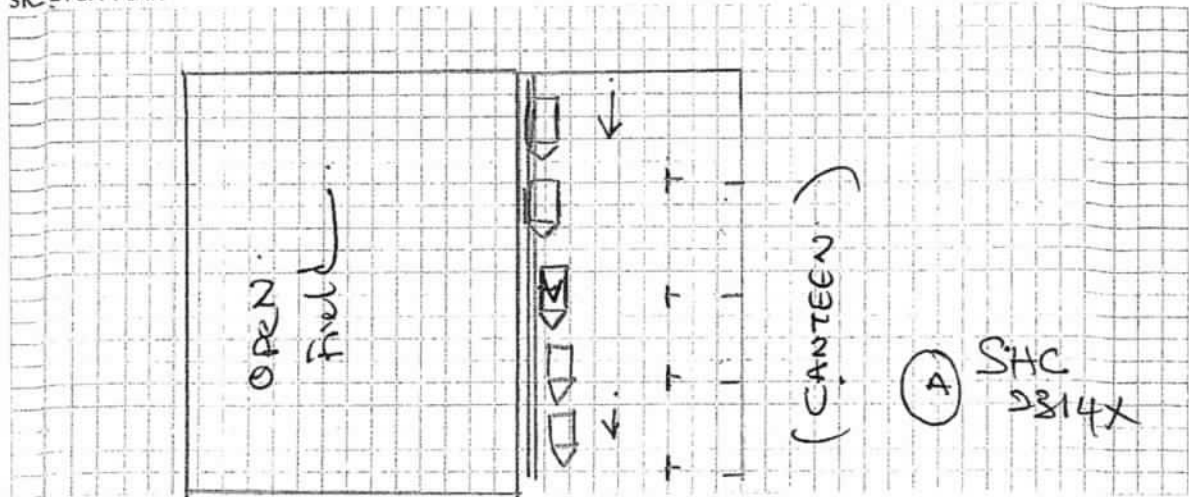

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Refer to police

Report A/20190805/2006

DECLARATION

I/We declare the foregoing particulars are true in every respect.

COMFORT TRANSPORTATION PTE LTD
CO. REG. NO. 199303821R

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:



**SINGAPORE
POLICE FORCE**



A/20190805/2006

1 of 2

POLICE REPORT (NP299)

Report No. A/20190805/2006

Police Station Of Origin
Rochor N.P.C
11 Kampong Kapur Road SINGAPORE
208678
Tel No: 1800-2949999


| | | |
|--|--|-------------------------|
| Date/Time Report Made 05/08/2019 03:51 | Vide Report No. F/20190803/0228 | Station Diary No. 14 |
| Name Of Informant TEO CHIU PENG | Address APT BLK 419 ANG MO KIO AVENUE 10 #03-1085 SINGAPORE 560419 | |
| ID Type / ID No. NRIC NO / S1822403H | Contact No. Home/Office Mobile 91130618 | |
| Nationality SINGAPORE CITIZEN | Email Address | |
| Occupation TAXI DRIVER | Sex Male | Age 52 |
| Institution/School Name | Date of Birth 02/02/1967 | Race Chinese |
| | Language | |
| Date/Time Of Incident 04/08/2019 21:15 - 04/08/2019 21:30 | Location Of Incident 4015 ANG MO KIO INDUSTRIAL PARK 1 ANG MO KIO INDUSTRIAL PARK 1 SINGAPORE 569631 | |

Brief details.

On 04/08/2019 at about 21:15hrs, I parked my blue Comfort Taxi bearing registration plate number: SHC 2314X along the double yellow lines of Ang Mo Kio Industrial Park 1 and proceeded to the canteen for my dinner. While having my dinner, I heard someone shouting Taxi on fire. As such I proceeded to make check and discovered the front right portion of my Taxi burnt. The fire was already been put out. The Fire fighters and Police Officers attended to my incident. The report number is: F/20190803/0228. As such I am lodging this Police report as required by my Taxi company. That is all.

| | |
|---|--------------------------------|
| Signature Of Officer Recording The Report: A / Staff Sgt ALVIN SHAM THEYOPHOLOUS | Signature Of Informant: |
| Signature Of Interpreter: Not applicable | Date/Time: 05/08/2019 03:51 |
| Officer In-Charge Of Case: SPF, ANG MO KIO POLICE DIVISION IO LIM THIAN LENG Contact No.: 62180000 | Classification Of Case: |

Authentication Stamp

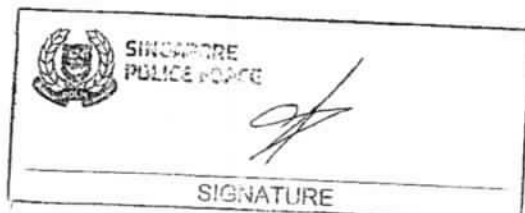



**SINGAPORE
POLICE FORCE**





A/20190805/2006

2 of 2

POLICE REPORT (NP299)

CONTINUATION OF REPORT

Report No. A/20190805/2006

| | |
|---|---|
| Signature Of Officer Recording The Report: A / Staff Sgt ALVIN SHAM THEYOPHOLOUS  | Signature Of Informant:  |
| Signature Of Interpreter: Not applicable | Date/Time: 05/08/2019 03:51 |
| Officer In-Charge Of Case: SPF, ANG MO KIO POLICE DIVISION IO LIM THIAN LENG Contact No.: 62180000 | Classification Of Case: |

Authentication Stamp



Team: ARC Repair OD(CLSO)1

JOB CARD

Sales Order:

JC NO.: 305322751


| | | |
|----------------------------|--------------------------------|-------------------------------|
| CUSTOMER | REGN NO.: SHC2314X | MILEAGE |
| 3/MS | MAKE: HYUNDAI | FUEL |
| CUSTOMER NO. 7010045 | MODEL: IONIQ(G2) | E.....1/2.....F |
| ADDRESS 383 SIN MING DRIVE | YR OF MANU. 08.11.2018 | DATE/TIME IN 04.08.2019 21:15 |
| Singapore SINGAPORE 575717 | CHASSIS CODE KMHC851CVKU115220 | TARGET DATE |
| 65508755 (O) | | COMPLETION DATE/TIME: |
| L (R) (P) | | |
| SCOUNT CARD NO. | | |

JOB DESCRIPTION

Accident Date: 04.08.2019

NATURE: OD 04.08.19 **FIRE CASE**

S/NO LABOR CODE DESCRIPTION

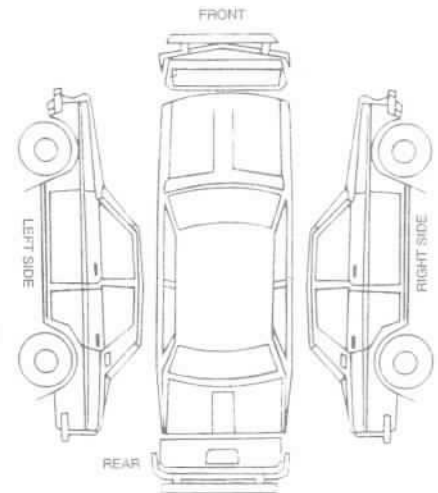

CHECKED & PASSED OUT BY:

SERVICE ADVISOR

CUSTOMER'S SIGNATURE

Acknowledgement Slip

Exit Pass

Vehicle No.: SHC2314X
LIMTS

Vehicle No.: SHC2314X

Signature of Service Advisor

Signature/Date

Name of Service Advisor

Date

Vehicle returned to Service Reception upon collection

To be kept by Security Guard

COMFORTDELGRO ENGINEERING PTE LTD

REPAIR ESTIMATE*

FIRE CASE

VEHICLE NO : SHC 2314X

DATE 5/8/2019

MAKE :

LKK-

Page 1/2

MODEL : HYUNDAI IONIQ

| Qty | Parts Description/ Labour | Type | Unit Price | Amount |
|-----|--|------|------------|-------------|
| | Bonnet ✓ | | | \$ 2,253.80 |
| | Bonnet Rubber (RH) ✓ | | | \$ 12.40 |
| | Bonnet Hinge (RH) ✓ | | | \$ 118.70 |
| | Front Fender (RH) ✓ | | | \$ 490.70 |
| | Front Fender Apron Panel (RH) X repair | | | \$ 756.20 |
| | Front Fender Apron Panel Upper (RH) X repair | | | \$ 129.60 |
| | Front Fender Shield (RH) ✓ | | | \$ 114.70 |
| | Front Fender Retainer ? | | | \$ 41.40 |
| | Emblem-Blue Drive (RH) ✓ | | | \$ 26.60 |
| | Front Door (RH) ✓ | | | \$ 1,797.20 |
| | Front Door Rubber ✓ | | | \$ 250.00 |
| | Front Door Glass (RH) ✓ | | | \$ 215.20 |
| | Front Door Gear / Regulator (RH) ? | | | \$ 250.40 |
| | Front Door Hinge Upper (RH) ? | | | \$ 41.10 |
| | Front Door Hinge Lower (RH) ? | | | \$ 41.10 |
| | Front Door Check (RH) ? | | | \$ 45.60 |
| | Front Door Inner Lock (RH) ? | | | \$ 191.50 |
| | Front Door Key Lock Set (RH) ? | | | \$ 141.00 |
| | Front Door Outer Handle (RH) ✓ | | | \$ 78.00 |
| | Front Door Outer Moulding (RH) ✓ | | | \$ 110.10 |
| | Front Door Mirror RH) ✓ | | | \$ 1,054.60 |
| | Front Door Power Motor, RH ? | | | \$ 289.20 |
| | Front Door Trim Board (RH) ? | | | \$ 498.00 |
| | Front Door Protector (RH) ✓ | | | \$ 116.20 |
| | Door Centre Pillar Outer (RH) X repair | | | \$ 3,764.90 |
| | Door Centre Pillar Inner X repair | | | \$ 503.20 |
| | Rocker Panel Inner (RH) X repair | | | \$ 227.50 |
| | Rocker Panel Outer Garnish ✓ | | | \$ 290.00 |
| | Rocker Panel Outer X repair | | | \$ 1,799.60 |
| | Rear Door (RH) ✓ | | | \$ 1,789.90 |
| | Rear Door Rubber (RH) ✓ | | | \$ 280.00 |
| | Rear Door Glass (RH) ✓ | | | \$ 190.20 |
| | Rear Door 1/4 Glass (RH) ✓ | | | \$ 71.00 |
| | Rear Door Outer Moulding (RH) ✓ | | | \$ 77.10 |
| | Rear Door Inner Handle (RH) ✓ | | | \$ 78.00 |
| | Rear Door Outer Handle (RH) ✓ | | | \$ 78.00 |
| | Rear Door Gear / Regulator (RH) ? | | | \$ 229.90 |
| | Rear Door Motor (RH) ? | | | \$ 160.50 |
| | Rear Door Lock Assy ? | | | \$ 191.50 |
| | Rear Door Hinge Upper (RH) ? | | | \$ 45.90 |
| | Rear Door Hinge Lower (RH) ? | | | \$ 45.90 |
| | Rear Door Check (RH) ? | | | \$ 53.70 |
| | Rear Door Trim Board (RH) ? | | | \$ 613.60 |
| | Rear Door Protector (RH) ✓ | | | \$ 116.20 |
| | Front Windscreen Glass ✓ | | | \$ 1,558.10 |
| | Front Windscreen Moulding ✓ | | | \$ 57.30 |
| | Front Windscreen Pillar Outer(RH) X repair | | | \$ 3,764.90 |

| Qty | Parts Description/ Labour | Type | Unit Price | Amount | |
|-----|---|---------------------------|------------|---------------------|-------------|
| | Front Windscreen Pillar Inner(RH) <i>x repair</i> | | | \$ 310.70 | |
| | Wiper Panel Top Garnish <i>/</i> | | | \$ 181.20 | |
| | Wiper Link <i>/</i> | | | \$ 224.00 | |
| | Wiper Container <i>/</i> | | | \$ 68.00 | |
| | Wiper Container Motor <i>?</i> | | | \$ 78.00 | |
| | Front Wheel Rim (RH) <i>?</i> | | | \$ 1,124.20 | |
| | Front Wheel Hub Cap (RH) <i>/</i> | | | \$ 346.40 | |
| | Front Wheel Bearing <i>x</i> | | | \$ 454.00 | |
| | Front Shock Absorber (Assy) (RH) <i>?</i> | | | \$ 372.50 | |
| | Front Shock Absorber Mounting (RH) <i>?</i> | | | \$ 126.90 | |
| | Front Drive Shaft (RH) <i>x</i> | | | \$ 936.70 | |
| | Rack & Pinion Assy <i>?</i> | | | \$ 887.40 | |
| | STG Tie Rod <i>x</i> | | | \$ 94.70 | |
| | STG Tie End <i>x</i> | | | \$ 91.50 | |
| | Stabilizer Bar <i>x</i> | | | \$ 246.80 | |
| | Stabilizer Bar Bush (RH) <i>?</i> | | | \$ 22.30 | |
| | Stabilizer Bar Link <i>x</i> | | | \$ 92.10 | |
| | Front Suspension Lower Arm (RH) <i>x</i> | | | \$ 296.80 | |
| | Front Chasis Member (RH) <i>x</i> | | | \$ 1,314.80 | |
| | Knuckle Arm (RH) <i>x</i> | | | \$ 363.60 | |
| | Roof Moulding <i>/</i> | | | \$ 71.20 | |
| | SUB TOTAL | | | \$ 32,754.00 | |
| | LESS 20% | | | \$ 6,550.80 | |
| | DISCOUNTED TOTAL | | | \$ 26,203.20 | |
| | Front Door Comfort Logo (RH) <i>/</i> | | | \$ 75.00 | Nett |
| | Rear Door Advertisement Logo (RH) <i>/</i> | | | \$ 100.00 | Nett |
| | Rear Door Comfort & Apps Sticker (RH) <i>/</i> | | | \$ 80.00 | Nett |
| | Front Windscreen Sealant <i>/</i> | | | \$ 46.00 | Nett |
| | Front ERP Sticker <i>/</i> | | | \$ 30.00 | Nett |
| | Front Tyre (RH) <i>/</i> <i>70%</i> | | | \$ 216.00 | Nett |
| | | | | \$ 547.00 | |
| | Labour Charge | | | | |
| | Panel Beating | <i>Not Author</i> | | \$ 2,200.00 | <i>600</i> |
| | Spray Painting Charge | <i>To Repair</i> | | \$ 1,600.00 | <i>1400</i> |
| | Wiring Charge | <i>Kaluh (K/K)</i> | | \$ 50.00 | <i>20</i> |
| | Tuff Kote | <i>M</i> | | \$ 50.00 | <i>20</i> |
| | Towing Charge | <i>6/8/19 1030h</i> | | \$ 90.00 | <i>?</i> |
| | Front Chassis Alignment Charge | <i>8 Days</i> | | \$ 400.00 | <i>x</i> |
| | Transfer of Door | <i>PIP</i> | \$ 120.00 | \$ 240.00 | <i>100</i> |
| | Remove/Refix Undercarriage (FRT) | <i>Before Paint p Ltr</i> | | \$ 400.00 | <i>x</i> |
| | Frt Wheel Alignment | <i>Excess - To repair</i> | | \$ 120.00 | <i>x</i> |
| | Diagnostic & Resetting To Erase Fault Code | <i>Excess - To repair</i> | | \$ 480.00 | <i>x</i> |
| | <i>Subject to supplementary estimate Chadden parts and with labor charges</i> | <i>Book value</i> | | \$ 5,630.00 | |
| | TOTAL LABOUR | | | | |
| | ESTIMATE TOTAL | | | \$ 32,380.20 | |

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company. 57224.28

TS

LRK-Kalvin.

DATE 6/8/2019 15:19

MODEL : HYUNDAI IONIQ

Kahr 10/12/19

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.





































...CLAIM SUBFOLDER...(Pending for Survey Report)



















































| CLAIM SUBFOLDER TRACKING | | | | | | | |
|--------------------------|---|---------------|---|--|--|-------------|---|
| Case | Notified | Est Submitted | Adj Assigned | Adj Rpt | Adj Submitted | Ins Auth'ed | Status |
| Main | 07 Aug 2019 Edit Reg | | 06 Aug 2019 00:00 Edit Adj Rpt | S\$0.00 Edit Estimates | S\$0.00 View Rpt | | Pending for Survey Report Cancel Case |

| Main | Reference | Claim Details | Documents | Show All | | | | | |
|---|--|------------------------|---|----------|---------|-------------|--------------|------------|-------|
| CLAIM SUBFOLDER DETAILS [Created by adjuster] | | | | | | | | | |
| Insured: | COMFORT TRANSPORTATION PTE LTD, Co. Reg. No.: 199303821R | | | | | | | | |
| Vehicle Reg. No.: | SHC2314X | Date of Loss: | 04/08/2019 21:00 - :59 [8 Months and 27 Days From LTA Reg Date (Man Yr)] | | | | | | |
| Claim Type: | OD / MCT19080095 | Policy/Cover Note No.: | MCOM0015 (Comprehensive) | | | | | | |
| | | Excess: | | | | | | | |
| Repairer: | ComfortDelGro Engineering Pte Ltd (Loyang) 59 Loyang Drive, 508969 Loyang - Tel: 6214 8300 | | | | | | | | |
| Handling Insurer: | India International Insurance Pte Ltd (HQ) - Tel: 63476100 ... [Handled by Pooi Chin Han Daniel] | | | | | | | | |
| Adjuster: | LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by KALVIN ANG WEI KUN] ... [Final Rpt due 19/08/2019] | | | | | | | | |
| ASSOCIATED MAIL RECEIVED View All Compose Case Mail | | | | | | | | | |
| <ul style="list-style-type: none"> III_SG (07/08/2019): Alert - Adj Mandate Maintained - SHC2314X - Claim Handler: Pooi Chin Han Daniel | | | | | | | | | |
| ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete | | | | | | | | | |
| Due Date | Priority | Type | Task Group | Subject | Handler | Assigned By | Completed On | Created On | Done? |
| No results. | | | | | | | | | |

Claim Documents

*SHC2314X (MCT19080095)
 OD
 Aug 4 2019 9:00PM
 [COMFORT TRANSPORTATION PTE LTD]
 ComfortDelGro Engineering Pte Ltd

| Upload Documents Upload Photos Compose New Letter | | | View View In Browser | |
|---|-----------------|-----------------------------------|--|-------------------------------------|
| Assessment Reports | | | 1 per page | <input checked="" type="checkbox"/> |
| No | Finalized On | LKK Auto Consultants Pte Ltd (HQ) | Thumbnail | Print |
| 1 | 07/08/19 13:29 | Adjuster Immediate Advice |  Load HTM | <input checked="" type="checkbox"/> |
| Photos/Images | | | 3 per page | <input checked="" type="checkbox"/> |
| No | Relabel/Reorder | LKK Auto Consultants Pte Ltd (HQ) | Thumbnail | Print |
| 1 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 2 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 3 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 4 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 5 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 6 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 7 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 8 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 9 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 10 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 11 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 12 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 13 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 14 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 15 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 16 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 17 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 18 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 19 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 20 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 21 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 22 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 23 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 24 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 25 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 26 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 27 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 28 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 29 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 30 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 31 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 32 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 33 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 34 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 35 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |

| Assessment Reports | | | 1 per page | <input checked="" type="checkbox"/> |
|--------------------|----------------|-----------------------------------|--|-------------------------------------|
| No | Finalized On | LKK Auto Consultants Pte Ltd (HQ) | Thumbnail | Print |
| 36 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 37 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 38 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 39 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 40 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 41 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 42 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 43 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 44 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 45 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 46 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 47 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 48 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 49 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 50 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 51 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 52 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 53 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 54 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 55 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 56 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 57 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 58 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 59 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 60 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 61 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 62 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 63 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 64 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 65 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 66 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 67 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 68 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 69 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 70 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 71 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 72 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 73 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 74 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 75 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 76 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 77 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 78 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 79 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 80 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 81 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 82 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 83 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 84 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |
| 85 | 07/08/19 09:27 | General View |  Load JPG | <input checked="" type="checkbox"/> |

| Assessment Reports | | | 1 per page | <input checked="" type="checkbox"/> |
|--------------------|-----------------|--|------------|--|
| No | Finalized On | LKK Auto Consultants Pte Ltd (HQ) | | Thumbnail Print |
| 86 | 07/08/19 09:27 | General View | | Load JPG <input checked="" type="checkbox"/> |
| 87 | 07/08/19 09:27 | General View | | Load JPG <input checked="" type="checkbox"/> |
| 88 | 07/08/19 09:27 | General View | | Load JPG <input checked="" type="checkbox"/> |
| 89 | 07/08/19 09:27 | General View | | Load JPG <input checked="" type="checkbox"/> |
| 90 | 07/08/19 09:27 | General View | | Load JPG <input checked="" type="checkbox"/> |
| 91 | 07/08/19 09:27 | General View | | Load JPG <input checked="" type="checkbox"/> |
| 92 | 07/08/19 09:27 | General View | | Load JPG <input checked="" type="checkbox"/> |
| Documentation | | | 1 per page | <input checked="" type="checkbox"/> |
| No | Relabel/Reorder | LKK Auto Consultants Pte Ltd (HQ) | | Thumbnail Print |
| 1 | 14/08/19 10:09 | Fire Report | | Load PDF |
| No | Finalized On | India International Insurance Pte Ltd (HQ) | | Thumbnail Print |
| 1 | 07/08/19 08:45 | Singapore Accident Statement | | Load PDF |

Documents Checklist

| DOCUMENTS CHECKLIST | | Reset | Save | Print |
|--|--|-------|------|-------|
| There are no document checklists configured. | | | | |
| Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) <div style="border: 1px solid black; height: 40px; margin-top: 5px;"></div> | | | | |
| Show Remarks To: <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small> | | | | |

LKK Auto Consultants Pte Ltd (Co. Reg. No: 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

India International Insurance Pte Ltd
64 Cecil Street, #04-00 IOB Building
Singapore 049711

Our File No: CS/III19013723/K1QD3E2

Date: 14/08/2019

REFERENCE

Insured/Claimant: COMFORT TRANSPORTATION PTE LTD Policy No: MCOM0015
Date of Loss: 04/08/2019 Nature of Claim: OD Claim No: MCT19080095

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SHC2314X**
Make & Model: HYUNDAI IONIQ HYBRID, 1.6 GLS DCT (A) Engine No: G4LEJU112152
Reg. Date: 08/11/2018 (Man. Year: 2018) Chassis No: KMHC851CVKU115220
Colour: Blue Odometer: 103857 km
Engine Capacity: 1580 cc
Market Value/New Car Price: S\$66,310.02
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 195/65 R15 Rear Tyre Size: 195/65 R15
Front Left Side: DURATURN 8 mm Rear Left Side: DURATURN 8 mm
Front Right Side: DURATURN 8 mm Rear Right Side: DURATURN 8 mm

The above values represent the remaining tyre treads depth

| COST OF CLAIMS | Repairer's | Adjuster's | Difference | Diff % |
|--------------------------|-------------|-------------|-------------|--------|
| Parts | 0.00 | 0.00 | 0.00 | |
| Miscellaneous Items | 0.00 | 0.00 | 0.00 | |
| Labour | 0.00 | 0.00 | 0.00 | |
| Paintwork Labour | 0.00 | 0.00 | 0.00 | |
| Towing | 0.00 | 0.00 | 0.00 | |
| Nett Amount (S\$) | 0.00 | 0.00 | 0.00 | |

INSPECTION

Date of Assignment: 06/08/2019

Date Inspected: 06/08/2019 Inspected At:

ComfortDelGro Engineering Pte Ltd
(Loyang)
59 Loyang Drive
Singapore 508969

Estimated Period of Repair: 0.0 days

Adjuster: KALVIN ANG WEI KUN

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

TOTAL LOSS ASPECT

| | |
|----------------------------|-------------|
| Book Value (est) : | \$66,310.02 |
| OMV : | \$24,937.00 |
| PARF Rebate (1) : | \$ 8,934.00 |
| Quota Premium Paid : | \$23,736.00 |
| COE Rebate (2) : | \$21,518.00 |
| Total Rebate (1) + (2) = : | \$30,452.00 |

The total amount incurred will be Book Value (est) \$66,310.02 minus Total Rebate \$30,452.00 = \$35,858.02 before excess.

In view of the above, the vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.

REPAIR DETAILS

| | |
|---|--|
| Reference | |
| Part Source: MRM-SG | Version: 1.0 (Last Synchronised: 14 Aug 2019) |
| Parts: 192 | HYUNDAI IONIQ HYBRID 1.6 GLS DCT (A) (Catalogue:Merimen Singapore 1.0) |
| Labour: Repairer's | (Price-denominated Standard List) |
| Print Code: | (Unsubmitted, no print-code for SHC2314X) |
| Validity: | These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page |
| Further Info: Items/values not in reference catalogue are prefixed with an asterisk *. | |

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

| |
|---|
| Report was unsubmitted during this print-out. |
|---|

< END OF ESTIMATES >