

22/02/2011

ASS. REC. BY:

REF: 08/AG/19018791/44d352

Special Instruction:

Surveyor: Marcus

ASSIGNMENT (Office)

From (Person): Hor Yinnul

of

AIG

Date/Time:

24/10/2019 @ 9:50am

Estimated Cost:

Bill to:

CD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SLQ 1764R

Insured:

SMG 88334

at Workshop m/s

Alpha Car

Tel:

6509 8258

of

1 Kaki Bukit Ave 6 # 01-54 Autobay

Policy No:

Claim No:

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

19/10/2019

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

0300am @ 24/10/19

Person Contacted:

Ceiling

Vehicle IN/OUT

Date/Time

Action/Instruction

Isling (✓)

Heiden
AK

ASS. REC. BY:

marcus

REF:

AIW/
ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

SLQ1764R

at Workshop m/s

AFL

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value:

70k.

IDAC Accident Rpt:

Consistent? : Yes or No

SLA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

4

days

Res.:

Yes or No

Lum Sum:

20

%

3 Val.:

Yes or No

CA / REV / REP. / 24 HRS

LTA 44891

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No:

SLQ1764R

Yr Regn:

6.17

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

CA /

Make:

Nissan Qashqai

197

Colour:

Grey

A/C: Insured / Std / NI / NA

Sp. Reading

21348

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

SJNFEA11U2008850

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F: 215/60R17

R:

BS / DUN / EXNOVA / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

6

Rear

6

R/Bal.

mm

R/Bal.

mm

L/Bal.

mm

L/Bal.

mm

D.O.A.

19/10/18

D.O.A.

24/10/18

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Acc-

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

larger case onely estimate.

26/12/19 confirmed w/s @ 1700 with Boss. (Red \$13112-13,88%)

RECEIVED 30 DEC 2019

Date/Time, File Pass to?

☐

Prel. Report

1)

☐

Final Report

Date/Time, File Return to?

2) 30/12/19 Typist

Days Of Repair:

4

Resurvey No. of Trip:

3

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech. Invs (\$

☐

Woolend (\$

Survey Fee:

250

Transportation:

\$ + RS. \$

Photos

Others:

TOTAL

Report Form:

Comp Sum / LBD: \$1700/-

PRE-REPAIR INSPECTION REQUEST – SLQ1764R vs SMG8833U (OI) on D.O.A.: 19/10/2019

From: Hor, Yinrul
To: 'assignments@lkkauto.com', Admin A (admin-a@lkkauto.com)
Cc: Fong, Andy-SY, Fan, Winnie-LW, Abu Kassim, Noor Mariesa, Azlan, Syazairdina, Chan, Yoke Shi, Lim, Sheng Yang, Mithoosingh, Aashweenjeetkaur, Parthiban, Theerthan, Subramaniam, Divyashni
Sent: 10/24/2019 9:50:48 AM

Hi,

Please refer to the enclosed request from **Allister Lim & Thrumurgan**.
Kindly carry out Policy coverage verification first before conducting the pre-repair inspection within 48 hours

If you have any queries/concerns, please let us know.
Kindly assist to assign **Marcus Chua** as Single Joint Expert as requested.

Thanks & Regards,

Hor Yin Rul (Viviane)
AtG
FNOL Adjuster I
Singapore FNOL | Claims Operations – Auto

Tel: 8001206556 | Ext: 1002208
Yinrul.Hor@aig.com | www.aig.sg

From: jiamin.mak@alt.sg [mailto:jiamin.mak@alt.sg]
Sent: Wednesday, October 23, 2019 6:09 PM
To: Hor, Yinrul
Cc: Fong, Andy-SY; Fan, Winnie-LW; Abu Kassim, Noor Mariesa; Azlan, Syazairdina; Chan, Yoke Shi; Lim, Sheng Yang; Mithoosingh, Aashweenjeetkaur; Parthiban, Theerthan; Subramaniam, Divyashni; 'Jerdine'; vincent@alt.sg; 'ALPHA CAR SERVICES'
Subject: [EXTERNAL] PRE-REPAIR INSPECTION - ACCIDENT INVOLVING OUR INSURED VEHICLE SMG8833U AND SLQ1764R ON 19/10/2019

This message is from an external sender; be cautious with links and attachments.

Dear Sir,

We refer to your email dated 23 October 2019.

Our client agreed to appoint **Mr Marcus Chua – LKK Auto Consultants Pte Ltd** to be the Single Joint Expert.

Thank you.

** Kindly be reminded of the change of our address as stated below.*

Best Regards,

Jiamin

For and on behalf of
Allister Lim

ALLISTER LIM & THRUMURGAN
ADVOCATES & SOLICITORS
1 Coleman Street
#05-01, The Adelphi
Singapore 179803
Telephone : 6422 2187
Facsimile : 6438 1211

Email Confidentiality Warning:

This message contains information which is subject to legal professional privilege and/or is confidential. If you are not the intended recipient, you are notified that any unauthorised disclosure, copying, distribution or use of this information is strictly prohibited. If you have received this message in error, please notify us by e-mailing us at mail@alt.sg and delete it from your system. Unless the contents of this email relate to matters within the scope of the firm's engagement, any opinions, views and other information are expressed in the sender's personal capacity. You should scan this email and any file attached for viruses.

From: Hor, Yinrul
Sent: Wed, 23 Oct 2019 07:52:53 +0000
To: 'jiamin.mak@alt.sg'
Cc: Fong, Andy-SY, Fan, Winnie-LW, Abu Kassim, Noor Mariesa, Azlan, Syazairdina, Chan, Yoke Shi, Lim, Sheng Yang, Mithoosingh, Aashweenjeetkaur, Parthiban, Theerthan, Subramaniam, Divyashni, 'Jerdine.wang@alt.sg'
Subject: PRE-REPAIR INSPECTION - ACCIDENT INVOLVING OUR INSURED VEHICLE SMG8833U AND SLQ1764R ON 19/10/2019

Your Reference : AL.INS.2019.SLQ1764R
Our Reference : SMG8833U

Dear Sir/Madam,

We refer to your Notice of Accident of even date.

We intend to conduct a pre-repair survey of the damage to your client's/your customer's vehicle jointly with your client/your motor workshop. We propose to use one of the motor surveyors named in the attached list to conduct the joint pre-repair survey as a single joint expert:

Name of Surveyor	Company Name
AIG In House Surveyor	AIG Asia Pacific Insurance Pte Ltd
Lawrence Ng Chun Kee	Priority Services
Jeffrey Ong Leng Kiat	Priority Services
Jimmy Lee	Priority Services
EC Looi	Automobile Inspection Services Pte Ltd
Pang Kiah Keen (Frankie)	Formteam Adjusters Pte Ltd
Ng You Han	Formteam Adjusters Pte Ltd
Soon HanXin (Gary)	Formteam Adjusters Pte Ltd
Chow Bo Xiong	Formteam Adjusters Pte Ltd
Chua Soo Teck (Benjamin)	Formteam Adjusters Pte Ltd
Kalvin Ang	LKK Auto Consultants Pte Ltd
Xing Guo Qiang	LKK Auto Consultants Pte Ltd
Marcus Chua	LKK Auto Consultants Pte Ltd
Mohamad Taufikh	LKK Auto Consultants Pte Ltd
Adrian Ling	LKK Auto Consultants Pte Ltd
Mohammed Rasul	LKK Auto Consultants Pte Ltd
Kenneth Kong	LKK Auto Consultants Pte Ltd

Please let us know within two (2) working days whether you agree to the appointment of any of these motor surveyors as a single joint expert. You may select one or more of the listed motor surveyors. We will bear the cost of the pre-repair survey carried out by the single joint expert.

Thanks & Regards,

Hor Yin Rul (Viviane)
AIG
FNOL Adjuster I
Singapore FNOL | Claims Operations – Auto

Tel: 8001206566 | Ext: 1002208
Yinrul.Hor@aig.com | www.aig.sg

From: jiamin.mak@alt.sg [mailto:jiamin.mak@alt.sg]
Sent: Wednesday, October 23, 2019 3:20 PM
To: AIG SGP, Claims-Survey
Cc: 'Jerdine'; vincent@alt.sg; allister@alt.sg; 'ALPHA CAR SERVICES'
Subject: [EXTERNAL] PRI - SLQ 1764 R

This message is from an external sender; be cautious with links and attachments.

Your Ref: SMG 8833 U

Our Ref: AL.INS.2019.SLQ1764R

23 October 2019

AIG ASIA PACIFIC INSURANCE PTE. LTD.
78 Shenton Way
Tower 2 #07-16
Singapore 079120

BY EMAIL ONLY

Dear Sirs,

ACCIDENT INVOLVING SLQ 1764 R & SMG 8833 U ALONG PUNGGOL WAY SLIP ROAD TOWARDS PUNGGOL FIELD ON 19 OCTOBER 2019 AT ABOUT 1340 HOURS

We act for the owner of vehicle no. SLQ 1764 R.

We are instructed to claim damages against you in connection with the above accident.

Pursuant to NIMA protocol, we hereby give you notice to conduct a pre-repair inspection of our client's motor vehicle at the under-stated workshop:-

ALPHA CAR SERVICES PTE LTD
Blk C Kaki Bukit Ave 4
#01-59 Kaki Bukit Autobay

Singapore 417883
Person In-Charge: Cailing
Mobile Number: 6509 8258

TAKE NOTICE that you are required to respond to us within 2 working days (excluding Saturday, Sunday and Public Holiday) of receipt of this notice as to whether you wish to carry out or waive a pre-repair inspection. If we do not hear from you in this regard by the stipulated time, we shall construe your silence as waiver of the requirement for a pre-repair inspection and our client's repairers shall proceed to repair our client's vehicle.

Please contact our staff, Jerdine / Jiamin at 6422 2187 or email us at jerdine.wang@alt.sg / jiamin.mak@alt.sg for future correspondences.

* Kindly be reminded of the change of our address as stated below.

Best Regards,

Jiamin

For and on behalf of
Allister Lim

**ALLISTER LIM & THRMURGAN
ADVOCATES & SOLICITORS**

1 Coleman Street
#05-01, The Adelphi
Singapore 179803
Telephone : 6422 2187
Facsimile : 6438 1211

Email Confidentiality Warning:

This message contains information which is subject to legal professional privilege and/or is confidential. If you are not the intended recipient, you are notified that any unauthorised disclosure, copying, distribution or use of this information is strictly prohibited. If you have received this message in error, please notify us by e-mailing us at mail@alt.sg and delete it from your system. Unless the contents of this email relate to matters within the scope of the firm's engagement, any opinions, views and other information are expressed in the sender's personal capacity. You should scan this email and any file attached for viruses.

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	19/10/2019 15:40
Date Of Accident	19/10/2019 13:40
Exact Location Of Accident	PUNGGOL WAY SLIP RD TWRDS PUNGGOL FIELD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLQ1764R
Insured/Policyholder	
Name Of Registered Owner	ANG LE QUAN
NRIC No	S8303892F
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-98242980
Alternative Phone No	OTHERS-98242980

Vehicle Particulars

Manufacturer	NISSAN
Model	QASHQAI 1.2 DIG-T CVT ABS 2WD 5DR
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	INDIA INTERNATIONAL INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	D19MPC0003075
Cover Note Number	

Driver

Name of Driver	ANG LE QUAN
NRIC No	S8303892F
Date Of Birth	07/02/1983
Occupation	INDOOR
Date Of Driving Pass	19/08/2005
Driving Experience	14 YEARS AND 2 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-98242980
Fax Number	
Contact Number	OTHERS-98242980
EEmail Address	NOEMAIL

Address	BLK 234A SUMANG LANE #14-283
Postcode	821234
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO BELOW STATEMENT/SKETCH PLAN ATTACHED

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SMG8833U
Vehicle Make/Model/Colour	MERCEDES BENZ / GLC200 (R18 LED)
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Common Statement

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (POPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims;
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated; or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature

Date & Time: 19 OCT 2013
15.50 HRS.

Driver's Signature

(If driver is not the policyholder)

Date & Time:

IDAC KAKI BUKIT (VAC)

23 Kaki Bukit Ave 4 #02-02

Singapore 415933

Tel: 67416697 Fax: 67492305

Email: vackb@vicom.com.sg

Reporting Centre Personnel's Signature


Name:

NRIC/FIN No.:

19 OCT 2013

Accident Sketch Plan

SKETCH PLAN

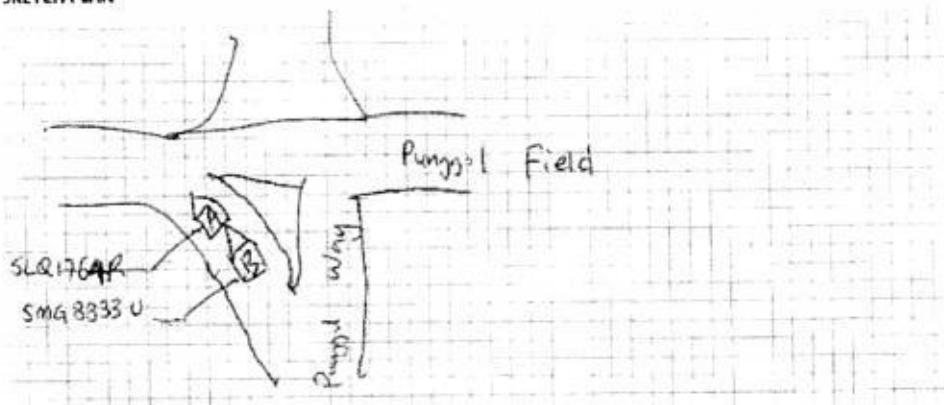

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

ON 19 October 2019 at 13:39 HRS, I WAS ON A
SLIP ROAD FROM PUNGOL WAY TOWARDS PUNGOL
FIELD WHEN SING 8833W HIT MY VEHICLE ON THE
BACK OF MY VEHICLE. AS I WAS GIVING WAY
TO THE TRAFFIC ON PUNGOL FIELD.

DECLARATION

1/We declare the foregoing particulars are true in every respect.

Policyholder's Signature _____

Date & Time: 19 OCT 2:34

15.50 HRS

Driver's Signature _____

(if driver is not the policyholder)

Date & Time:

IDAC KAKI BUKIT (YAC)

23 Kaki Bukit Ave 4 #02-02

Singapore 415933

Tel: 67416697 Fax: 67492305

Email: vackb@vicom.com.bg

Reporting Centre Personnel's Signature

Number:

NRIC/FIN No: 1 OCT 2013

> **Back to OneMotoring**

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC

Owner ID: 892F

Vehicle Details

Vehicle No.: SLQ1764R

Vehicle to be Exported: No

Intended Deregistration Date: 24 Oct 2019

Vehicle Make: NISSAN

Vehicle Model: QASHQAI 1.2 DIG-T CVT ABS 2WD 5DR

Primary Colour: Grey

Manufacturing Year: 2017

Engine No.: HRA2440351A

Chassis No.: SJNFEAJ11UZ008850

Maximum Power Output: 85.0 kW (113 bhp)

Open Market Value: \$18,583.00

Original Registration Date: 29 Jun 2017

First Registration Date: 29 Jun 2017

Transfer Count: 0

Actual ARF Paid: \$13,583.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 28 Jun 2027

PARF Rebate Amount: \$10,187.00

Intended COE Rebate Details

COE Expiry Date: 28 Jun 2027

COE Category: A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years): 10

QP Paid: \$45,201.00

COE Rebate Amount: \$34,704.00

Total Rebate Amount: \$44,891.00

The information contained herein is correct as at 24 Oct 2019

OK

Advanced light technology
Engineered to improve
your performance

dyson lightcycle

Visit Dyson

Free next-day delivery

Post an Advertisement
Sell it yourself! Advertise it at just
\$58 until it's SOLD!

Post an Ad

Advertiser Login

Ways of Selling

New 5 Years Renewal Coe Toyota Vios 1.5A



2.88% P.A, \$0 Down, \$0
Admin, Monthly Fm \$438, 2
Year Warranty Engine, Gearbox
GV Credit Pte Ltd StarAd

HIN LUNG AUTO
Ho Bee Group

One Stop Car Hub
Finance, Insurance, Workshop
New and Used Cars

30 years
of car sale

Browse by Category

« Back (1 2 3) Next »

Sort by Date Posted

20 results/page

41 vehicles

qashqai

Advanced Search

Submit

	Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Search Selection	qashqai		Any	Any	2017	Any	Any	Any	Available
	Nissan	Qashqai 2.0A Premium Moonroof	\$82,000	\$9,720 /yr	31-Mar-2017	1,997 cc	28,957 km	SUV	Available
Offer Loan Interest At 2.28%, Extremely Well Maintained And Comes With Agent Warranty. This Beast Does Not Just Look Beautiful, It's...									
Posted: 23-Oct-2019 Tags: 2017 Nissan Qashqai, 2017 nissan qashqai, Nissan Qashqai, nissan qashqai, Nissan, Qashqai, qashqai, Used Nissan									
	Nissan	Qashqai 1.2A DIG-T Premium	\$73,800	\$8,950 /yr	20-Apr-2017	1,197 cc	61,000 km	SUV	Available
5 Years Agent Warranty, Maintained By Agent, In House Loan Available. High Trade In For Your Car. Call Now Before Sold!									
Benefit Auto Enterprise Pte Ltd									
Posted: 23-Oct-2019 Tags: 2017 Nissan Qashqai, 2017 nissan qashqai, Nissan Qashqai, nissan qashqai, Nissan, Qashqai, qashqai, Used Nissan									
	Nissan	Qashqai 1.2A DIG-T	\$81,300	\$9,170 /yr	15-Nov-2017	1,197 cc	29,900 km	SUV	Available
Look No Further! 1 Owner Car Fully Maintained And Warranty By Agent Tan Chong Motors. Low Mileage Of Only 29,900km Done. Car In...									
Posted: 23-Oct-2019 Tags: 2017 Nissan Qashqai, 2017 nissan qashqai, Nissan Qashqai, nissan qashqai, Nissan, Qashqai, qashqai, Used Nissan									
	Nissan	Qashqai 1.2A DIG-T Premium	\$80,500	\$8,960 /yr	11-Dec-2017	1,197 cc	40,000 km	SUV	Available
1 Owner New Facelift, The Most Popular SUV With Low Depreciation/Low Fuel Consumption, Low Running Cost, Agent Warranty, Flexibl...									
Posted: 23-Oct-2019 Tags: 2017 Nissan Qashqai, 2017 nissan qashqai, Nissan Qashqai, nissan qashqai, Nissan, Qashqai, qashqai, Used Nissan									
		Rear Bumper Reflector Light							
Rear Bumper Reflector Light with installation and 1 year warranty. For Nissan X-Trail & Qashqai									
More info about this product									
	Nissan	Qashqai 1.2A DIG-T	\$70,800	\$8,730 /yr	18-Feb-2017	1,197 cc	47,339 km	SUV	Available
Graded A by STA									
Offer 1.98% Interest Rate! Purchase From An Award Winning Dealerships! STA Certified Accident Free Quality Pre-Owned With Low Mile...									
Cosmo Automobiles									
Posted: 23-Oct-2019 Tags: 2017 Nissan Qashqai, 2017 nissan qashqai, Nissan Qashqai, nissan qashqai, Nissan, Qashqai, qashqai, Used Nissan									
	Nissan	Qashqai 1.2A DIG-T Premium	\$76,000	\$8,730 /yr	31-Aug-2017	1,197 cc	44,000 km	SUV	Available
Well Maintained By A Single Owner. Low Depreciation, High Loan Available. Good Fuel Consumption. Bad Credit Also Can Apply.									
Allmotoring.sg									
Posted: 22-Oct-2019 Tags: 2017 Nissan Qashqai, 2017 nissan qashqai, Nissan Qashqai, nissan qashqai, Nissan, Qashqai, qashqai, Used Nissan									

Compare

ALPHA CAR SERVICES PTE LTD

ROC : 201717633Z

Branch : Blk C, #01-59 Kaki Bukit Ave 6, Kaki Bukit Autobay Singapore 417883.

Tel : 6509 8258 Email : alphacarservices@hotmail.com

416.

Vehicle No : SLQ 1764R

Model : Nissan Qashqai 1.2

Chassis / Engine No : SJNFEAJ11UZ008850

Year : 2017

REPAIR ESTIMATE

<u>PARTS REPLACEMENT - LIST ITEM</u>		Oty		Price (\$)	
1	Rear tailgate	1	12	\$ 2,936.80	X
2	Rear tailgate inner trim board	1	17	\$ 399.00	X
3	Rear tailgate lock	1	17	\$ 161.60	X
4	Rear tailgate weatherstrip	1	17	\$ 158.70	X
5	Rear tailgate outer grille upper	1	17	\$ 336.00	X
6	Rear tailgate outer grille lower	1	17	\$ 198.00	X
7	Rear tailgate tail lamp	2	17	\$ 647.40	X
8	Rear "QASHQAI" emblem 94.00	1	12	\$ 97.10	✓
9	Rear fender	2	17	\$ 2,338.80	X
10	Rear fender inner shield	2	17	\$ 432.00	X
11	Rear fender outer shield	2	17	\$ 966.00	X
12	Rear bumper	1	12	\$ 763.70	✓
13	Rear bumper retainer	2	17	\$ 116.20	X
14	Rear bumper bracket	1	17	\$ 126.00	X
15	Rear bumper reflector	1	17	\$ 133.20	X
16	Rear bumper towing cover 78.80	1	12	\$ 28.10	✓
17	Rear reinforcement	1	17	\$ 619.20	X
18	Rear reinforcement sponge	1	17	\$ 133.80	X
19	Rear end panel	1	12	\$ 682.70	X
20	Rear spare tyre panel	1	17	\$ 482.60	X
21	Rear exhaust	1	17	\$ 830.00	X
				\$ 12,586.90	
				Less 30% (\$3,776.07)	
				<u>Sub Total :</u>	<u>\$ 8,810.83</u>

PARTS REPLACEMENT - NETT ITEMS

1	Rear bumper clip	1 set	12	\$ 45.00	✓
2	Rear reverse sensor	1 set	show	\$ 350.00	200
3	Rear reverse camera	1	17	\$ 480.00	X
4	Rear o/s bumper "NISSAN" logo	1	17	\$ 42.00	X
5	Rear tailgate number plate lamp	2	17	\$ 80.00	X
6	Rear number plate with bracket	1	17	\$ 80.00	X
7	Rear windscreen sealant		17	\$ 80.00	X
				\$ 1,157.00	
				Less 10% (\$115.70)	
				<u>Sub Total :</u>	<u>\$ 1,041.30</u>

not Authorized
Lian
24/10/19
shop. After rep.
2/5 1700
4 day.

P-888.50
302
P-622.23
5.11-245.00
L-1310.00
2177.23
1741.78

LABOUR AND MISCELLANEOUS CHARGES

1	Labour for panel beating, cut, weld, straighten front right affected area and replace front right damaged parts		\$	1,800.00	520
2	To putty and spray painting		\$	2,200.00	680
3	To apply anti rust proofing to rear portion affected area	11	\$	230.00	X
4	To conduct wheel alignment	11	\$	150.00	X
5	To balance rear wheel	11	\$	80.00	X
6	To remove and refit inner garnishes, inner trim to assist repair		\$	140.00	60
7	To remove and refit rear reverse sensor and camera		\$	120.00	50
8	To remove and refit rear tailgate mechanism and wiring assembly to assist repair	11	\$	80.00	X
9	To remove and refit rear windscreen glass with rear wiper blade	11	\$	80.00	X
10	To remove and refit replace exhaust silencer and mountings	11	\$	140.00	X

Sub Total : \$ 5,020.00

Grand Total : \$ 14,872.13

Date of survey / Inspected :

Recommended part by part / Lum Sum :

Recommended number of days :

Survey by / Surveyor firm :

Re-Survey dismantle parts / Before paint / After Paint :

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- That this survey is on a "Without Prejudice" basis
- No repair modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

14987.83*

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	24 Oct 2019 Edit Reg		24 Oct 2019 00:00 Edit Adj Rpt	S\$1,700.00 Edit Estimates	S\$1,700.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by adjuster]									
Insured: LEE PEI SHAN , ID: S8512265G									
Main Claimant: -									
Vehicle Reg. No.: SLQ1764R		Date of Loss: 19/10/2019 13:00 - :59 [27 Months and 20 Days From LTA Reg Date (Man Yr)]							
Claim Type: TP / 9874530638SG		Policy/Cover Note No.: 1900151541 (Comprehensive)							
Vehicle Reg. No. (Insured): SMG8833U		Policy No. (Claimant):							
		Excess:							
Repairer: Alpha Car Services Pte Ltd (HQ) Blk C, Kaki Bukit Ave 6 #01-59, Kaki Bukit Autobay, 417883 Kaki Bukit - Tel: 65098258									
Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. (Express) - Tel: 65-6419-3000 ... [Handled by Chan, Kian-Meng]									
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MARCUS CHUA] ... [Final Rpt due 05/11/2019]									
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
<ul style="list-style-type: none"> AIG_SG (25/10/2019): Request to upload TP GIA Report AIG_SG (25/10/2019): No OI GIA Report 									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents





































***SLQ1764R (9874530638SG)**
[SMG8833U]


TP

-
Oct 19 2019 1:35PM

[LEE PEI SHAN]

Alpha Car Services Pte Ltd

Upload Documents Upload Photos Compose New Letter Upload Video Upload Audio			View View in Browser	
Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	25/10/19 07:51	Chassis Number	 Load JPG	<input checked="" type="checkbox"/>
2	25/10/19 07:51	Odometer Reading	 Load JPG	<input checked="" type="checkbox"/>
3	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
4	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
5	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
6	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
7	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
8	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
9	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
10	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
11	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
12	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
13	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
14	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
15	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
16	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
17	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
18	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
19	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
20	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
21	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
22	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
23	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
24	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
25	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
26	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
27	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
28	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
29	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
30	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
31	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
32	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
33	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
34	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
35	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
36	25/10/19 07:51	General View	 Load JPG	<input checked="" type="checkbox"/>
37	25/10/19 07:51	General View	Load JPG	<input checked="" type="checkbox"/>
38	25/10/19 07:51	General View	Load JPG	<input checked="" type="checkbox"/>
39	26/10/19 11:30	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
40	26/10/19 11:30	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>

Photos/Images			3 per page ▼	☑
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
41	26/10/19 11:30	Reinspection Photo	 Load JPG	☑
42	26/10/19 11:30	Reinspection Photo	 Load JPG	☑
43	26/10/19 11:30	Reinspection Photo	 Load JPG	☑
44	26/10/19 11:30	Reinspection Photo	 Load JPG	☑
45	26/10/19 11:30	Reinspection Photo	 Load JPG	☑
46	26/10/19 11:30	Reinspection Photo	 Load JPG	☑
47	26/10/19 11:30	Reinspection Photo	 Load JPG	☑
48	26/10/19 11:30	Reinspection Photo	 Load JPG	☑
49	26/10/19 11:30	Reinspection Photo	 Load JPG	☑
50	26/10/19 11:30	Reinspection Photo	 Load JPG	☑
51	26/10/19 11:30	Reinspection Photo	 Load JPG	☑
52	26/10/19 11:30	Reinspection Photo	 Load JPG	☑
53	26/10/19 11:30	Reinspection Photo	 Load JPG	☑
54	26/10/19 11:30	Reinspection Photo	 Load JPG	☑
55	26/10/19 11:30	Reinspection Photo	 Load JPG	☑
56	29/10/19 16:58	After Repair Photo	 Load JPG	☑
57	29/10/19 16:58	After Repair Photo	 Load JPG	☑
58	29/10/19 16:58	After Repair Photo	 Load JPG	☑
59	29/10/19 16:58	After Repair Photo	 Load JPG	☑
60	29/10/19 16:58	After Repair Photo	 Load JPG	☑

Documents Checklist

DOCUMENTS CHECKLIST

[Reset](#) [Save](#) [Print](#)

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/AIG19018791/UYD3S2
Date: 07/01/2020

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 1900151541
Claimant Vehicle No : SLQ1764R **Insured Vehicle No :** SMG8833U
Date of Loss: 19/10/2019 Nature of Claim: TP Claim No: 9874530638SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLQ1764R**
Make & Model: NISSAN QASHQAI, 1.2 DIG-T CVT ABS 2WD 5DR (A) Engine No: HRA2440351A
Reg. Date: 29/06/2017 (Man. Year: 2017) Chassis No: SJNFEAJ11UZ008850
Colour: Grey Odometer: 21348 km
Engine Capacity: 1197 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Good Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/60 R17 Rear Tyre Size: 215/60 R17
Front Left Side: Goodyear 6 mm Rear Left Side: Goodyear 6 mm
Front Right Side: Goodyear 6 mm Rear Right Side: Goodyear 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	9,967.83	867.23	9,100.60	91.30
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,020.00	1,310.00	3,710.00	73.90
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	14,987.83	2,177.23	12,810.60	85.47
Approved Total (Overridden) (S\$)		1,700.00		
Nett Amount (S\$)	14,987.83	1,700.00	13,287.83	88.66

INSPECTION

Date of Assignment: 24/10/2019
Date Inspected: 24/10/2019 Inspected At: Alpha Car Services Pte Ltd
Singapore 417883
Estimated Period of Repair: 4.0 days

Adjuster: MARCUS CHUA**Manager:** YVONNE WONG YIN CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR TAILGATE	Repair	2,936.80 FL	*- FL
2	1		*REAR TAILGATE INNER TRIM BOARD	Not Necessary	399.00 FL	*- FL
3	1		*REAR TAILGATE LOCK	Not Necessary	161.60 FL	*- FL
4	1		*REAR TAILGATE WEATHERSTRIP	Not Necessary	158.70 FL	*- FL
5	1		*REAR TAILGATE OUTER GRILLE UPPER	Not Necessary	336.00 FL	*- FL
6	1		*REAR TAILGATE OUTER GRILLE LOWER	Not Necessary	198.00 FL	*- FL
7	2		*REAR TAILGATE TAIL LAMP	Not Necessary	647.40 FL	*- FL
8	1		*REAR QASHQAI EMBLEM	Necessary	97.10 FL	*97.10 FL
9	2		*REAR FENDER	Not Necessary	2,338.80 FL	*- FL
10	2		*REAR FENDER INNER SHIELD	Not Necessary	432.00 FL	*- FL
11	2		*REAR FENDER OUTER SHIELD	Not Necessary	966.00 FL	*- FL
12	1		*REAR BUMPER	Deformed	763.70 FL	*763.70 FL
13	2		*REAR BUMPER RETAINER	Not Necessary	116.20 FL	*- FL
14	1		*REAR BUMPER BRACKET	Not Necessary	126.00 FL	*- FL
15	1		*REAR BUMPER REFLECTOR	Not Necessary	133.20 FL	*- FL
16	1		*REAR BUMPER TOWING COVER	Deformed	28.10 FL	*28.10 FL
17	1		*REAR REINFORCEMENT	Repair	619.20 FL	*- FL
18	1		*REAR REINFORCEMENT SPONGE	Not fitted	133.80 FL	*- FL
19	1		*REAR END PANEL	Repair	682.70 FL	*- FL
20	1		*REAR SPARE TYRE PANEL	Not Necessary	482.60 FL	*- FL
21	1		*REAR EXHAUST	Not Necessary	830.00 FL	*- FL
22	1		*SET REAR BUMPER CLIP	Necessary	45.00 FS	*45.00 FS
23	1		*SET REAR REVERSE SENSOR	Shorted	350.00 FS	*200.00 FS
24	1		*REAR REVERSE CAMERA	Not Necessary	480.00 FS	*- FS
25	1		*REAR O/S BUMPER NISSAN LOGO	Not Necessary	42.00 FS	*- FS
26	2		*REAR TAILGATE NUMBER PLATE LAMP	Not Necessary	80.00 FS	*- FS
27	1		*REAR NUMBER PLATE WITH BRACKET	Not Necessary	80.00 FS	*- FS
28	1		*REAR WINDSCREEN SEALANT	Not Necessary	80.00 FS	*- FS

F=Franchise part, S=SpcNett, L=ListItemDisc.

Sub Total (\$\$)	13,743.90	1,133.90
- List Item Discount on L Items 30.00/30.00% (\$\$)	3,776.07	266.67
Total Parts (\$\$)	9,967.83	867.23

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR FOR PANEL BEATING, CUT, WELD, STRAIGHTEN FRONT RIGHT AFFECTED AREA AND REPLACE FRONT RIGHT DAMAGED PARTS.	New	1,800.00	520.00
2	TO PUTTY AND SPRAY PAINTING.	New	2,200.00	680.00
3	TO APPLY ANTI RUSH PROOFING TO REAR PORTION AFFECTED AREA.	New	230.00	0.00
4	TO CONDUCT WHEEL ALIGNMENT.	New	150.00	0.00
5	TO BALANCE REAR WHEEL.	New	80.00	0.00
6	TO REMOVE AND REFIT INNER GARNISHES, INNER TRIM TO ASSIST REPAIR.	New	140.00	60.00
7	TO REMOVE AND REFIT REAR REVERSE SENSOR AND CAMERA.	New	120.00	50.00
8	TO REMOVE AND REFIT REAR TAILGATE MECHANISM AND WIRING ASSEMBLY TO ASSIST REPAIR.	New	80.00	0.00
9	TO REMOVE AND REFIT REAR WINDSCREEN GLASS WITH REAR WIPER BLADE.	New	80.00	0.00
10	TO REMOVE AND REFIT REPLACE EXHAUST SILENCER AND MOUNTINGS.	New	140.00	0.00
Gross Labour Cost (\$\$)			5,020.00	1,310.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >