

ASS. REC. BY:

Cs/r/90/9686/Usd3/02

ASSIGNMENT

From:

Date:

0930

Estimated Cost:

OD / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

SMF12534

at Workshop m/s

321

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Vehl:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value:

70k.

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

20

days

Res.: Yes or No

Lum Sum:

20

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

LTA 37488

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No:

SMF12534 Yr Regn: 10/18

Type: M.Cat / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

CAI

Make:

KIA CERATO

c.c

1591

Colour:

Blue

A/C:

Insured / Std / NI / NA

Sp. Reading

18085

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

KNAF3416MK50/8062

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rib / STD A/Rim or

Tyre Size:

F:

205/55 R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

KUMHO

Front

Rear

R/Bal.

7

mm

R/Bal.

7

mm

L/Bal.

7

mm

L/Bal.

7

mm

D.O.A

2/11/19

D.O.I.

6/11/19

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear & L.F.

The U/C Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Issue Ajax 27-11-19 After repair

L/S \$ 17,500 confirmed.
(\$ 16,387-80 Red - 48%)

RECEIVED 26 DEC 2019

Date/Time, File Pass to?

26/12/19 Type

Date/Time, File Return to?

2

☐

: Preli. Report

☒

: Final Report

Days Of Repair:

20

Resurvey No. of Trip:

2

Add Fee:

☐

: Site Insp. (\$

☐

: Interview (\$

☐

: Tech. Inve (\$

☐

: West end (\$

Survey Fee:

Transportation:

S + RS St

Photos

Other

total

23015 = 345

170 + 345

50

50 + 50

246

80

991

Report Format:

Independent

Comp. Sum. F.R.:

\$ 17,500/- ds

SPECTACULAR
11.11 SALE

Post an Advertisement
Sell it yourself! Advertise it at just
\$58 until it's SOLD!

[Post an Ad](#)
[Advertiser Login](#)
[Ways of Selling](#)
[Toyota Dyna 150 Year 2012 Dec.](#)


Very Excellent Condition! Low
Mileage And Valid Maintenance
Direct Owner
Direct Owner

AutoInt
An Inspiration For Car Bu...

click here to view
our **PRISTINE USED**
at GREAT

[Browse by Category](#)
[Sort by Date Posted](#)

8 vehicles

Kia Cerato

[Advanced Search](#)

Search Selection	Kia Cerato	Any	Any	2018	Any	Any	Any
	Kia Cerato Forte 1.6A SX	\$76,800	\$7,730 /yr	13-Aug-2018	1,591 cc	10,532 km	Sedan
Latest Model! Highest Specs SX Model With High OMV! 1 Owner, Like New Condition! Low Depreciation Full Agent Unit Maintained By Cycle And Carriage Still Under Warranty! Flexible Loan Available, View Now!							
Posted: 03-Nov-2019 Tags: 2018 Kia Cerato, 2018 kia cerato, Kia Cerato, kia cerato, Kia, Cerato, cerato, Used Kia							
	Kia Cerato Forte 1.6A SX	\$84,000	\$8,380 /yr	16-Oct-2018	1,591 cc	59,500 km	Sedan
Offer Loan Interest At 2.28%. Extremely Well Maintained, This Beast Does Not Just Look Beautiful, It's 100% Accident Free. Come With Agent Warranty 5 Years/Unlimited Mileage. View To Believe! 80% Financing Of Car Price Possible! Trade In Welcome Call/SMS To Arran...							
Posted: 30-Oct-2019 Tags: 2018 Kia Cerato, 2018 kia cerato, Kia Cerato, kia cerato, Kia, Cerato, cerato, Used Kia							
	Kia Cerato K3 1.6A SX Sunroof	\$73,800	\$7,720 /yr	28-May-2018	1,591 cc	22,000 km	Sedan
Free 1 Year Insurance Sporty Ride In Gravity Blue With Sunroof, Fully Serviced By C&C, Still Under Warranty. Fully Stock. Genuine Mileage. Good Condition. Road Tax Valid Till Nov 19, Trade In And High Loan 95% Of The Car Price Available Here. Don't Miss It. Call U...							
Euro Performance Asia Pte Ltd							
Posted: 30-Oct-2019 Tags: 2018 Kia Cerato, 2018 kia cerato, Kia Cerato, kia cerato, Kia, Cerato, cerato, Used Kia							
	Kia Cerato K3 1.6A SX Sunroof	\$71,800	\$7,550 /yr	08-May-2018	1,591 cc	36,679 km	Sedan
1 Owner, Fully Agent C&C Serviced. Original Paintwork. Low Mileage Used. Low Depreciation. 5 Years Warranty By C&C,10 Years Engine Warranty At C&C. Original Factory Bodykit. Beautiful Dark Blue. Low Interest Rate. Contact Us For Viewing							
Posted: 12-Oct-2019 Tags: 2018 Kia Cerato, 2018 kia cerato, Kia Cerato, kia cerato, Kia, Cerato, cerato, Used Kia							
	New Cerato takes on Seat's honest Toledo						
The Kia Cerato may boast a lot more features than its Seat Toledo rival, but it does cost quite a bit more and isn't as light-footed and fuel-econor							
Read this article							
	Kia Cerato K3 1.6A	\$62,700	\$6,820 /yr	19-Mar-2018	1,591 cc	-	Sedan
1 Owner, Full Cycle And Carriage Servicing Record. Best Selling Kia Sedan In Singapore. Low Fuel Consumption, Low Maintenance. Original Paintwork Condition. Prestige Condition, View To Believe. Flexible 100% Approval In House Loan Available. High Over Trade In...							
Posted: 11-Oct-2019 Tags: 2018 Kia Cerato, 2018 kia cerato, Kia Cerato, kia cerato, Kia, Cerato, cerato, Used Kia							

[Compare](#)

SPECTACULAR
11.11 SALE

Kia Cerato

Price Range ▼

Depreciation ▼

2018 ▼

Vehicle Type ▼



Home » Used Cars » Exclusive Auto Trading Pte Ltd » Kia Cerato Forte 1.6A SX

Kia Cerato Forte 1.6A SX

Overview

Financial

Accessories

Similar

Research

Photos

Map

Price \$76,800**Depreciation** \$7,730 /yr
[View models with similar depre](#)**Reg Date** 13-Aug-2018
(8yrs 9mths 5days COE left)**Mileage** 10,532 km (8.5k /yr)**Manufactured** 2018**Road Tax** \$738 /yr**Transmission** Auto**Dereg Value** \$43,091 as of today (change)**OMV** \$17,934**COE** \$33,798**ARF** \$17,934**Engine Cap** 1,591 cc**Power** 93.8 kW (125 bhp)**Curb Weight** 1,287 kg**No. of Owners** 1**Type of Vehicle** Mid-Sized Sedan

Features

Gamma 1.6 MPI 6 Speed Auto Transmission Dual Continuously Variable Valve Timing (D-CVVT) And Electronic Fuel Injection, 6 Airbags.

Accessories

8" Infotainment System, Apple Car Play, Keyless Entry, Wireless Charging, Heated And Ventilated Seats, Electric Memory Seats, Sunroof And Rear Aircon.

Description

Latest Model! Highest Specs SX Model With High OMV! 1 Owner, Like New Condition! Low Depreciation Full Agent Unit Maintained By Cycle And Carriage Still Under Warranty! Flexible Loan Available, View Now!

Category

PARF Car, Low Mileage Car

Status

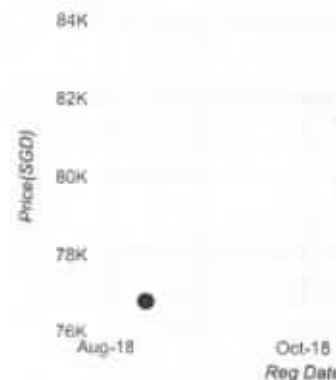
Available

Re:

[Compare](#)https://www.sgcarmart.com/used_cars/info.php?ID=864800&DL=3013

Location Map

Price Chart



Click on the point to view the vehicle

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	093A
Vehicle Details	
Vehicle No.:	SMF1253U
Vehicle to be Exported:	No
Intended Deregistration Date:	07 Nov 2019
Vehicle Make:	KIA
Vehicle Model:	CERATO 1.6(A) EX
Primary Colour:	Blue
Manufacturing Year:	2018
Engine No.:	G4FGJH709769
Chassis No.:	KNAF3416MK5018662
Maximum Power Output:	93.8 kW (125 bhp)
Open Market Value:	\$13,843.00
Original Registration Date:	29 Oct 2018
First Registration Date:	29 Oct 2018
Transfer Count:	0
Actual ARF Paid:	\$13,843.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	28 Oct 2028
PARF Rebate Amount:	\$10,382.00
Intended COE Rebate Details	
COE Expiry Date:	28 Oct 2028
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$30,209.00
COE Rebate Amount:	\$27,106.00
Total Rebate Amount:	\$37,488.00

The information contained herein is correct as at 07 Nov 2019

OK

MSG# H146086 / JMI Motor Pte Ltd - 9040 Bukit
ENTRY DATE & TIME: 04/11/2019 17:25
SUBMITTED BY: Chia Kai Ying

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available afterwards.

ACCIDENT STATEMENT

Date Of Report 04/11/2019 17:25
Date Of Accident 02/11/2019 20:50
Exact Location Of Accident PUNJIGOL FIELD
Country/State of Loss SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number SMF1253U
Insured/Policyholder
Name Of Registered Owner HUI WAI LOONG
NRIC No S8527093A
Email Address NOEMAIL
Mobile Phone No (LOCAL) +65-93215654
Alternative Phone No OFFICE-93215654

Vehicle Particulars

Manufacturer KIA
Model CERATO

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? NO

If No, Please state action to be taken THIRD PARTY

Vehicle Category PRIVATE CAR

Insurance Company

Name of Insurance Company AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage COMPREHENSIVE
Fleet Policy NO
Policy Number 1800122740

Cover Note Number

Driver

Name of Driver HUI WAI LOONG
NRIC No S8527093A
Date Of Birth 20/08/1985
Occupation INDOOR
Date Of Driving Pass 09/04/2005
Driving Experience 14 YEARS AND 5 MONTHS
Gender MALE
Mobile Number (LOCAL) +65-93215654
Fax Number
Contact Number OFFICE-93215654
Email Address NOEMAIL

Address BLK 54 EDGEDALE PLAINS #10-01
 Postcode 828617
 Was driver an employee of the Insured's Company? NO
 If No, Relationship of the Driver with the Insured OWNER
 Vehicle Registration Number of Driver's Own Vehicle -
 -
 Insurance Company of Driver's Own Vehicle -
 -

General Information of the Accident

Type Of Accident CHAIN COLLISION
 Weather Conditions CLEAR
 Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO
 Number of vehicles (including own vehicle) involved in the accident 3
 Was any body injured in the Accident? YES
 Was any injured conveyed to hospital by ambulance? NO
 Was any other material or property damaged? YES
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
 Number of Passengers (Including Driver) 3
 Passenger 1

NAME: : SIM PEI HUI
 GENDER: : FEMALE

Passenger 2

NAME: : HUI DE KAI :OIEL
 GENDER: : MALE

Details of Police Action

Was the accident reported to the police? YES
 If Yes, Please state which Police Station
 Police Station Name EUNCS NPP
 Police Station Address ROAD: 829 BEDOK RESERVOIR ROAD #01-1620, POSTCODE: 470629, COUNTRY: SINGAPORE
 Police Station Contact TEL NO: - FAX NO:
 Was notice of intended Prosecution given? NO
 If Yes, against whom?

Circumstances of Accident

REFER TO POLICE REPORT: 7/20161104/2039.

Attachment(s)

Are accident photos available for attachment? YES
 Was there any video captured by Car Camera? NO
 Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number GBH7796A
 Vehicle Make/Model/Colour
 Details Of Properties VEHICLE B
 Vehicle Category COMMERCIAL VEHICLE
 Name of Driver MOHD REJAB BIN JAMALUDIN

NRIC/Passport Number S6311824B
Contact Number
Address
Postcode
Insurance Company Name
Nature Of Damage
No. Of Passenger (Including Driver)

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number SHDESX
Vehicle Make/Model/Colour
Details Of Properties VEHICLE C
Vehicle Category TAXI
Name of Driver LAM HUA ER
NRIC/Passport Number S0551000H
Contact Number
Address
Postcode
Insurance Company Name
Nature Of Damage
No. Of Passenger (Including Driver)

DETAILS OF INJURED PERSON 1

Name SIM FEI HUI
Approximate Age
Injuries Sustain
Injured person in which vehicle? SMF1253U
Were seat belts worn?
Was this injured conveyed to hospital by ambulance?
Address
Postcode

DETAILS OF INJURED PERSON 2

Name HUI DE KAI ZOEL
Approximate Age
Injuries Sustain
Injured person in which vehicle? SMF1253U
Were seat belts worn?
Was this injured conveyed to hospital by ambulance?
Address
Postcode

Sketch Plan Pg. 1


SKETCH PLANIMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to rescind the policy.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and this copies of the report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.


B. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this Form and any other personal information provided by me or accessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosing of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/are be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purposes of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all Insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


 Policyholder's Signature
 Date & Time: 4/11/19, 2:15pm


 Driver's Signature
 (If driver is not the policyholder)
 Date & Time: 4/11/19, 2:15pm


 Reporting Centre Person's Signature
 Name:
 NRIC/PR No.:

GIA/MA (GIA/MA) Form 10

BUNEL

Sketch Plan #2 Pg. 1

SKETCH PLAN

Diagram illustrating the sketch plan on a grid. The plan shows a horizontal line with points labeled A, B, and C. Point A is on the left, B is in the middle, and C is on the right. Above the line, there is a handwritten note "Punch and Seal". To the right of the line, there are three arrows pointing right, labeled A, B, and C. Below the line, there are three arrows pointing left, labeled A, B, and C.

A - 9M 1013M
B - 6B 1496E
C - 5M 1013M

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Describe the circumstances of the accident in the following space. The text "voter police" is written diagonally across the space.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time: 4/11/19 2:57pm

Driver's Signature
(if vehicle is not being policyholder)
Date & Time: 4/11/19 2:57pm

Reporting Centre Personnel's Signature

Name:
IIRC/RIN No.:

IQA/RAC SketchPlanForm_V3

2

Sketch Plan #3 Pg. 1



**SINGAPORE
POLICE FORCE**



T:20191104/2019

Police Station Of Origin:
Eunos NPP
629 Bedok Reservoir Road #01-1620
SINGAPORE 470529
Tel No: 1800-4439999

1 of 3

Report No. T/20191104/2019

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 04/11/2019 13:39		Video Report No.:		Station Diary No.: 21	
Name of Informant: HUI WAI LOONG		Address: APT BLK 94 EDGE DALE PLAINS #13-31 SINGAPORE 828887			
ID Type / ID No.: NRIC NO / S8527093A		Contact No.:		Mobile: 93215554	
Nationality: SINGAPORE CITIZEN		Email:			
Sex: Male	Age: 34	Date of Birth: 20/08/1983	Type of Informant: Driver		
Race: Chinese		Language: English		Institution / School Name:	
Occupation: PUBLIC SERVANT		Driving Licence Information: Class: 3		Date of Expiry:	

Type of Accident:	Non-injury Attended by Police	Drink Drive: No	Date/Time of Accident: 02/11/2019 20:50	Type of Location: Straight Road
Location: Along Road 1 PUNGGOL CENTRAL NEAR TO PUNGGOL NPC				
Weather: Clear		Road Surface: Dry		Road Speed Limit:
Traffic Flow: One Way		Traffic Control:		Traffic Volume: Moderate
Type of Collision: CHAIN COLLISION				Anyone conveyed by ambulances: No

GBH7796A	Van				0
SHD95K	Car				5
SMF1253U	Car	KIA	CERATO 1.6(A) EX	Blue	2

Sketch Plan #4 Pg. 1


**SINGAPORE
POLICE FORCE**


T/2019/104/208

Police Station Of Origin:
Eunos NPP
529 Bedok Reservoir Road #01-1620
SINGAPORE 470629
Tel No: 1800-4439999

2 of 3

Report No: T/20191104/208H

CONTINUATION OF REPORT

SMF1253U	AIG ASIA PACIFIC INSURANCE PTE. LTD.	1600122740	29/10/2018	23/10/2020

Brief Details.

On the 02/11/2019 at about 2050hrs, I was driving my vehicle (SMF1253U) travelling on lane 2 along Punggol Central. I noticed that the traffic light is green but the vehicles were lining up to move off, hence I slowly came to a stop right behind a taxi (SHD95K). I almost came to a stop and I notice that there is still a bit of distance between me and the taxi in front. Suddenly, I received a very hard impact that came from the rear of my vehicle and thus caused my vehicle to roll in front and hit the taxi in front of me. After the accident, I immediately got off and checked on the vehicle behind that hit me. It was a Van (GBH7796A) and the impact was quite hard so I presume he was not travelling at low speed. I observed that I was involved in a chain accident. All of the parties involved then exchanged particulars and took photo of all the damages. There was traffic police at scene but however there was no report number given to me. There was also an ambulance at scene but there is no conveyance of anyone at the point of time. I observed that the taxi suffered slight damages, the van suffered serious damages to the front portion of the vehicle. My own vehicle also suffered serious damages to the rear portion of my vehicle, resulting in the rear bumper and bonnet all damaged. Although there were no injury at the point of time, but due to the hard impact, my wife and my infant child suffered shocks and pains to the body. My wife felt left side of her body in pain, Chest pains and also neck pain and due to that she got a 5 days MC from the doctor. My infant child was in shock due to the accident and as for me, I felt minor neck aches but have not seen a doctor as the injury I sustained is not uncomfortable as of now. I also wish to state that there is no government property damaged.

Sketch Plan #5 Pg. 1

**SINGAPORE
POLICE FORCE**

Police Station Of Origin
Eunos NPP
629 Bedok Reservoir Road #01-1620
SINGAPORE 470629
Tel No: 1800-4439999



T/20191104/2089

3 of 3

Report No. T/20191104/2089

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report:
G/

Sgt 2 TAN ZHI XIANG

Signature Of Informant:

Signature Of Interpreter:
Not applicableDate/Time:
04/11/2019 13:39

Officer In Charge Of Case:
TP / GIT /
Sr Staff Sgt SYED ZAYID MUHAMMAD BIN
SYED ABDUL WAHID ALHINDUAN
Contact No: 65476394

Authentication Stamp
NP168

Classification Of Case:



BLUWEL AUTOMOTIVE SERVICE PTE LTD

Workshop: 1 Kaki Bukit Ave 6 (Unit B) #01-28
 (Unit C) #01-28-53/55 Singapore 417883
 Hp: 9755 2088 Tel: 6745 2088 Fax: 6841 2088
 Website: www.bluwel.com.sg Email: bluwel2088@yahoo.com.sg
 Co. Reg. No.: 200704951N
 GST Reg. No. 200704951N

not Authorized
 Mark
 1/5# 17,500
 2017.

SMF 12534

	Bootlid	∞/suc	1297.00	✓
	Bootlid Rear logo	neu	48.60	✓
	Bootlid CBC logo	neu	40.00	✓
2pc	Bootlid reflectors @ 295.00	CNE	590.00	✓
	Bootlid centre reflector	CNE	245.00	✓
2pc	Bootlid hinges @ 141.00	del	282.00	✓
2pc	Bootlid license plate lamps @ 68.00	11	136.00	X
	Bootlid inner lock	twl	112.00	✓
	Bootlid lock striker	11	66.20	X
	Bootlid inner trim	Re/trim	241.00	✓
150+	Bootlid inner trim clips	neu	35.00	✓
	Bootlid weatherstrip	twl	109.00	✓
	Bootlid Rear reverse camera	shock	380.00	✓
	Rear bumper	7.5	688.00	✓
	Rear bumper lower garnish	7.5	347.00	✓
2pc	Rear bumper side retainers @ 31.00	del	62.00	✓
150+	Rear bumper clips	neu	50.00	✓
	Rear bumper reinforcement	CN	318.00	✓
2pc	Rear bumper reinforcement brackets @ 145.00	del	290.00	✓
2pc	Rear bumper reinforcement retainers @ 15.00	twl	30.00	✓
	Rear bumper sponge	WF	105.00	X
4pc	Rear bumper PDC sensors @ 195.00	shock	780.00	150+ 2005.00
	Rear bumper PDC sensor wire	Trim	207.00	✓
2pc	Rear bumper lamps @ 191.00	CN	382.00	✓
2pc	Rear bumper lamp garnishes @ 62.50	twl/cn	125.00	✓
	Rear bumper lower tray	Trim	68.00	✓
	Rear antenna assy smartkey	shock	145.00	✓
	Rear end panel	sub/300	598.50	✓
	Rear end panel top garnish	CN	15.250	✓
2pc	Tail lamps @ 425.00	CNE	850.00	✓

(10h)



BLUWEL AUTOMOTIVE SERVICE PTE LTD

Workshop: 1 Kaki Bukit Ave 6 (Unit B) #01-28
 (Unit C) #01-29-33/55 Singapore 417883
 Hp: 9755 2088 Tel: 6745 2088 Fax: 6841 2088
 Website: www.bluwel.com.sg Email: bluwei2088@yahoo.com.sg
 Co. Reg. No.: 200704951N
 GST Reg No.: 200704951N

SMF12534

2pc	tail lamp housing panels @ 258.00	bel	510.00	✓
2pc	Rear fenders @ 891.00	nlr olshuc	1782.00	1pc
2pc	Rear fender inner trim @ 242.00	rel/brn	484.00	✓
1set	Rear fender inner trim clips	nbc	50.00	✓
	Rear floor panel	crumpled/suc	1120.00	✓
	Rear floor panel top board	waged	399.00	✓
	Rear exhaust	n	675.00	X
	Rear exhaust heat shield	sent	112.00	✓
	Rear windscreen moulding	nlr	78.50	✓
	Rear chassis member ol	n	645.00	X
	Rear wheel housing panel ol	n	911.00	X
	front bumper	rel/brn	639.00	✓
1set	front bumper clips	nlr	45.00	✓
2pc	front bumper side retainers @ 25.00	sent	50.00	✓
	front bumper sponge	brn	84.00	✓
	front bumper reinforcement	sent	496.00	✓
2pc	front bumper reinforcement brackets @ 65.00	11	130.00	X
	front bumper centre grille	one	228.00	✓
2pc	front bumper lamps @ 303.00	nlr	606.00	X
2pc	front bumper fog lamps grilles @ 241.00	olshuc	482.00	1pc
	front bumper logo	nlr	45.00	✓
	front grille	cmg	328.00	✓
	front grille chrome moulding	scr	118.00	✓
2pc	headlamps @ 2209.00	cm	4418.00	✓
	front support panel	11	675.00	X
	front licence plate garnish	11	28.00	X
	front support panel top garnish	11	66.50	X
	Bonnet	n	835.00	X
	Air con condenser	11	689.00	X
	Radiator	11	939.00	X

10%

26467.80

16028.1



BLUWEL AUTOMOTIVE SERVICE PTE LTD

Workshop: 1 Kaki Bukit Ave 6 (Unit B) #01-28
 (Unit C) #01-29-53/55 Singapore 417883
 Hp: 9755 2088 Tel: 6745 2088 Fax: 6841 2088
 Website: www.bluwel.com.sg Email: bluwel2088@yahoo.com.sg
 Co. Reg. No.: 200704951N
 GST Reg. No.: 200704951N

S.No. f SMF12534

	Rear licence plate w/holder	svc	50.00	X
	Rear windscreen sealant	nu	50.00	40
150 f	Rear floor panel insulator	nu	180.00	100
	Rear end panel sealant	nu	50.00	✓
	front licence plate w/holder	but	50.00	40
160	Radiator coolant	u1	50.00	X
	To check wiring		80.00	- 30
	To Dismantle & replacing reverse sensor		80.00	- 50
	To Dismantle & refix rear exhaust		100.00	- 60
	To Dismantle & refix rear windscreen		150.00	- 120
	To Dismantle & refix petrol tank		100.00	- 60
	To Dismantle & refix cushion upholstery		120.00	- 100
	To straighten chassis alignment		380.00	300
	To spray rust proofing		150.00	- 120
	To refit air con gas	u1	150.00	X
	labour for panel beating & replacing parts		3200.00	- 2600
	To putty & spray painting		2500.00	- 2000
			TOTAL @ 33887.50	

LKK Auto Consultants hence notify the Repairer of the following:

- To survey before/after spray painting
- To display damaged part(s) during survey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No other compensation(s) is allowed
- Supplementary item(s) must be surveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date:

21816.59



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
BLUWEL AUTOMOTIVE SERVICE PTE LTD			Ref : CS/TP19019686/Usd3n2	
BLK 1 KAKI BUKIT AVE 6 #01-28/51/53/55(MAIN OFFICE)SINGAPORE 417883			Date : 31-12-2019 	
ON BEHALF OF HUI WAI LOONG			Code : TP149	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.		Veh. Inspected		SMF 1253U
Policy No.		Coverage (\$)		0.00
Claim No.		Excess (\$)		0.00
Assign From		Assign Date		06/11/2019
2. Vehicle Particulars & Condition				
Make & Model	KIA CERATO (A)	c.c	1591	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	KNAF3416MK5018662	Colour	BLUE	
Odometer	18085	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/55 R16	KUMHO	7 mm	
L/H Front Tyre	205/55 R16	KUMHO	7 mm	
R/H Rear Tyre	205/55 R16	KUMHO	7 mm	
L/H Rear Tyre	205/55 R16	KUMHO	7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR AND FRONT PORTION.THE CHASSIS FRAME AFFECTED DUE TO COLLISION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date		Inspection Date		06/11/2019
Survey held at		BLUWEL AUTOMOTIVE SERVICE PTE LTD BLK 1 KAKI BUKIT AVE 6 #01-28/51/53/55(MAIN OFFICE) SINGAPORE 417883		
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		20 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMF 1253U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	BOOTLID	DENTED / BUCKLED	1,297.00	1,297.00
1	BOOTLID REAR LOGO	NECESSARY	48.60	48.60
1	BOOTLID C&C LOGO	NECESSARY	40.00	40.00
2	BOOTLID REFLECTORS @\$295.00	CRACKED	590.00	590.00
1	BOOTLID CENTRE REFLECTOR	CRACKED	245.00	245.00
2	BOOTLID HINGES @\$141.00	BENT	282.00	282.00
2	BOOTLID LICENCE PLATE LAMPS @\$68.00	NOT NECESSARY	136.00	-
1	BOOTLID INNER LOCK	TWISTED	112.00	112.00
1	BOOTLID LOCK STRIKER	NOT NECESSARY	66.20	-
1	BOOTLID INNER TRIM	DEFORMED / TORN	241.00	241.00
1	SET BOOTLID INNER TRIM CLIPS	NECESSARY	35.00	35.00
1	BOOTLID WEATHERSTRIP	TWISTED	109.00	109.00
1	BOOTLID REAR REVERSE CAMERA	SHORTED	380.00	380.00
1	REAR BUMPER	DISTORTED	688.00	688.00
1	REAR BUMPER LOWER GARNISH	DISTORTED	347.00	347.00
2	REAR BUMPER SIDE RETAINERS @\$31.00	BENT	62.00	62.00
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	50.00
1	REAR BUMPER REINFORCEMENT	CRACKED	318.00	318.00
2	REAR BUMPER REINFORCEMENT BRACKETS @\$145.00	BENT	290.00	290.00
2	REAR BUMPER REINFORCEMENT RETAINERS @\$15.00	TWISTED	30.00	30.00
1	REAR BUMPER SPONGE	NOT FITTED	105.00	-
1	REAR BUMPER PDC SENSOR WIRE	TORN	207.00	207.00
2	REAR BUMPER LAMPS @\$191.00	CRACKED	382.00	382.00
2	REAR BUMPER LAMP GARNISHS @\$62.50	TWISTED / CRACKED	125.00	125.00
1	REAR BUMPER LOWER TRAY	TORN	68.00	68.00
1	REAR ANTENNA ASSY SMARTKEY	SHORTED	145.00	145.00
1	REAR END PANEL	BADLY DENTED	598.50	598.50
1	REAR END PANEL TOP GARNISH	CRACKED	152.50	152.50
2	TAILLAMPS @\$425.00	CRACKED	850.00	850.00
2	TAILLAMP HOUSING PANELS @\$255.00	BENT	510.00	510.00
2	REAR FENDERS @\$891.00	O/S BUCKLED / N/S TO REPAIR SEE LABOUR	1,782.00	891.00

Report Ref No. CS/TP19019686/Usd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR FENDER INNER TRIMS @\$242.00	DEFORMED / TORN	484.00	484.00
1	SET REAR FENDER INNER TRIM CLIPS	NECESSARY	50.00	50.00
1	REAR FLOOR PANEL	CRUMPLED / BUCKLED	1,120.00	1,120.00
1	REAR FLOOR PANEL TOP BOARD	WARPED	399.00	399.00
1	REAR EXHAUST	TO REPAIR SEE LABOUR	675.00	-
1	REAR EXHAUST HEAT SHIELD	BENT	112.00	112.00
1	REAR WINDSCREEN MOULDING	NECESSARY	78.50	78.50
1	REAR CHASSIS MEMBER O/S	TO REPAIR SEE LABOUR	645.00	-
1	REAR WHEEL HOUSING PANEL O/S	TO REPAIR SEE LABOUR	911.00	-
1	FRONT BUMPER	DEFORMED / TORN	639.00	639.00
1	SET FRONT BUMPER CLIPS	NECESSARY	45.00	45.00
2	FRONT BUMPER SIDE RETAINERS @\$25.00	BENT	50.00	50.00
1	FRONT BUMPER SPONGE	TORN	84.00	84.00
1	FRONT BUMPER REINFORCEMENT	BENT	496.00	496.00
2	FRONT BUMPER REINFORCEMENT BRACKETS @\$65.00	NOT NECESSARY	130.00	-
1	FRONT BUMPER CENTRE GRILLE	CRACKED	228.00	228.00
2	FRONT BUMPER LAMPS @\$303.00	SERVICEABLE	606.00	-
2	FRONT BUMPER FOG LAMPS GRILLE @\$241.00	O/S TORN	482.00	241.00
1	FRONT BUMPER LOGO	NECESSARY	45.00	45.00
1	FRONT GRILLE	CRACKED	328.00	328.00
1	FRONT GRILLE CHROME MOULDING	SCRATCHED	118.00	118.00
2	HEADLAMPS @\$2209.00	CRACKED	4,418.00	4,418.00
1	FRONT SUPPORT PANEL	NOT NECESSARY	675.00	-
1	FRONT LICENCE PLATE GARNISH	NOT NECESSARY	28.00	-
1	FRONT SUPPORT PANEL TOP GARNISH	NOT NECESSARY	66.50	-
1	BONNET	TO REPAIR SEE LABOUR	835.00	-
1	AIR CON CONDENSER	NOT NECESSARY	689.00	-
1	RADIATOR	NOT NECESSARY	939.00	-
	LESS 10% DISCOUNT		-	-1,802.91
			25,667.80	16,226.19
	SPECIAL NETT ITEMS			
4	REAR BUMPER PDC SENSORS (SN)	SHORTED (1 SET ONLY)	780.00	200.00

Report Ref No. CS/TP19019686/Usd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR LICENCE PLATE W/HOLDER (SN)	SERVICEABLE	50.00	-
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00
1	SET REAR FLOOR PANEL INSULATOR (SN)	NECESSARY	180.00	100.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
1	FRONT LICENCE PLATE W/HOLDER (SN)	BENT	50.00	40.00
1	BOL RADIATOR COOLANT (SN)	NOT NECESSARY	50.00	-
			1,210.00	430.00
	LABOUR			
	TO CHECK WIRING.		80.00	30.00
	TO DISMANTLE & REPLACING REVERSE SENSOR.		80.00	50.00
	TO DISMANTLE & REFIX REAR EXHAUST.		100.00	60.00
	TO DISMANTLE & REFIX REAR WINDSCREEN.		150.00	120.00
	TO DISMANTLE & REFIX PETROL TANK.		100.00	60.00
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY.		120.00	100.00
	TO STRAIGHTEN CHASSIS ALIGNMENT.		380.00	300.00
	TO SPRAY RUST PROOFING.		150.00	120.00
	TO REFILL AIR CON GAS.	NOT NECESSARY	150.00	-
	LABOUR FOR PANEL BEATING & REPLACING PARTS.INCLUSIVE OF THE REPAIR OF N/S REAR FENDER,REAR EXHAUST,REAR CHASSIS MEMBER O/S,REAR WHEEL HOUSING PANEL O/S AND BONNET.		3,200.00	2,600.00
	TO PUTTY & SPRAY PAINTING.		2,500.00	2,000.00
			7,010.00	5,440.00
GRAND TOTAL			33,887.80	22,096.19
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				17,500.00

Report Ref No. CS/TP19019686/Usd3n2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.