

ASS. REC. BY:

REF: CS/INC/9021338/Kvd3n2 Special Instruction:

Summary: Kenneth

ASSIGNMENT (Office)

From (Person): Annie Koh of INC Date/Time: 9:49am 31/12/19

Estimated Cost: Bill to:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV/CS

To Inspect Vehicle No: SKZ 5688R Insured: 84D1835K

at Workshop m/s Autoworx House Tel: 6452 8211

of 176 Sin Ming Drive # 02-01

Policy No: Claim No: MT/1073833-002

Sum Insured: Excess:

Make of Veh: D.O.A. 29/11/19
(Client's Record)

CA / REV / REP. / REV 24 HRS wp? H.O.D. Endorsement:

Date/Time: 10:02am 31/12/19 Person Contacted: Yulci / Winnie Vehicle: IN/OUT

Date/Time Action/Instruction Johnnie ✓

SKZ 5688R - X

84D1835K-CC3/CTI/19016759/Klk63 DoA: 20/11/19

26/12 61 Lm @ 4950k email

31/12000 LS \$5600 confirmed by email (Recd 8105.60, 59%)

ASS. REG. BY

REF: INC

ASSIGNMENT

From:

Date: 31/12/19

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

SKZ 5688R

at Workshop n/s

Autoworx House

of 176 Sin Ming Drive #02-01

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

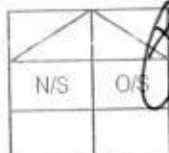

Bal. or Market Value:

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 806 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Inp

Vehicle: IN / OUT

Date: Person Contacted:

Veh No:

SKZ 5688R

Yr Regn: 10, 15

Type: ☒ M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

NIS Qashqai

C.C.

1197

Colour:

M. Blue

A/C:

Insured / Std / NI / NA

Sp. Reading:

78985

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

STNFEAT/11488152

Gen. Cond: ☒ Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

215/60R17

R:

BS: ☒ DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

7

mm

R/Bal.

6

mm

L/Bal.

7

mm

L/Bal.

6

mm

D.O.A.

29/11/19

D.O.I.

31/12/19

11.04 am

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

O/S on body & etc

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

RECEIVED 06 JAN 2020

Date/Time, File Pass to?

☐

Preli. Report

1)

☐

Final Report

Date/Time, File Return to?

2) 31- typist

Report Format:

TP

Lump Sum / L&M:

5600/2

Days Of Repair: 6

Resurvey No. of Trip: 2

Add Fee:

☐

Site Insp (\$)

☐

Interview (\$)

☐

Tech. Invs (\$)

☐

Week end (\$)

Survey Fee:

Transportation:

S+RS: \$1

Photos:

Others:

TOTAL

250

Nivitha (LKK Auto)

From: Annie Koh <annie.koh@income.com.sg>
Sent: Tuesday, 3 December 2019 9:56 AM
To: 'assignments@lkkauto.com'; Admin-D (LKKAuto)
Subject: RE: TP CASES FARMED OUT TO LKK ON 03/12/2019

Re-send

Warmest Regards

Annie Koh
Senior Admin,
Operations, Motor & Personal Lines (PL)
T +65 64307899
www.income.com.sg



From: Annie Koh
Sent: Tuesday, 3 December 2019 9:48 AM
To: 'assignments@lkkauto.com' <assignments@lkkauto.com>; 'Admin-D (LKKAuto)' <admin-d@lkkauto.com>
Cc: Thio Tse Kiat <tsekiat.thio@income.com.sg>; Teng Ken Leong <kenleong.teng@income.com.sg>
Subject: RE: TP CASES FARMED OUT TO LKK ON 03/12/2019

Dear LKK,

Please assist to survey the following vehicles as per Mr Teng's instruction :-

SN	Surveyor	Claim No.	Appt Type	Survey Date	Vehicle	WorkShop Name	WorkShop Address	WorkShop Contact	Survey Type	Survey Time	S/E	Zone	Additional Remarks
----	----------	-----------	-----------	-------------	---------	---------------	------------------	------------------	-------------	-------------	-----	------	--------------------

1	Charlotte Chew	MT/1073833-002	TP	3/12/2019	SKZ5688R	AUTOWORK HOUSE	176 SIN MING DRIVE #02-01 SIN MING AUTOCARE SINGAPORE 575721	WK Chew / 64528211	Physical Survey	SHD1835K	29/11/19	
2	Serene Lim	MT/1073937-001	TP	3/12/2019	SGT6769M	BCC AUTOMOTIVE PTE LTD	BLK 1 #01-101 SIN MING INDUSTRIAL EST SECTOR C SINGAPORE 575636	Christina Lim / 6552 5588	Physical Survey	SMN5903J	30/11/19	
3	Chester Chong	MT/1073992-001	TP	3/12/2019	SJV9205H	LEONG AUTO PTE LTD	160 SIN MING DRIVE #02-13 SIN MING AUTOCITY	Shawn Chen / 9692 4113	Physical Survey	SJS3946H	30/11/19	
4	Chryllis Quah	MT/1067684-002	TP	3/12/2019	FQ4656X	LIM SIANG CHOW AUTO SERVICE	160 SIN MING DRIVE #05-20 SINGAPORE 575722	Peter /Samantha / 65527761	Physical Survey	SLL4738Z	20/10/19	
5	Muhammad Airwan	MT/1073928-001	TP	3/12/2019	SMH5233R	LIM SIANG CHOW AUTO SERVICE	160 SIN MING DRIVE #05-20 SINGAPORE 575722	Peter /Samantha / 65527761	Physical Survey	SLV3142X	30/11/19	
6	Azhari	MT/1073919-001	TP	3/12/2019	SKC2460X	VIN'S AUTOMOTIVE GROUP	160 SIN MING DRIVE #08-09 SIN MING DRIVE SINGAPORE 575722	Raymond Teo / 64532121	Physical Survey	SIL5500J	29/11/19	
7	Chester Chong	MT/1073520-002	TP	3/12/2019	SJV4174X	RYDER AUTO PTE LTD	2 KAKI BUKIT AVE 2 #02-19 AUTOHUB @ KAKI BUKIT SINGAPOR 417921	Mr Orson / 90908277	Physical Survey	SLL9679C	28/11/19	97924673 Mr Chan

Please contact workshops.

Please revert to officer-in-charge after survey.

Thank you.

Annie Koh
Senior Admin Assistant, Motor Insurance
T +65 6430 7899
www.income.com.sg

income
made different



Disclaimer

This e-mail contains privileged or confidential information which is intended only for the use of the recipient(s) named above. If you have received this message in error, please notify the sender immediately and delete all copies of it. Thank you.

Veron Chen (LKKAUTO)

From: Veron Chen (LKKAUTO)
Sent: Friday, 3 January 2020 5:15 PM
To: claim.autoworxhouse@gmail.com; SUR
Subject: RE: SKZ 5688R-DOA: 29/11/2019

Dear Winnie,

Noted with thanks.

Kindly send Final invoice and all supporting documents directly to NTUC INCOME

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: claim.autoworxhouse@gmail.com <claim.autoworxhouse@gmail.com>
Sent: Friday, 3 January 2020 5:07 PM
To: Veron Chen (LKKAUTO) <veronchen@lkkauto.com>
Subject: RE: SKZ 5688R-DOA: 29/11/2019

Dear Veron,

We accept your offer of \$5,600/--, 6 repair days.
Thank you.

Best regards,
Ms. Lee
Autoworx House
No.176 Sin Ming Drive
#02-01 Singapore 575721
Tel: 96725547 / 87668115
Fax: 64517423

From: Veron Chen (LKKAUTO) <veronchen@lkkauto.com>
Sent: Friday, January 3, 2020 12:47 PM
To: claim.autoworxhouse@gmail.com; SUR <sur@lkkauto.com>
Subject: RE: SKZ 5688R-DOA: 29/11/2019

Dear Winnie,

WITHOUT PREJUDICE

Check with surveyor's remain at 6 working days.

Please confirm.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: claim.autoworxhouse@gmail.com <claim.autoworxhouse@gmail.com>

Sent: Friday, 3 January 2020 10:42 AM

To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>

Subject: RE: SKZ 5688R-DOA: 29/11/2019

Dear Veron,

We accept your offer for COR \$5,600.00/--.
However, we would like to request for 8 working days.
Thank you.

Best regards,

Ms. Lee

Autoworx House

No.176 Sin Ming Drive

#02-01 Singapore 575721

Tel: 96725547 / 87668115

Fax: 64517423

From: Veron Chen (LKKAuto) <veronchen@lkkauto.com>

Sent: Friday, January 3, 2020 9:56 AM

To: claim.autoworxhouse@gmail.com; SUR <sur@lkkauto.com>

Subject: SKZ 5688R-DOA: 29/11/2019

Dear Winnie,

WITHOUT PREJUDICE

Confirmed Lump Sum \$5600/- @ 6 working days

Kindly send Final invoice and all supporting documents directly to NTUC INCOME

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	30/11/2019 13:22
Date Of Accident	29/11/2019 23:40
Exact Location Of Accident	ALONG BLK 177 BISHAN ST. 13 CARPARK
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKZ5688R
Insured/Policyholder	
Name Of Registered Owner	LIM JIEW LIANG
NRIC No	S7238334F
Email Address	LIMJIEWLIANG@HOTMAIL.COM
Mobile Phone No	(LOCAL) +65-96552632
Alternative Phone No	OTHERS-96552632

Vehicle Particulars

Manufacturer	NISSAN
Model	QASHQAI-1.2 DIG-T (A)

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? YES

If No, Please state action to be taken

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	2100435286-04
Cover Note Number	

Driver

Name of Driver	LIM JIEW LIANG
NRIC No	S7238334F
Date Of Birth	17/10/1972
Occupation	INDOOR
Date Of Driving Pass	10/06/1992
Driving Experience	27 YEARS AND 5 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-96552632
Fax Number	
Contact Number	OTHERS-96552632
Email Address	LIMJIEWLIANG@HOTMAIL.COM

Address	7 SIN MIN WALK #05-15
Postcode	575577
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - CHANGE/CROSS LANE
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : YI WEN GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

SEE ATTACHED SKETCH PLAN

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SHD1835K
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	TAXI
Name of Driver	LIM KEK BOK
NRIC/Passport Number	S0068868A
Contact Number	93759722
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders


Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name: *Nishah*
NRIC/FIN No.: *51660822/2*

TAN CHONG MOTOR SALES PTE LTD
17 Toa Payoh Lorong 8
Singapore 319254
Tel: 6357 0756 Fax: 6356 4922

SKETCH PLAN

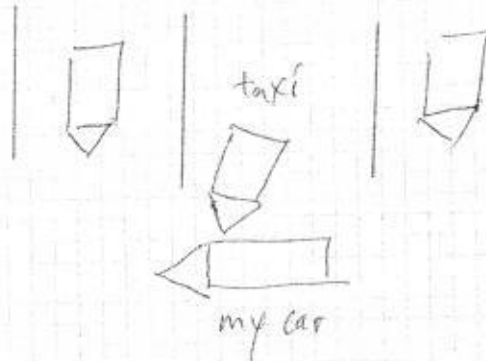

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I was driving along B/K 177, Bishan St. 13 carpark with the intention of dropping my friend. Suddenly, out of no way, one car drove out from the parking lots and hit my car on the right side. At first period of time, the impact was very great and it was so sudden. Both my friend and me are shocked. The car (taxi S/KD1835K) did not even switch on the headlight when he was driving out from the parking lot.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:
30/11/19 10.44pm

Driver's Signature
(If driver is not the policyholder)
Date & Time:

TAN CHONG MOTOR SALES PTE LTD
17 Teo Payoh Lorong 8
Singapore 319254
Tel: 6357 0756 Fax: 6356 4922

Reporting Centre Personnel's Signature
Name: Aishah
NRIC/FIN No.: S1660822/2

Work Order:

R035457

VIN:

SKZ5688R

Year:

16

Date

10.12.19 18:12



SKZ5688R

Nissan/Datsun : Qashqai J11 4X2 R.Beam 16,17" (Modified Specification)

Front : Left

Actual	Before	Specified Range
-0°40'	-0°41'	-1°15' 0°15'
5°57'	5°57'	4°40' 6°10'
0°01'	-0°04'	-0°02' 0°02'
10°59'	11°00'	10°00' 11°30'
10°18'	10°18'	8°45' 11°45'

Camber
Caster
Toe
SAI
Included Angle
Turning Angle Diff.

Front : Right

Actual	Before	Specified Range
-1°05'	-1°02'	-1°15' 0°15'
5°12'	5°12'	4°40' 6°10'
0°00'	-0°21'	-0°02' 0°02'
11°09'	11°06'	10°00' 11°30'
10°04'	10°04'	8°45' 11°45'

Front

Cross Camber
Cross Caster
Cross SAI
Total Toe
Cross Turn Diff.

Actual	Before	Specified Range
0°24'	0°21'	-0°36' 0°36'
0°45'	0°45'	-0°36' 0°36'
-0°10'	-0°07'	
0°00'	-0°26'	-0°05' 0°05'

Rear : Left

Actual	Before	Specified Range
-1°28'	-1°25'	-2°00' -1°00'
-0°06'	-0°06'	0°01' 0°25'

Camber
Toe

Rear : Right

Actual	Before	Specified Range
-1°18'	-1°18'	-2°00' -1°00'
0°16'	0°17'	0°01' 0°25'

Rear

Cross Camber
Total Toe
Thrust Angle

Actual	Before	Specified Range
-0°10'	-0°07'	
0°10'	0°10'	0°02' 0°50'
-0°11'	-0°12'	

AUTOWORX HOUSE

176 SIN MING DRIVE #02-01 SINGAPORE 575721
TEL: 6452 8211 FAX: 6451 7420

ESTIMATE

LIM JEW LIANG
c/o 46 Lenton Plain
Singapore 786548

Date: 3/12/2019

QUANTITY	PARTICULARS	AMOUNT (\$)
RE: NISSAN QAHQAI / SKZ 5688 R		
1 pc	front fender	567.40
1 pc	front fender dust cover 210.	263.60
1 pc	front door	876.40
1 pc	front door weather rubber strip 168-705m	337.40
1 pc	rear door	855.30
1 pc	front shock absorber top mount	215.30
1 pc	front steering tie rod 162.20	325.30
1 pc	front steering tie rod end 168-10	263.50
1 pc	front anti roll bar linkage	275.60
sub-total		3,979.80
less 30%		1193.94
sub-total (a)		2785.86
1 pc	front fender arch protector	326.10
12 pcs	front fender dust cover clip	34.80
1 pc	front door glass regulator 456.4	485.50
1 pc	front door upper hinge	163.40
1 pc	front door lower hinge	163.40
1 pc	front door outer sticker 1	76.50
1 pc	front door outer sticker 2	67.40
1 pc	front door lower protector	274.30
1 pc	front door linkage stopper	226.10
1 pc	front A pillar outer panel	586.50
1 pc	rear fender arch protector	326.10
1 pc	rear door lower protector	326.10
1 pc	rear door outer sticker 1	76.50
1 pc	rear door outer sticker 2	55.30
sub-total		3188.00

	balance brought forward.			3188.00	
1 pc	front lower arm	489.00	nett	Dr 575.40	✓
1 pc	front knuckle arm	395.30	nett	B 447.30	✓
1 pc	front wheel hub		nett	B 322.70	✓
1 pc	front wheel bearing		nett	Dr 326.30	✓
1 pc	front shock absorber		nett	B 552.60	✓
1 pc	front steering power rack		nett	R 2326.30	✓
			sub-total	7738.60	
			less 10%	773.86	
			sub-total (b)	6964.74	
1 pc	tyre 215/60R17		s.nett	13450 Pr 220.00	70300
1 pc	alloy rim	Pr?	s.nett	Dr 650.00	✓
	To remove and replace the parts mentioned above, panel beat and realign the necessary affected areas.			5500 1200.00	✓
	To check wiring system.			50.00	200
	To apply rust proofing on affected areas.			100.00	600
	To apply waterproof sealant on affected areas.			nn 100.00	X
	To remove and install front undercarriage parts to enable repair.			300.00	2000
	To perform 4 wheels computerised alignment.			85.00	600
	To apply putty and spray painting on affected areas.			1,050.00	600
	To change tyre(s) and perform wheel(s) balancing.			40.00	200
	To transfer 2 door(s) accessories.			160.00	600
			total	13,705.60	

LKK Auto Computers & Services notify the Reparer of the following:

- To survey before starting repair
- To discuss and agree the estimated survey
- Parts must be replaced on a "like for like" basis
- The work must be carried out on a "no fault" basis
- No hidden charges
- Free estimate and quotation

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

DAMAGE ASSESSMENT REPORT

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: CS/INC19021338/Kvd3n2
73 BRAS BASAH ROAD Date: 09-01-2020
#05-01 NTUC TRADE UNION HOUSESINGAPORE
189556



ATTN: CHARLOTTE CHEW

Code: INC

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHD 1835K	Veh. Inspected	SKZ 5688R
Policy No.		Coverage (\$)	0.00
Claim No.	MT/1073833-002	Excess (\$)	0.00
Assign From	ANNIE KOH	Assign Date	03/12/2019

2. Vehicle Particulars & Condition

Make & Model	NISSAN QASHQAI (A)	c.c	1197
Engine No.	HIDDEN	Year of Reg.	2015
Chassis No.	SJNFEAJ11U1488152	Colour	METALLIC BLUE
Odometer	78985 KM	Steering	JAMMED
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/60 R17	DUNLOP	7 mm
L/H Front Tyre	215/60 R17	DUNLOP	7 mm
R/H Rear Tyre	215/60 R17	DUNLOP	6 mm
L/H Rear Tyre	215/60 R17	DUNLOP	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT BODY AND UNDERCARRIAGE. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	29/11/2019	Inspect Date / Time	03/12/2019 (11:04 AM)
Survey held at	AUTOWORX HOUSE 176 SIN MING DRIVE #02-01 SINGAPORE 575721		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	6 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKZ 5688R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FRONT FENDER	BENT	567.40	567.40
1	FRONT FENDER DUST COVER	CRACKED	263.60	210.00
1	FRONT DOOR	BENT	876.40	876.40
1	REAR DOOR	TO REPAIR SEE LABOUR	855.30	-
1	FRONT SHOCK ABSORBER TOP MOUNT	BENT	215.30	215.30
1	FRONT STEERING TIE ROD	DISTORTED	325.30	162.20
1	FRONT STEERING TIE ROD END	DISTORTED	263.50	168.10
1	FRONT ANTI ROLL BAR LINKAGE	BENT	275.60	275.60
	LESS 30% DISCOUNT		-1,092.72	-742.50
			2,549.68	1,732.50
1	FRONT DOOR WEATHER STRIP STRIP (50%)(SN)	CUT	337.40	168.70
	LESS 30% DISCOUNT		-101.22	-
			236.18	168.70
NETT ITEMS				
1	FRONT FENDER ARCH PROTECTOR (N)	DISTORTED	326.10	326.10
12	FRONT FENDER DUST COVER CLIP @\$2.90 (N)	NECESSARY	34.80	34.80
1	FRONT DOOR GLASS REGULATOR (N)	DISTORTED	485.50	456.00
1	FRONT DOOR UPPER HINGE (N)	TO REPAIR SEE LABOUR	163.40	-
1	FRONT DOOR LOWER HINGE (N)	TO REPAIR SEE LABOUR	163.40	-
1	FRONT DOOR OUTER STICKER 1 (N)	NECESSARY	76.50	76.50
1	FRONT DOOR OUTER STICKER 2 (N)	NECESSARY	67.40	67.40
1	FRONT DOOR LOWER PROTECTOR (N)	DENTED	274.30	274.30
1	FRONT DOOR LINKAGE STOPPER (N)	SERVICEABLE	226.10	-
1	FRONT A PILLAR OUTER PANEL (N)	TO REPAIR SEE LABOUR	586.50	-
1	REAR FENDER ARCH PROTECTOR (SCRATCHED)(N)	NOT CONSISTENT WITH THE IMPACT	326.10	-
1	REAR DOOR LOWER PROTECTOR (N)	SERVICEABLE	326.10	-

Report Ref No. CS/INC19021338/Kvd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR DOOR OUTER STICKER 1 (N)	NOT NECESSARY	76.50	-
1	REAR DOOR OUTER STICKER 2 (N)	NOT NECESSARY	55.30	-
1	FRONT LOWER ARM (N)	DISTORTED	575.40	489.00
1	FRONT KNUCKLE ARM (N)	BENT	447.30	395.30
1	FRONT WHEEL HUB (N)	BENT	322.70	322.70
1	FRONT WHEEL BEARING (N)	NECESSARY	326.30	326.30
1	FRONT SHOCK ABSORBER (N)	BENT	552.60	552.60
1	FRONT STEERING POWER RACK (N)	TO REPAIR SEE LABOUR	2,326.30	-
	LESS 10% DISCOUNT		-773.86	-332.10
			6,964.74	2,988.90
	SPECIAL NETT ITEMS			
1	TYRE 215/60R17 (70%)(SN)	PUNCTURE	220.00	154.00
1	ALLOY RIM (SN)	DENTED	650.00	400.00
			870.00	554.00
	LABOUR			
	TO REMOVE AND REPLACE THE PARTS MENTIONED ABOVE, PANEL BEAT AND REALIGN THE NECESSARY AFFECTED AREAS. INCLUSIVE OF THE REPAIR OF REAR DOOR, FRONT DOOR UPPER HINGE, FRONT DOOR LOWER HINGE, FRONT A PILLAR OUTER PANEL AND FRONT STEERING POWER RACK.		1,200.00	550.00
	TO CHECK WIRING SYSTEM.		50.00	20.00
	TO APPLY RUST PROOFING ON AFFECTED AREAS.		100.00	60.00
	TO APPLY WATERPROOF SEALANT ON AFFECTED AREAS.	NOT NECESSARY	100.00	-
	TO REMOVE AND INSTALL FRONT UNDERCARRIAGE PARTS TO ENABLE REPAIR.		300.00	200.00
	TO PERFORM 4 WHEELS COMPUTERISED ALIGNMENT.		85.00	60.00
	TO APPLY PUTTY AND SPRAY PAINTING ON AFFECTED AREAS.		1,050.00	600.00
	TO CHANGE TYRE (S) AND PERFORM WHEEL (S) BALANCING.		40.00	20.00
	TO TRANSFER 1 DOOR (S) ACCESSORIES.		160.00	60.00
			3,085.00	1,570.00

Report Ref No. CS/INC19021338/Kvd3n2



GRAND TOTAL		13,705.60	7,014.10
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)			5,600.00

Report Ref No. CS/INC19021338/Kvd3n2

KONG SENG CHEONG

Licensed Appraiser

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,
MinstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.
No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report in whole or in part, does so at his or her own risk.