


REF: CC4/AIG 20005639/Bka3
 Km
 Khanchua

ASSIGNMENT

Date: 11/5/2020
 To inspect Vehicle No: GBG 7556G
 at Workshop m/s Dean Autopro
 of 160 Sin Ming Dr. #81-14
 Insured:
 Policy No.
 Claims No.
 Sum Insured: Excess:
 (Client's Record)
 Make of Veh:

Veh No: GBG 7556G Yr Regn: 24/10/2017
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or
 Make: Hyundai H/Starex C.C. 2427
 Colour: Silver A/C: Insured / Std / NI / NA
 Sp. Reading: 36702 T/Radio: Insured / Std / NI / NA
 Eng/No: D4CBG053233
 C/No: KMFNBX7KLHU347613
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: Inorder / Jammed / Leaked / Burnt or
 Brake: Inorder / Jammed / Leaked / Burnt or
 Modi: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: 215/70/16 FALKEN
 R: 215/70/16 INEXEN

(Policy Condition)
 Remark: The veh had commenced its repair at the time of inspection.

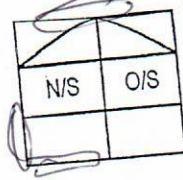

Bal. or Market Value: 48,000 plus body
 IDAC Accident Rpt: Consistent? : Yes or No
 GIA / PR Seen: Consistent? : Yes or No
 Est. Repairs: 14 days Res.: Yes or No
 Lum Sum: % 3 Val.: Yes or No

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or FRI FALKEN / REAR NEXEN
 Front
 R/Bal. 6 mm R/Bal. 6 mm
 L/Bal. 6 mm L/Bal. 6 mm
 D.O.A. 8/5/2020 D.O.I. 11/5/2020
 Survey held at Dean Autopro
 Des. of Damages: Frt / Rear / D/S / N/S / U/C / Rooftop or

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: Person Contacted:

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	In view of the COR being at \$15800/2 lump sum. 1/5 repair requested by workshop.
	Recommendation for COR is at NV \$9362/2 with 14 repair days.
	Lump 16,150/2
	MV 48,000/2 plus body
	PV 38,638/2
	NV 9,362/2

Date/Time, File Pass to? ☐ : Preli. Report
☐ : Final Report

Days Of Repair:
 Resurvey No. of Trip:

Add Fee: ☐ : Site Insp (\$)
☐ : Interview (\$)
☐ : Tech. Invs (\$)
☐ : Weekend (\$)

Survey Fee:
 Transportation: S + RS \$
 Photos
 Others
 TOTAL

Rep. Format:
 Lump Sum / L.B.F. ()

SJE : _____
 Date of Survey : _____
 Date of ReSurvey: _____ After-Paint: _____
 Contacts : _____

Vehicle Nos : **GB67556 G**
 Model : Hyundai H1
 Year : _____
 Chassis No : _____

*** AGREED Cost Of Repair and Repair Day/s with SJE ***

Amount: _____

Working Day: _____

2017

Nos.	PARTS	Qty	Unit S\$	TOTAL S\$	
1	Tailgate LH	1	\$ 2,108.30	\$ 2,108.30	DDV ✓
2	Tailgate emblem 'Hyundai'	1	\$ 78.20	\$ 54.00 78.20	NECV ✓
3	Tailgate outer garnish	1	\$ 132.50	\$ 132.50	CuTV ✓
4	Tailgate inner trim board	1	\$ 253.10	\$ 253.10	NDX ✓
5	Tailgate inner handle	1	\$ 45.00	\$ 45.00	JMV ✓
6	Tailgate lock assy	1	\$ 128.30	\$ 128.30	JMV ✓
7	Tailgate Lower Lock	1	\$ 104.80	\$ 104.80	JMV ✓
8	Tailgate outer lock handle	1	\$ 325.60	\$ 325.60	NSX ✓
9	Tailgate charker LH	1	\$ 140.00	\$ 80.00 280.00	BTJ ✓
10	Tailgate hinge	2	\$ 183.90	\$ 187.00 367.80	BTJ ✓
11	Tailgate sticker	1	\$ 65.00	\$ 20.00 65.00	NECV ✓
12	Tailgate weatherstrip <i>Left hand door Tailgate</i>	1	\$ 385.30	\$ 145.00 385.30	CuTV ✓
13	Rear windscreen	1	\$ 842.30	\$ 842.30	BRV ✓
14	Rear windscreen moulding	1	\$ 214.00	\$ 214.00	NECV ✓
15	Weatherstrip <i>Tailgate</i>	1	\$ 415.30	\$ 187.50 415.30	CuTV ✓
16	Rear no plate lamp	2	\$ 74.30	\$ 148.60	NDX ✓
17	Rear bumper	1	\$ 388.30	\$ 388.30	BRV ✓
18	Rear bumper side retainer	2	\$ 65.30	\$ 130.60	NECV ✓
19	Rear bumper bracket	1	\$ 85.25	\$ 85.25 255.75	BRV ✓
20	Rear bumper reflector	1	\$ 283.60	\$ 58.50 567.20	BRV ✓
21	Rear bumper reinforcement	1	\$ 652.30	\$ 347.80 652.30	DDV ✓
22	Rear bumper inner sponge	1	\$ 204.30	\$ 114.30 204.30	BRV ✓
23	Rear fender LH	1	\$ 1,873.60	\$ 1433.00 1,873.60	DDV ✓
24	Rear fender inner trim board	1	\$ 214.30	\$ 214.30	NSX ✓
25	Rear fender inner cowling LH	1	\$ 385.00	\$ 198.00 385.00	TN ✓
26	Rear air vents LH	1	\$ 250.00	\$ 150.00 250.00	BRV ✓
27	Rear end panel	1	\$ 842.60	\$ 680.00 842.60	DDV ✓
28	Rear end panel top garnish	1	\$ 210.50	\$ 210.50	DIS ✓
29	Taillamp LH	1	\$ 488.50	\$ 488.50	BRV ✓
30	Taillamp base panel (outer) LH	1	\$ 652.00	\$ 652.00	BRV ✓
31	Taillamp base panel (inner) LH	1	\$ 458.60	\$ 458.60	DDV ✓
32	Taillamp lower garnish LH	1	\$ 71.90	\$ 71.90	NSX ✓
33	Taillamp bracket LH	1	\$ 64.80	\$ 64.80	BRV ✓
34	Taillamp lower garnish retainer	1	\$ 68.00	\$ 68.00	NECV ✓
35	Rear Side Panel (Outer) LH	1	\$ 691.20	\$ 691.20	BRV ✓
36	Rear Side Panel (Inner) LH	1	\$ 874.30	\$ 874.30	DD ✓
37	Rear Side Panel Inner Trimboard LH	1	\$ 1,352.60	\$ 1,352.60	NSX ✓
38	Rear Side Inner Lower Panel LH	1	\$ 652.30	\$ 652.30	NDX ✓
39	Rear Side Lower Corner Inner Panel LH	1	\$ 384.60	\$ 384.60	DDV ✓
40	Front bumper	1	\$ 953.60	\$ 423 953.60	BRV ✓
41	Front bumper lower	1	\$ 753.90	\$ 355.00 753.90	BRV ✓
42	Front bumper side retainer	2	\$ 87.90	\$ 175.80	NECV ✓
43	Front bumper reinforcement	1	\$ 428.70	\$ 320.00 428.70	BTJ ✓

44	Front bumper inner sponge	1	\$	210.50	\$175.00	210.50	BR ✓
45	Front grille	1	\$	472.30	\$424.00	472.30	DL ✓
46	Front grille logo	1	\$	85.00	\$35.00	85.00	UTV ✓
47	Front grille outer chrome garnish	1	\$	241.00	\$	✓ 241.00	UTV ✓
48	Front fog lamp LH	1	\$	250.00	\$	✓ 250.00	UTV ✓
49	Front fog lamp outer garnish	1	\$	581.30	\$	581.30	NSX
50	Headlamp LH	1	\$	1,182.30	\$	✓ 1,182.30	BR ✓
51	Bonnet	1	\$	1,402.50	\$1345.00	1,402.50	DD ✓
52	Bonnet inner lock	1	\$	357.60	\$	357.60	} NDX
53	Bonnet inner rubber	1	\$	210.00	\$	210.00	
54	Front support panel	1	\$	1,472.50	\$	1,472.50	NDX
55	Front fender LH	1	\$	NN 987.20	\$556.00	987.20	BT ✓ X
				Parts Sub Total :	\$	27,391.55	
				20% Discount:	\$	5,478.31	
				PARTS TOTAL :	\$	21,913.24	

17,739.65
3547.93
14,191.72

Nos.	SPECIAL NETT	Qty	Unit S\$	TOTAL S\$		
1	Sundries	1	\$	80.00	80.00	NNX
2	Tailgate sealant	1	\$	80.00	80.00 30.00	NECV ✓
3	Tailgate inner trim board clips	1	\$	50.00	50.00	} NNX
4	Tailgate outer garnish clips	1	\$	50.00	50.00	
5	Tailgate sticker '70km/h'	1	\$	30.00	30.00 20.00	NECV ✓
6	Rear windscreen inner seal	1	\$	180.00	180.00 80.00	NECV ✓
7	Rear windscreen primer and cleaner	1	\$	80.00	80.00	NNX
8	Rear windscreen sealant	1	\$	120.00	120.00 40.00	NECV ✓
9	Rear bumper clips	1	\$	50.00	50.00 30.00	NECV ✓
10	Rear bumper reverse sensor	2	\$	250.00	500.00 200.00	SCV ✓
11	Rear fender sealant	1	\$	80.00	80.00 40.00	NECV ✓
12	Rear fender inner trim board clips	1	\$	50.00	50.00 30.00	} NECV ✓
13	Rear fender inner cowling clips	1	\$	50.00	50.00 30.00	
14	Rear end panel sealant	1	\$	80.00	80.00 40.00	} NEC ✓
15	Rear end panel top garnish clips	1	\$	50.00	50.00 30.00	
16	Taillamp seal	1	\$	60.00	60.00	NNX
17	Taillamp clips	1	\$	50.00	50.00	NNX
18	Rear Side Panel (Outer) sealant LH	1	\$	80.00	80.00	NNX
19	Rear Side Panel (Inner) sealant LH	1	\$	80.00	80.00 30.00	NECV ✓
20	Rear Side Panel Inner Trimboard sealant LH	1	\$	80.00	80.00	NNX
21	Rear Side Inner Lower Panel Sealant LH	1	\$	80.00	80.00 30.00	} NECV ✓
22	Rear Side Lower Corner Inner Panel sealant LH	1	\$	80.00	80.00 30.00	
23	Rear no plate w/cowling	1	\$	80.00	80.00 50.00	BT ✓
24	Front bumper clips	1	\$	50.00	50.00 30.00	NECV ✓
25	Front bumper lower clips	1	\$	50.00	50.00 30.00	NECV ✓
26	Front no plate w/cowling	1	\$	80.00	80.00 50.00	DD ✓
27	Front grille clips	1	\$	50.00	50.00 30.00	NECV ✓
28	Front fog lamp outer garnish clips	1	\$	50.00	50.00	NSX
29	Bonnet sealant	1	\$	80.00	80.00 30.00	NECV ✓
30	Bonnet inner rubber clips	1	\$	50.00	50.00	NNX
31	Front fender Sealant	1	\$	80.00	80.00 30.00	NECV ✓
32	Rear floor board	1	\$	800.00	800.00	} NNX
33	Radiator coolant	1	\$	80.00	80.00	
34	A/c fluid	1	\$	80.00	80.00	
SPECIAL NETT TOTAL :				910.00 3,100.00		

Nos.	LABOUR	S\$	
1	R&R Rear windscreen	\$180.00	200.00 ✓
2	R&R reverse sensor	\$60.00	100.00 ✓
3	R&R tailgate component	\$80.00	150.00 ✓
4	R&R rear floor board	\$	100.00 NNX
5	R&R Rear fuel tank pipe	\$80.00	150.00 ✓
6	Check wiring	\$50.00	100.00 ✓
7	Panel beat Rear	\$2,000.00	2,400.00 ✓
8	Spray paint Rear	\$1,000.00	2,000.00 ✓
9	Rust proofing	\$60.00	200.00 ✓
10	R&R upholstery	\$	200.00 NNX
11	R&R rear silding door	\$80.00	150.00 ✓
12	Panel beat Front	\$800.00	1,400.00 ✓
13	Spray paint Front	\$800.00	1,400.00 ✓
14	R&R radiator	\$	150.00 } NNX
15	R&R a/c condenser	\$	150.00 }
16	Diagnostic reset fault code	\$	180.00 }
LABOUR TOTAL :		\$5,110.00	9,030.00

Survey 11/5/2020 Resurvey 12/5/2020
 TGM lin TGM lin
 1500hrs 1410hrs

PARTS TOTAL : \$ 21,913.24
 SPECIAL NETT TOTAL : \$ 3,100.00
 LABOUR TOTAL : \$ 9,030.00
 GRAND TOTAL : \$ 34,043.24

Lump sum repair
 Repair days 14

PARTS 14,191.72
 S/N 910.00
 LABOUR 5,110.00
 20,211.72
 @ 20 %
 4042.34
 16,169.38

L/S 16,150 / 2

TGM lin
 14/2/2020

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date:

VAN / LORRY (Tru)

Front Portion

Vehicle No: GBG 7556 G

NAC	INC	Item	CON	AC	Qty
1001	991886	Frt Number Plate	DD	✓	
1002	991887	Frt Number Plate Base	DD	✓	
1004	991300	Frt Bumper	BR	✓	
1001	991477	Frt Bumper Upper			
1002	991387	Frt Bumper Lower			
1003	991449	Frt Bumper Side Cover	BR	✓	
1004	991443	Frt Bumper Side			
1006	991325	Frt Bumper Bracket Retainer	NEC	✓	2
1008	991433	Frt Bumper Reinforcement	BT	✓	
1005	991466	Frt Bumper Signal Lamp			
1017	995100	Frt LH Bumper Fog Lamp Cover			
1018	991355	Frt RH Bumper Fog Lamp Cover			
1019	995079	Frt LH Bumper Fog Lamp	BR	✓	
1020	995080	Frt RH Bumper Fog Lamp			
1021	991793	Frt Grille	DL	✓	
1022	991328	Frt Grille Emblem	CUT	✓	
1006	990247	Frt Grille Sticker			
1023	991799	Frt Grille Chrome Moulding	CUT	✓	
1007	991891	Frt Panel			
1008	991874	Frt Lower Panel			
1009	991328	Frt Panel Emblem			
1010	990247	Frt Panel Sticker			
1011	991893	Frt Panel Garnish			
1024	991222	Frt Apron Panel			
1012	991527	Frt Corner Panel			
1013	991532	Frt Corner Panel Signal Lamp			
1014	995245	Frt Signal Lamp LH			
1015	995246	Frt Signal Lamp RH			
1029	995153	Frt LH Headlamp Assy			
1030	991821	Frt RH Headlamp Assy			
1031	995088	Frt LH Side Lamp			
1032	995089	Frt RH Side Lamp			
1016	992149	Frt Wiper Panel			
1017	995043	Frt Wiper Nozzle			
1120	992140	Frt Wiper Arm			
1121	992142	Frt Wiper Blade			
1048	992145	Frt Wiper Link			
1019	992148	Frt Wiper Motor			
1122	995045	Wiper Panel Garnish			
1114	992093	Frt Windscreen			
1115	992097	Frt Windscreen Rubber			
1117	992098	Frt Windscreen Sealant			
1020	992114	Frt Windscreen Outer Pillar			
1021	992113	Frt Windscreen Inner Pillar			
1118	991019	FRP Bracket			
1119	991020	FRP Unit			
1022	991958	Frt Side Mirror (Big)			
1023	991959	Frt Side Mirror (Small)			
1024	991962	Frt Side Mirror (Round)			
1025	995015	Frt Wing Mirror Stay			
1025	992013	Frt Support Panel			
1033	990248	Bonnet	DD	✓	
1035	990287	Bonnet Lock			
1037	990273	Bonnet Hinge			
1039	990305	Bonnet Rubber			
1042	990119	Air Con Condenser			
1043	990122	Air Con Fan Assy			
1048	990149	Air Con Liquid Pipe			
1049	995066	Air Con Receiver Drier			
1052	995074	Radiator			
1053	992738	Radiator Cowling			
1054	992742	Radiator Fan Assy			
1056	992758	Radiator Hose Top			
1058	992741	Radiator Expansion Tank			
1026	992596	Oil Cooler			
1079	991431	Power Steering Cooler Pipe			
1059	990151	Air Duct			
1060	990070	Air Cleaner Assy			
1067	990219	Battery			
1069	990223	Battery Bracket			

NAC	INC	Item	CON	ACC	Qty
1085	991011	Engine Under Cover			
1086	990946	Engine Mounting			
2027	991500	Frt Cabin Assy			
2028	991501	Frt Cabin Mounting			
2029	991502	Frt Cabin Rear Panel			
1092	991520	Frt LH Chassis Member			
1093	991520	Frt RH Chassis Member			
1094	990728	Frt Vertical Cross Member			
1095	991863	Frt Lower Cross Member			
2030	990143	Air Con Evaporator Assy			
2031	990106	Air Con Blower			
1082	990427	Brake Master Pump Assy			
1083	990403	Brake Booster Pump Assy			
2032	990431	Brake Pedal			
2033	990021	Accelerator Pedal			
2034	990627	Clutch Pedal			
1127	994483	Steering Wheel Airbag			
1128	994485	Steering Wheel Airbag Sensor			
1131	990029	Airbag Control Unit			
1133	991922	Frt RH Seat Belt Assy			
1135	995182	Frt LH Seat Belt Assy			
1124	990753	Dashboard Assy			
1125	992282	Glove Box Cover			
1126	992281	Glove Box Compartment			
1096	995070	Frt LH Fender			
1097	995072	Frt LH Fender Inner Panel			
1100	991740	Frt LH Fender Inner Shield			
1101	995179	Frt LH Mudflap			
2035	994966	Frt LH Wheel Guard			
1102	995170	Frt LH Wheel Rim			
1104	995065	Frt LH Tyre			
1105	995071	Frt RH Fender			
1106	991739	Frt RH Fender Inner Panel			
1109	991740	Frt RH Fender Inner Shield			
1110	991884	Frt RH Mudflap			
2036	994966	Frt RH Wheel Guard			
1111	992087	Frt RH Wheel Rim			
1113	995065	Frt RH Tyre			
1255	995326	Frt LH Door			
1256	995140	Frt LH Door Protector			
1257	995104	Frt LH Door Hinge			
1258	995142	Frt LH Door Wing Mirror			
1262	995103	Frt LH Door Glass			
1263	991595	Frt LH Door Glass Regulator			
1264	991596	Frt LH Door Glass Regulator Motor			
1265	991662	Frt LH Door Rubber			
1266	991636	Frt LH Door Outer Handle			
1272	991617	Frt LH Door Inner Trim Board			
1316	995327	Frt RH Door			
1317	991654	Frt RH Door Protector			
1318	991601	Frt RH Door Hinge			
1319	991685	Frt RH Door Wing Mirror			
1323	991584	Frt RH Door Glass			
1324	991595	Frt RH Door Glass Regulator			
1325	991596	Frt RH Door Glass Regulator Motor			
1326	991662	Frt RH Door Rubber			
1327	991636	Frt RH Door Outer Handle			
1333	991617	Frt RH Door Inner Trim Board			
2037	991644	Frt Door Frt Pillar			
2038	991657	Frt Door Rear Pillar			
2039	992072	Frt Wheel Arch Panel			
2040	992069	Frt Wheel Arch Panel Garnish			
2041	991996	Frt Step Panel			
2042	994498	Frt Step Panel Top Garnish			
2043	994495	Frt Step Panel Inner Garnish			
1073	995053	Wiper Washer Tank			
1136	990247	Sticker			
		Front bumper sponge		BR	✓

No of Items: 12

Assessor:

Tecim bin
14/5/2020

Condition (C24)

(01) Bent (2) Bent (3) Distorted (4) Cracked (5) Cut (6) Scratched
(7) Deformed (8) Replaced (9) Busted (10) Broken (11) Necessary
(12) Missing (13) Torn (14) Unconfirmed (15) Not Working

VAN / LORRY (Rear)

ACTION (AC)

(1) Replace (✓) (2) Repair (X) (3) Check (C)
(4) Not Consistent (NC)

Aug 2005

Vehicle No: GBG 7556G

Rear Portion

NAC	INC	Item	CON	AC	Qty
1137	993626	Rear Number Plate	CUT	✓	
1138	993627	Rear Number Plate Base	CUT	✓	
2044	993628	Rear Number Plate Bracket			
1140	993632	Rear Number Plate Lamp			
1141	992958	Rear Bumper	BR	✓	
1142	993108	Rear Bumper Upper			
1143	993017	Rear Bumper Lower			
1144	993054	Rear Bumper Side			
1147	992976	Rear Bumper Bracket	BR	✓	1
1148	993068	Rear Bumper Side Retainer	NEC	✓	2
1149	993045	Rear Bumper Reinforcement	DD	✓	
2045	993081	Rear Bumper Step Panel			
2046	993079	Rear Bumper Step Garnish			
2047	993186	Rear Crash Bar			
1158	994023	Reverse Sensor	SC	✓	
1159	993327	Rear End Panel	DD	✓	
1163	993851	Rear LH Taillamp	BR	✓	
1164	993853	Rear LH Taillamp Garnish			
1165	993859	Rear LH Taillamp Panel	DD	✓	
1166	995116	Rear RH Taillamp			
1167	993853	Rear RH Taillamp Garnish			
1168	993859	Rear RH Taillamp Panel			
1169	993554	Rear Apron Panel			
1289	995156	Rear LH Door	DD	✓	
1350	993201	Rear RH Door			
2048	991328	Rear Door Emblem	NEC	✓	
2049	993274	Rear Door Outer Handle			
2050	993228	Rear Door Garnish			
2051	993294	Rear Door Rubber LH	TN	✓	
1291	995194	Rear LH Door Hinge	BT	✓	2
1352	995307	Rear RH Door Hinge			
1301	993261	Rear LH Door Lock	JM	✓	
1362	993261	Rear RH Door Lock			
2052	993232	Rear Door Glass	BR	✓	
2053	993955	Rear Door Glass Sealant	NEC	✓	
1248	994729	Third Brake Light			
1181	994543	Tailgate			
2054	993700	Rear Rubber Stopper			
2055	993701	Rear Rubber Stopper Bracket			
1182	991328	Tailgate Emblem			
1183	994643	Tailgate Outer Handle			
1185	994545	Tailgate Garnish			
1193	994602	Tailgate Glass			
1194	994606	Tailgate Glass Rubber			
1195	994604	Tailgate Glass Moulding			
1196	994607	Tailgate Glass Sealant			
2056	994597	Tailgate Extension Mirror			
1197	994629	Tailgate Lock			
1198	994651	Tailgate Rubber			
1199	994611	Tailgate Hinge			
1200	994594	Tailgate Damper			
1201	994613	Tailgate Inner Board			
2057	993992	Rear Wiper Arm			
2058	993995	Rear Wiper Blade			
2059	993997	Rear Wiper Motor			
2060	993484	Rear Floor Panel			
1204	995065	Spare Tyre			
2061	993785	Spare Tyre Bracket			
1212	993364	Rear Exhaust Pipe			
1214	993361	Rear Exhaust Mounting			
1216	995223	Rear LH Chassis Member			
1217	993165	Rear RH Chassis Member			

NAC	INC	Item	CON	AC	Qty
2062	993748	Rear Sidegate			
2063	994225	Rear Sidegate Lock			
2064	993749	Rear Sidegate Hinge			
2065	994226	Sidegate Lower Panel			
2066	994227	Sidegate Railing			
2067	994208	Side Cover Hook			
2068	991965	Side Step Panel			
2069	994496	Side Step Panel Stopper			
2070	992857	Rear Body Panel			
2071	992866	Rear Body Panel Inner			
2072	995329	Sliding Door LH			
2073	995328	Sliding Door RH			
2074	994295	Sliding Door Handle			
2075	994300	Sliding Door Lock			
2076	994313	Sliding Door Rubber			
2077	994291	Sliding Door Bottom Roller			
2078	994317	Sliding Door Top Roller			
2079	994306	Sliding Door Rail			
2080	994315	Sliding Door Stepboard			
2081	994316	Sliding Door Stepboard Garnish			
1224	993621	Rear LH Mudflap	TN	✓	
1225	993933	Rear LH Wheel Rim			
1226	994025	Rear LH Rim Cover			
1227	995065	Rear LH Tyre			
1234	993622	Rear RH Mudflap			
1235	993934	Rear RH Wheel Rim			
1236	994025	Rear RH Rim Cover			
1237	995065	Rear RH Tyre			
1252	992179	Fuel Tank			
1253	992184	Fuel Tank Bracket			
1136	990247	Sticker LH (70KMH)	NEC	✓	
		Rear bumper sponge	BR	✓	
		Rear end panel	DD	✓	
		Rear fender/panel	DD	✓	
		Rear door glass moulding	NEC	✓	
		Rear vent	BR	✓	
		Rear LH outer corner panel	BR	✓	

No of Items: 25

Assessor:

TGM/Min

14/5/2020

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	731N
Vehicle Details	
Vehicle No.:	GBG7556G
Vehicle to be Exported:	No
Intended Deregistration Date:	12 May 2020
Vehicle Make:	HYUNDAI
Vehicle Model:	H1 STAREX 2.5 CRDI MT 6DR
Primary Colour:	Silver
Manufacturing Year:	2016
Engine No.:	D4CBG053233
Chassis No.:	KMFWBX7KLHU847613
Maximum Power Output:	-
Open Market Value:	\$21,711.00
Original Registration Date:	24 Oct 2017
First Registration Date:	24 Oct 2017
Transfer Count:	1
Actual ARF Paid:	\$1,086.00
Intended PARF Rebate Details	
PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	23 Oct 2027
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	10
QP Paid:	\$51,890.00
COE Rebate Amount:	\$38,638.00
Total Rebate Amount:	\$38,638.00

The information contained herein is correct as at 12 May 2020

OK

Dep 6,210/yr
518/mth

MV 48,000/2 plus body
PV 38,638/2
NV 9,362/2

Tellin Am
12/5/2020