ASSI	GNM	ENT
-		

From Date	Veh No SMN 73976 SMM DOPP KING
Estimated Cost.	Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
OB TP / WS / TP RES / OD RES / EVA / INV / MV	Truck / Trailer or
To Inspect Vehicle No: SMN 73976	Make: Audi A3 SEDAN 1-OTFS 1 999
at Workshop m/s PRenium	Golour GREY A. Insured / Std / NI / NA
of Benor Socrok	Sp.Reading 75224 Tre idio: Insured / Std / NI / NA
Insured: A(4	Eng/No:
Policy No	C/No: war 2228 4 4 K 1026449
Claims No.	Gen. Cond: Good (Fair / Poor / Burnt
Sum Insured: Excess: 784	Steering: Lorder / Jammed / Leaked / Burnt or
(Client's Record)	Brake: norder / Jammed / Leaked / Burnt or
Make of Veh:	Modi: Nil / SRim / STD A/Rim or
	Tyre Size: F: 205 58 R16
(Policy Condition)	R: 7 1
Remark: The veh had commenced its N/S O/S	BS IDUN / EXNOVA / GY / FS / LIZA / MIC OHTSU . PIR SUM!
repair at the time of inspection.	TOYO / YOKO or
Bal. or Market Value: 105k	Front East
IDAC Accident Rport: Consistent? : Yes or No	R/Bal. 6 mm 95al. 6 mm
GIA / PR Seen: Consistent?: Yes or No	L/Bal. mm _ Sal. 6 mm
Est. Repairs: days Res.: Yes or No	D.O.A. 16 05 220 20/05/2020
Lum Sum: % 3 Val.: Yes or No	Survey held at PREMIUM
Lem Sum: % 3 Val.: Yes or No	
	Des. of Damages : Frt / Rear / O/S / N/S / U/C / Rooftap or
Lum Sum: % 3 Val.: Yes or No CA / REV / REP. / 24 HRS	Des. of Damages : Frt / Rear / O/S / N/S / U/C / Rooftap or
Lum Sum: % 3 Val.: Yes or No CA / REV / REP. / 24 HRS Vehicle: IN / OUT	Des. of Damages : Frt / Rear / O/S / N/S / U/C / Rooftep or O/S REAR
CA / REV / REP. / 24 HRS Date: Person Contacted: Date / Time Action / Instruction	Survey held at PREMIUM Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftap or OS REAR The U/C / Chassis frame / Body Structure affected due to collision.
Lum Sum: % 3 Val.: Yes or No CA / REV / REP. / 24 HRS Vehicle: IN / OUT Date: Person Contacted:	Survey held at PREMIUM Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftap or OS REAR The U/C / Chassis frame / Body Structure affected due to collision.
CA / REV / REP. / 24 HRS Date: Person Contacted: Date / Time Action / Instruction	Survey held at PREMIUM Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftap or OS REAR The U/C / Chassis frame / Body Structure affected due to collision.
CA / REV / REP. / 24 HRS Date: Person Contacted: Date / Time Action / Instruction	Survey held at PREMIUM Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftap or OS REAR The U/C / Chassis frame / Body Structure affected due to collision.
CA / REV / REP. / 24 HRS Date: Person Contacted: Date / Time Action / Instruction	Survey held at PREMIUM Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftap or OS REAR The U/C / Chassis frame / Body Structure affected due to collision.
CA / REV / REP. / 24 HRS Date: Person Contacted: Date / Time Action / Instruction	Survey held at PREMIUM Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftap or OS REAR The U/C / Chassis frame / Body Structure affected due to collision.
CA / REV / REP. / 24 HRS Date: Person Contacted: Date / Time Action / Instruction	Survey held at PREMIUM Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftap or OS REAR The U/C / Chassis frame / Body Structure affected due to collision.
CA : REV REP. 24 HRS Vehicle: IN / OUT Date: Person Contacted: Date / Time Action / Instruction 2/3/21 Final fig \$50,690.00 confirmed by e	Survey held at PREMIUM Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or O/S REAR The U/C / Chassis frame / Body Structure affected due to collision. Pemail (Red 28,386,35%)
CA / REV / REP. / 24 HRS Date: Person Contacted: Date / Time Action / Instruction	Survey held at PREMIUM Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftap or OS REAR The U/C / Chassis frame / Body Structure affected due to collision.
CA : REV REP. 24 HRS Vehicle: IN / OUT Date: Person Contacted: Date / Time Action / Instruction 2/3/21 Final fig \$50,690.00 confirmed by 6	Survey held at PREMIUM Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or O/S REAR The U/C / Chassis frame / Body Structure affected due to collision. Pemail (Red 28,386,35%)
Lem Sum: % 3 Val.: Yes or No CA / REV / REP. / 24 HRS Vehicle: IN / OUT Date: Person Contacted: Date / Time Action / Instruction 2/3/21 Final fig \$50,690.00 confirmed by e	Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftep or o S REAR The U/C / Chassis frame / Body Structure affected due to collision. Pemail (Red 28,386,35%) Days Of Repair: 32 Resurvey No. of Trip: 1 Survey Fee
CA : REV REP. 24 HRS Vehicle: IN / OUT Date: Person Contacted: Date / Time Action / Instruction 2/3/21 Final fig \$50,690.00 confirmed by 6	Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or o S REAR The U/C / Chassis frame / Body Structure affected due to collision. Pemail (Red 28,386,35%) Days Of Repair: 32 Resurvey No. of Trip: 1 Survey Fee
CA REV REP. 24 HRS Date: Person Contacted: Date Time Action Instruction 2/3/21 Final fig \$50,690.00 confirmed by e Date/Time, File Pass to? : Preli. Report Date/Time, File Return to? 2/3/21-Typist Add Fe	Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftep or o S REAR The U/C / Chassis frame / Body Structure affected due to collision. Pemail (Red 28,386,35%) Days Of Repair: 32 Resurvey No. of Trip: 1 Survey Fee
Date: 7 I REP. / 24 HRS Vehicle: IN / OUT Date: Person Contacted: Date / Time Action / Instruction 2/3/21 Final fig \$50,690.00 confirmed by e Date/Time, File Pass to? Preli. Report Date/Time, File Return to? 2/3/21-Typist Add Fe	Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftap or O/S REAR The U/C / Chassis frame / Body Structure difected due to collision. Pemail (Red 28,386,35%) Days Of Repair: 32 Resurvey No. of Trip: 1 Survey Fee Transportation
CA REV REP. 24 HRS Date: Person Contacted: Date Time Action Instruction 2/3/21 Final fig \$50,690.00 confirmed by e Date/Time, File Pass to? : Preli. Report Date/Time, File Return to? 2/3/21-Typist Add Fe	Survey held at Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftep or OS REAR The U/C / Chassis frame / Body Structure affected due to collision. Pemail (Red 28,386,35%) Days Of Repair: 32 Resurvey No. of Trip: 1 Survey Fee. Transportation Site Insp. (\$ Imperview \$ Im

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate

Accident Repairs

Workshop

Ubi Road 1

Contact No

: 6366 2323 : 6841 1183

Fax No Reference

PA/0D/0394/2020/NS

WIP: 35747

Date

: 19-May-20

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way #07-16 AIG Building Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name

Mr Shamsudin Bin Md Esa

Address

958 Dunearn Road

#01-22

Singapore 589485

Telephone

HP +65 81279767

Type of Claim

Own Damage Claim

Policy No.

: 1900152820

Vehicle No

: SMN 7397 G

Model Code

Audi A3 1.0 TFSI S Tronic

Model / Year

Aug-19

Engine No

CHZ C28451

Chassis No

WAUZZZ8V4K1026449

Mileage

7538

Date In

13-May-20

Estimated By

Johnny Boo / Allan Wu

Accident Date

16-May-20

Place of Accident

Bukit Batok Street 11

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMN 7397 G

	77 96 59 00	Damage Parts & Pri			s & Prices
S/N	Parts Description			S/Nett	Remarks
1	SIDE PART - RH Jul /		\$	3,274.00	
2	SIDE WINDOW - RH NEC /		\$	537.00	
3	PRIMER NE		\$	19.00	
4	C-PILLAR REINFORCEMENT - RH LOWER 64 /		\$	182.00	
5	WHEEL HOUSING INNER PART - RH 7		\$	582.00	
6	SIDE MEMBER - RH 6		\$	373.00	
7	C-PILLAR PPLATE - LOWER /		\$	13.00	
8	WHEEL HOUSING LINER - RH & /		\$	226.00	
9	WHEEL HOUSING LINER ATTACHMENTPARTS - REAR	/	\$	84.00	
10	REAR WHEEL SPOILER - RH ?		\$	33.00	
11	REAR DOOR - RH		\$	2,375.00	
12	REAR DOOR OUTER SEAL - RH	NEC	\$	151.00	
13	BONDING AGENT ***	NEC	\$	46.00	
14	CLEANING SOLUTION /	NEC	\$	64.00	
15	REAR DOOR ATTACHMENT PARTS		\$	121.00	
16	REAR DOOR CATCH ".		\$	89.00	
17	INNER DOOR SEAL ***		\$	180.00	
18	DOOR HINGE HALF-UPPER PART - RH UPPER		\$	75.00	
19	DOOR HINGE HAL-UPPER PART - RH LOWER		\$	45.00	
20	DOOR HINGE HALF-LOWER PART - RH UPPER .		\$	45.00	
	SUB TOTAL SPARE PARTS CHARGES	:	\$	8,514.00	

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMN 7397 G

c /N	Parts Description	Damage Parts & Prices		
5/N	7		S/Nett	Remarks
21	DOOR HINGE HALF-LOWER PART - RH LOWER	\$	75.00	
22	EXTERIOR DOOR HANDLE- RH	\$	342.00	
23	DOOR HANDLE HOUSING - RH 🗶	\$	49.00	
24	SLIDE VALVE - RH 🗡	\$	21.00	
25	MOUNTING BAR X	\$	154.00	
26	BOWDEN CABLE ?	\$	50.00	
27	DOOR LOCK - RH ?	\$	510.00	
28	DOOR INNER PANEL COVER - RH ?	\$	24.00	
29	WINDOW REGULATOR - RH ?	\$	234.00	
30	WINDOW REGULATOR MOTOR - RH ?	\$	261.00	
31	REAR GUIDE RAIL - RH	\$	49.00	
32	DOOR CONTROL UNIT ? (diagrose)	\$	707.00	
33	DOOR PANEL - RH	\$	1,555.00	
34	REAR WINDOW SLOT SEAL - RH	\$	279.00	
35	WINDOW GUIDE TRIM STRIP - RH ★	\$	211.00	
36	WINDOW GUIDE - RH 🗶	\$	396.00	
37	PILLAR C TRIM - RH ?	\$	109.00	
38	WINDOW APERTURE SEAL- RH INNER 🗡	\$	106.00	
39	B PILLAR TRIM - RH ?	\$	110.00	
40	FRONT DOOR - RH 🗡	\$	2,375.00	
	SUB TOTAL SPARE PARTS CHARGES	: \$	7,617.00	

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMN 7397 G

				Damage Parts & Price	
5/N	Parts Description			S/Nett	Remarks
41	FRONT DOOR OUTER SEAL 🗡	NEC	\$	151.00	
42	BONDING AGENT 🗡	NEC	\$	46.00	
43	CLEANING SOLUTION 🗡	NEC	\$	64.00	
44	FRONT DOOR ATTACHMENT PARTS 🗡		\$	227.00	
45	FRONT DOOR CATCH 🔀		\$	99.00	
46	FRONT WINDOW SLOT SEAL - RH 🗶		\$	291.00	
47	WINDOW GUIDE TRIM STRIP - RH 🗡		\$	242.00	
48	B PILLAR TRIM ?		\$	98.00	
49	UNDERLAY TRIM - RH ?		\$	163.00	
50	SIDE AIRBAG UNIT - RH FRONT AG -		\$	1,428.00	
51	HEAD AIRBAG UNIT - LH / RH ACT /	2	\$	3,512.00	
52	AIRBAG CONTROL UNIT AG -		\$	1,482.00	
53	AIRBAG CRASH SENSOR 44 -			ТВС	
54	SEAT BELT - LH / RH	2	\$	2,080.00	
55	SEAT BELT HEIGHT AD USTER 7	2	\$	368.00	
56	BACKREST COVER - RH		\$	2,068.00	
57	MOULDED HEADLINER du /		\$	1,666.00	
58	FOLDING GRAB HANDLE - FRONT	2	\$	266.00	
59		2	\$	266.00	
60	A-PILLAR TRIM - RH UPPER .		\$	151.00	
	SUB TOTAL SPARE PARTS CHARGES	:	\$:	14,668.00	

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Telefax ·

Material List for Accident Vehicle Regn No. SMN 7397 G

C /N	Parts Description			Damage Par	
S/N	Parts Description			S/Nett	Remarks
61	A-PILLAR TRIM - BAT UPPER ?		\$	151.00	
62	B-PILLAR TRIM - LH / RH UPPER ?	2	\$	408.00	
63	C-PILLAR TRIM - LH / RH UPPER ?	2	\$	284.00	
64	WHEEL HOUSING TRIM - RH ?		\$	100.00	
65	SILL TRIM STRIP - RH INNER ?		\$	200.00	
66	REAR ALUMINIUM RIM - RH Cut		\$	666.00	
67	REAR ALE BEAM ?		\$	1,830.00	
68	REAR AXLE BEARING BRACKET - RH 7		\$	193.00	
69	STUB AXLE ?		\$	269.00	
70	WHEEL BEARING ?		\$	448.00	
71	GAS SHOCK ABSORBER ?		\$	230.00	
72	PROTECTIVE PIPE STOP BUFFER ?		\$	58.00	
73	ACRYLIC SEALANT	S/N	\$	180.00	
74	CAVITY WAX	S/N	\$	140.00	
75	STONE CHIP /	S/N	\$	180.00	
76	METAL FILLER POWDER ***	S/N	\$	280.00	
77	REAR WINDSCREEN SEALANT /	S/N	\$	200.00	
78	1/4 GLASS SEALANT	S/N	\$	100.00	
79	REAR TYRE - RH ➤			TBC	
80	SUNDRIES ?		\$	700.00	
	TOTAL SPARE PARTS CHARGES	:	(7)	37,416.00	
	TOTAL LABOUR CHARGES	:		36,834.00	
	GRAND TOTAL	:	\$	74,250.00	

All charges are not inclusive of GST.
Legend: Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

oad 1, Singapore 408699 66 2323 Fax: 6841 1183

efax

Estimated Labour Charges for Accident Vehicle. SMN 7397 G

S/N	Nature of Jobs		Estimated Charges	Surveyor's Recommendations
1	To tow and recover vehicle from scene of accident.	S/N	\$ 280.00	
2	To carry out first measurement test on car o-liner.	S/N	\$ 800.00	photo (report)
3	To remove and reinstall rear parking aid, check function.	S/N	\$ 280.00	
4	To renew rear windscreen and rhs 1/4 glass to facilitate fender renewal.	S/N	\$ 600.00	
5	To install rear windscreen solar film.	S/N	\$ 400.00 7	
6	To remove and transfer rhs rear and front door's multi-lock system and power window devices. Inspect for damages.	S/N	\$ 560.00	7 hopo
	SUB TOTAL LABOUR CHARGES	: _	\$ 2,920.00	

ud 1, Singapore 408699 2323 Fax: 6841 1183

fax

stimated Labour Charges for Accident Vehicle. SMN 7397 G

5/N	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
7	To dismantle rhs front door panel trim. To remove and reinstall rhs wing mirror assy.	5/N	\$ 350.00	<
8	To dislodge and reinstall rear wire harness for lights, battery manager, fuse and relay trays, electrical and audio equipment.	5.N	\$ 1,400.00 ?	? phoh
9	To remove and reinstall rear seat, back rest, hat tray, abcd pillar trims and luggage compartment trims.	S/N	\$ 980.00	Lh
10	To dismantle and reinstall centre console. Renew airbag control unit and both front seatbelt. To dislodge and renew roof lining. Both curtain airbags and rhs front seat cushion airbag.	S/N	\$ 2,800.00	
11	To renew rhs front seat cushion assy.	S/N	\$ 780.00	/
12	To remove and reinstall exhaust system and rear suspension assembly, including rear axle. Renew accordingly.	S/N	\$ 2,400.00	loh?
	SUB TOTAL LABOUR CHARGES	: [\$ 8,710.00	

Jad 1, Singapore 408699 J6 2323 Fax: 6841 1183

efax

Estimated Labour Charges for Accident Vehicle. SMN 7397 G

S/N	Nature of Jobs			Estimated Charges	Surveyor's Recommendations
13	To remove and reinstall fuel tank assy.	S/N	5	600.00	?
14	To setup vehicle on car o-liner for repair.	S.N	\$	2,400.00	? photo & report
15	To dismantle rear bumper, rearlid, rhs rear and front door. Cut out and weld rhs rear fender, (rhs rear inner side panel, rhs rear wheel housing and rhs inner sill panel.) Renew rhs rear door and rhs front door. Re-organise rear crash management components. reinstall all parts removed.		\$	13,300.00 500	
16	To respray rhs rear fender, rhs rear door, door handles, rhs sill panel, door entrances, roof channel, drain panel, end panelling ths side inner panel, rhs inner sill panel and rhs wheel housing) To carry out stone chip treatment and joint sealer works.		\$	8,000.00	3300
17	To renew rhs rear rim and tyre. To carry out pre-repair wheel alignment check and post-repair wheel alignment check.	S/N	\$	520.00	
18	To carry out pre-diagnostic check and post-diagnostic check.	S/N	\$	384.00	
	TOTAL LABOUR CHARGES	:	\$	36,834.00	

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Telefax

Name

Surveyed Date

Authorised Date

Excess Cost

Liability

Remarks

Pasul - Hp 90010068

: 20/05/2000 @ 1100 hs

: 17 days

Excess:TDA

Rever

Rever

Rever

Rever

Please Note

ASI

1599

by A

This estimate is based on visual inspection of the affected vehicle Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly. For inspection of vehicle, please refer to Ms Norah Khai at Tel:6768 9828 for appointment.

Yours faithfully, Premium Automobiles Pte Ltd LKK Auto Consultants hence notify

- the Repairer of the following:
- To resurvey before/after spray painting • To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Johnny Boo Body Repair Manager Allan Wu Claims Consultant

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

- 1. Please report correctly the details of the accident to speed up the claims process.
- 2. This Form must be completed by the Policyholder and/or the Authorised Driver.
- 3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or witholding of material facts may allow insurance companies to repudiate policy liability.
- 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- 5. Any false reporting may be referred to the Police for Investigation.
- 5. Any raise reporting may be sold the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for 6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for o. This report this be forwarded by the made available upon application by interested parties.

7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT: STATEMENT:

18/05/2020 17:18 Date Of Report 16/05/2020 12:45 Date Of Accident

BUKIT BATOK STREET 11 Exact Location Of Accident

SINGAPORE Country/State of Loss

II DETAILS OF OWN VEHICLE

SMN7397G Vehicle Registration Number

Insured/Policyholder

NUR SHAMSUDIN BIN MD ESA Name Of Registered Owner

SXXXX473B NRIC No

DINI606@HOTMAIL.COM **Email Address** (LOCAL) +65-81279767 Mobile Phone No

OFFICE-81279767 Alternative Phone No

Vehicle Particulars

Manufacturer

A3 SEDAN 1.0 TFSI S TRONIC Model

Exact Purpose for which vehicle was being used at PRIVATE USE

time of accident

Are you claiming under your own insurance policy

for repair to your vehicle?

YES

If No, Please state action to be taken

PRIVATE CAR Vehicle Category

Insurance Company

AIG ASIA PACIFIC INSURANCE PTE, LTD. Name of Insurance Company

COMPREHENSIVE Type Of Coverage

NO Fleet Policy

1900152820 Policy Number

Cover Note Number

Driver

ROHANI BINTI HASSAN Name of Driver

NRIC No SXXXX804I Date Of Birth 11/11/1969 Occupation **INDOOR** Date Of Driving Pass 12/04/2004

Driving Experience 16 YEARS AND 1 MONTH

Gender **FEMALE**

Mobile Number (LOCAL) +65-81279767

Fax Number

Contact Number

EMail Address DINI606@HOTMAIL.COM 958 DUNEARN ROAD

#01-22

Postcode

Address

NO

Was driver an employee of the Insured's Company If No, Relationship of the Driver with the Insured

SPOUSE

589485

Vehicle Registration Number of Driver's Own

Vehicle

Insurance Company of Driver's Own Vehicle

General Information of the Accident

Type Of Accident

COLLISION - MAJOR/MINOR RD

Weather Conditions

CLEAR

Road Surface

DRY

Other Information

Was any foreign vehicle involved in this accident?

NO

Number of vehicles (including own vehicle)

2

involved in the accident

Was any body injured in the Accident?

NO

Was any injured conveyed to hospital by ambulance?

NO

Was any other material or property damaged?

YES

I have been approached by unknown person(s)

soliciting/offering accident claims assistance.

NO

Number of Passengers (Including Driver)

2

Passenger 1

NAME:

: YASMIN NUR SHAMSUDIN

GENDER:

: FEMALE

Details of Police Action

Was the accident reported to the police?

NO

If Yes, Please state which Police Station

Was notice of intended Prosecution given?

NO

If Yes, against whom?

Circumstances of Accident

THE ACCIDENT HAPPENED ALONG BUKIT BATOK STREET 11 NEAR BLOCK 152, AT 15.45 PM ON SATURDAY 16 MAY 2020. I LOOKED RIGHT TRAFFIC WAS CLEAR I LOOKED LEFT, LOOKED RIGHT AGAIN, THEN MOVED OFF. I MOVED OUT OF THE STOP LINE, WENT OVER THE FIRST LANE. TURNED TO THE RIGHT TO JOIN THE OPPOSITE LANE AND THAT WAS WHEN MY CAR WAS HIT ON THE BACK RIGHT DOOR WITH GREAT IMPACT THAT THE AIR CURTAINS ON BOTH THE RIGHT AND LEFT SIDES GOT ACTIVATED. I WAS IN THE CAR WITH MY DAUGHTER IN THE FRONT PASSENGER SEAT. I AM FAMILIAR WITH THAT ROAD. VEHICLES HAVE TO GO THROUGH 2 JUNCTIONS. THAT STRETCH OF ROAD HAS BUS STOPS, BEFORE AND AFTER THE 2 JUNCTIONS. THERE IS ALSO A PEDESTRIAN TRAFFIC LIGHT CROSSING IN BETWEEN THE 2 JUNCTIONS WHICH ARE A SHORT DISTANCE APART. USUALLY VEHICLES ARE GOING SLOW IN THAT STRETCH. TRAFFIC FROM MY RIGHT, THE TRAFFIC LIGHT JUNCTION ARE USUALLY SLOWER THAN TRAFFIC FROM THE LEFT FAR SIDE, THE NON-TRAFFIC LIGHT JUNCTION

Attachment(s)

Are accident photos available for attachment?

YES

Was there any video captured by Car Camera?

NO

Was there any audio recorded?

NO

IDETAILS OF OTHER VEHICLE PROPERTY IN

Vehicle Registration Number

SHD2728E

Vehicle Make/Model/Colour

TOYOTA BLACK

Details Of Properties

Vehicle Category

PRIVATE CAR

Name of Driver

KWAN ZHIYAO, ANDY

NRIC

NRIC/Passport Number Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

SXXXX563A

87152827

432A SENGKANG WEST WAY #15-503

791432

NTUC INCOME INSURANCE CO-OPERATIVE LTD

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

- 1 Picase report correctly the details of the accident to speed up the claims process
- 2. This form must be completed by the Policyholder and/or the Authorised Driver
- into mation provided must be as truthful and accurate as possible. Any wilful misrepresentation or with a ding of material facturing allow insurance companies to repudiate policy liability.
- 4. The issue and acceptance of this Form by insurance companies is not an admission of policy Lability on the part of the incurance (chapanes
- 5. Any false reporting may be referred to the Police for investigation.
- 6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the Comeral Insurance Association of Singapore (G.A) for archiving and that copies of this report will for a fee be mode available upon applicar on by remoted parties
- By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of me report being made available aforesaid.
- 5 Consent under the Personal Data Protection Act (PDPA)

understand, acknowledge, agree and consent that

- b) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose an "transfer such Personal information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the insurers' lawyers/ aw firm, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police - for the purpose of
 - till processing, handling and/or dealing with my claims including the settlement of the claims and all vinecessory investigations relating to the claims,
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me,
 - ity administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as in the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectives, the
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law fire imagine permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purpoles, and
- my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service provides or agents/including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal information will also be collected and used to compile claims history for the purpose of maud detection investigation and management in present and all future claims
- (c) the information so collected under (d) above may be shared / disclosed
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing freed. regulators, law enforcement and government agencies as reasonably required for the purposes mated, or
 - (a) for complying with requirements under any regulations, laws or court orders

Policyholder's Signature Date & Lone


(if ariver is not the policyholder)

Date & Time 18 05 122

Reporting Centre Per Time Sing only Name Allera

NAICHIN NO GESSLUWY

SKETCH PLAN

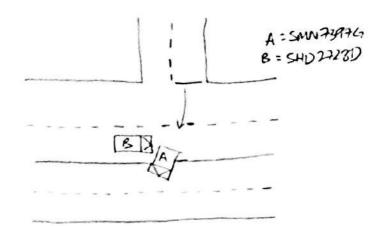

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Constitution of the Accident
The accident impresed along Booked Batok Street 11 near block 152,
1347
Hooked with deller to Hooken left booken now along
The state of the s
the fire and let in the once had both and
Lie half the right and et since que
nchivated. I was in the can with my dangliter in the front
passenger scat
I it is that mad tehicles have to an
is the or there stretch of read has our stops.
the second secon
tratific light crossing in between the 2 junctions which are a short distance upart. Usually relicted are going show in test stretch.
a short distance apart. Usually vehicles are going show in
to it shetch.
Traffic from my right the traffic light inviction, are usual
Traffic from my right the traffic light innection, are usual slower than traffic from the left for side, the non-traffic light mostion.
light quetion.

DECLARATION

If We declare the foregoing particulars are true in every respect.

Pointyholder's Signature Date & Time Driver's Signature
(If driver is not the policyholder)
Date & Time: 15'0'5/2--

12.05 pm

Reporting Centre Personnel's Signature Name Reported Ting Ging Wer NAIC/FIN NO (18682) 10X GLAUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder period of Insurance

: NUR SHAMSUDIN BIN MD ESA

Engine No.

: 27 Aug 2019 To 26 Aug 2020 : CHZC28451

chassis No.

: WAUZZZ8V4K1026449

Vehicle No.

: SMN7397G

Policy No.

: 1900152820

Endorsement No.

: 00000000324686

Issued Date

: 17 Jan 2020

ABOUT THE COVER

Make/Model

: AUDI A3 Sedan 1.0 TFSI S tronic

Engine Capacity/Tonnage: 999.00 CC

Sum Insured : Market Value

First Year of Registration

2019

Driver Restriction

: NA

Off Peak Car : No

Insuring with COE/PARF

Yes

Person or Classes of Persons Entitled to Drive*:

a) The Policyholder

b) Any other person who is driving on the Policyholder's order or with his/her permission.

This Policy will indemnify the Policyholder or any authorised criver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDR") if You are or Your Authorised Driver (named or unnamed) is unassing age of 20 miles age of 20 miles age of 20 miles.

Age Condition

: All Age Condition

Limitation as to use* :

Use only for social idomestic and pleasure purposes and for the Policyholder's business.
This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability that or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1800cc - 2000cc Optional

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189), Section 95 of the Road Transport Act, 1997 (Malaysia) and Poad Transport (Amendment) Act 2019, are not to be included under these headings.

EXCESS-

Section 1 Fire - \$0 Own Damage - \$1600 Theft - \$0 Flood Cover - \$0

Section 2

Property Damage - \$0

Windscreen: \$100

Named Driver and Excess (where applicable)

NUR SHAMSUDIN BIN MD ESA - \$1600 (Own Damage)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRES (FOR CLAIMS RELATED REPAIRS)

1 Audi Customer Service Center Add 55 Ubi Road 1 Singapore 408699 63662323

For other: Approved Reporting Centres/AtG Authorised Repairers, please contact our 24-hour accident emergency hottine at +65-6338-6200. Attenuatively, you may refer to AtG website to a 3-5-12-or AtG SG Michile App. Simply search and download "AtG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: United Overseas Bank Limited

It we hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Can 1891 Part IV of the Road Transport Act, 1987 (Malaysia), Road Transport (Amendment) Act 2019 and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia).

0504125200

PREMIUM LEASING - AP

AIG Asia Pacific Insurance Pte. Ltd.

This computer generated document does not require a signature.

281 ALEXANDRA ROAD AUDI CUSTOMER SERVICE CENTRE SINGAPORE 159938

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

SSCSAN

Insur

Bridge & 3360477



DRIVING LICENCE

1 Facte Martin S 69728041



ROHANI BINTI HASSAN

Birth Date. 11 Nov 1969 Date 12 Apr 2004

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASSIES)

PASS DATE

Class 3 Motor Cars and Motor Tractors the weight of which unladen does not exceed 2500 kilograms

12 Apr 2004

Licence No. Se972804

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type: Owner ID:	Singapore NRIC 4738	
Vehicle No.:	SMN7397G	
Vehicle to be Exported:	No	
Intended Deregistration Date:	20 May 2020	
Vehicle Make:	AUDI	
Vehicle Model:	A3 SEDAN 10 TFSI STRONIC (LED & N.	Pres
Primary Colour:	Grey Grey	AV)
Manufacturing Year:	2019	
Engine No.:		
Chassis No:	CHZC28451	
Maximum Power Output:	WAUZZZ8V4K1026449	
Open Market Value:	85.0 kW (113 bhp)	
Original Registration Date:	\$23,355.00	
First Registration Date:	27 Aug 2019	
Transfer Count:	27 Aug 2019	
Actual ARF Paid:	0	
- incomplete year (characters) (characters)	\$24.697.00	
PARF Eligibility:	Yes	
PARF Eligibility Expiry Date:	26 Aug 2029	
PARF Rebate Amount:	\$18.522.00	$-\infty$
च (प्रवर्गनिक्षेत्रे ल के अ वस्थिति है। होते के प्रविद्याल के प्रवर्गनिक के प्		
COE Expiry Date:	26 Aug 2029	
COE Category:	A - Car up to 1600cc & 97kW (130bhp)	
COE Period (Years):		
QPPaid:	\$31,917.00	
COE Rebate Amount:	\$29.574.00	
Total Rebate Amount: The information contained herein is correct as at 20 May 2020	\$48.096.00	

ОК

27 Aug 2019

[Untitled]_5-8 (2) jpg

ite:

5VN 739715 - 1804 par

