

ASS. REC. BY:

REF:

AIG/

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____

IDAC Accident Report: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: _____

06 days

Res.: Yes or No

Lum Sum: _____

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: _____

SLO 9785D

Yr Regn: _____

07, 16

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or

Make: _____

Honda Jazz

c.c

1318

Colour

M. Maroon

A/C:

Insured / Std / NI / NA

Sp. Reading

74003

T/Radio:

Insured / Std / NI / NA

Eng/No: _____

C/No: _____

JH MAK 3850GX 240592

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rlm / STD / Rlm or

Tyre Size: F: _____

R: _____

175/65R15

BS / BUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal. _____

9

mm

R/Bal. _____

9

mm

L/Bal. _____

9

mm

L/Bal. _____

9

mm

D.O.A. _____

31/7/20

D.O.I. _____

3/8/2020

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

O/S / R & UIC

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trlp: _____

Survey Fee: _____

Transportation: _____

S + RS. SI

Fines

Others

TOTAL

Add Fee: ☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

Lump Sum / I.B.I. (\$) _____

Cheng Hoe Motor Pte Ltd

Blk 1019, Yishun Industrial Park A #01-374/382, Singapore 768761
 TEL: 67556142 (YIS) FAX: 67557719 (YIS) Email: chmotor@singnet.com.sg
 GST:201001158E RCB NO:201001158E

SLD9765D
 TP/AIG

M/S : AIG ASIA PACIFIC INSURANCE PTE LTD
 78 SHENTON WAY
 #07-16 AIG BUILDING
 SINGAPORE 079120
 TEL: 64193000 FAX: 64153727
 ATTN: Motor Claim Department

Estimate No: ES2090565/YISHUN
 Date: 03 Aug 2020
 Policy No: 20-ML000325-R00
 Veh Reg No: SLD9765D
 Make/Model: HONDA HONDA JAZZ
 1.3 CVT ABS D/AIRBAG
 2WD

WS Ref: TP/AIG
 Claim Type: Third Party
 Accident Date: 31/07/2020
 TP Veh Reg No: SJY241X

Chassis No: JHMGK3850GX240592
 Engine No: L13B11010300
 Reg. Date: 01/07/2016

Estimate Repair Cost to Vehicle No :SLD9765D

PAGE:1/1

Description	U/Price	Quantity	List Price S\$	Amount S\$
List Price				
1 FRONT RH FENDER	435.60	1 PC	435.60	✓
2 FRONT RH FENDER INNER SHIELD	71.50	1 PC	71.50	✓
3 FRONT RH FENDER INNER SHIELD CLIPS	3.90	6 PCS	23.40	✓
4 FRONT RH DOOR	1,050.20	1 PC	1,050.20	✓
5 FRONT RH DOOR FRAME STICKER	20.20	1 PC	20.20	✓
6 FRONT RH DOOR INNER RUBBER	83.10	1 PC	83.10	✓
7 FRONT RH DOOR TOP HINGE	40.10	1 PC	40.10	✓
8 FRONT RH DOOR BOTTOM HINGE	40.10	1 PC	40.10	✓
9 FRONT RH SHOCK ABSORBER	310.90	1 PC	310.90	✓
10 FRONT RH KNUCKLE ARM	280.30	1 PC	280.30	✓
11 FRONT RH WHEEL BEARING	168.00	1 PC	168.00	✓
12 FRONT RH LOWER ARM	160.10	1 PC	160.10	✓
			2,683.50	
	Less 20%		536.70	2,146.80
Special Net				
13 FRONT RH SPORT RIM	450.00	1 PC	450.00	✓
			450.00	450.00
Labour				
14 REMOVE & REFIX FRT BUMPER ASSY,FRT RH FENDER,FRT RH DOOR & ATTACHMENT,SIDE MIRROR,KNOCK & REPAIR FRT RH W/SCREEN PILLAR & REALIGN THE SAME	800.00	1 LA	800.00	600
15 REMOVE & REFIX SEAT,CARPET,SAFETY BELT	100.00	1 LA	100.00	60
16 REMOVE & REFIX FRT RH UNDER CARRIAGE AND CHECK STEERING & DRIVE SHAFT	200.00	1 LA	200.00	7
17 PUTTY & RESPRAY ON FRT RH W/SCREEN PILLAR,RH ROCKER PANEL,FRT RH SIDE MIRROR,FRT RH FENDER,FRT RH DOOR,FRT BUMPER & ALL AFFECTED AREAS	900.00	1 LA	900.00	800
18 TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT	60.00	1 PC	60.00	✓
19 RUSTPROOFING	60.00	1 LA	60.00	✓
			2,120.00	2,120.00

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date:

Total S\$ 4,716.80
 Add GST @ 7% 330.18
 Total Amount Payable S\$ 5,046.98

For Cheng Hoe Motor Pte Ltd

AUTHORISED SIGNATURE

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	01/08/2020 11:46
Date Of Accident	31/07/2020 08:15
Exact Location Of Accident	NO.3 LEEDON HEIGHT
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLD9765D
Insured/Policyholder	
Name Of Registered Owner	STEVEN YONG YEW CHON
NRIC No	SXXXX288C
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-97738948
Alternative Phone No	OFFICE-97738948

Vehicle Particulars

Manufacturer	HONDA
Model	JAZZ-1.3 (A)

Exact Purpose for which vehicle was being used at time of accident	PTE USE
--	---------

Are you claiming under your own insurance policy for repair to your vehicle?	NO
--	----

If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	TOKIO MARINE INSURANCE SINGAPORE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	20-ML000325-R00
Cover Note Number	1/7/20 TO 30.3.2022

Driver

Name of Driver	STEVEN YONG YEW CHON
NRIC No	SXXXX288C
Date Of Birth	19/11/1959
Occupation	INDOOR
Date Of Driving Pass	25/09/1984
Driving Experience	35 YEARS AND 10 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-97738948
Fax Number	
Contact Number	OFFICE-97738948
Email Address	NOEMAIL

Address BLK 681B WOODLANDS DRIVE 62. 09-19
 Postcode 732681
 Was driver an employee of the Insured's Company NO
 If No, Relationship of the Driver with the Insured OWNER
 Vehicle Registration Number of Driver's Own Vehicle -
 -
 -
 Insurance Company of Driver's Own Vehicle -
 -
 -

General Information of the Accident

Type Of Accident COLLISION - MAJOR/MINOR RD
 Weather Conditions CARPARK
 Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO
 Number of vehicles (including own vehicle) involved in the accident 2
 Was any body injured in the Accident? NO
 Was any injured conveyed to hospital by ambulance? NO
 Was any other material or property damaged? YES
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
 Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? NO
 If Yes, Please state which Police Station
 Was notice of intended Prosecution given? NO
 If Yes, against whom?

Circumstances of Accident

I WAS MOVING STRAIGHT AHEAD TOWARDS THE CARPARK EXIT WHEN THE CAR SJY241X TURNED RIGHT FROM THE SIDE ROAD AND HIT ONTO MY VEHICLE (DRIVER SIDE) AND CAUSE DAMAGE. THERE WAS NO INJURIES TO BOTH PARTIES

Attachment(s)


Are accident photos available for attachment? YES
 Was there any video captured by Car Camera? YES
 Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SJY241X
 Vehicle Make/Model/Colour MAZDA
 Details Of Properties FRONT LEFT
 Vehicle Category PRIVATE CAR
 Name of Driver HE XIAOLI
 NRIC/Passport Number SXXXX673A
 Contact Number 81393050
 Address
 Postcode
 Insurance Company Name
 Nature Of Damage
 No. Of Passenger (Including Driver)

Kenn

F SKETCH PLAN

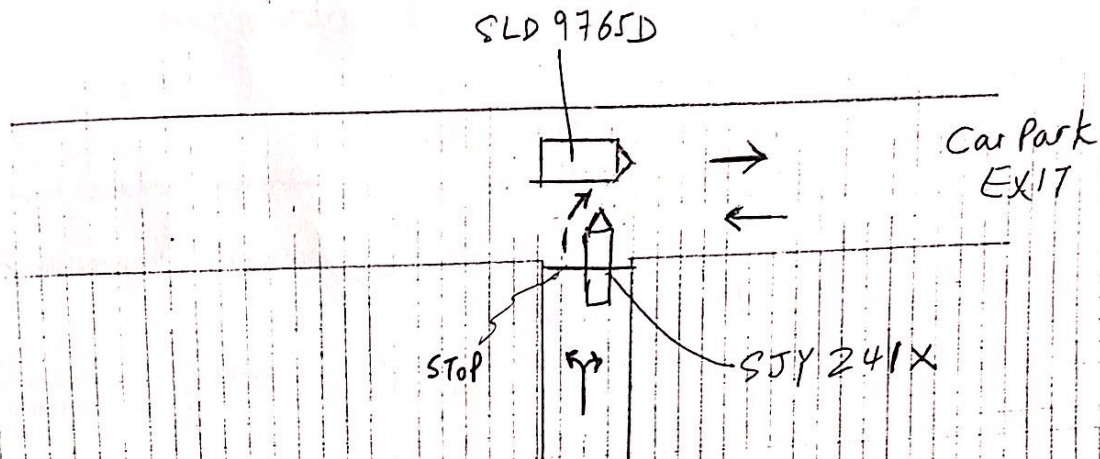

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I was moving straight ahead towards the car park exit when the car (SJY 241X) turned right from the side road and hit onto my vehicle (Driver's side) and caused damage. There was no injuries to both parties.

Note : Please note that your insurer may have 14days Time Frame for you to submit an Own Damage Claim under your own comprehensive policy. Please check with your policy for more information.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature

Date & Time:

1/8/2020

Driver's Signature

(If driver is not the policyholder)

Date & Time:

() Claim Own Policy (☒) Claim Third Party () Reporting Only
() Claim OD/TP at other workshop ()

Reporting Centre Personnel's Signature

Name:

NRIC/FIN No.:

[Signature]

WL - 1/8/20