

## ASSIGNMENT

COE Sept 2026

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

N/S	O/S
<input checked="" type="checkbox"/>	<input type="checkbox"/>

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Report \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: 7 days Res.: Yes or NoLum Sum: P/P % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Vehicle: IN / OUT

Veh No: SH 9667A Yr Regn: 2018 / Sept

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Hyundai Ioniq c.c. 1580Colour: Blue A/C: Insured / Std / NI / NASp. Reading: 169832 T/Radio: Insured / Std / NI / NAEng/No: G4LEJU032193C/No: KMHG851CVK114707

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195/65R15R: — 11 —

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Westlake

Front

Rear

R/Bal. S mm R/Bal. S mmL/Bal. S mm L/Bal. S mmD.O.A. 18/09/2020 D.O.I. 21/09/2020Survey held at Bijrost Sin Ming

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

MSG YQ 1638T

1/10 Sent Preli by Mornen

Date/Time, File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Report Format: \_\_\_\_\_

Lump Sum / I.B.I: (\$) \_\_\_\_\_

Days Of Repair: \_\_\_\_\_

Resurvey No. of Trip: \_\_\_\_\_

Add Fee:

☐

: Site Insp (\$)

☐

: Interview (\$)

☐

: Tech. Invs (\$)

☐

: Weekend (\$)

Survey Fee:

Transportation:

S+RS \$

Photos

Others

TOTAL

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	18/09/2020 13:14
Date Of Accident	18/09/2020 08:50
Exact Location Of Accident	YISHUN AVE 7 TWDS YISHUN AVE 6
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SH9667A
<b>Insured/Policyholder</b>	
Name Of Registered Owner	COMFORT TRANSPORTATION PTE LTD
Co Reg No	1XXXXX821R
Email Address	FLEETSAFETY@CDGTAXI.COM.SG
Mobile Phone No	
Alternative Phone No	OFFICE-65508768

### Vehicle Particulars

Manufacturer	HYUNDAI
Model	IONIQ

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? NO

If No, Please state action to be taken THIRD PARTY

Vehicle Category TAXI

### Insurance Company

Name of Insurance Company	MS FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-18088936MFSH
Cover Note Number	

### Driver

Name of Driver	SIA HUAT LOW
NRIC No	SXXXX365H
Date Of Birth	26/08/1953
Occupation	OUTDOOR
Date Of Driving Pass	25/03/1977
Driving Experience	43 YEARS AND 5 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-98480126
Fax Number	
Contact Number	
Email Address	SHUATLOW_0808@YAHOO.COM

Address	422 10-437 CANBERRA ROAD
Postcode	750422
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - TAXI DRIVER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

#### General Information of the Accident

Type Of Accident	SIDE SWIPE
Weather Conditions	CLEAR
Road Surface	DRY

#### Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : -
	GENDER: : FEMALE

#### Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

SEE ATTACH.

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	-
Was there any audio recorded?	NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	YQ1638T
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	KEE BO XUN
NRIC/Passport Number	
Contact Number	81134154
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	FRT RHT

No. Of Passenger (Including Driver)

## SKETCH PLAN

### IMPORTANT NOTICE


1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**


I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
  - (ii) for complying with requirements under any regulations, laws or court orders.

COMFORT TRANSPORTATION PTE LTD  
CO. REG. NO. 199303821R


Policyholder's Signature  
Date & Time:

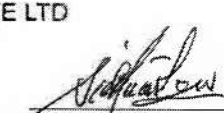  
Driver's Signature  
(If driver is not the policyholder)  
Date & Time: 18.09.2020  
@ 10:45 hrs

  
Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:



# SKETCH PLAN

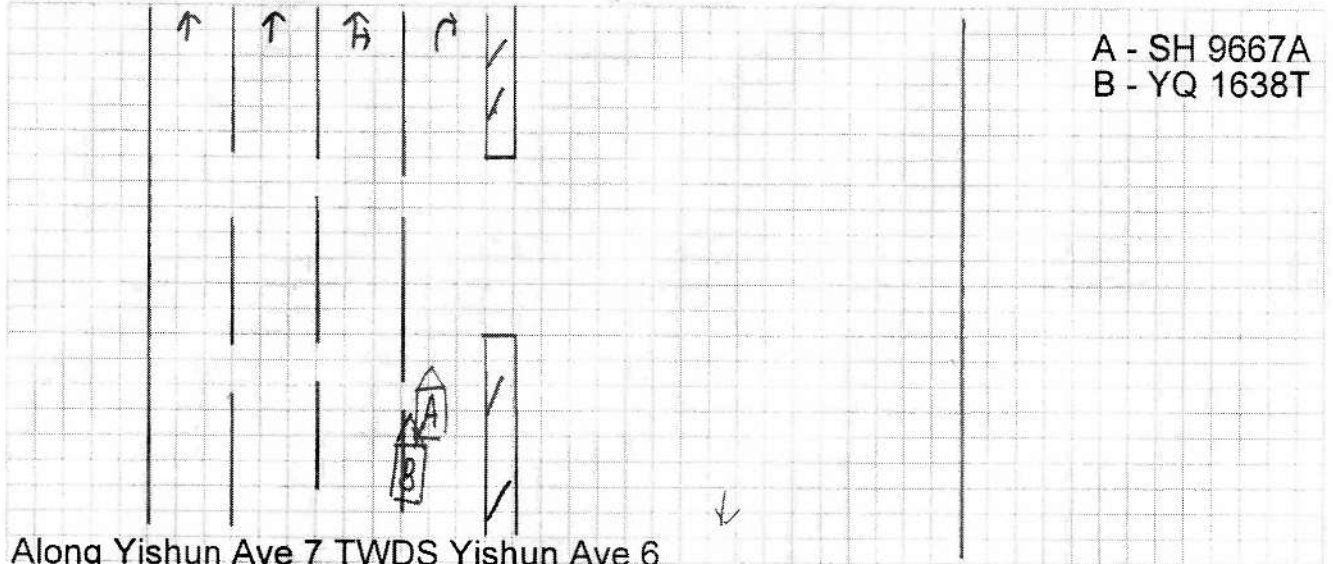

Along Yishun Ave 7 TWDS Yishun Ave 6

## DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On 18.09.2020 at about 08:50 hours I was travelling along Yishun Ave 7 TWDS
Yishun Ave 6 with One Female Passenger onboard .
While I saw the taxi in front of me slowed down and stop and I performed a pressure
break and suddenly veh B ( YQ 1638T ) lost control and collided into my taxi A -
Left Rear Portion .
As it take place too fast I could not take evasive action to prevent .
I have company video and photo to support my claims .
After the accident my female passenger and I felt unwell , will consult doctor later
on .
Veh B ( YQ 1638T ) - Mr Kee Bo Xun H/P : 8113 4154

## DECLARATION

I/We declare the foregoing particulars are true in every respect.

COMFORT TRANSPORTATION PTE LTD

CO. REG. NO. 199303821R

Date & Time:

GIARMC Sketch Plan Form V3

Driver's Signature

(If driver is not the policyholder)

Date & Time: 18.09.2020

@ 10:45 hrs

Reporting Centre Personnel's Signature

Name:

NRIC/FIN No.:

Back to OneMotoring

### Enquire PARF/COE Rebate for Registered Vehicle

#### Vehicle Owner Particulars

Owner ID Type

Company

Owner ID

821R

#### Vehicle Details

Vehicle Hoc

SH9667A

Vehicle to be Exported

Yes

Intended Re-registration Date

21 Sep 2020

Vehicle Make

HYUNDAI

Vehicle Model

AE IONIQ HEV 1.6 DCT

Primary Colour

Blue

Manufacturing Year

2018

Engine No

G4LEJU032193

Chassis No

KMHCB51CVKU114707

Maximum Power Output

103.4 kW (138 bhp)

Open Market Value

\$24,968.00

Original Registration Date

28 Sep 2018

First Registration Date

28 Sep 2018

Transfer Count

0

Actual ARF Paid

\$11,956.00

#### Intended PARF Rebate Details

PARF Eligibility

Yes

PARF Eligibility Expiry Date

27 Sep 2026

PARF Rebate Amount

\$8,967.00

#### Intended COE Rebate Details

COE Expiry Date

27 Sep 2026

COE Category

A - Car up to 1600cc & 97kW (130bhp)

COE Period (Years)

8

EQP Paid

\$25,872.00

COE Rebate Amount

\$19,457.00

Total Rebate Amount

\$28,424.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.  
The information contained herein is correct as at 21 Sep 2020

OK

SH  
9667A

Phone Number:

Fax Number:

Customer:			Date: 22/9/2020 11:22 AM			
Company:			VIN			
License NO: SH9667A			Technician:			
Odometer:			Order NO:			
<b>VEHICLE ALIGNMENT REPORT</b> HYUNDAI, IONIQ hybrid 17> AE Series All Models, 17-17 (Customized)						
Primary Angles			Initial	Specifications Min. Max.		Final
Front	Caster	Left	4°56'	4°00'	5°00'	5°08' *
		Right	4°53'	4°00'	5°00'	5°06' *
	Camber	Left	-0°38'	-1°00'	0°00'	-0°26'
		Right	-0°06'	-1°00'	0°00'	-0°11'
	Toe	Left	-0°01'	-0°02'	0°05'	-1°30' *
		Right	-0°19' *	-0°02'	0°05'	1°11' *
Total		-0°19' *	-0°04'	0°11'	-0°19' *	
Rear	Camber	Left	-1°28' *	-1°25'	-0°25'	-0°40'
		Right	-2°03' *	-1°25'	-0°25'	-2°01' *
	Toe	Left	1°43' *	0°00'	0°11'	1°55' *
		Right	-0°13' *	0°00'	0°11'	-0°10' *
		Total	1°31' *	0°00'	0°22'	1°45' *
	Thrust Angle		-0°58'	----		-1°03'
Secondary Angles			Initial	Specifications Min. Max.		Final
SAI	Left	14°03'	13°18'	14°18'	14°03'	
	Right	13°53'	13°18'	14°18'	13°53'	
Included Angle	Left	13°24'	----	----	13°37'	
	Right	13°47'	----	----	13°42'	
Toe Out On Turns	Left	----	----	----	----	
	Right	----	----	----	----	
Max Turn Inside	Left	----	38°00'	41°00'	----	
	Right	----	38°00'	41°00'	----	
Toe Curve Change	Left	----	----	----	----	
	Right	----	----	----	----	
Setback	Front	-0.11"	----	----	-0.11"	
	Rear	0.25"	----	----	0.25"	
Track Width Diff.		-0.36"			-0.36"	
Wheel Base Diff.		-0.36"			-0.36"	
Front Ride Height	Left	----	----	----	----	
	Right	----	----	----	----	
Rear Ride Height	Left	----	----	----	----	
	Right	----	----	----	----	
Frame Angle					----	



# BIFROST AUTO PTE LTD

## REPAIR ESTIMATE

DATE: 18-Sep-20

INSURANCE: MSIG

MODEL: HYUNDAI IONIC

VEHICLE NO.: SH 9667 A

Description	Qty	List Price	Amount
Boot Lid <i>Defect</i>	1	\$ 2,480.40	\$ 2,480.40
Boot Lid Hinge (LH/RH) <i>HH</i>	2	\$ 71.30	\$ 142.60
Boot Lid Absorber (LH) <i>HH</i>	1	\$ 86.70	\$ 86.70
Boot Lid 'H' Emblem <i>HH</i>	1	\$ 28.00	\$ 28.00
Emblem-Hybrid <i>HH</i>	1	\$ 24.30	\$ 24.30
Emblem-Ionic <i>HH</i>	1	\$ 31.30	\$ 31.30
Boot Lid Lamp(LH) <i>Circle</i>	1	\$ 794.40	\$ 794.40
Boot Lid Trimboard Clips (10pcs) <i>HH</i>	1	\$ 11.00	\$ 11.00
Boot Lid Trimboard SIDE (LH) <i>HH</i>	1	\$ 92.50	\$ 92.50
Rear Bumper <i>Defect</i>	1	\$ 459.40	\$ 459.40
Rear Bumper Reinforcement <i>HH</i>	1	\$ 394.80	\$ 394.80
Rear Bumper Reinforcement Bracket (LH/RH) <i>HH</i>	2	\$ 188.10	\$ 376.20
Antenna Assy-SMARTK <i>HH</i>	1	\$ 689.50	\$ 689.50
Rear Bumper Stay <i>HH</i>	1	\$ 138.10	\$ 138.10
Rear Bumper Side retainer (LH) <i>broken</i>	1	\$ 85.80	\$ 85.80
Rear Bumper Cover Clips <i>HH</i>	1	\$ 22.00	\$ 22.00
Rear Bumper Side Under(LH) <i>broken</i>	1	\$ 123.10	\$ 123.10
Rear Bumper Reflector Lamp(LH) <i>SVC</i>	1	\$ 82.90	\$ 82.90
Rear Bumper Towing Cover <i>HH</i>	1	\$ 98.80	\$ 98.80
Rear Bumper Reserve Light (Parking Brake Light) <i>HH</i>	1	\$ 328.60	\$ 328.60
Licence Lamp (LH) <i>HH</i>	1	\$ 85.30	\$ 85.30
Licence Lamp WIRE <i>HH</i>	1	\$ 135.80	\$ 135.80
Tail Lamp(LH) <i>broken</i>	1	\$ 870.40	\$ 870.40
Tail Lamp Quarter Panel(LH) <i>Defect</i>	1	\$ 208.90	\$ 208.90
Rear Panel <i>Defect</i>	1	\$ 532.00	\$ 532.00
Rear Panel Garnish <i>HH</i>	1	\$ 346.80	\$ 346.80
Spare Tyre Holder <i>HH</i>	1	\$ 223.10	\$ 223.10
Spare Wheel Lock Nut <i>HH</i>	1	\$ 89.50	\$ 89.50
Spare Tyre Panel <i>HH</i>	1	\$ 892.50	\$ 892.50
Rear tray tools box LH <i>HH</i>	1	\$ 693.20	\$ 693.20
Rear Fender(LH) <i>Defect</i>	1	\$ 1,768.30	\$ 1,768.30
Rear Fender SHIELD REAR PIECE ( LH ) <i>HH</i>	1	\$ 173.60	\$ 173.60
Rear Fender Air-Duct (LH) <i>SVC</i>	1	\$ 87.30	\$ 87.30
Rear Fender Trim Board (LH) <i>HH</i>	1	\$ 788.75	\$ 788.75
Assy BSD Blind Spot Radar (LH) <i>Defect</i>	1	\$ 1,625.00	\$ 1,625.00
Rear Tyre Rim (LH) <i>Defect</i>	1	\$ 1,124.20	\$ 1,124.20
Rear Wheel Hup-Cap (LH) <i>HH</i>	1	\$ 346.40	\$ 346.40
Rear Wheelbearing & Hub assy <i>Defect</i>	1	\$ 554.00	\$ 554.00
Rear Trailing Arm(LH) <i>Defect</i>	1	\$ 265.40	\$ 265.40
Rear Assist (LH) <i>Defect</i>	1	\$ 227.90	\$ 227.90
Rear shock Absorber(LH) <i>Defect</i>	1	\$ 230.50	\$ 230.50
Rear Shock Absorber Mounting (LH) <i>HH</i>	1	\$ 133.10	\$ 133.10

Rear Absorber stopper (LH) NH	1	\$ 137.60	\$ 137.60	X
Rear Absorber Cover (LH) NH	1	\$ 175.60	\$ 175.60	X
Rear Crossmember NH <i>disturb</i>	1	\$ 1,468.70	\$ 1,468.70	X L
Stabilizer Bar NH	1	\$ 387.30	\$ 387.30	X
Stabilizer Link (LH) NH	1	\$ 147.30	\$ 147.30	X
Rear Upper Arm(LH) <i>disturb</i>	1	\$ 239.50	\$ 239.50	2 ✓
Rear Lower Arm(LH) <i>disturb</i>	1	\$ 393.10	\$ 393.10	2 ✓
Rear Knuckle Arm (LH) <i>disturb</i>	1	\$ 538.10	\$ 538.10	2 ✓
<b>SUB TOTAL</b>				
<b>LESS 20%</b>				
<b>DISCOUNTED TOTAL</b>				
Boot Lid Comfort Logo & Tel No. Sticker HCC SN	1	\$ 35.00	\$ 35.00	✓
Rear Bumper Rubber Mat HCC SN	1	\$ 50.00	\$ 50.00	✓
Rear Bumper Reverse Sensor NH SN	1	\$ 180.00	\$ 180.00	X
Rear Tyre(LH) NH SN	1	\$ 216.00	\$ 216.00	X
<b>SUB TOTAL</b>				
<b>Labour Charge</b>				
Panel Beating	1	\$1,400.00	\$1,400.00	800/-
Spray Painting Charge	1	\$1,200.00	\$1,200.00	700/-
Wiring Charge	1	\$160.00	\$160.00	30/-
Tuff Kote	1	\$160.00	\$160.00	40/-
Towing Charge	1	\$80.00	\$80.00	NH
Remove/Refix Reverse Sensor	1	\$120.00	\$120.00	40/-
Remove/Refix Undercarriage (RR)	1	\$400.00	\$400.00	2 ✓
Re-set Rear ABS System	1	\$400.00	\$400.00	NH
Four Wheel Alignment	1	\$120.00	\$120.00	60/-
Diagnostic & Resetting To Erase Fault Code	1	\$550.00	\$550.00	180/-
<b>TOTAL LABOUR</b>				
<b>ESTIMATE TOTAL</b>				
This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.				

21/09/2020 @ 1700hrs

N/A Actual

Part by Part.

7 to days.

2KK Auto

Photo after repair with damaged parts

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

parts