

ASS. REC. BY:

REF:

105/

## ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

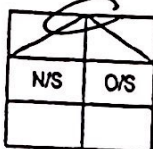
Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

04 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SBZ 1908

Yr Regn:

04, 13

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

M. E200

c.c

1991

Colour

M. Grey

A/C:

Insured / Std / NI / NA

Sp. Reading

70296

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WDD 2120482A 758007

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F:

245/40ZR18

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

7

mm

R/Bal.

7

mm

L/Bal.

7

mm

L/Bal.

7

mm

D.O.A.

26/10/20

D.O.I.

29/10/2020

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. SI

Fees

Others

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format:

Lump Sum / I.B.I. (\$)

TOTAL

## Alan's United Auto Pte Ltd (Co.Reg.No:201113667N)

Blk 7 Sin Ming Industrial Estate, #01-76

Singapore 575642

Tel: 6453 8686 Fax: 6459 6550 Email: kennychan@alanutd.com;Janicechou@alanutd.com

INSURER:

ECICS Limited (HQ)

## PARTICULARS OF CLAIM

Claim Type:	OD (OWN DAMAGE)	Ref. No:	020149
Policy No:	MPC20P00148300	Date of Loss:	26/10/2020
Vehicle Reg. No.:	SBZ190Z	Driveable?	
Driver Age/Info:	29 / FEMALE	Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	CHEW STEPHEN	Contact No:	+6597307851
Driver:	GLORIA CHEW		

Make/Model:	MERCEDES-BENZ E200, 1.8 CGI BLUEEFFICIENCY (W212) (A)	Vehicle Reg. Date:	11/04/2013
Vehicle Colour:	SILVER	Chassis No:	WDD2120482A758007
Engine No:	27186030636148		
Odometer:	0 KM		

Paint Type:  
Total Loss?  
Est. Duration of Repair (day)

NO

4 ✓



Not Authorized  
L1 Imp @  
Repairing After Repair  
Ex @ 500k

Present Location: ALAN'S UNITED AUTO PTE LTD (HQ)

Fax: 62564315

## COST OF CLAIMS

## Amount

Parts	4,259.70
Miscellaneous Items	0.00
Labour	920.00
Paintwork Labour	0.00
Towing	0.00

Gross Total (S\$)	5,179.70
+ GST 7.00% (S\$)	362.58
Nett Amount (S\$)	5,542.28

This claim is handled by: OW JING JIE

Generated using Merimen e-Claims Internet Estimation &amp; Adjusting System



**REPAIR DETAILS****Reference**

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 28 Oct 2020)

Parts: 143 MERCEDES-BENZ E200 1.8 CGI BlueEfficiency (W212) (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: Alan's United Auto Pte Ltd/SBZ190Z/28/10/2020 14:44

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk \*.

**Estimates on Parts**

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount	
1	1		*FRONT BUMPER FASCIA	CM	0.00	0.00	*1,200.00 F ✓
2	2		*FRONT BUMPER PARKING SENSOR		0.00	0.00	*290.00 F ?
3	1		*FRONT RH PARKING SENSOR		0.00	0.00	*145.00 F ?
4	3		*FRONT PARKING SENSOR O RING	NC	0.00	0.00	*12.00 F ✓
5	1		*FRONT BUMPER SPONGE (CENTRE)		0.00	0.00	*70.00 F ?
6	1		*FRONT BUMPER LOWER GRILLE	Dir	0.00	0.00	*95.00 F ✓
7	1		*FRONT BUMPER NO.PLATE GARNISH	Dr	0.00	0.00	*80.00 F ✓
8	1		*RADIATOR GRILLE	CM	0.00	0.00	*580.00 F ✓
9	1		*RADIATOR GRILLE LOGO	NC	0.00	0.00	*33.00 F 2
10	1		*RADIATOR GRILLE CENTRE BRACKET	CM	0.00	0.00	*18.00 F 2
11	1		*RADIATOR GRILLE TOP COVER	CM	0.00	0.00	*86.00 F ✓
12	1		*BRACE PANEL	R	0.00	0.00	*32.00 F ✓
13	1		*CONDENSER GUIDE COVER		0.00	0.00	*55.00 F ?
14	1		*CONDENSER GUIDE LOWER		0.00	0.00	*95.00 F ?
15	2		*BONNET SPRING STOPPER	CM	0.00	0.00	*36.00 F ✓
16	2		*HEADLAMP		0.00	0.00	*1,000.00 F ?
17	1		*FRONT NO.PLATE WITH BOX		0	0.00	*50.00 FS 95M

F=Franchise part. S=SpcNett.

Sub Total (\$\$)	3,877.00
+ Margin on L,N Items 10.00% (\$\$)	382.70
<b>Total Parts (\$\$)</b>	<b>4,259.70</b>

Alan's United Auto Pte Ltd/SBZ190Z/28/10/2020 14:44. Not valid without Reference section.  
Generated using Merimen e-Claims IEAS

10/28/2020

Repairer Estimates

## Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

## Estimates on Labour

No	Particulars	Lab.Type	Amount
<u>Labour Items</u>			
1	TO REWIRE DAMAGED PARTS AND REFOCUS HEADLAMP BEAM.	New	20.00 ✓
2	TO PUTTY AND SPRAY REPLACED PARTS	New	400.00 ✓
3	TO REMOVE DAMAGED PARTS,PANEL BEATING ,ALIGN,REFIX AND TO RENEW ABOVE PARTS	New	500.00 450/
Gross Labour Cost (\$)			920.00

Alan's United Auto Pte Ltd/SBZ190Z/28/10/2020 14:44. Not valid without Reference section.  
Generated using Merimen e-Claims IEAS

&lt; END OF ESTIMATES &gt;

> Back to OneMotoring

### Enquire PARF/COE Rebate for Registered Vehicle

<b>Vehicle Owner Particulars</b>	
Owner ID Type:	Singapore NRIC
Owner ID:	925A
<b>Vehicle Details</b>	
Vehicle No.:	SBZ190Z
Vehicle to be Exported:	Yes
Intended Deregistration Date:	28 Oct 2020
Vehicle Make:	MERCEDES BENZ
Vehicle Model:	E 200 BLUEEFFICIENCY
Primary Colour:	Silver
Manufacturing Year:	2013
Engine No.:	27186030636148
Chassis No.:	WDD2120482A758007
Maximum Power Output:	135.0 kW (181 bhp)
Open Market Value:	\$50,758.00
Original Registration Date:	11 Apr 2013
First Registration Date:	11 Apr 2013
Transfer Count:	1
Actual ARF Paid:	\$63,365.00
<b>Intended PARF Rebate Details</b>	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	10 Apr 2023
PARF Rebate Amount:	\$38,019.00
<b>Intended COE Rebate Details</b>	
COE Expiry Date:	10 Apr 2023
COE Category:	B - Car (1601cc & above)
COE Period(Years):	10
QP Paid:	\$73,900.00
COE Rebate Amount:	\$18,124.00
<b>Total Rebate Amount:</b>	<b>\$56,143.00</b>

The information contained herein is correct as at 27 Oct 2020

OK



## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	27/10/2020 12:45
Date Of Accident	26/10/2020 23:00
Exact Location Of Accident	CTE EXIT YIO CHU KANG SLIP RD
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SBZ190Z
<b>Insured/Policyholder</b>	
Name Of Registered Owner	CHEW STEPHEN
NRIC No	SXXXX925A
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-97307851
Alternative Phone No	OFFICE-97307851

### Vehicle Particulars

Manufacturer	MERCEDES-BENZ
Model	E200-1.8 CGI BLUEEFFICIENCY (W212) (A)
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

### Insurance Company

Name of Insurance Company	ECICS LIMITED
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	MPC20P00148300
Cover Note Number	

### Driver

Name of Driver	GLORIA CHEW
NRIC No	SXXXX251B
Date Of Birth	14/05/1991
Occupation	OUTDOOR
Date Of Driving Pass	07/03/2013
Driving Experience	7 YEARS AND 7 MONTHS
Gender	FEMALE
Mobile Number	(LOCAL) +65-91761850
Fax Number	
Contact Number	
Email Address	GLRCHEW@OUTLOOK.SG

Address	530 JOO CHIAT ROAD #01-01
Postcode	427710
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	CHILDREN
Vehicle Registration Number of Driver's Own Vehicle	-
Insurance Company of Driver's Own Vehicle	-

#### General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

#### Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : OW JING JIE GENDER: : MALE

#### Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

REFER TO SKETCH PALN ATTACHED

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	OVERRIDE
Was there any audio recorded?	NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SMS9588H
Vehicle Make/Model/Colour	MAZDA
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	SEET KAI SHENG GABRIEL
NRIC/Passport Number	SXXXX288E
Contact Number	97532157
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	



Y10 Cihu Kanh Road

SMS 25884

SBZ1402

Y10 Cihu Kanh Road

CTE (Yohnd)



Y10 Cihu Kanh Flyover

SMS95884 WAS STOPPED AT ZEBRA CROSSING.  
SBZ 1902 WAS ~~BE~~ ROLLING TO A STOP BEHIND HIM.  
DUE TO CHECKING FOR ONCOMING TRAFFIC ON MAIN ROAD, FAILED  
TO STOP IN TIME AND HIT SMS95884, FROM BEHIND.  
  
PLACE: EXIT CTE ONTO Y10 CTR PARK ROAD.  
2 VEHICLES INVOLVED.  
  
DATE: 26 OCT 2020  
TIME: 2300H

I/We declare the foregoing particulars are true in every respect.

CLARK'S Sketch-Plan 0:11 x 3

Driver's Signature \_\_\_\_\_  
(If driver is not the policyholder)  
Date & Time: 7/10/2022



27/10

Reporting Centre Personnel's signature  
 Name: \_\_\_\_\_  
 NRIC/FIN No.: \_\_\_\_\_