

ASS. REC. BY:

REF:

AIG/20011995 1K

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

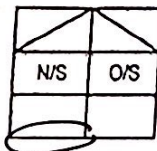

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

04

days

Res.:

Yes or No

Lum Sum:

1.1.1

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SLX 6771A

Yr Regn:

12. 17

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or

Make:

Toy Pienta

c.c

1496

Colour

M. P. White

A/C:

Insured / Std / NI / NA

Sp. Reading

22547

T/Radlo:

Insured / Std / NI / NA

Eng/No:

C/No:

NHP170 - 7091380

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F: Mic

185/60R15

Wet/Leak

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

9

mm

R/Bal.

7

mm

L/Bal.

9

mm

L/Bal.

7

mm

D.O.A.

30/10/20

D.O.I.

9/11/2020

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trlp:

Survey Fee:

Transportation:

S - RS. SI

Parties

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$

ACCORD AUTO SERVICES PTE LTD

10 Ang Mo Kio Industrial Park 2A

#03-11 AMK Autopoint Singapore 568047

Tel: 6481 9518 / 6481 9517 Fax: 6481 9516 email: claims@mycarworkshop.com.sg

ESTIMATE

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

AIG Building #09-16

Singapore 079120

Attn: Motor Claims Department

Date :

02.11.2020

Vehicle No :

SLX6771A

Veh Make/Model :

Toyota Sienta Hybrid

YOM :

2017

Chassis No :

NHP1707091380

Date of Accident :

31.10.2020

Not Authorised
Running B4 painting
4 days

No	Qty	Description	Amount \$
		List Items:-	
1	1	Rear Tail Gate	\$ <i>By</i> 1,131.00 ✓
2	2	Rerar Tail Gate Absorber	\$ <i>in</i> 470.00 X
3	1	Rear Tailgate Logo	\$ <i>na</i> 80.00 ✓
4	1	Rear Tail Gate Lock	\$ <i>R</i> 326.00 X
5	1	Rear Tail Gate Inner Trim Board	\$ <i>in</i> 175.00 X
6	1	Rear Lower Bumper	\$ <i>Per/Not</i> 318.00 ✓
7	2	Rear Bumper Reflector LH & RH	\$ <i>Per</i> 120.00 X
8	1	Rear LH Side Bumper Bracket	\$ <i>R</i> 135.00 X
9	1	Rear RH Side Bumper Bracket	\$ <i>R</i> 135.00 Y
10	Set	Rear Galss Moulding	\$ <i>na</i> 154.00 ✓
11	1	Rear End Panel	\$ <i>R</i> 696.00 X
12	1	Rear LH Bumper Garnish	\$ <i>Not/na</i> 145.00 ✓
13	1	Rear LH Bumper Sensor Cover / Garnish X	
14	1	Rear Centre Bumper Garnish	\$ <i>Not</i> 190.00 ✓
15	2	Rear Bumper Side Retainer	\$ <i>in</i> 196.00 X
16			
17			
18			
19			
20			
21			
22			
23			
24			
25			
26			
27			
28			
29			
30			
Total - List Item			\$ 4,271.00
Less 25%			\$ 1,067.75
Total			\$ 3,203.25

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

10 Ang Mo Kio Industrial Park 2A

Tel: 6481 9518 / 6481 9517 Fax: 6481 9516 email: claims@mycarworkshop.com.sg

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

AIG Building #09-16

Singapore 079120

Attn: Motor Claims Department

Date :

02.11.2020

Vehicle No :

SLX6771A

Veh Make/Model :

Toyota Sienta Hybrid

YOM :

2017

Chassis No :

NHP1707091380

Date of Accident :

31.10.2020

Page 2/2

Address BLK 318A YISHUN AVE 9 #06-114
Postcode 761318
Was driver an employee of the Insured's Company NO
If No, Relationship of the Driver with the Insured OWNER
Vehicle Registration Number of Driver's Own Vehicle -
-
-
Insurance Company of Driver's Own Vehicle -
-
-

General Information of the Accident

Type Of Accident COLLISION - HEAD TO REAR
Weather Conditions CLEAR
Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO
Number of vehicles (including own vehicle) involved in the accident 2
Was any body injured in the Accident? NO
Was any injured conveyed to hospital by ambulance? NO
Was any other material or property damaged? YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
Number of Passengers (Including Driver) 4
Passenger 1 NAME: : CHUA XIN YI
GENDER: : FEMALE
Passenger 2 NAME: : SIEW JIA LING STEFFI
GENDER: : FEMALE
Passenger 3 NAME: : SIEW QUN HONG RYAN
GENDER: : MALE

Details of Police Action

Was the accident reported to the police? NO
If Yes, Please state which Police Station
Was notice of intended Prosecution given? NO
If Yes, against whom?

Circumstances of Accident

PLEASE REFER TO THE ACCIDENT SKETCH PLAN

Attachment(s)

Are accident photos available for attachment? YES
Was there any video captured by Car Camera? YES
Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1


Vehicle Registration Number SLT1197L
Vehicle Make/Model/Colour NISSAN
Details Of Properties
Vehicle Category PRIVATE CAR
Name of Driver BENEDICT CHUA SONG SHING
NRIC/Passport Number SXXXX678B
Contact Number 83398726

Sketch Plan #2

SKETCH PLAN

Veh A: GLX 6771A

Veh B: ST 1197L

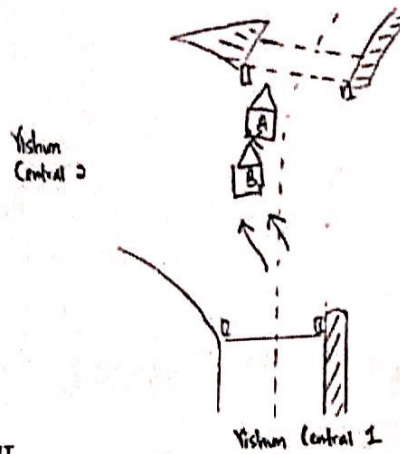

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

My family and I was were driving on Yishun Central 1 on 31/10/20 at 7.30pm, as my vehicle approaching the traffic junction linking Yishun Central 1 and Yishun Central 2. I noticed vehicles stopping at the crossing and I slowed down and saw a lady crossing the road even though it was red man on the traffic light.

As I slow down to almost stopping, my vehicle suddenly recieved a bang from the rear. as the lady is now in the way my lane

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature

Date & Time: 02/11/20
10.08am

Driver's Signature
(If driver is not the policyholder)
Date & Time:



Reporting Centre Personnel's Signature
Name: Y. Lina Lai
NRIC/FIN No.: