

ASS. REC. BY:

REF: LPC / 2001213211K4Kenneth

ASSIGNMENT

From: _____

Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: 848k

IDAC Accident Report: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: 16 days

Res.: Yes or No

Lump Sum: 20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Date / Time

Action / Instruction

Veh No: GBG 86214Regn: 11.17Type: M.Car / M.Cycle / Bus / Van / Corr / Taxi / Prime Mover /

Truck / Trailer or _____

Make: NIS Cobrac.c. 2953Colour: White

AC: Insured / Std / NI / NA

Sp. Reading: 129101

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JNISC 2F 248 0880398Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: NIL / S/R/m / STD A/R/m orTyre Size: Green Max 195R 15 x 8Racing Max 165R 13 x 8 (D)

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or _____

Front

Rear

R/Bal. 4 mmR/Bal. 66 mmL/Bal. 4 mmL/Bal. 22 mmD.O.A. 30/10/20D.O.I. 5/11/2020

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

FR N/SThe UIC / Chassis frame / Body Structure affected due to collision. ☒

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

S + RS \$ _____

Fees _____

Others _____

TOTAL

Add Fee: ☐

: Site Insp (\$ _____)

☐

: Interview (\$ _____)

☐

: Tech Invs (\$ _____)

☐

: Weekend (\$ _____)

Report Format :

Lump Sum / I.B.I. (\$ _____)



CO. REG. NO: 199402370D
GST NO: M2-0123250-3

AUTO PTE LTD

金興(龔)汽車私人有限公司

160 Sin Ming Drive, #02-18/19/20/21,
Sin Ming AutoCity, Singapore 575722
Tel: 6452 7018 Fax: 6458 3895
Email: service@kkinhin.com.sg

INSURER: Lonpac Insurance Bhd (HQ)

PARTICULARS OF CLAIM

Claim Type:	OD (OWN DAMAGE)	Ref. No:	30/10/2020
Policy No:	Z/19/VC00/105296	Date of Loss:	
Vehicle Reg. No.:	GBG8621U	Driveable?	
Driver Age/Info:	30 / MALE	Party At Fault:	UNKNOWN
TP Injury Involved?	YES	Third Party Involved?	YES
Insured/Claimant:	MONTREUX PATISSERIE PTE LTD		
Driver:	LEE LIE WEI		

Make/Model:	NISSAN CABSTAR, 3.0 5M/T ABS 2DR	Vehicle Reg. Date:	21/11/2017
	2WD EURO 5 (A)		
Vehicle Colour:	WHITE	Chassis No:	JN1SC2F24Z0860398
Engine No:	ZD30026731N		
Odometer:	0 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	18/6		

Not Authored
6/1/20
Repair After Paint
Ex 81500

Description of Accident/Loss: PLEASE REFER TO SKETCH PLAN AND POLICE REPORT.

Remarks: VEHICLE IS TOWED IN TO WORKSHOP FROM TRAFFIC POLICE COMPOUND. PLS ARRANGE FOR SURVEY. THANK YOU - SANDRA

Present Location: K KIM HIN AUTO PTE LTD (HQ)

COST OF CLAIMS

Amount

Parts	32,442.60
Miscellaneous Items	0.00
Labour	6,620.00
Paintwork Labour	0.00
Towing	0.00
Gross Total (S\$)	39,062.60
+ GST 7.00% (S\$)	2,734.38
Nett Amount (S\$)	41,796.98

This claim is handled by: SANDRA KHONG YEE TENG

Generated using Merimen e-Claims Internet Estimation & Adjusting System

REPAIR DETAILS

Reference

Part Source: (Last Synchronised: 05 Nov 2020)

Parts: N/A NISSAN CABSTAR 3.0 5M/T ABS 2DR 2WD EURO 5 (A) (Model not available in database)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for GBG8621U)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the
END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars		%Disc	%Depr	Amount	
				<i>Bt/Tn</i>	0.00	0.00	*520.00 F	✓
1	1		*FRONT BUMPER	<i>Ry</i>	0.00	0.00	*60.00 F	✓
2	1		*N/S FRONT BUMPER BRACKET	<i>mi</i>	0.00	0.00	*255.00 F	✓
3	1		*FRONT GRILLE	<i>mi</i>	0.00	0.00	*40.00 F	✓
4	1		*FRONT GRILLE LOGO	<i>mi</i>	0.00	0.00	*30.00 F	✓
5	10		*FRONT GRILLE CLIPS	<i>mi</i>	0.00	0.00	*60.00 F	✓
6	1		*FRONT GRILLE INNER BRACKET	<i>N/S Ry</i>	0.00	0.00	*500.00 F	✓
7	2		*HEADLAMP ASSY LH/RH	<i>N/S mi</i>	0.00	0.00	*130.00 F	✓
8	2		*HEADLAMP LOWER APRON GARNISH LH/RH	<i>Ry</i>	0.00	0.00	*640.00 F	✓
9	1		*FRONT PANEL	<i>mi</i>	0.00	0.00	*35.00 F	✓
10	1		*FRONT PANEL CABSTAR EMBLEM	<i>Ry</i>	0.00	0.00	*340.00 F	✓
11	1		*FRONT WIPER PANEL	<i>mi</i>	0.00	0.00	*35.00 F	✓
12	1		*FRONT WIPER LOWER MOULDING	<i>Sm</i>	0.00	0.00	*190.00 F	X
13	2		*FRONT WIPER ARM LH/RH	<i>Sm</i>	0.00	0.00	*30.00 F	X
14	2		*FRONT WIPER ARM SCREW CAP LH/RH		0.00	0.00	*210.00 F	✓
15	1		*FRONT WIPER LINKAGE		0.00	0.00	*395.00 F	✓
16	1		*FRONT WIPER MOTOR	<i>Sm</i>	0.00	0.00	*60.00 F	X
17	2		*FRONT WIPER BLADE LH/RH	<i>Ry</i>	0.00	0.00	*200.00 F	✓
18	1		*N/S FRONT CORNER PANEL	<i>R</i>	0.00	0.00	*145.00 F	X
19	1		*N/S WING MIRROR STAY	<i>mi</i>	0.00	0.00	*95.00 F	✓
20	1		*N/S WING MIRROR OUTER GARNISH	<i>mi</i>	0.00	0.00	*24.00 F	✓
21	1		*N/S WING MIRROR OUTER GARNISH INNER COVER	<i>mi</i>	0.00	0.00	*35.00 F	✓
22	1		*N/S WING MIRROR OUTER ROUND CAP COVER	<i>CRA</i>	0.00	0.00	*680.00 F	✓
23	1		*FRONT WINDSCREEN GLASS	<i>mi</i>	0.00	0.00	*65.00 F	✓
24	1		*FRONT WINDSCREEN GLASS UPPER MOULDING	<i>mi</i>	0.00	0.00	*45.00 F	✓
25	1		*FRONT WINDSCREEN GLASS LOWER MOULDING	<i>mi</i>	0.00	0.00	*130.00 F	✓
26	2		*FRONT WINDSCREEN GLASS SIDE MOULDING LH/RH	<i>Sm</i>	0.00	0.00	*175.00 F	X
27	1		*ERP IU UNIT	<i>Ry</i>	0.00	0.00	*940.00 F	✓
28	1		*N/S DOOR A PILLAR - OUTER	<i>Ry</i>	0.00	0.00	*165.00 F	✓
29	1		*N/S DOOR INNER STEP PILLAR	<i>Ry</i>	0.00	0.00	*285.00 F	✓
30	1		*N/S DOOR INNER UPPER PILLAR	<i>Ry</i>	0.00	0.00	*310.00 F	✓
31	1		*N/S DOOR INNER LOCK PILLAR	<i>mi</i>	0.00	0.00	*105.00 F	✓
32	1		*N/S DOOR INNER LOCK INNER GARNISH		0.00	0.00	*370.00 F	✓
33	2		*FRONT CABIN MOUNTING BRACKET LH/RH		0.00	0.00	*110.00 F	✓
34	2		*FRONT CABIN MOUNTING BUSH LH/RH		0.00	0.00	*100.00 F	✓
35	2		*REAR CABIN MOUNTING LH/RH		0.00	0.00	*450.00 F	✓
36	1		*FRONT CABIN TILT SHAFT		0.00	0.00	*295.00 F	✓
37	1		*FRONT CABIN TILT INNER SHAFT		0.00	0.00	*120.00 F	✓
38	1		*FRONT CABIN TILT STAY		0.00	0.00	*145.00 F	✓
39	1		*CABIN TILT OUTER PULL LEVER		0.00	0.00	*90.00 F	✓
40	1		*CABIN TILT OUTER PULL LEVER LINKAGE	<i>Ry</i>	0.00	0.00	*550.00 F	✓
41	1		*AIR CON CONDENSER	<i>Ry</i>	0.00	0.00	*380.00 F	✓
42	1		*AIR CON FAN ASSY	<i>Ry</i>	0.00	0.00	*145.00 F	✓
43	1		*AIR CON CONDENSER BRACKET		0.00	0.00	*210.00 F	✓
44	1		*AIR CON LIQUID PIPE		0.00	0.00	*230.00 F	✓
45	1		*AIR CON DISCHARGE PIPE		0.00	0.00	*135.00 F	✓
46	1		*AIR CON DRYER RECEIVER		0.00	0.00	*125.00 F	✓
47	1		*AIR CON SUCTION PIPE		0.00	0.00	*480.00 F	✓
48	1		*AIR CON BLOWER		0.00	0.00		

Report was unsubmitted during this print-out.
Generated using Merimen e-Claims IEAS

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount	
49	1		*AIR CON COOLING COIL	0.00	0.00	*1,150.00 F	?
50	1		*AIR CON COOLING COIL INLET HOSE	0.00	0.00	*70.00 F	?
51	1		*AIR CON COOLING COIL OUTLET HOSE	0.00	0.00	*820.00 F	?
52	1		*AIR CON HEATER UNIT	0.00	0.00	*680.00 F	?
53	1		*N/S FRONT DOOR	Bu	0.00	*35.00 F	?
54	1		*N/S FRONT DOOR SIGNAL LAMP	CPA	0.00	*100.00 F	?
55	2		*N/S FRONT DOOR HINGE TOP/LOWER	Rj	0.00	*45.00 F	?
56	1		*N/S FRONT DOOR CHECKER	D.Y	0.00	*120.00 F	?
57	1		*N/S FRONT DOOR STEP GARNISH	M/Y	0.00	*135.00 F	?
58	1		*N/S FRONT DOOR STEP GARNISH BRACKET	Rj	0.00	*130.00 F	?
59	1		*N/S FRONT DOOR LOCK	D.Y	0.00	*30.00 F	?
60	1		*N/S FRONT DOOR LOCK CATCH	D.Y	0.00	*100.00 F	?
61	1		*N/S FRONT DOOR WEATHERSTRIP	CPA	0.00	*95.00 F	?
62	1		*N/S FRONT DOOR FRAME WEATHERSTRIP	D.Y	0.00	*90.00 F	?
63	1		*N/S FRONT DOOR OUTER MOULDING	Bu	0.00	*55.00 F	?
64	1		*N/S FRONT DOOR INNER MOULDING	Bu	0.00	*440.00 F	?
65	1		*N/S FRONT DOOR GLASS	Bu	0.00	*145.00 F	?
66	1		*N/S FRONT DOOR GLASS CHANNEL	D.Y	0.00	*95.00 F	?
67	1		*N/S FRONT DOOR GLASS CHANNEL FRAME	Rj	0.00	*340.00 F	?
68	1		*N/S FRONT DOOR REGULATOR	Jm	0.00	*30.00 F	?
69	1		*N/S FRONT DOOR REGULATOR MOTOR	CPA	0.00	*135.00 F	?
70	1		*N/S FRONT DOOR LOWER SEAL	Sm	0.00	*120.00 F	?
71	1		*N/S FRONT DOOR OUTER PULL HANDLE	D.Y	0.00	*420.00 F	?
72	1		*N/S FRONT DOOR INNER PULL HANDLE	CPA	0.00	*120.00 F	?
73	1		*N/S FRONT DOOR INNER TRIMBOARD	0.00	0.00	*80.00 F	?
74	1		*N/S FRONT DOOR POWER WINDOW SWITCH	CPA	0.00	*145.00 F	?
75	1		*N/S FRONT DOOR ARCH PANEL INNER GARNISH	D.Y	0.00	*70.00 F	?
76	1		*N/S FRONT DOOR INNER PULL HANDLE INNER TRIM	CPA	0.00	*95.00 F	?
77	1		*N/S FRONT DOOR INNER AIR VENT	Sm	0.00	*1,450.00 F	?
78	1		*N/S FRONT DOOR VERTICAL OUTER GARNISH	0.00	0.00	*130.00 F	?
79	1		*TURBO COOLER	0.00	0.00	*155.00 F	?
80	1		*TURBO COOLER INLET TUBE	0.00	0.00	*75.00 F	?
81	1		*TURBO COOLER INLET HOSE	0.00	0.00	*90.00 F	?
82	1		*TURBO COOLER SUCTION HOSE	0.00	0.00	*300.00 F	?
83	1		*TURBO COOLER SUCTION TUBE	0.00	0.00	*300.00 F	?
84	1		*DASHBOARD TOP LH	0.00	0.00	*300.00 F	?
85	1		*DASHBOARD TOP CENTRE	0.00	0.00	*300.00 F	?
86	1		*DASHBOARD TOP RH	0.00	0.00	*350.00 F	?
87	1		*DASHBOARD TOP INNER	0.00	0.00	*60.00 F	?
88	1		*N/S DASHBOARD TOP SIDE COVER	0.00	0.00	*120.00 F	?
89	1		*N/S DASHBOARD LOWER COVER	D.Y	0.00	*145.00 F	?
90	1		*N/S DASHBOARD LOWER LID GLOVE BOX	0.00	0.00	*70.00 F	?
91	1		*N/S DASHBOARD CUP HOLDER FINISHER	0.00	0.00	*120.00 F	?
92	1		*N/S DASHBOARD GLOVE BOX LID	0.00	0.00	*90.00 F	?
93	1		*N/S DASHBOARD GLOVE BOX COVER	0.00	0.00	*220.00 F	?
94	1		*DASHBOARD CENTRE LOWER GARNISH	0.00	0.00	*150.00 F	?
95	1		*DASHBOARD CENTRE LOWER GLOVE BOX	0.00	0.00	*480.00 F	?
96	1		*DASHBOARD REINFORCEMENT	Rj	0.00	*290.00 F	?
97	2		*DASHBOARD REINFORCEMENT BRACKET - TOP LH/RH	0.00	0.00	*220.00 F	?
98	2		*DASHBOARD REINFORCEMENT BRACKET - LOWER LH/RH	0.00	0.00	*580.00 F	?
99	1		*O/S DASHBOARD INSTRUMENT PANEL	0.00	0.00	*125.00 F	?
100	1		*O/S DASHBOARD CLUSTER LID FINISHER	0.00	0.00	*110.00 F	?
101	2		*ENGINE MOUNTING LH/RH	0.00	0.00	*55.00 F	?
102	1		*GEARBOX MOUNTING	0.00	0.00	*580.00 F	?
103	1		*RADIATOR ASSY	0.00	0.00	*125.00 F	?
104	1		*RADIATOR FAN BLADE	0.00	0.00	*310.00 F	?
105	1		*RADIATOR FAN CLUTCH	0.00	0.00	*55.00 F	?
106	1		*RADIATOR FAN COWLING TOP	0.00	0.00	*55.00 F	?
107	1		*RADIATOR FAN COWLING LOWER	0.00	0.00	*320.00 F	?
108	1		*N/S FRONT UPPER ARM	0.00	0.00	*380.00 F	?
109	1		*N/S FRONT LOWER ARM	0.00	0.00	*450.00 F	?
110	1		*N/S FRONT KNUCKLE ARM	Sm	0.00		X

Report was unsubmitted during this print-out.
Generated using Merimen e-Claims IEAS

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount	
111	1		*N/S FRONT KNUCKLE ARM BEARING	0.00	0.00	NA *95.00 F	X
112	1		*N/S FRONT KNUCKLE BEARING HUB	0.00	0.00	NA *330.00 F	X
113	1		*N/S FRONT SHOCK ABSORBER	0.00	0.00	*95.00 F	?
114	1		*N/S FRONT SHOCK ABSORBER STOPPER	0.00	0.00	*25.00 F	?
115	1		*FLOOR PANEL	0.00	0.00	*880.00 F	?
116	1		*O/S FRONT DOOR	0.00	0.00	*680.00 F	X
117	1		*O/S FRONT DOOR LOCK	0.00	0.00	*130.00 F	X
118	1		*O/S FRONT DOOR WEATHERSTRIP	0.00	0.00	*100.00 F	X
119	1		*FRONT NUMBER PLATE	0	0.00	*40.00 FS	?
120	1		*FRONT PANEL INNER HEAT INSULATION	0	0.00	*150.00 FS	?
121	1		*FRONT WINDSCREEN GLASS SEALANT	0	0.00	NA *40.00 FS	?
122	1		*FRONT WINDSCREEN GLASS DAMPING SEAL	0	0.00	NA *20.00 FS	?
123	1		*ERP BRACKET	0	0.00	NA *26.00 FS	?
124	1		*N/S FRONT DOOR ROC STICKER	0	0.00	NA *25.00 FS	?
125	1		*N/S FRONT DOOR INNER SPEAKER	0	0.00	*120.00 FS	?
126	1		*RADIATOR COOLANT	0	0.00	*48.00 FS	?
127	1		*FLOOR PANEL HEAT INSULATION	0	0.00	*250.00 FS	?
128	1		*O/S FRONT DOOR ROC STICKER	0	0.00	NA *25.00 FS	X
Sub Total (\$\$)						28,308.00	
+ Margin on L,N Items 15.00% (\$\$)						4,134.60	
Total Parts (\$\$)						32,442.60	

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.
Generated using Merimen e-Claims IEAS

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

Estimates on Labour

No	Particulars	Lab.Type	Amount
			2100
Labour Items			
1	TO REMOVE, CUT OUT DAMAGED PARTS, PANEL BEATING, WELDING, ALIGN, REFIX AND TO RENEW AFFECTED PARTS	New	2,400.00
2	TO REMOVE AND RENEW FRONT WINDSCREEN GLASS AND CONDUCT WATER LEAK TEST	New	120.00 ✓
3	TO REMOVE AIRCON CONDENSER, PIPES AND DRIERS. VACUUM AND RECHARGE GAS	New	100.00 ✓
4	TO REMOVE AND RENEW FRONT INSTRUMENT PANEL ASSY, TO REWIRING AND TRANSFER INSTRUMENT FITTINGS	New	250.00 ✓
5	TO REMOVE AND REFIT FRONT SEAT ASSY TRIMBOARD AND CARPET TO FACILITATE REPAIRING WORKS	New	80.00 ✓
6	TO REMOVE DOORS FITTINGS	New	160.00 60
7	TO DISMANTLE AND CHECK FRONT UNDER-CARRIAGES. TO REPLACE AFFECTED PORTIONS	New	180.00 7
8	TO CONDUCT FRONT WHEEL ALIGNMENT TEST	New	80.00 60
9	TO PLACE VEHICLE ON CELLETE BENCH AND TO REALIGN CAR BODY ACCORDING TO SPECIFICATION	New	1,800.00 ?
10	TO PUTTY AND RESPRAY ON AFFECTED PORTIONS	New	1,400.00 1200
11	TO FOCUS HEADLAMPS. TO CHECK FRONT WIRING AND LIGHTING OPERATION	New	20 50.00
Gross Labour Cost (S\$)			6,620.00

Report was unsubmitted during this print-out.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report 30/10/2020 17:13
Date Of Accident 30/10/2020 11:00
Exact Location Of Accident EUNOS LINK
Country/State of Loss SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number GBG8621U
Insured/Policyholder
Name Of Registered Owner MONTREUX PATISSERIE PTE LTD
Co Reg No 2XXXXX725E
Email Address DERRICK.WANG@MONTREUX.SG
Mobile Phone No
Alternative Phone No OFFICE-96933924

Vehicle Particulars

Manufacturer NISSAN
Model CABSTAR-3.0 5M/T ABS 2DR 2WD EURO 5 (A)
Exact Purpose for which vehicle was being used at time of accident
Are you claiming under your own insurance policy for repair to your vehicle? YES
If No, Please state action to be taken
Vehicle Category COMMERCIAL VEHICLE

Insurance Company

Name of Insurance Company LONPAC INSURANCE BHD
Type Of Coverage COMPREHENSIVE
Fleet Policy NO
Policy Number Z/19/VC00/105296
Cover Note Number

Driver

Name of Driver LEE LIE WEI
NRIC No SXXXX192A
Date Of Birth 16/03/1990
Occupation INDOOR
Date Of Driving Pass 21/09/2017
Driving Experience 3 YEARS AND 1 MONTH
Gender MALE
Mobile Number (LOCAL) +65-93670885
Fax Number
Contact Number
Email Address NOEMAIL

Address BLK 843 WOODLANDS STREET 82 #06-85
 Postcode 730843
 Was driver an employee of the Insured's Company YES
 If No, Relationship of the Driver with the Insured
 Vehicle Registration Number of Driver's Own Vehicle -
 -
 -
 Insurance Company of Driver's Own Vehicle -
 -
 -

General Information of the Accident

Type Of Accident COLLISION - HEAD TO REAR
 Weather Conditions CLEAR
 Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO
 Number of vehicles (including own vehicle) involved in the accident 2
 Was any body injured in the Accident? YES
 Was any injured conveyed to hospital by ambulance? YES
 Was any other material or property damaged? YES
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
 Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? YES
 If Yes, Please state which Police Station
 Police Station Name CHANGI NEIGHBOURHOOD POLICE CENTRE
 Police Station Address ROAD: 9 SIMEI STREET 2, POSTCODE: 529914, COUNTRY: SINGAPORE
 Police Station Contact TEL NO: 1800-5872999 - FAX NO: 65872900
 Was notice of intended Prosecution given? NO
 If Yes, against whom?

Circumstances of Accident

PLEASE REFER TO SKETCH PLAN AND POLICE REPORT.


Attachment(s)

Are accident photos available for attachment? YES
 Was there any video captured by Car Camera? YES
 Remarks/ Reasons: SD CARD WITH TRAFFIC POLICE
 Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SKK3220Z
 Vehicle Make/Model/Colour BMW
 Details Of Properties
 Vehicle Category PRIVATE CAR
 Name of Driver NEO PECK CHEN
 NRIC/Passport Number SXXXX376B
 Contact Number 81982033
 Address
 Postcode
 Insurance Company Name

SKETCH PLAN

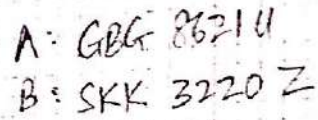

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

PLEASE REFER TO POLICE REPORT
T/20201030/2074.

VEHICLE TOWED TO TP (TRAFFIC POLICE)
COMPOUND.

DECLARATION

I/We declare that the foregoing particulars are true in every respect.

Policyholder's Signature

Date & Time:

Company Chop (if applicable)

Driver's Signature

(If driver is not the policyholder)

Date & Time:

Reporting Centre Personnel's Signature

Name: _____

NRIC/FIN No.:

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Company

Owner ID:

725E

Vehicle Details

Vehicle No.:

GBG8621U

Vehicle to be Exported:

No

Intended Deregistration Date:

30 Oct 2020

Vehicle Make:

NISSAN

Vehicle Model:

CABSTAR 3.0 5M/T ABS 2DR 2WD EURO 5

Primary Colour:

White

Manufacturing Year:

2017

Engine No.:

ZD30026731N

Chassis No.:

JN15C2F24Z0860398

Maximum Power Output:

-

Open Market Value:

\$27,176.00

Original Registration Date:

21 Nov 2017

First Registration Date:

21 Nov 2017

Transfer Count:

0

Actual ARF Paid:

\$1,359.00

Intended PARF Rebate Details

PARF Eligibility:

No

PARF Eligibility Expiry Date:

-

PARF Rebate Amount:

\$0.00

Intended COE Rebate Details

COE Expiry Date:

20 Nov 2027

COE Category:

C - Goods Vehicle & Bus

COE Period(Years):

10

QPPaid:

\$46,890.00

COE Rebate Amount:

\$33,096.00

Total Rebate Amount:

\$33,096.00

The information contained herein is correct as at 30 Oct 2020

OK