

ASS. REC. BY:

REF:

C72/ 20012134/kv

C

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

MBM

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: @ 360k

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

30-36 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

12/26

Person Contacted:

Vehicle: IN / OUT

Veh No:

SGU 888L

Yr Regn:

01.07

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Rolls Royce Phantom

6749

Colour:

M. Silver

A/C: Insured / Std / NI / NA

Sp. Reading

78515

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

SCA1S68097-UIH00604

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F:

285/50R21

R:

285/45R21

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

Rear

R/Bal.

J mm

R/Bal.

mm

L/Bal.

J mm

L/Bal.

mm

D.O.A.

2/11/20

D.O.I.

17/11/2020

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S RT & old body

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

514 11 Pm @ 304,000 Car from

Date/Time, File Pass to?

☐

: Prell. Report

1)

Date/Time, File Return to?

☐

: Final Report

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. SI

Fees

Others

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

Lump Sum / I.B.I. (\$

TOTAL

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	599W
Vehicle Details	
Vehicle No.:	SGU888L
Vehicle to be Exported:	Yes
Intended Deregistration Date:	17 Nov 2020
Vehicle Make:	ROLLS ROYCE
Vehicle Model:	PHANTOM
Primary Colour:	Silver
Manufacturing Year:	2006
Engine No.:	60643872
Chassis No.:	SCA1S68097UH00604
Maximum Power Output:	338.0 kW (453 bhp)
Open Market Value:	\$450,926.00
Original Registration Date:	03 Jan 2007
First Registration Date:	03 Jan 2007
Transfer Count:	1
Actual ARF Paid:	\$496,019.00
Intended PARF Rebate Details	
PARF Eligibility:	Forfeited
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	31 Dec 2026
COE Category:	E - Open Category
COE Period(Years):	10
PQP Paid:	\$55,187.00
COE Rebate Amount:	\$33,779.00
Total Rebate Amount:	\$33,779.00

The information contained herein is correct as at 17 Nov 2020

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	04/11/2020 16:45
Date Of Accident	02/11/2020 16:00
Exact Location Of Accident	HOLLAND RD TOWARDS DEMPSEY RD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SGU888L
Insured/Policyholder	
Name Of Registered Owner	JAPFA LTD
Co Reg No	2XXXXXX99W
Email Address	YONGNANG.TAN@JAPFA.COM
Mobile Phone No	(LOCAL) +65-83221415
Alternative Phone No	OFFICE-83221415

Vehicle Particulars

Manufacturer	ROLLS-ROYCE
Model	PHANTOM
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	COMMERCIAL VEHICLE

Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	THIRD PARTY
Fleet Policy	NO
Policy Number	VPX/P1871207
Cover Note Number	

Driver

Name of Driver	TAN WEI JOON
NRIC No	SXXXX283C
Date Of Birth	12/08/1972
Occupation	OUTDOOR
Date Of Driving Pass	02/03/1998
Driving Experience	22 YEARS AND 8 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-83221415
Fax Number	
Contact Number	
Email Address	YONGNANG.TAN@JAPFA.COM

Address	391B ORCHARD RD #18-08 NGEE ANN CITY TOWER B S(238874)
Postcode	
Was driver an employee of the Insured's Company	YES
If No, Relationship of the Driver with the Insured	
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	SIDE SWIPE
Weather Conditions	RAINING
Road Surface	WET

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	YES
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Police Station Name	DOVER NEIGHBOURHOOD POLICE POST
Police Station Address	ROAD: BLK 3 DOVER ROAD , POSTCODE: 130003 , COUNTRY: SINGAPORE
Police Station Contact	TEL NO: 1800-7788999 - FAX NO: 67762859
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

refer attached police report.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SKP8786Z
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	

No. Of Passenger (Including Driver)

DETAILS OF INJURED PERSON 1

Name TAN WEI JOON

Approximate Age

Injuries Sustain

Injured person in which vehicle? SGU888L

Were seat belts worn?

Was this injured conveyed to hospital by ambulance? YES

Address

Postcode

SKETCH PLANIMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:


- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated; or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SKETCH PLAN

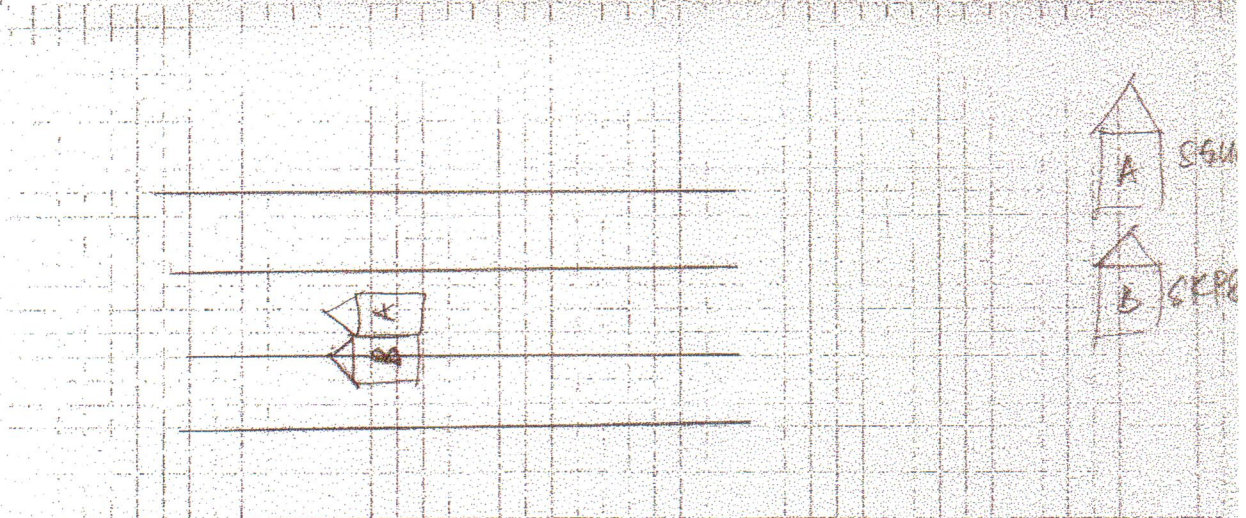

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT


As per police report -
Vehicle for commercial use.

DECLARATION


I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature
Date & Time:


Driver's Signature
(If driver is not the policyholder)
Date & Time: 4/11/2020




Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:



**SINGAPORE
POLICE FORCE**



T/20201103/2099

Police Station Of Origin:

Dover NPP

3 Dover Road #01-368 SINGAPORE 130003

Tel No: 1800-7788999

1 of 3

Report No: T/20201103/2099

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 03/11/2020 18:43	Vide Report No.: E/20201102/0137	Station Diary No.: 22
--	-------------------------------------	--------------------------

Informant's Particulars

Name of Informant: TAN WEI JOON	Address: APT BLK 5 GHIM MOH ROAD #07-228 SINGAPORE 270005		
ID Type / ID No.: NRIC NO / S7228283C	Contact No.: Home/Office: Mobile: 83221415		
Nationality: SINGAPORE CITIZEN	Email:		
Sex: Male	Age: 48	Date of Birth: 12/08/1972	Type of Informant: Driver
Race: Chinese	Language: English	Institution / School Name:	
Occupation: Chauffeur	Driving Licence Information: Class: 3		Date of Expiry:

General Information of the Accident

Type of Accident:	Injury Attended by Police	Drink Drive: No	Date/Time of Accident: 02/11/2020 16:00	Type of Location: Straight Road
Location: HOLLAND ROAD				
Lamp Post Number: V114F				
Weather: Raining		Road Surface: Wet		Road Speed Limit:
Traffic Flow: Dual Carriage Way		Traffic Control: Not Controlled		Traffic Volume: Moderate
Type of Collision: Between Moving Vehicles - Side Swipe - Same Direction				Anyone conveyed by ambulance: Yes

Details of Vehicle Involved


Vehicle No	Type	Make	Model	Color	Condition	No of Passenger
SGU888L	Car	ROLLS ROYCE		Silver	Seriously Damaged	0
SKP8786Z	Car	MERCEDES BENZ		Red		0

Details of Person Involved

Any Pedestrian Involved: No	Use of Pedestrian Crossing: NA
No. of Pedestrians Injured: NIL	



**SINGAPORE
POLICE FORCE**



T/20201103/2099

Police Station Of Origin:

2 of 3

Dover NPP

Report No. T/20201103/2099

3 Dover Road #01-368 SINGAPORE 130003

Tel No: 1800-7788999

CONTINUATION OF REPORT

Driver			
Name	TAN WEI JOON		ID No. S7228283C
Related Vehicle	SGU888L (Car)		Contact No. 83221415
Hospital/Clinic	NATIONAL UNIVERSITY HOSPITAL		Class of Driving Licence & Expiry Date Class: 3 Date of Expiry: NIL
Date Treatment	02/11/2020	Date Discharge	NIL
No. of Days granted Medical Leave	03	Degree of Injury	Slight
Driver			
Name	Degani Zenobia Yushea		ID No. S8127892Z
Related Vehicle	SKP8786Z (Car)		Contact No. NIL
Hospital/Clinic	NIL		Class of Driving Licence & Expiry Date Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

Brief Details.

On 02/11/2020, at about 1602hrs, I was driving my boss's car SGU888L along Holland Road towards Dempsey Road direction, as I was heading to Takashimaya to pick up my boss. At that time, it was raining and I was driving on lane 2. As I was at the Holland Flyover, I suddenly felt an impact from the left side of my car. I lost control of the car and the car subsequently hit the divider. The air bags were activated due to the accident. I was shocked and in pain after the accident and I could not alight from the vehicle. I reached out to my phone and sent a message in a group chat to seek assistance. Some of my friends shortly arrived at scene and assisted me to take photos of the accident and get particulars of the other driver. The ambulance and the traffic police subsequently arrived at scene as well. I was then conveyed to NUH by the ambulance after giving my particulars to the Traffic Police. I was then checked for injuries at NUH and was subsequently discharged on the same day. I did not suffer any fractures or major injuries due to the accident. I was given 3 days of MC by the NUH doctor.

On 03/11/2020, I received a call from Traffic Police to collect the car from their compound and to lodge a police report about this incident.



**SINGAPORE
POLICE FORCE**



T/20201103/2099

Police Station Of Origin:
Dover NPP
3 Dover Road #01-368 SINGAPORE 130003
Tel No: 1800-7788999

3 of 3




Report No. T/20201103/2099

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

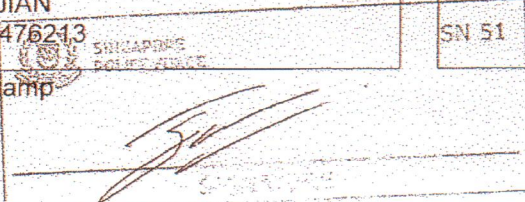Signature Of Officer Recording The Report: D / Sr Staff Sgt TAN WEI JIAN 	Signature Of Informant: 
Signature Of Interpreter: Not applicable	Date/Time 03/11/2020 18:43
Officer In Charge Of Case: TP / GIT / SI YEO CHUN JIAN Contact No.: 65476243	Classification Of Case: SN 51
Authentication Stamp NP168 	

MBM WHEELPOWER PTE. LTD.

YOUR REF.: XD8331L

OUR REF.: SKP8786Z

TO: CHINA TAIPING


CC: MOTOR CLAIMS DEPARTMENT

FAX:

ESTIMATE FOR VEHICLE NO.: SGU888L

Not Authorized
21 Rmp @ 300,000dp
Recovery After Repair
32 days

DATE: 16/11/2020
FROM: Lee Shirley
FAX: 6452 5333
CONTACT: 8686 5188
MAKE & MODEL: ROLLS ROYCE PHANTOM
CHASSIS NO.: SCA1S68097UH00604
ENGINE NO.: 60643872
YEAR MADE: 2007
ACCIDENT DATE: 2 November 2020

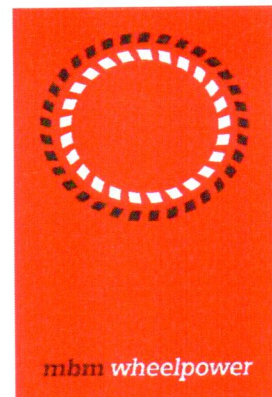

NO.	DESCRIPTION	PART NO.	QTY.	LIST PRICE
1	FRONT SUPPORT PANEL		1	\$ 30,000.00 X
2	FRONT BUMPER		1	\$ CM ✓ 25,000.00
3	FRONT BUMPER RETAINER LH	R 580	1	\$ CM ✓ 5,800.00
4	FRONT BUMPER RETAINER RH	R 580	1	\$ DIT ✓ 5,800.00
5	FRONT BUMPER TOWING COVER		1	\$ MIT ✓ 550.00
6	FRONT BUMPER CHROME		1	\$ M ✓ 4,400.00
7	FRONT BUMPER SPRAY NOZZLE LH		1	\$ M ✓ 250.00
8	FRONT BUMPER SPRAY NOZZLE RH		1	\$ M ✓ 250.00
9	FRONT BUMPER SPOILER		1	\$ M ✓ 1,910.00
10	FRONT BUMPER TRIM STRIP LH		1	\$ S ✓ 1,700.00
11	FRONT BUMPER TRIM STRIP RH		1	\$ S ✓ 1,700.00
12	FRONT BUMPER REINFORCEMENT		1	\$ DIT ✓ 6,700.00
13	FRONT BUMPER SHOCK ABSORBER LH		1	\$ DIT ✓ 3,000.00
14	FRONT BUMPER SHOCK ABSORBER RH		1	\$ R ✓ 3,000.00
15	FRONT BUMPER SENSOR		3 A	\$ SCD MIT ✓ 4,000.00
16	HEADLAMP LH		1	\$ S X 12,500.00
17	HEADLAMP RH		1	\$ CM ✓ 12,500.00
18	FRONT BUMPER HEADLAMP COVER LH		1	\$ DIT ✓ 1,800.00
19	FRONT BUMPER HEADLAMP COVER RH		1	\$ DIT ✓ 1,800.00
20	RADIATOR GRILLE		1	\$ S X 45,000.00
21	RADIATOR FIGURE SPIRIT OF ECSTASY		1	\$ S X 10,000.00
22	FRONT RETRACT MECHANISM, HOOD ORNAMENT		1	\$ S X 11,300.00
23	FRONT LIGHT LH		1	\$ S X 6,500.00
24	FRONT LIGHT RH		1	\$ CM ✓ 6,500.00
25	FRONT FENDER LH		1	\$ CM ✓ 28,000.00
26	FRONT FENDER RH		1	\$ CM ✓ 28,000.00
27	FRONT FENDER INNER SHIELD LH		1	\$ DIT ✓ 16,000.00
28	FRONT FENDER INNER SHIELD RH		1	\$ CM ✓ 16,000.00
29	FRONT FENDER INNER SHIELD CLIP	P 7	20	\$ M ✓ 1,000.00 200dp

MBM WHEELPOWER PTE. LTD.

160 SIN MING DRIVE, #06-02

SIN MING AUTOCITY

t 6262 8888 f 6452 5333

COMPANY REG. NO.: 200204110W

30	FRONT FENDER LAMP LH	1	\$	my Dis	1,700.00
31	FRONT FENDER LAMP RH	1	\$	mit ✓	1,700.00
32	FRONT FENDER FLASHER LH	1	\$	scr ✓	1,100.00
33	FRONT FENDER FLASHER RH	1	\$	su x	1,100.00
34	FRONT FENDER ROLLS ROYCE EMBLEM LH	1	\$	rec -	2,200.00
35	FRONT FENDER ROLLS ROYCE EMBLEM RH	1	\$	rec -	2,200.00
36	FRONT DOOR LH	1	\$	At ✓	35,000.00
37	FRONT DOOR LH WEATHERSTRIP	1	\$	me 508in	5,400.00
38	FRONT DOOR LH UPPER HINGE	1	\$	R x	1,400.00
39	FRONT DOOR LH LOWER HINGE	1	\$	R x	1,500.00
40	FRONT DOOR INNER TRIM BOARD LH	1	\$	su x	8,500.00
41	FRONT DOOR INNER TRIM BOARD POCKET LH	1	\$	su x	4,000.00
42	FRONT SIDE MIRROR LH	1	\$	cm ✓	5,700.00
43	FRONT SIDE MIRROR LENS LH	1	\$	su x	3,150.00
44	FRONT SIDE MIRROR FOOT LH	1	\$	su x	860.00
45	FRONT SIDE MIRROR COVER LH	1	\$	su x	1,200.00
46	FRONT SIDE MIRROR FRAME LH	1	\$	su x	750.00
47	FRONT DOOR RH	1	\$	At ✓	35,000.00
48	FRONT DOOR RH WEATHERSTRIP	1	\$	me 508in	5,400.00
49	FRONT DOOR UPPER HINGE RH	1	\$	R x	1,400.00
50	FRONT DOOR LOWER HINGE RH	1	\$	R x	1,500.00
51	FRONT DOOR RH INNER TOP PILLAR	1	\$	su x	4,300.00
52	FRONT DOOR INNER TRIM BOARD RH	1	\$	Tn ✓	8,500.00
53	FRONT DOOR INNER TRIM BOARD POCKET RH	1	\$	su x	4,000.00
54	FRONT DOOR INNER CENTER TRIM BOARD	1	\$	su x	3,000.00
55	FRONT DOOR AIRBAG RH	1	\$	Burn ✓	3,800.00
56	HEAD AIRBAG RH	1	\$	✓	9,500.00
57	FRONT SIDE MIRROR RH	1	\$	su x	5,700.00
58	FRONT SIDE MIRROR LENS RH	1	\$	su x	3,150.00
59	FRONT SIDE MIRROR FOOT RH	1	\$	su x	860.00
60	FRONT SIDE MIRROR COVER RH	1	\$	su x	1,200.00
61	FRONT SIDE MIRROR FRAME RH	1	\$	su x	750.00
62	REAR DOOR LH	1	\$	At ✓	35,000.00
63	REAR DOOR LH WEATHERSTRIP	1	\$	me 508in	4,900.00
64	REAR DOOR UPPER HINGE LH	1	\$	R x	1,950.00
65	REAR DOOR LOWER HINGE LH	1	\$	R x	4,200.00
66	REAR DOOR RH	1	\$	At ✓	35,000.00
67	REAR DOOR RH WEATHERSTRIP	1	\$	me 508in	4,900.00
68	REAR DOOR UPPER HINGE RH	1	\$	R x	1,950.00
69	REAR DOOR LOWER HINGE RH	1	\$	R x	4,200.00
70	REAR DOOR INNER TOP TRIM BOARD RH	1	\$	su x	3,900.00
71	REAR MUGUARD LH	1	\$	R At x	41,000.00
72	REAR MUGUARD LH RIVETS	10	\$	me x	180.00

MBM WHEELPOWER PTE. LTD.

160 SIN MING DRIVE, #06-02

SIN MING AUTOCITY

t 6262 8888 f 6452 5333

COMPANY REG. NO.: 200204110W

73	REAR MUDGUARD WHEELARCH TRIM LH	1	\$	Sub X	4,500.00	
74	REAR MUDGUARD INNER SHIELD LH	1	\$	Sub X	15,150.00	
75	REAR MUDGUARD INNER SHIELD CLIP	10	\$	Sub X	100.00	
76	REAR MUGUARD RH	1	\$	Sub -	41,000.00	
77	REAR MUGUARD RH RIVETS	10	\$	Sub -	180.00	
78	REAR MUDGUARD WHEELARCH TRIM RH	1	\$	Sub X	4,500.00	
79	REAR MUDGUARD INNER SHIELD RH	1	\$	Sub X	15,150.00	
80	REAR MUDGUARD INNER SHIELD CLIP	10	\$	Sub X	100.00	
81	ROCKER PANEL LH	1	\$	R X	22,000.00	
82	ROCKER PANEL LH CLIP	26	\$	Sub X	260.00	
83	ROCKER PANEL RH	1	\$	R X	22,000.00	
84	ROCKER PANEL RH CLIP	26	\$	Sub X	260.00	
85	SIDE TRIM PANEL CHROME LH	1	\$	Sub X	4,700.00	X
86	SIDE TRIM PANEL CHROME RH	1	\$	Sub X	4,700.00	X
87	FRONT WHEEL TOP WISHBONE LH	1	\$	Sub X	3,500.00	X
88	FRONT WHEEL BOTTOM WISHBONE LH	1	\$	Sub X	5,800.00	X
89	FRONT WHEEL TENSION STRUT LH	1	\$	Sub X	5,200.00	X
90	FRONT WHEEL STABILIZER LH	1	\$	Sub X	4,500.00	X
91	FRONT WHEEL STABILIZER LINK LH	1	\$	Sub X	2,900.00	X
92	FRONT WHEEL BEARING LH	1	\$	Sub -	3,600.00	
93	FRONT WHEEL AIR SUSPENSION LH	1	\$	Sub	15,500.00	✓
94	FRONT WHEEL AXLE SUPPORT LH	1	\$	Sub	25,000.00	✓
95	FRONT WHEEL TOP WISHBONE RH	1	\$	Sub	3,500.00	X
96	FRONT WHEEL BOTTOM WISHBONE RH	1	\$	Sub	5,800.00	X
97	FRONT WHEEL TENSION STRUT RH	1	\$	Sub	5,200.00	X
98	FRONT WHEEL STABILIZER RH	1	\$	Sub	4,500.00	X
99	FRONT WHEEL STABILIZER LINK RH	1	\$	Sub	2,900.00	X
100	FRONT WHEEL BEARING RH	1	\$	Sub -	3,600.00	
101	FRONT WHEEL AIR SUSPENSION RH	1	\$	Sub	155,000.00	X
102	FRONT WHEEL AXLE SUPPORT RH	1	\$	Sub	25,000.00	X
103	REAR WHEEL CARRIER LH	1	\$	Sub	5,600.00	X
104	REAR WHEEL SWING PART LH	1	\$	Sub	2,200.00	X
105	REAR WHEEL INTEGRAL LINK	1	\$	Sub	710.00	X
106	REAR WHEEL CONTROL ARM LH	1	\$	Sub	1,200.00	X
107	REAR WHEEL WISHBONE LH	1	\$	Sub	2,900.00	X
108	REAR WHEEL BEARING LH	1	\$	Sub	1,900.00	X
109	REAR WHEEL SUSPENSION LH	1	\$	Sub	13,000.00	X
110	REAR WHEEL STABILIZER LH	1	\$	Sub	4,300.00	X
111	REAR WHEEL STABILIZER LINK LH	1	\$	Sub	2,200.00	X
112	REAR AXLE CARRIER LH	1	\$	Sub	25,000.00	X

113	REAR WHEEL CARRIER RH	1	\$	By ✓	5,600.00	
114	REAR WHEEL SWING PART RH	1	\$	Sn ?	2,200.00	X
115	REAR WHEEL INTEGRAL LINK RH	1	\$	Sn ?	710.00	X
116	REAR WHEEL CONTROL ARM RH	1	\$	Sn ?	1,200.00	X
117	REAR WHEEL WISHBONE RH	1	\$	Di	2,900.00	✓
118	REAR WHEEL BEARING RH	1	\$	na ✓	1,900.00	
119	REAR WHEEL SUSPENSION RH	1	\$	Dis	13,000.00	✓
120	REAR WHEEL STABILIZER RH	1	\$	Sn ?	4,300.00	X
121	REAR WHEEL STABILIZER LINK RH	1	\$	Sn ?	2,200.00	X
122	REAR AXLE CARRIER RH	1	\$	By	25,000.00	✓
123	REAR AXLE ASSEMBLY	1	\$	By	46,000.00	✓
124	REAR WINDOW COVER	1	\$	Tn	1,000.00	X
125	REAR WINDOW DEFLECTOR	1	\$	Tn	4,000.00	X
126	REAR WINDOW RUBBER BUFFER	6	\$	Tn	120.00	X
			TOTAL:	\$	1,168,900.00	
			LESS 10%:	\$	(116,890.00)	
			PARTS TOTAL:	\$	1,052,010.00	

SPECIAL NETT

NUMBER PLATE & HOLDER	1	\$	Sn	200.00	X
BODY SEALANT	1	\$	na ✓	80.00	
WINDOW SEALANT	1	\$	na X	80.00	
FRONT SPORTS RIM	2	\$	na ✓	38,000.00	
REAR SPORTS RIM	2	\$	na ✓	46,000.00	
SPORTS RIM CAP	4	\$	na ✓	4,000.00	
SPORTS RIM CAP CARRIER	4	\$	na X	8,000.00	
SPORTS RIM CAP SUPPORTING RING	4	\$	na X	400.00	
Goodyear EMT R21 106 W RSC FRONT	2	\$	na X	6,000.00	
Goodyear EMT R21 109 W RSC REAR	2	\$	na X	7,600.00	
SPECIAL ROLLS-ROYCE DETAIL LINING	1	\$	na X	10,000.00	

LABOUR

TO REMOVE, REFIT & REPAIR AFFECTED DAMAGED PARTS, INCLUDING TO KNOCK-OUT, WELD & STRAIGHTEN ON THE AFFECTED PARTS

\$ 4000. 6,000.00

TO REMOVE & INSTALL REAR WINDOW GLASS

\$ 1201 350.00

TO REMOVE, REFIT & UPHOLSTERY TO FACILITATE REPAIRS

\$ 3501 500.00

TO REMOVE & INSTALL ROOF LINING TO FACILITATE ROOF AIRBAG

\$ 200.00 ✓

TO DISMANTLE & TRANSFER DOOR FITTINGS & MECHANISM TO NEW DOOR

\$ 3001 600.00

TO CONDUCT AIRCON PRESSURE TEST

\$ nn 150.00 X

TO CONDUCT RADIATOR PRESSURE TEST

\$ nn 150.00 X

TO REMOVE & REFIT FRONT LH & RH UNDERCARRIAGE

\$ 3001 600.00

TO REMOVE & REFIT REAR LH & RH UNDERCARRIAGE

\$ 3001 600.00

TO REMOVE, RENEW & REFIT FRONT RH SUSPENSION

\$ 250.00 X

TO REMOVE, RENEW & REFIT REAR RH SUSPENSION

\$ 250.00 X

TO CONDUCT ALL WHEEL COMPUTERISED ALIGNMENT

\$ 1501 250.00

TO CHECK & RECONNECT ALL NECESSARY WIRING

\$ 1001 200.00

TO INSTALL NEW TYRES INTO NEW RIMS, TYRE & BALANCING (21")

\$ 1201 200.00

TO REMOVE & REFIT ALL SENSOR

\$ 1201 250.00

TO RESET ENGINE WARNING LIGHT (ABS, SRS, ECU MEMORY & ETC)

\$ ✓ 250.00

TO APPLY RUST ROOFING

\$ 301 180.00

TO SPRAY PAINT ON THE AFFECTED AREAS

\$ 28001 4,000.00

TOTAL: \$ 1,187,350.00

7% GST: \$ 83,114.50

GRAND TOTAL: \$ 1,270,464.50

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

MBM WHEELPOWER PTE. LTD.

160 SIN MING DRIVE, #06-02

SIN MING AUTOCITY

t 6262 8888 f 6452 5333

COMPANY REG. NO.: 200204110W