

ASS. REC. BY:

Steve

REF:

CS/A1620913144/EF3

ASSIGNMENT

From:

Date:

Estimated Cost:

☒ OD / ☐ TP / ☐ WS / ☐ TP RES / ☐ OD RES / ☐ EVA / ☐ INV / ☐ MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

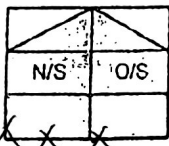

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Turn Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No:

SMV 44796

Yr Regn:

30/9/20

Type: ☒ M. Car / ☐ M. Cycle / ☐ Bus / ☐ Van / ☐ Lorry / ☐ Taxi / ☐ Prime Mover /

Truck / Trailer or

Make:

KIA Cerato

c.c

1591

Colour:

Silver

A/C:

Insured / Std / NI / N

Sp. Reading

1133

T/Radio: Insured / Std / NI / N

Eng/No:

C/No:

KNAF 5416 ML 5064339

Gen. Cond: ☒ Good / ☐ Fair / ☐ Poor / ☐ BurntSteering: ☒ In order / ☐ Jammed / ☐ Leaked / ☐ Burnt orBrakes: ☒ In order / ☐ Jammed / ☐ Leaked / ☐ Burnt orModl: ☒ Nil / ☐ S/Rim / ☐ STD A/Rim or

Tyre Size:

F:

205/50R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / ☒ MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

S

mm

R/Bal.

S

mm

L/Bal.

S

mm

L/Bal.

S

mm

D.O.A.

27/11/20

D.O.A.

30/11/20

Survey held at

Cycle & Carriage

Des. of Damages: Frt / ☒ Rear / ☐ O/S / ☐ N/S / ☐ UIC / ☐ Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision:

Date / Time

Action / Instruction

MK-8SK

Date/Time, File Pass to?

☐

: Prel. Report

☐

: Final Report

Date/Time, File Return to?

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

S + RS. \$

Photos

Others

TOTAL

Report Format:

Lump Sum / L&L: \$



CYCLE & CARRIAGE

CYCLE & CARRIAGE KIA PTE LTD
PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65651240

**ESTIMATE**

Co Reg No : 199405410K

GST Reg No : MR-8500111-X

Invoice Name & Address	Owner Name & Vehicle Info
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPARTMENT 78 SHENTON WAY #08-16 AIG BUILDING SINGAPORE 079120 Contact No 64191000	Cust No/Name /LIM LIJUAN SHERILYN Reg No/Reg Date SMV4479G / 30/09/202 Date In/Mileage 28/11/2020/ 0 Chassis No KNAF5416ML5064339 Engine No G4FGKH740249 Make/Model KIA/CERATO 1.6 A GT LINE H171 Colour/Trim 4SS SILKY SILVER / WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
LAX00000	Credit	30/11/2020/ 13:45	QUK	282 / Kevin Leong	25075			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
E PNT88000								1200 2000.00
REPLACE REAR BUMPER, BOOT, END PANEL & AFFECTED AREA					400			
REPAIR ON SPARE TYRE PANEL								
E PNT98000								1050 1400.00
PAINT WORK ON REAR BUMPER, BOOT, END PANEL & SPARE TYRE PANEL					350			
E PNT88000								100 120.00
REMOVE & INSTALL REAR PARKING ASSIST								
E PNT88000								120.00
REMOVE & INSTALL REAR BOOT COMPARTMENT FOR FACILITATE REPAIR								
E PNT88000								120.00
TO TRANSFER REAR BOOT ATTACHMENTS TO NEW PANEL								
M SUNDRY								40 80.00
TO APPLY SEALANT ON AFFECTED AREA								
M SUNDRY								40 80.00
PERFORM RUST PREVENTION								
A 54900099								30.00
CHECK WIRING & CHASSIS ELECTRICAL SYSTEM								
A 10028901								120.00
TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST								
USING HI-SCAN PRO TEST								
M SUNDRY								40.00
TO SUPPLY C & C EMBLEM								
M SUNDRY								20 50.00
SUNDRIES								
M PANEL ASSY-TRUNK LID	✓	00			1.00	1297.00	20.00	1037.60
M HINGE ASSY-TRUNK LID,LH	✓	00			1.00	97.00	20.00	77.60
M HINGE ASSY-TRUNK LID,RH	✓	00			1.00	97.00	20.00	77.60
M PANEL ASSY-BACK	✓	00			1.00	324.00	20.00	259.20
M TRIM ASSY-RR TRANSVERSE	✓	00			1.00	41.00	20.00	32.80
M COVER-RR BUMPER	✓	00			1.00	651.00	20.00	520.80
M COVER-RR BUMPER LWR	✓	00			5.00	241.00	20.00	964.00
M COVER-RR BUMPER FOG LAMP,LH	✓	00			1.00	19.00	20.00	15.20
M LAMP ASSY-SIDE T/SIGNAL,LH	✓	00			1.00	181.00	20.00	144.80

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE & CARRIAGE

CYCLE & CARRIAGE KIA PTE LTD

PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65651240



ESTIMATE

GST Reg No : MR-8500111-X

Co Reg No : 199405410K

Invoice Name & Address	Owner Name & Vehicle Info
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPARTMENT 78 SHENTON WAY #08-16 AIG BUILDING SINGAPORE 079120 Contact No 64191000	Cust No/Name /LIM LIJUAN SHERILYN Reg No/Reg Date SMV4479G / 30/09/202 Date In/Mileage 28/11/2020/ 0 Chassis No KNAF5416ML5064339 Engine No G4FGKH740249 Make/Model KIA/CERATO 1.6 A GT LINE H171 Colour/Trim 4SS SILKY SILVER / WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
LAX00000	Credit	30/11/2020/ 13:45	QUK	282 / Kevin Leong	25075			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
M	BRACKET-RR BEAM UPR MTG, LH				1.00	9.00	20.00	7.20
M	BRACKET-RR BEAM UPR MTG, RH				1.00	9.00	20.00	7.20
M	BRACKET-RR BEAM LWR, CTR				1.00	6.00	20.00	4.80
M	BRACKET-RR BEAM LWR MTG				1.00	6.00	20.00	4.80
M	BEAM-RR BUMPER				1.00	318.00	20.00	254.40
M	ANTENNA ASSY-SMARTKEY				1.00	46.00	20.00	36.80
M	STAY-RR BUMPER LH				1.00	65.00	20.00	52.00
M	STAY-RR BUMPER RH				1.00	65.00	20.00	52.00
M	BRACKET ASSY-RR BPR SIDE UPR, L				1.00	25.00	20.00	20.00
M	BRACKET-ASSY RR BPR SIDE UPR, R				1.00	31.00	20.00	24.80
M	EMBLEM-CERATO				1.00	28.00	20.00	22.40
M	EMBLEM-GT LINE				1.00	45.00	20.00	36.00
M	LOGO ASSY-KIA SUB				1.00	32.00	20.00	25.60

Estimate

Sten (LKIK)

OD - M1 Ad

EXCISE - ?

30/11/20, 3.9004

6 dgr

P/P

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis

- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Authorized signatory and company stamp

7% GST on **Nett** 7,837.60
7837.60 548.63
Total Payable 8,386.23

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or