

Surveyor : STEVE LKK
 Claim : AIG OD
 DOA : 13.12.2020
 Emailed : 21.12.2020, 4.15pm
 Date Survey : 14.12.2020

VEHICLE NO : SMJ 7059 D
 MODEL : KIA CERATO 1.6 A L
 WIP : 25707

Material	:	\$	<u>2,486.40</u>
Labour	:	\$	<u>1,790.00</u>
Sub-Total	:	\$	<u>4,276.40</u>
	:		<u>-</u>
Less Excess	:	\$	<u>600.00</u>
Total	:	\$	<u>3,676.40</u>
GST 7%	:	\$	<u>257.35</u>
Grand Total	:	\$	<u>3,933.75</u>
Finalise By/Date	:		<u>LOI / 21/12/2020</u>

☒ REVERT BACK WITHIN 7 DAYS,
 OTHERWISE WILL PROCEED WITH INVOICING

☐ SURVEYOR'S REPORT REQUIRED

☐ REPAIR TOOK 0 WORKING DAYS + 0 Days (0) Weekends
 + 0 Days (0) Public Holiday
 TOTAL DAYS REPAIR TOOK = 0

☐ TP claim _____

☐ Claim GIA / LTA fee _____

☐ Claim Loss of ☐ Use / ☐ Rental

☐ Claim Medical Fee / Others _____

☐ Third Party Report - _____

PRO-FORMA INVOICE

Co Reg No : 199405410K

THIS IS NOT AN OFFICIAL TAX INVOICE

GST Reg No : MR-8500111-X

Invoice Name & Address	Owner Name & Vehicle Info	
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPARTMENT 78 SHENTON WAY #08-16 AIG BUILDING SINGAPORE 079120 Contact No 64191000 14/12/2020	Cust No/Name	LCV08915/LOH YUE THONG
	Reg No/Reg Date	SMJ7059D / 18/03/2019
	Date In/Mileage	14/12/2020/ 17790
	Chassis/Package	KNAF1416MK502520C /KC17P(F)
	Engine No	G4FGJH714153
	Make/Model	KIA/CERATO 1.6 A L S116
	Colour/Trim	BBL HORIZON BLUE / WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
LAX00000	Credit	21/12/2020/ 13:37	BLC	260 / AiTing	25707			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
E PNT88000 REPLACE DAMAGED PARTS, REPLACE FRONT BUMPER, LH FRONT FENDER, REPAIR ALL OTHER AFFECTED AREAS, ADJUST AND ALIGN BODY GAPS ALIGNMENT TO THE SAME								✓ 600.00
E PNT98000 RESPRAY ON FRONT BUMPER, LH FRONT FENDER, AND ALL OTHER AFFECTED AREAS TO THE SAME								✓ 700.00
M SUNDRY SUNDRIES								✓ 20.00
A 90000001 CHECK WIRING & ELECTRICAL SYSTEM								✓ 30.00
A 10028901 CONDUCT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST AND CLEAR TROUBLE CODE								✓ 120.00
B WHEELALIGNMENT To Conduct Computerize Full Wheel Alignment								✓ 120.00
X EXC EXCESS FOR OWN DAMAGE CLAIM								-600.00
A 90000001 REPLACE LH FRONT LOWER ARM → Supp.								200.00
X	COVER-FR BUMPER				1.00	✓ 633.00	20.00	506.40
X	GRILLE-FRONT BUMPER				1.00	✓ 262.00	20.00	209.60
X	MOULDING-FRONT BUMPER,LH				1.00	✓ 36.00	20.00	28.80
X	LAMP ASSY-SIDE REPEATER,LH				1.00	✓ 143.00	20.00	114.40
X	AIR DUCT-FR BUMPER,LH				1.00	✓ 14.00	20.00	11.20
X	BRACKET-FR BUMPER UPR SIDE MTG				1.00	✓ 22.00	20.00	17.60
X	PANEL-FENDER,LH				1.00	✓ 430.00	20.00	344.00
X	LAMP ASSY-HEAD,LH				1.00	✓ 1040.00	20.00	832.00
X	GUARD ASSY-FRONT WHEEL,LH				1.00	✓ 95.00	20.00	76.00
X	DUCT ASSY-EXTENSION				1.00	✓ 115.00	20.00	92.00
X	ORNAMENT-KIA NO.115				1.00	32.00	20.00	25.60
X	ARM COMPLETE-FR LWR,LH				1.00	286.00	20.00	228.80
Z TEXT AIG OD CLAIM								

INSURANCE CO. : AIG

Supplementary Parts For Registration No.: SMJ 7059 D

<u>Materials</u>		<u>Cost (\$)</u>
1	Ornament-kia No 115	32.00 ✓
2	Arm complete-fr lwr, LH	286.00 ✓

Total Materials		318.00
Less 20% discount		63.60

Total after discount		254.40


<u>Labour</u>		<u>Cost (\$)</u>
1	Rpelace Lh front lower arm	200.00 ✓

Total labour		200.00
Total amount		454.40
7% GST		31.81

Grand total		<u>\$ 486.21</u>

Thank You.

Yours faithfully

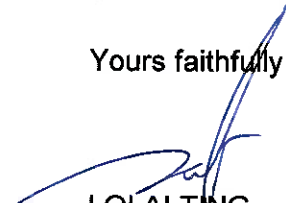

LOI AI TING
SENIOR OFFICER - ADMIN
KIA SERVICE CENTRE
DID : 6568 4556 / 6568 4501
FAX : 6567 5258 / 6565 1240

Work Order: R001277
 License: smj 7059 d
 Technician: kfs810119
 Mileage: 17791
 Date: 18.12.20 16:22

KIA CERATO 1.6 2019

Front : Left

Actual	Before	Specified Range
-0°28'	-0°28'	-0°53' 0°07'
4°33'	4°33'	4°00' 5°00'
-0°03'	-0°03'	-0°03' 0°09'
10°24'*	10°24'*	13°30' 14°30'
9°56'*	9°56'*	12°37' 14°37'

Camber
 Caster
 Toe
 SAI
 Included Angle
 Turning Angle Diff.

Front : Right

Actual	Before	Specified Range
-0°21'	-0°21'	-0°53' 0°07'
5°07'*	5°07'*	4°00' 5°00'
-0°01'	-0°01'	-0°03' 0°09'
13°32'	13°32'	13°30' 14°30'
13°11'	13°11'	12°37' 14°37'

Front

Cross Camber
 Cross Caster
 Cross SAI
 Total Toe
 Cross Turn Diff.

Actual	Before	Specified Range
-0°07'	-0°07'	
-0°34'	-0°34'	
-3°08'	-3°08'	
-0°03'	-0°03'	-0°06' 0°18'

Rear : Left

Actual	Before	Specified Range
-1°14'	-1°14'	-1°42' -0°42'
0°05'	0°05'	-0°02' 0°16'

Camber
 Toe

Rear : Right

Actual	Before	Specified Range
-1°29'	-1°29'	-1°42' -0°42'
0°09'	0°09'	-0°02' 0°16'

Rear


Cross Camber
 Total Toe
 Thrust Angle

Actual	Before	Specified Range
0°15'	0°15'	
0°14'	0°14'	-0°04' 0°32'
-0°02'	-0°02'	

* This value is not within specification. Tire wear, handling and safety problems may result.

 Fault Code Searching

Rescan Erase All DTC Go to DTC Save

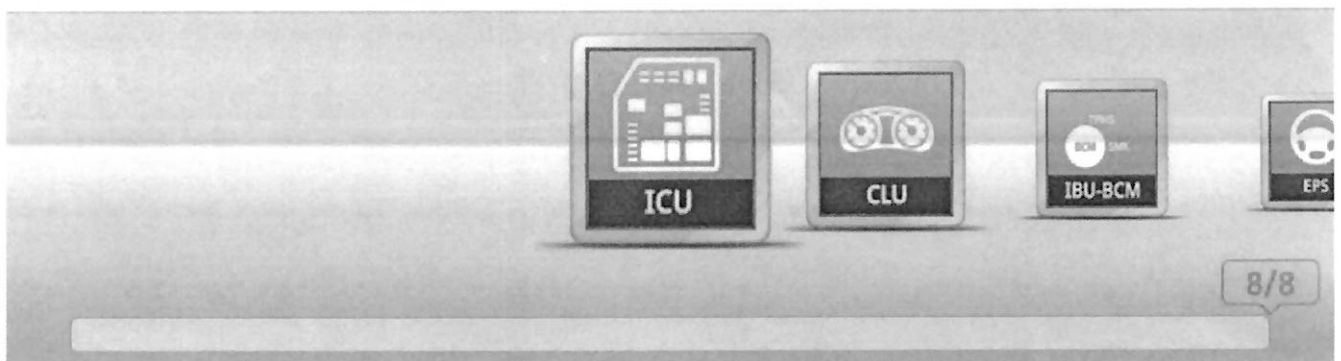

System	Status	Result
ENGINE	No Current DTC	Good
AT	No Current DTC	Good
ABSESC	No Current DTC	Good
AIRBAG	No Current DTC	Good
EPS	No Current DTC	Good
IBU-BCM	No Current DTC	Good

System	DTC	Description	State
--------	-----	-------------	-------