

ASS. REC. BY:

Taufikh

REF:

LS/CT/20013955/T. q 13.

## ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. DMCVSNW00056492001

Claims No. SNM20D204794C01

Sum Insured: \_\_\_\_\_ Excess: 500

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 954K.

IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: 18 days Res.: Yes or No

Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Vehicle: IN / OUT

Catherine.

Veh No:

G Y 3227D

Yr Regn:

2017, Aug.

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toyota Dyna

c.c

2982.

Colour

Silver

A/C: Insured / Std / NI / NA

Sp. Reading

-

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JTFATSSy. 90K20532

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: (NI) S/Rim / STD A/Rim or

Tyre Size:

F:

185/R15

R:

155/R13

(D)

BS DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

6/6

mm

L/Bal.

6

mm

L/Bal.

6/6

mm

D.O.A.

D.O.I.

17/12/20

Survey held at

Goldbell Tues

Des. of Damages: (Frt) Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

22/12/20@9.51am revert to Tan Kah Leong via Merimen. (repairer able to repair the vehicle within LS \$35K)

24/12/20@10.24am So Chow informed C/A at \$35K via Merimen.

24/12/20@4.08pm Informed Catherine C/A not more than LS \$35K &amp; ex:\$500 by email.

11/03/21 Taufikh confirmed with Catherine LS \$30400, 18 days (Red \$13712.02, 31%)

Date/Time, File Pass to?

☐

Preli. Report

1) 18/03 Typist

☐

Final Report

Date/Time, File Return to?

2)

Days Of Repair: 18

Resurvey No. of Trip: 2

Survey Fee:

Transportation:

S + RS \$

Photos

Add Fee: ☐ Site Insp (\$☐ Interview (\$

Per. Format:

**Goldbell Engineering Pte Ltd**  
**8 Tuas Ave 18, Singapore**  
**638892**

**Insurer Reference: GY3227D**

**Repairer Reference: 038252**

**Date calculated: 15/12/2020 10:44 PM**

**Full Report**

**Registration: GY3227D**

**Printed: 15/12/2020 10:47 PM**

**Summary Information**

Claim Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Catherine Chong Kai Ling	Currency:	SGD
Claim Reference:	GY3227D	Date of Incident:	09/12/20
Estimated Repair Time:	30	Hire Car Start:	
Actual Repair Days:	30	Hire Car End:	

**Vehicle Details**

<b>Vehicle</b>	
Manufacturer:	TOYOTA
Model:	DYNA
Sub Model:	BASE MODEL
Model Sheet Number:	70 1C 01
Registration:	GY3227D
VIN number:	JTFAT35Y90K208532
Odometer:	0
<b>Model Specs</b>	
AIR CONDITIONING	REAR HEATER
4.0 LTR 73KW	WHEELBASE 2525MM

*Tanpha 97475749*  
*Not the same as new*  
*Ex \$500 17/12/2021/20*  
*Lumpsum 18 days*  
*To check repair limit*  
*Resurvey after repair*

**Vehicle Condition**


**Vehicle Status**

Pre-Accident Damage:

Date of Inspection:

**Damage Areas**

All ☐  
Underbody ☐

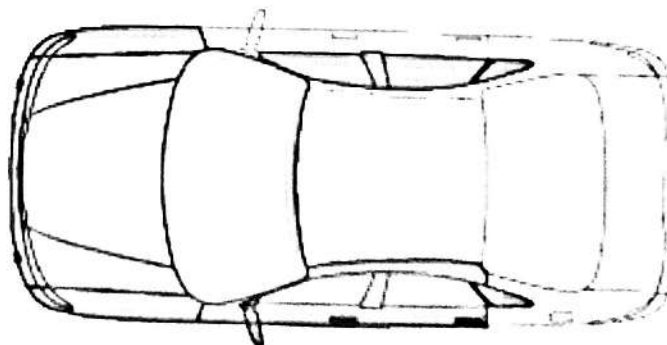

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

**Labour**  
Signature:

Date:

Time Base 10 WU/h

Price = 42.00 SGD/h

Code	Description	WU	Price SGD
NO NUMBER	RENEW ENGINE COVER	60.0	252.00
520011	RENEW FRONT BUMPER	10.0	42.00
	INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS		
810051)	R + R L/HEADLAMP (RADIATOR GRILLE REMOVED)	1.0	4.20
	DOES NOT INCLUDE: ADJUST HEADLAMP		
810051)	R + R R/HEADLAMP (RADIATOR GRILLE REMOVED)	1.0	4.20
	DOES NOT INCLUDE: ADJUST HEADLAMP		
810151A	ADJUST HEADLAMPS	3.0	12.60
NO NUMBER	RENEW FRONT NUMBER PLATE (REMOVED)	1.0	4.20
NO NUMBER	RENEW L/CENTRE SIDE REINFORCEMENT	8.0	33.60
NO NUMBER	RENEW R/CENTRE SIDE REINFORCEMENT	8.0	33.60
NO NUMBER	RENEW FRONT PANEL	20.0	84.00
NO NUMBER	RENEW L/FRT COVER PANEL	5.0	21.00
NO NUMBER	RENEW R/FRT COVER PANEL	5.0	21.00
NO NUMBER	R + R L/F STEP	3.0	12.60
NO NUMBER	RENEW REAR CABIN PANEL	90.0	378.00
NO NUMBER	R + R R/OUTER MIRROR BRACKET	2.0	8.40
NO NUMBER	R + R L/F SEAT BELT BUCKLE	1.0	4.20
NO NUMBER	R + R R/F SEAT BELT BUCKLE	1.0	4.20
711041 ZAX	R + R L/SEAT	2.0	8.40
711041 ZAX	R + R R/SEAT	2.0	8.40
711011)	R + R R/F SEAT CUSHION	2.0	8.40
711021)	R + R R/SEAT BACKREST	1.0	4.20
883621)	R + R HEATING CPL	14.0	58.80
870151)	R + R HEATER BLOWER	4.0	16.80
883611)	R + R EVAPORATOR	17.0	71.40
550451)	R + R INSTRUMENT PANEL	9.0	37.80
550451)	RENEW INSTRUMENT PANEL (REMOVED)	4.0	16.80
NO NUMBER	R + R INSTRUMENT PANEL CARRIER (REMOVED)	2.0	8.40
NO NUMBER	R + R CENTRE CONSOLE INSERT	2.0	8.40
850161)	R + R WIPER MOTOR (WIPER UNIT REMOVED)	7.0	29.40
862051	R + R FANFARE	3.0	12.60
851051	R + R WASHER PUMP	6.0	25.20
NO NUMBER	R + R WASHER RESERVOIR PIPE	1.0	4.20
160011)	R + R RADIATOR	8.0	33.60
	INCLUDES: R + R FAN, FAN BLADE AND EXPANSION TANK, BLEED COOLING SYSTEM		
160011)	RENEW RADIATOR (RADIATOR REMOVED)	1.0	4.20
NO NUMBER	R + R AIR INLET NECK	2.0	8.40
161101)	R + R THERMOSTAT COOLANT	3.0	12.60
171021	R + R AIR CLEANER BRACKET	3.0	12.60
131051K)	R + R CRANKSHAFT PULLEY	5.0	21.00
	INCLUDES: R + R FAN BELT		
161011K)	R + R WATER PUMP	6.0	25.20
NO NUMBER	R + R ALTERNATOR CLAMP	2.0	8.40
271011)	R + R ALTERNATOR	2.0	8.40
461201)	R + R BRAKE FLUID RESERVOIR	2.0	8.40
112011)	R + R OIL PAN	7.0	29.40
111261	R + R FRONT ENGINE MOUNTING	4.0	16.80
281011	R + R STARTER	5.0	21.00
NO NUMBER	R + R REAR ENGINE MOUNTING	3.0	12.60

Code	Description	WU	Price SGD
332011)	R + R HAND SHIFT LEVER	2.0	8.40
442151 ZAX	R + R STEERING COLUMN ASSY	4.0	16.80
441101	R + R STEERING WHEEL	4.0	16.80
NO NUMBER	DETACH + REFIT STEERING COLUMN	2.0	8.40
883161)	R + R DRYER BOTTLE	3.0	12.60
	INCLUDES: R + R CONDENSER, NOT INCLUDED: AIR CON DRAIN AND REFILL		
NO NUMBER	R + R CONDENSER/DRYER HOSE	3.0	12.60
NO NUMBER	R + R COMPRESSOR-/CONDENSER PIPE	3.0	12.60
NO NUMBER	R + R CONDENSER/EVAPORATOR HOSE	3.0	12.60
NO NUMBER	R + R COMPRESSOR-/EVAPORATOR PIPE	3.0	12.60
NO NUMBER	R + R FAN HOUSING	2.0	8.40
883401)	R + R AIR CONDITIONING COMPRESSOR	5.0	21.00
	INCLUDES: R + R AIR CONDITIONING BELT		
002889	DRAIN AND REFILL AIR CONDITIONING	7.0	29.40
883451)	R + R COMPRESSOR BELT PULLEY (REMOVED)	2.0	8.40
NO NUMBER	R + R COMPRESSOR CARRIER	1.0	4.20
NN	GRILLE R&R / NEW PARTS	3.0*	12.60
NN	BADGE MODEL R&R / NEW PARTS	2.0*	8.40
NN	L/F WIPER ARM R&R / NEW PARTS	2.0*	8.40
NN	R/F WIPER ARM R&R / NEW PARTS	2.0*	8.40
NN	L/F WIPER BLADE R&R / NEW PARTS	2.0*	8.40
NN	ROOF R&R / NEW PARTS	114.0*	478.80
NN	CABIN HEAD R&R / NEW PARTS	160.0*	672.00
1401	WINDSCREEN REMOVE AND REFIT	34.0*	142.80
2206	R/F STEP REMOVE AND REFIT	3.0*	12.60
3013	CROSSMEMBER 2 REMOVE AND REFIT	25.0*	105.00
3029	FRT TOWING EYE REMOVE AND REFIT	5.0*	21.00
3151	REAR SCREEN REMOVE AND REFIT	21.0*	88.20
3010	FRONT CROSSMEMBER REPAIR	50.0*	210.00

#### Labour Cost

Panel / Mechanical Labour

Hrs WU  
81.50 815.0 3,423.00

Total of Labour

3,423.00

#### Paint

Code	Description - MF	Manufacturer	Time Basis 10 WU/h	WU	Price SGD
LE 0413	ENGINE FIREWALL NEW PART PAINT ST 1			27.0	113.40
LE 0418	OUTER ENG FIREWALL NEW PART PAINT ST 1			8.0	33.60
LE 0931	FRONT PANEL INNER- PAINT STG II			4.0	16.80
LE 0939	L/F COVER PANEL INNER- PAINT STG II			4.0	16.80
LE 0940	R/F COVER PANEL INNER- PAINT STG II			4.0	16.80
LE 2061	REAR CABIN PANEL NEW PART PAINT ST 1			37.0	155.40
LE 2237	L/SIDE REINFORCEMENT INNER- PAINT STG II			4.0	16.80
LE 2238	R/SIDE REINFORCEMENT INNER- PAINT STG II			4.0	16.80
LE 2351	ROOF NEW PART PAINT ST 1			21.0	88.20
L 3010	FRONT CROSSMEMBER INNER- PAINT STG II			4.0	16.80
NO NUMBER	PREPARE FOR PAINTING			13.0	54.60

**Total Paint**

Hrs 13.00 WU 130.0 Price SGD 546.00

**Spare Parts**

prices as at 2015-06-01/01				
Code	Description	Part Number	Part Source	Price SGD
4439	AIR CON BELT	90916 02594	Original	48.00?
4435	AIR CON COMPRESSOR	88320 37080	Original	1,400.00?
2639	AIR DUCT	55967 37100	Original	0.00?
8391	AIR FILTER ASSY	17700 78471	Original	0.00?
8388	AIR FILTER INT PIPE	53097 37390	Original	0.00?
8404	AIR INTAKE HOSE	17881 78140	Original	0.00?
8411	ALTERNATOR	27040 E0030	Original	0.00?
8429	ALTERNATOR LINK	S1250 91890	Original	0.00?
0431	BADGE	75315 37080	Original	0.00?
0433	BADGE MODEL	75311 37160	Original	43.50?
1000	CABIN HEAD	CABIN HEAD	Original	21,500.00?
4400	CENTRE CONSOLE	58941 37110B0	Original	0.00?
4366	COMBI INSTRUMENT	83800 37N33	Original	0.00?
4481	COMPR/CONDENSER TUBE	88711 37A30	Original	0.00?
4482	COMPR/CONDENSER TUBE	88715 37460	Original	0.00?
4489	COMPR/EVAP TUBE	88712 37A60	Original	0.00?
4490	COMPR/EVAP TUBE	88712 37A70	Original	0.00?
3879	COMPRESSOR BRACKET	88345 37140	Original	0.00?
4461	COMPRESSOR PULLEY	88410 37130	Original	0.00?
4465	CONDENSER	88461 37080	Original	1,349.80?
4464	CPL BLOWER HOUSING	88590 37180	Original	0.00?
8273	CRANKSHAFT PULLEY	13470 78090	Original	0.00?
2636	CTR AIR DUCT CHANNEL	55845 37080	Original	0.00?
4333	CTR INSTR PANEL TRIM	55405 37200C0	Original	0.00?
4497	DRYER/EVAP PIPE	88721 37A80	Original	0.00?
4471	DRYER BOTTLE	88471 34010	Original	0.00?
0413	ENGINE FIREWALL	55700 37440	Original	0.00?
4492	EVAPORATOR/TANK PIPE	88716 37B60	Original	0.00?
7787	EXPANSION TANK	16470 78080	Original	0.00?
7793	FAN	16361 78070	Original	212.50?
0281	FRONT BUMPER	52111 37301	Original	0.00?
0257	FRONT NUMBER PLATE	KNPL3	Original	360.00?
0931	FRONT PANEL	57408 37274	Original	30.00?
0258	FRT NO PLATE REINF	KNPL0	Original	600.00?
4401	GEAR LEVER CONSOLE	58255 37061B1	Original	0.00?
4355	GLOVEBOX	55440 37020C0	Original	0.00?
0410	GRILLE	53111 37891	Original	0.00?
4415	HEATER BLOWER CPL	87210 37050	Original	300.00?
4432	HEATER CONTROL	55900 37440	Original	0.00?
4411	HEATER CPL	87010 37090	Original	0.00?
3739	HORN	86520 37130	Original	0.00?
4331	INSTRUMENT PANEL	55301 37090C0	Original	0.00?
4330	INSTRUMENT SUPPORT	55330 37180	Original	1,714.42?
4343	INSTRUMENT TRIM	55411 37060C0	Original	0.00?
8293	INTAKE PIPE	S1711 38240	Original	0.00?
2627	L/AIR CHANNEL DUCT	55844 37070	Original	0.00?
2951	L/AIR DUCT	87213 37060	Original	0.00?



Code	Description	Part Number	Part Source	Price SGD
4423	L/CTR AIR DUCT	55650 37060B0	Original	0.00?
1727	L/DOOR MIRROR ASSY	87940 37E92	Original	400.00 <del>ms</del>
0837	L/END MOULDING	53814 37100A0	Original	0.00?
0837	L/F BUMPER BRACKET	52012 37033	Original	165.00?
0837	L/F COVER PANEL	58252 37061	Original	143.00 <del>de</del>
8624	L/F ENGINE BRACKET	51231 51940	Original	0.00?
8624	L/F ENGINE MOUNTING	12361 78111	Original	0.00?
8624	L/F ENGINE STRUT	12382 78010	Original	0.00?
0572	L/F FLASH LAMP TRIM	81638 37011	Original	0.00?
0572	L/F INDICATOR CPL	81620 37200	Original	0.00?
4666	L/F SEAT BELT LOCK	73230 37210B1	Original	360.00?
2209	L/F ST/BOARD BRK FRT	61456 37010	Original	0.00?
2211	L/F ST/BOARD BRKT RR	61452 37010	Original	0.00?
2205	L/F STEP	51772 37091	Original	482.12 <del>ds</del>
1445	L/F WASHER JET	85381 37030	Original	0.00 <del>ds</del>
1453	L/F WIPER ARM	85221 37240	Original	75.00 <del>ms</del>
1457	L/F WIPER BLADE	85222 37151	Original	37.50 <del>ms</del>
4425	L/HEATER VENT	55650 37060B0	Original	0.00?
4445	L/INSTR PANEL LID	55548 37020B0	Original	0.00 <del>de</del>
4363	L/INSTR PANEL TRIM	55473 37010C0	Original	0.00 <del>de</del>
4501	L/LWR AIR CHANNEL	87212 37060	Original	0.00?
4393	L/LWR INST PNL COVER	55046 37080B0	Original	0.00?
4335	L/LWR INSTR PNL CVR	55045 37040B0	Original	0.00?
0889	L/MOULDING SEAL	55785 37050	Original	0.00?
8637	L/R ENGINE BRACKET	12325 78201	Original	0.00?
2237	L/SIDE REINFORCEMENT	53702 37060	Original	0.00?
5897	L/UPPER TRAY	55521 37030	Original	0.00?
0561	LEFT HEADLAMP ASSY	81150 37121	Original	420.00 <del>ms</del>
8405	LOWER AIR HOSE	17885 78111	Original	0.00?
8409	LOWER AIR HOSE	17882 78181	Original	0.00?
4352	LOWER GLOVE BOX	55452 37040B0	Original	0.00?
4337	LWR INSTR PANEL TRIM	55320 37080B0	Original	Photo 0.00 <del>de</del>
7773	LWR RADIATOR HOSE	16572 78353	Original	0.00 <del>de</del>
0427	MOUNTING CLAMP	67771 37040	Original	34.00?
0418	OUTER ENG FIREWALL	55078 37120	Original	0.00?
4572	PASSENGER BACKREST	71430 37B60B0	Original	0.00?
4508	PASSENGER S/CUSHION	71410 37C01B0	Original	0.00x
2628	R/AIR CHANNEL DUCT	55843 37150	Original	0.00?
2952	R/AIR DUCT	87214 37060	Original	0.00?
4424	R/CTR AIR DUCT	55650 37060B0	Original	0.00?
1740	R/D-MIRROR BRACKET	87921 37090	Original	0.00?
1742	R/DOOR MIRROR	87901 37140	Original	0.00 <del>ms</del>
0888	R/END MOULDING	53813 37100A0	Original	0.00?
0294	R/F BUMPER BRACKET	52011 37034	Original	0.00?
0940	R/F COVER PANEL	58251 37090	Original	165.00?
8622	R/F ENGINE BRACKET	12311 E0230	Original	143.00 <del>ms</del>
8632	R/F ENGINE MOUNTING	12361 78111	Original	0.00?
8624	R/F ENGINE SUPPORT	12381 58011	Original	0.00?
0680	R/F FLASH LAMP TRIM	81637 37011	Original	0.00?
0678	R/F INDICATOR CPL	81610 37200	Original	0.00?
4666	R/F SEAT BELT LOCK	73150 37130B0	Original	0.00?
1446	R/F WASHER JET	85381 37030	Original	360.00 <del>ms</del>
1454	R/F WIPER ARM	85211 37240	Original	0.00 <del>ds</del>
4351	R/GLOVEBOX	55451 37061B0	Original	75.00 <del>ms</del>
0608	R/HEADLAMP TRIM	81193 37050	Original	0.00 <del>de</del>
4426	R/HEATER VENT	55650 37060B0	Original	0.00?
				0.00?

Code	Description	Part Number	Part Source	Price SGD
4446	R/INSTR PANEL LID	55549 37010B0	Original	0.00
4354	R/INSTR PANEL TRIM	55472 37010C0	Original	0.00
4502	R/LWR AIR CHANNEL	87214 37100	Original	0.00
4336	R/LWR INSTR PNL CVR	55312 37061B0	Original	0.00
0890	R/MOULDING SEAL	55785 37050	Original	0.00
8638	R/R ENGINE BRACKET	12321 78221	Original	0.00
2730	R/SIDE REINFORCEMENT	53701 37022	Original	0.00
5808	R/UPPER TRAY	55521 37030	Original	0.00
7781	RADIATOR	16400 78A80	Original	1,300.00
7787	RADIATOR SHROUD	16711 78051	Original	271.67
2561	REAR CABIN PANEL	64111 37374	Original	0.00
3151	REAR SCREEN INN SEAL	64831 37041	Original	198.70
0562	RIGHT HEADLAMP ASSY	81110 37120	Original	420.00
2351	ROOF	63111 37132	Original	0.00
8635	RR ENGINE SUPPORT	12303 78010	Original	0.00
8501	STARTER MOTOR	28100 78090	Original	0.00
8065	SUMP	S1211 12730	Original	0.00
7876	THERMOSTAT	S1632 E9130	Original	74.00
7776	UPPER RADIATOR HOSE	16571 78383	Original	16.00
1436	WASHER RESERVOIR	85315 37160	Original	0.00
1438	WASHER RESERVOIR CAP	85332 37051	Original	0.00
1439	WASH RESERVOIR TUBE	85319 37160	Original	0.00
7813	WATER PUMP	16100 E0151	Original	497.47
7855	WATER PUMP BELT	SZ910 45322	Original	0.00
7831	WATER PUMP PULLEY	S1617 32110	Original	0.00
1411	WINDSCREEN BOND KIT	PZ49I 00C1131		0.00
1410	WINDSCREEN SEAL	56121 25040	Original	356.54
1461	WIPER LINKAGE	85150 37180	Original	120.00
1450	WIPER MOTOR	85070 37393	Original	435.00
1437	W-SCREEN WASHER PUMP	85310 90B00	Original	0.00
f: OEM Parts	<b>Savings</b>			0.00
n: Non-OEM Parts	<b>Subtotal</b>			34,107.22
u: Used parts	<b>Total</b>			34,107.22

## Final Calculation

	SGD	SGD
Parts	34,107.22	
Total Parts		<b>34,107.22</b>
Labour Time Base 10 WU/h		
Total 615.0 WU X 42.00 SGD/h	3,423.00	
Total Labour		<b>3,423.00</b>
Paint Work Time Base 10 WU/h		
Labour Cost 130.0 WU X 42.00 SGD/h	546.00	
Total Paint Including Material		<b>546.00</b>
Repair Cost Excludes GST		<b>38,076.22</b>
GST (+7.0%)		<b>2,665.34</b>
Repair Cost Included GST		<b>40,741.56</b>

## Comments

\* - USER SUPPLIED DATA  
NN - NO MANUFACTURERS CODE EXISTS  
) - WU PARTIAL INCL IN OTHER POSITIONS

## Assessment Note

No assessment notes entered.



# SINGAPORE ACCIDENT STATEMENT

## IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate a claim.
4. The insured's acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. ~~any claim may be referred to the Police for investigation.~~
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the submission of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

## ACCIDENT STATEMENT

Date of Submission	09/12/2020 14:35 (SGT)
Date of Accident	09/12/2020 07:30 (SGT)
Exact Location of Accident	Near 31 Lor Semangka, Singapore 698937
Additional Location Information	Nil
Country/State of Loss	Singapore

## DETAILS OF OWN VEHICLE

Vehicle Registration Number	GY3227D
INSURED/POLICYHOLDER	
Is company?	Yes
Name Of Registered Owner	CHONG SIN NAM TRADING
Company Reg No	5XXXX905K
Email Address	CSNVEG@GMAIL.COM
Mobile Phone No	(Phone) +65-83334040
Alternative Phone No	(Office) +65-83334040

## VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Dyna
Variant	-
Exact purpose for which vehicle was being used at time of accident	Employment
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Commercial vehicle

## INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	DMCVSNW00056492001
Cover Note Number	Nil

## DRIVER

Name of Driver	CHONG MING YANG
NRIC No	SXXXX276B
Date Of Birth	06/06/1983
Occupation	Outdoor

Date Of Driving Pass	27/09/2001
Driving experience	19 YEARS AND 3 MONTHS
Gender	Male
Mobile Number	(Phone) +65-83334040
Alt. Phone Number	-
Email Address	CSNVEG@GMAIL.COM
Address	192 WESTWOOD AVENUE #12-26
Address complement	Nil
Postcode	648151
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Employee
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

#### GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Clear
Road Surface	Dry

#### OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other material or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

#### DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

#### CIRCUMSTANCES OF ACCIDENT

ON 09/12/2020 AT 7.30AM, I WAS DRIVING VEHICLE NO. GY3227D (A) ALONG LORONG SEMAGKA TOWARDS SUNGEI TENGAH ROAD. THERE WAS A VEHICLE NO. YN849Z (B) INFRONT LOOKS MOVING SLOWLY BUT WHEN I REACH NEARER TO VEHICLE (B) FOUND IT WAS STATIONARY. MY VISION WAS FURTHER BLUR DUE TO SUN GLARE. I WAS UNABLE TO STOP MY VEHICLE (A) ON TIME AND HIT ONTO VEHICLE (B) REAR. NO ONE WAS INJURED.

#### ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No
Was there any audio recorded?	No

#### DETAILS OF OTHER VEHICLE PROPERTY

Vehicle Registration Number	YN849Z
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	-
Name of Driver	Commercial vehicle
Contact Number	PEEN CHAI KOK
Address	(Phone) +65-81289340
Address complement	-

Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

## SKETCH PLAN

### IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be **truthful and accurate as possible**. Any willful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of the report will for a fee be made available upon application by interested parties.
7. By the lodging of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes").
- (b) all insurer(s) and have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/are be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including the Insurers' law firms), which may be sited outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation, and management of present and all future claims;
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, irregularities, law enforcement and government agencies as reasonably required for the purposes stated; or
  - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder - Signature  
Date & Time

Driver - Signature  
If driver is not the policyholder:  
Date & Time

Receiving Centre - Signature  
Name  
Address

SKETCH PLAN

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

ON 6/11/2020 AT 7:30AM I WAS DRIVING VEHICLE NO  
GY3227D (A) ALONG JORONG SEMABKA TOWARDS  
SUNGAI TENGKIL ROAD  
THERE WAS A VEHICLE NO YN8492 (B) IN FRONT OF ME  
MOVING SLOWLY BUT WHEN I REACH NEARER TO  
VEHICLE (B) FOUND IT WAS STATIONARY  
MY VISION WAS FURTHER BLUR DUE TO SUN GLARE  
I WAS UNABLE TO STOP MY VEHICLE (A) ON TIME  
AND HIT ONTO VEHICLE (B) REAR  
NO ONE WAS INJURED

DECLARATION

I hereby declare that the above particulars are true and correct

Policyholder's Signature  
Date & Time

Driver's Signature  
(If driver is not the policyholder)  
Date & Time

Representative of Insurer's Signature  
Name  
NRIC No.

Motor Commercial

MZ300/C

R SN

AN0420A

Cov. Type:C

**CERTIFICATE OF INSURANCE**  
Motor Vehicles (Third Party Risks and Compensation) Act (Chapter 189)  
Motor Vehicles (Third Party Risks and Compensation) Rules, 1969  
Road Transport Act, 1987 (Malaysia)  
Motor Vehicles (Third Party Risks) Rules, 1969 (Malaysia)

CERTIFICATE No.

UMCV8NW00006492001

Engine No.: 1KD2732433

Chs. No.: JTFAT35Y90K208532

1. Index Mark and Registration  
Number of Vehicle

3Y3227D

AUTOSAFE  
\*\*\*\*\*

2. Name of Policy Holder

CHONG BIN NAM TRADING

3. Effective date of the Commencement of  
Insurance for the purposes of the Regulations,  
Enactment or Enactment

04/08/2020

Excess Sect I. S\$500.00  
EX ON WINDSCREEN. S\$100.00

4. Date of Expiry of Insurance

03/08/2021

5. Persons or Classes of Persons entitled to drive\*

Any person who is driving on the Policyholder's order or with their permission.

Provided that the person driving is permitted in accordance with the licensing or other laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from driving the Motor Vehicle.

6. Limitations as to use\*

- (1) Use in connection with the Policyholder's business.
- (2) Use for the carriage of passengers (other than for hire or reward) in connection with the Policyholder's business.
- (3) Use for social, domestic or pleasure purposes.

The Policy does not cover

- (1) Use for hire or reward or racing, pace-making, reliability trial or speed testing.
- (2) Use whilst drawing a trailer except the towing of any one disabled mechanically propelled vehicle.

HIRE PURCHASE CO - MAYBANK SINGAPORE LIMITED AS HP OWNER

\* Limitations rendered imperative by Section 8 of the Motor Vehicles (Third Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act 1987 (Malaysia), are not to be included under these headings

**I/We hereby Certify** that the policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia).

Please see reverse



*[Signature]*

Issued By: INDEPENDENT INSURANCE AGENCY PTE LTD  
Authorised Officer

For CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD.

*[Signature]*

Authorised Signatory



## ► Toyota Dyna 150 3.0M

[Overview](#)
[Financial](#)
[Accessories](#)
[Similar](#)
[Research](#)
[Photos](#)
[Map](#)
[PREMIUM AD](#)


# EZY-1 PTE LTD

## NEW & USED COMMERCIAL | PRIVATE VEHICLES

<b>Price</b>	<b>\$58,800</b>	<b>Lifespan</b>	29-Oct-2037
<b>Depreciation</b> ⓘ	\$8,560 /yr View models with similar depre	<b>Reg Date</b>	30-Oct-2017 (6yrs 10mths 12days COE left)
<b>Mileage</b>	N.A.	<b>Manufactured</b> ⓘ	2017
<b>Road Tax</b> ⓘ	N.A.	<b>Transmission</b>	Manual
<b>Dereg Value</b> ⓘ	\$24,086 as of today (change)	<b>OMV</b> ⓘ	\$27,084
<b>COE</b> ⓘ	\$35,068	<b>ARF</b> ⓘ	\$1,355
<b>Engine Cap</b>	2,982 cc	<b>No. of Owners</b> ⓘ	2
<b>Curb Weight</b> ⓘ	1,780 kg		
<b>Type of Vehicle</b>	Truck		

### Features

View specs of the Toyota Dyna 150 (2014)

### Accessories

Front Recorded, Reachable Side Mirror.

### Description

Best Toyota Dyna With Canopy, New Paint Done, Well Maintain By Previous Owner, High Trade In, Flexible Bank Or In-House Loan Available. Call Us For More Information.

### Category

Premium Ad Car

### Status

Available

### Resources




#### Car Valuation - Free

Find out the market value of your existing car for free. Get started



#### Vehicle Evaluation


Afraid of lemons? Request to have this car evaluated professionally. Find out more

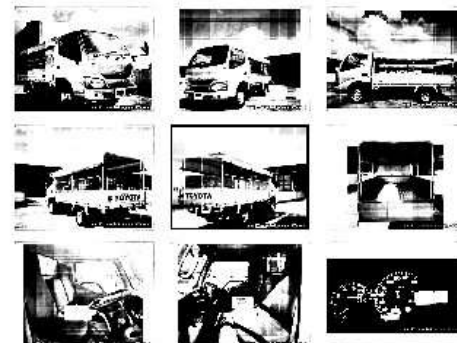

Location Map

### Price Chart

### Summary

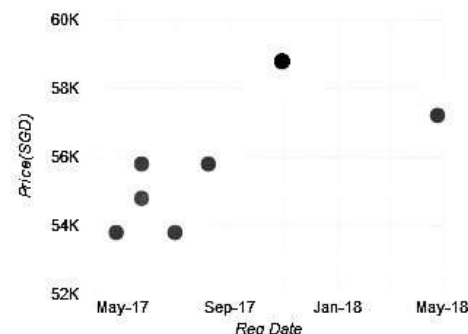

Click on the point to view the vehicle



Shortlist



Compare



Report Error



More Actions

### Seller Information

#### Ezy-1 Pte Ltd

39 vehicles for sale. 36 sold in past 3 mths

15 Yishun Industrial Street 1 #01-21

Win 5

Tel: 68730300

Search cars nearby



Ken Tan

91350913 ⓘ

Alvin Yeow

98001660 ⓘ

Kenny Toh

98751109 ⓘ

MH Tan

93666693 ⓘ

Posted on: 26-Nov-2020 | Last Updated on: 11-Dec-2020

### Upfront Payment

► more Financial info

<b>Transfer Fee</b>	\$25	
<b>Down Payment</b> ⓘ	\$5,880 (change)	Maximum 90% Loan
<b>1st Instalment</b> ⓘ	\$795	Based on 3.4% interest rate
<b>Total Upfront Payment</b> ⓘ	<b>\$6,700</b> (excluding insurance)	Check with seller for exact figure

### Products and Services

► View All

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Business
Owner ID:	905K
Vehicle Details	
Vehicle No.:	GY3227D
Vehicle to be Exported:	No
Intended Deregistration Date:	17 Dec 2020
Vehicle Make:	TOYOTA
Vehicle Model:	DYNA 150 5MT
Primary Colour:	Silver
Manufacturing Year:	2017
Engine No.:	1KD2732433
Chassis No.:	JTFAT35Y90K208532
Maximum Power Output:	-
Open Market Value:	\$26,436.00
Original Registration Date:	04 Aug 2017
First Registration Date:	04 Aug 2017
Transfer Count:	0
Actual ARF Paid:	\$1,322.00
Intended PARF Rebate Details	
PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	03 Aug 2027
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	10
PQP Paid:	\$28,016.00
COE Rebate Amount:	\$18,571.00
Total Rebate Amount:	\$18,571.00

The information contained herein is correct as at 17 Dec 2020