

ASS. REC. BY: JanREF: CS/111 200 14302/Rqld3S  
369A

## ASSIGNMENT

From: \_\_\_\_\_

Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_


☒ OD / TP / WS / TP RES / OD RES / EVA / INV / MVTo Inspect Vehicle No: SKR 197SEat Workshop m/s MOVAof 15, Mangrove RdInsured: 111

Policy No. \_\_\_\_\_

Claims No. MPC2020D0002667Sum Insured: \_\_\_\_\_ Excess: 600

(Client's Record)

Make of Veh: \_\_\_\_\_

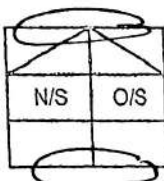(Policy Condition) 2-4 pmRemark: The veh had commenced its  
repair at the time of inspection.Bal. or Market Value: 60K 60.5K

IDAC Accident Report \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: 20 days Res.: Yes or No

Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Veh No: SKR 197SEYr Regn: 2017 / MAYType: ☒ M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or \_\_\_\_\_

Make: HONDA JAZZ 1.5 VTI c.c. 1498Colour: GREY A/C: Insured / Std / NI / NA

Sp. Reading \_\_\_\_\_ T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: JHMK8504X201661Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 185/55 R16

R: \_\_\_\_\_

☒ BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or \_\_\_\_\_

Front

R/Bal. 5 mmL/Bal. 5 mmD.O.A. 05/12/2020

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear

R/Bal. 5 mmL/Bal. 5 mmD.O.I. 23/12/2020MOVA

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Repair limit - 17K24/12/20@1.30pm revert to Priya via Merimen. (REPAIRER ABLE TO REPAIR THE VEHICLE  
WITHIN \$17,000.00 ON LUMP SUM BASIS.)

29/12/20@1.41pm Meka informed C/A at \$17K &amp; ex:\$600 via Merimen.

29/12/20@2.26pm Informed Avril C/A not more than LS \$17K &amp; ex:\$600 by email.

We will be advising our Principal a cost of repair of L/S \$17,000.00 /-  
with 20 days of repair, subject to their approval. (Red \$7865.53, 32%)

Date/Time, File Pass to?



: Prel. Report

1) 15/02 Typist



: Final Report

Date/Time, File Return to?

2) \_\_\_\_\_

Days Of Repair: 20Resurvey No. of Trip: 2

Survey Fee: \_\_\_\_\_

Transportation: \_\_\_\_\_

S + RS. \$I

Photos

Others

TOTAL

Repair Format: MER-ODLump Sum 17000Add Fee: ☐ : Site Insp (\$ \_\_\_\_\_)☐ : Interview (\$ \_\_\_\_\_)☐ : Tech. Invs (\$ \_\_\_\_\_)☐ : Weekend (\$ \_\_\_\_\_)

**MOVA Automotive Pte Ltd**  
**Blk 1008, Bukit Merah Lane 3,**  
**#01-04/06/08. Singapore 159722**

**Insurer Reference: CK139769**  
**Repairer Reference: 038396**  
**Date calculated: 23/12/2020 10:04 AM**

**Full Report**  
**Registration: SKR1975E**  
**Printed: 23/12/2020 10:05 AM**

### Summary Information

#### Claim

Location:	Singapore (SG)	Work Provider:	India International Insurance
Printed by:	ALAN CHNG	Currency:	SGD
Claim Reference:	CK139769	Date of Incident:	
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

### Vehicle Details

#### Vehicle

Manufacturer:	HONDA
Model:	JAZZ (GK3/GK5/GK7)
Sub Model:	BASE MODEL
Model Sheet Number:	35 CJ 01
Registration:	SKR1975E
VIN number:	JHMGK5850HX201661
Odometer:	

#### Model Specs

1.5 LTR 88KW


### Vehicle Condition

#### Vehicle Status

Pre-Accident Damage:  
Date of Inspection:

#### Damage Areas

**All** ☒  
**Underbody** ☐

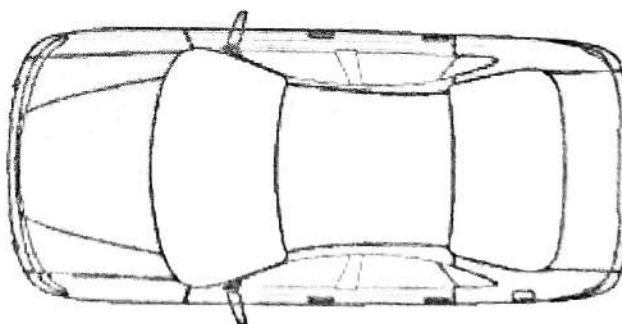

# Labour

Code	Description	Time Rate 10 WU/h		Price = 45.00 SGD/h	
				WU	Price SGD
NO NUMBER	RUST PROOFING BODY SHELL PART		2.0		9.00
NO NUMBER	FRONT BUMPER CARRIER RUST PROTECT PROOF		1.0		4.50
NO NUMBER	R + R FRONT BUMPER		5.0		22.50
NO NUMBER	RENEW FRONT BUMPER		4.0		18.00
	INCLUDES: R + R NECESSARY ATTACHED PARTS				
8101B1)	R + R FRONT BUMPER SUPPORT		1.0		4.50
NO NUMBER	R + R LEFT HEADLAMP		2.0		9.00
NO NUMBER	R + R RIGHT HEADLAMP		2.0		9.00
NO NUMBER	RENEW BONNET		5.0		22.50
	INCLUDES: R + R BONNET AND				
	REQUIRED ATTACHED PARTS ASSEMBLE				
NO NUMBER	R + R L/BONNET HINGE		1.0		4.50
NO NUMBER	R + R R/BONNET HINGE		1.0		4.50
NO NUMBER	R + R LEFT FRONT WING		5.0		22.50
	INCLUDES: R + R LEFT FRONT INNER WING				
	COVER				
NO NUMBER	R + R RIGHT FRONT WING		5.0		22.50
	INCLUDES: R + R RIGHT FRONT INNER WING				
	COVER				
NO NUMBER	RENEW FRONT PANEL CPL		20.0		90.00
NO NUMBER	R + R COWL PANEL TRIM		3.0		13.50
NO NUMBER	RENEW REAR BUMPER		4.0		18.00
	INCLUDES: BUMPER AND ALL				
	REQUIRED ATTACHED PARTS R + R				
NO NUMBER	R + R TAILGATE		6.0		27.00
NO NUMBER	RENEW TAILGATE		8.0		36.00
	(TAILGATE AND REAR SCREEN REMOVED)				
	INCLUDES: R + R INNER TAILLAMPS, REAR				
	NUMBER PLATE, BADGES, NUMBER PLATE LAMP,				
	LOCK AND TRIMS				
NO NUMBER	R + R REAR SCREEN		21.0		94.50
NO NUMBER	RENEW REAR END PANEL CPL		39.0		175.50
NO NUMBER	RENEW L/RR WING		80.0		360.00
NO NUMBER	RENEW R/RR WING		80.0		360.00
NO NUMBER	RENEW BOOT FLOOR		39.0		175.50
NO NUMBER	RENEW REAR CROSSMEMBER		16.0		72.00
NO NUMBER	RENEW INSTRUMENT PANEL		25.0		112.50
	INCLUDES: R + R INSTRUMENT PANEL AND				
	CONVERT ALL ATTACHED PARTS				
NO NUMBER	R + R REAR SEAT		3.0		13.50
8371A0	R + R L/R DOOR OPENING SEAL		2.0		9.00
8381A0	R + R R/R DOOR OPENING SEAL		2.0		9.00
NO NUMBER	R + R HEADLINING		13.0		58.50
	INCLUDES: R + R TRIMS AND NECESSARY				
	ATTACHED PARTS				
NO NUMBER	DETACH + REFIT FLOOR CARPET		3.0		13.50
NO NUMBER	RENEW RADIATOR		4.0		18.00
1211D5	R + R AIR FILTER HOUSING		4.0		18.00
NO NUMBER	R + R INTAKE MANIFOLD		4.0		18.00
NO NUMBER	R + R ENGINE BRACKET		7.0		31.50
1161D1)	R + R STARTER		4.0		18.00
5101C0	R + R STEERING WHEEL		8.0		36.00

Code	Description	WU	Price SGD
NO NUMBER	INCLUDES: R + R DRIVER AIR BAG MODULE		
3991	R + R LOWER STEERING COLUMN COVER	2.0	9.00
3992	L/R SIDE MEMBER REPAIR	40.0*	180.00
0340	R/R SIDE MEMBER REPAIR	40.0*	180.00
	FRT BUMPER SUPPORT CAVITY PROTECTION		
<b>Labour Cost</b>		<b>Hrs</b>	<b>WU</b>
<b>Panel / Mechanical Labour</b>		<b>50.80</b>	<b>508.0</b>
<b>Total of Labour</b>			<b>2,286.00</b>

## Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description	WU Price SGD
	BONNET NEW PART PAINTING	15.0
	L/F WING NEW PART PAINTING	9.0
	R/F WING NEW PART PAINTING	8.0
	FRONT PANEL CPL SURFACE PAINT	6.0
	REAR PANEL NEW PART PAINTING	18.0
	BOOTLID/TAILGATE NEW PART PAINTING	15.0
	L/R WING NEW PART PAINTING	24.0
	R/R WING NEW PART PAINTING	24.0
	L/R DRIP RAIL NEW PART PAINTING	11.0
	R/R DRIP RAIL NEW PART PAINTING	11.0
	BOOTFLOOR SURFACE PAINT	8.0
	REAR CARRIER SURFACE PAINT	4.0
	GRILLE NEW PART PAINT K1R	4.0
	L/INN A-PILLAR REINF SURFACE PAINT	5.0
	R/INN A-PILLAR REINF SURFACE PAINT	5.0
	L/R SIDE MEMBER SURFACE PAINT	5.0
	R/R SIDE MEMBER SURFACE PAINT	5.0

## Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	36.67
0741	L/F WING NEW PART PAINTING	14.91
0742	R/F WING NEW PART PAINTING	10.08
1009	FRONT PANEL CPL SURFACE PAINT	8.98
2711	REAR PANEL NEW PART PAINTING	17.04
2931	BOOTLID/TAILGATE NEW PART PAINTING	35.87
3481	L/R WING NEW PART PAINTING	27.09
3482	R/R WING NEW PART PAINTING	27.09
3571	L/R DRIP RAIL NEW PART PAINTING	6.99
3572	R/R DRIP RAIL NEW PART PAINTING	6.99
3900	BOOTFLOOR SURFACE PAINT	17.25
3931	REAR CARRIER SURFACE PAINT	2.82
0410	GRILLE NEW PART PAINT K1R	8.73
2247	L/INN A-PILLAR REINF SURFACE PAINT	5.63
2248	R/INN A-PILLAR REINF SURFACE PAINT	5.63
3991	L/R SIDE MEMBER SURFACE PAINT	5.63
3992	R/R SIDE MEMBER SURFACE PAINT	5.63

**Labour Cost - Paint**

Factor	45.00 SGD/h	Hrs	WU	Price SGD
Time Paint			177.0	
Preparation Main Work Metal		1.70	17.0	76.50
Preparation Comp. Work Plastic		0.30	3.0	13.50
<b>Total</b>	<b>10 WU/h</b>	<b>19.70</b>	<b>197.0</b>	<b>886.50</b>

**Material Cost - Paint**

New Part Painting	Price SGD
New Part Painting - Plastic K1R	182.73
Surface-/Blend Paint	8.73
Material-constant Metal	51.57
Material-constant Plastic	18.10
<b>Total</b>	<b>9.00</b>
	<b>270.13</b>

**Spare Parts**

prices as at 2015-06-01/01

Code	Description	Part Number	Part Source	Price SGD
1004	AIRBAG ACT ✓	ECU	Original	935.00
1000	AIRCON ✓	CONDENSER	Original	710.00
3020	BADGE I-VTEC ✓	75725T5LT00		0.00
3017	BADGE JAZZ ✓	75722T5LT01	Original	30.00
0471	BONNET ✓	60100T5AG00ZZ	Original	540.00
0492	BONNET LOCK ✓	74120T5A003	Original	95.00
2977	BOOT/TAILGATE LOCK ✓	74801T5A013	Original	95.00
2944	BOOT/TAILGATE SEAL ✓	74440T5A003	Original	100.00
3900	BOOTFLOOR ✓	04655T5AG02ZZ	Original	770.00
2931	BOOTLID/TAILGATE ✓	68100TARE00ZZ	Original	735.00
7442	CONTACT RING ✓	77900T5AJ21	Original	275.00
7445	DRIVER AIRBAG ✓	77810TARG80ZA	Original	1,640.00
4985	END PANEL TRIM ✓	84640T5A003ZA	Original	75.00
7787	EXPANSION TANK ✓	191015R1000	Original	30.00
1003	FRESH AIR GRILLE ✓	74119T5A000	Original	30.00
0283	FRONT BUMPER ✓	71101TARG10ZA	Original	550.00
1009	FRONT PANEL CPL ✓	60400T5AG01ZZ	Original	395.00
0340	FRT BUMPER SUPPORT ✓	71130TARG00	Original	220.00
1002	FRT LH ACT ✓	SEAT BELT	Original	550.00
0351	FRT LWR BUMP GRILLE ✓	71102TARG00	Original	45.00
0258	FRT NO PLATE REINF ✓	KNPL0	Original	75.00
1001	FRT RH ACT ✓	SEAT BELT	Original	550.00
1003	FRT X 2 ✓	IMPACT SENSOR	Original	172.00
0410	GRILLE ✓	71121TARG00	Original	300.00
9646	HIGH TONE HORN ✓	38150SFJW02	Original	60.00
4331	INSTRUMENT PANEL ✓	77100T5AJ00ZA	Original	718.00
8221	INTAKE MANIFOLD ✓	1710055AZ01	Original	440.00
0475	L/BONNET HINGE ✓	60170TAR000ZZ	Original	42.00
7791	L/FAN MOTOR ✓	190305R1003	Original	290.00
7769	L/FAN SHROUD ✓	190155R1003	Original	85.00
0561	L/F HEADLAMP ✓	33150T5AJ01	Original	1,176.00
0317	L/F OUT BUMPER BRKT ✓	71198T5A000	Original	20.00
0319	L/F UPP BUMPER BRKT ✓	71190TARG00	Original	65.00
0741	L/F WING REPAIR ✓	60261T5RA00ZZ	Original	375.00
7795	L/RADIATOR FAN ✓	190205R1003	Original	75.00
2619	L/R BUMPER BRACKET ✓	71598T5A000	Original	30.00

Code	Description	Part Number	Part Source	Price SGD
2587	L/R BUMPER COVER?	7150T5A000	Original	30.00
3571	L/R DRIP RAIL?	63720T5AE01ZZ	Original	450.00
3193	L/R LAMP?	34155T5AJ01	Original	105.00
3281	L/R LAMP?	33550T5AE02	Original	307.00
4991	L/R SIDE PANEL TRIM?	84651TARG01ZA	Original	303.00
3677	L/R WHEELHOUSE?	74592T5B003	Original	40.00
	COVER			
3165	L/R WINDOW SEAL X	73214T5A013	Original	56.00
3481	L/R WING repair	04646T5AE00ZZ	Original	877.00
2997	L/TAI LGATE DAMPER X?	74870T5CJ01	Original	150.00
0841	L/WHEELHOUSE SHELL X	74150T5A000	Original	172.00
4907	LOWER TAILGATE TRIM?	84440T5AJ02ZA	Original	200.00
9645	LOW TONE HORN?	38100SNAK02	Original	60.00
4988	LUGG COMPART CARPET	84521T5A003ZA	Original	298.00
4325	PASSENGER AIRBAG AG	77820TARG80	Original	2,236.00
4987	PLATFORM?	84550T5RG20	Original	221.00
0476	R/BONNET HINGE?	60120TAR000ZZ	Original	42.00
7792	R/FAN MOTOR?	386165R1003	Original	290.00
7770	R/FAN SHROUD?	386155R1003	Original	85.00
0562	R/F HEADLAMP CR	33100T5AJ01	Original	1,176.00
0318	R/F OUT BUMPER BRKT	71193T5A000	Original	20.00
0320	R/F UPP BUMPER BRKT	71140TARG00	Original	65.00
0742	R/F WING bt	60211T5RA00ZZ	Original	375.00
7796	R/RADIATOR FAN?	386115R1003	Original	75.00
2620	R/R BUMPER BRACKET	71593T5A000	Original	30.00
2588	R/R BUMPER COVER?	71502T5A000	Original	30.00
3572	R/R DRIP RAIL?	63320T5AE01ZZ	Original	450.00
3194	R/R LAMP?	34150T5AJ01	Original	105.00
3282	R/R LAMP	33500T5AE02	Original	307.00
4992	R/R SIDE PANEL TRIM	84601TARG01ZA	Original	303.00
3678	R/R WHEELHOUSE CVR?	74552T5B003	Original	40.00
3166	R/R WINDOW SEAL	73214T5A013	Original	56.00
3482	R/R WING bt	04636T5AE00ZZ	Original	877.00
2998	R/TAI LGATE DAMPER?	74870T5CJ01	Original	150.00
0842	R/WHEELHOUSE SHELL?	74100T5A000	Original	172.00
0412	RAD GRILLE COVER	71123T5RX00	Original	130.00
7761	RADIATOR bt	190105V3Q01	Original	1,187.00
2583	REAR BUMPER	71501T5A000ZA	Original	495.00
3931	REAR CARRIER?	65750T5AG00ZZ	Original	150.00
2711	REAR PANEL bt	66100T5AG00ZZ	Original	430.00
3160	- REAR SCREEN BOND KIT	0871899960EH X		0.00
3170	- REAR SCREEN CLAMPS	91501T5AJ01 X		0.00
3171	REAR SCREEN CLAMPS	91502S70003 X		0.00
3172	REAR SCREEN CLAMPS	91536SS0J01 X		0.00
3163	REAR SCREEN FIX SET	USE SINGLE PARTS X		
3221	REAR WIPER MOTOR?	76710T5A003	Original	200.00
8680	? - RIGHT ENGINE SUPPORT	50822T9A013	Original	220.00
8501	? - STARTER MOTOR	3120055AZ01	Original	630.00
2979	? - TAILGATE HANDLE MLDG	74890T5A013	Original	212.00
0433	UP/CVR RADIAT GRILLE	71105TARG00	Original	25.00

f: OEM Parts  
n: Non-OEM Parts  
u: Used parts

**Savings**  
**Subtotal**  
**Subtotal Discount(+20.00%)**  
**Fixed Sundry Parts Price**

0.00  
26,125.00  
-5,225.00  
2.00



Total

20,902.00

Extras  
Code

## Description

Price SGD

1005	ERT & REAR NO PLATE	50 <del>35</del>	100.00*
1006	REAR GLASS SEALANT <i>nee</i>		40.00*
1007	REAR PARKING SENSOR <i>nw</i>		200.00*
1008	REAR CAMERA ?		200.00* ?
1009	RAD COOLANT <i>nee</i>		30.00*
1010	MERIMEN FEE		11.00*
1011	AUDATEX FEE		40.00*
	<b>Total Extras</b>		<b>621.00</b>

## Final Calculation

	SGD	SGD
<b>Parts</b>		
Total Discount(+20.00%)		
Fixed Sundry Parts Price		
<b>Total Parts</b>		<b>20,902.00</b>
<b>Labour Time Base 10 WU/h</b>		
Total 508.0 WU X 45.00 SGD/h		
<b>Total of Labour</b>		<b>2,286.00</b>
<b>Additional Costs</b>		
Rustproofing		
Rate 3.0 WU X 45.00 SGD/h		
<b>Total Of Additional Costs</b>		<b>13.50</b>
<b>Total Of Extras</b>		<b>621.00</b>
<b>Paint Work Time Base 10 WU/h</b>		
Labour Cost 197.0 WU X 45.00 SGD/h		
Material Cost		
<b>Total Paint Including Material</b>		<b>1,156.63</b>
<b>Repair Cost Excludes GST</b>		<b>24,979.13</b>
GST (+7.00%)		<b>1,748.54</b>
<b>Repair Cost Included GST</b>		<b>26,727.67</b>

## Comments

\* - USER SUPPLIED DATA  
 NN - NO MANUFACTURERS CODE EXISTS  
 ) - WU PARTIAL INCL IN OTHER POSITIONS

## Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

# SINGAPORE ACCIDENT STATEMENT

## IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

## ACCIDENT STATEMENT

Date of Submission	09/12/2020 13:57 (SGT)
Date of Accident	05/12/2020 12:00 (SGT)
Exact Location of Accident	AYE, Singapore
Additional Location Information	AYE(CITY) BEFORE NORTH BUONA VISTA RD
Country/State of Loss	Singapore

## DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKR1975E
-----------------------------	----------

### INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	AMANDA TAN
NRIC No	SXXXX369A
Email Address	AMANDA.TANSH@GMAIL.COM
Mobile Phone No	(Phone) +65-98456098
Alternative Phone No	+65-98456098

### VEHICLE PARTICULARS

Manufacturer	Honda
Model	Jazz
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car

### INSURANCE COMPANY

Name of Insurance Company	India International
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	D20MPC0002649
Cover Note Number	-

### DRIVER

Name of Driver	AMANDA TAN
NRIC No	SXXXX369A
Date Of Birth	21/03/1980
Occupation	Outdoor



Date Of Driving Pass  
Driving experience  
Gender  
Mobile Number  
Alt. Phone Number  
Email Address  
Address  
Address complement  
Postcode

Is the driver the policyholder?  
If No, Relationship of the Driver with the Insured  
Does Driver Own Other Vehicles?  
Vehicle Registration Number of Other Vehicle Owned by Driver  
Insurance Company of Other Vehicle Owned by Driver

13/02/2004  
16 YEARS AND 10 MONTHS  
Female  
(Phone) +65-98456098  
+65-98456098  
AMANDA.TANSH@GMAIL.COM  
5 UPPER BUKIT TIMAH VIEW #04-12  
-  
588134  
Yes  
-  
No  
-  
-

#### GENERAL INFORMATION OF THE ACCIDENT

Type of Accident  
Weather Conditions  
Road Surface

Chain Collision  
Clear  
Dry

#### OTHER INFORMATION

Was any foreign vehicle involved in the accident? No  
Number of vehicles involved in the accident 5  
Was anybody injured in the Accident? Yes  
Was any injured conveyed to hospital by ambulance? No  
Was any other material or property damaged? Yes  
Number of Passengers (Including Driver) 1  
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance? No

#### DETAILS OF POLICE ACTION

Was the accident reported to the police? Yes  
Police Station Name Clementi Division Headquarters  
Police Station Phone No (Phone) +65-18007740000  
Alt. Police Station Phone No (Fax) +65-67741705  
Police Station Address 20 Clementi Avenue 5 Singapore 129858  
Was notice of intended Prosecution given? No  
If yes, against whom? -

#### CIRCUMSTANCES OF ACCIDENT

REFER TO POLICE REPORT D/20201205/7070

#### ATTACHMENT(S)

Are accident photos available for attachment? Yes  
Was there any video captured by Car Camera? No  
Was there any audio recorded? No

#### DETAILS OF OTHER VEHICLE PROPERTY

Vehicle Registration Number SLT4389E  
Vehicle Manufacturer -  
Vehicle Model -  
Vehicle Variant -  
Vehicle Colour -  
Vehicle Category Private car  
Name of Driver -  
Contact Number -

Address -  
Address complement -  
Postcode -  
Insurance Company Name -  
Nature Of Damage -  
Details of property damaged in accident -  
No. Of Passenger (Including Driver) -

**DETAILS OF OTHER VEHICLE PROPERTY 2**

Vehicle Registration Number SHD9054U  
Vehicle Manufacturer -  
Vehicle Model -  
Vehicle Variant -  
Vehicle Colour -  
Vehicle Category Taxi  
Name of Driver -  
Contact Number -  
Address -  
Address complement -  
Postcode -  
Insurance Company Name -  
Nature Of Damage -  
Details of property damaged in accident -  
No. Of Passenger (Including Driver) -

**DETAILS OF OTHER VEHICLE PROPERTY 3**

Vehicle Registration Number SHD6067C  
Vehicle Manufacturer -  
Vehicle Model -  
Vehicle Variant -  
Vehicle Colour -  
Vehicle Category Taxi  
Name of Driver -  
Contact Number -  
Address -  
Address complement -  
Postcode -  
Insurance Company Name -  
Nature Of Damage -  
Details of property damaged in accident -  
No. Of Passenger (Including Driver) -

**DETAILS OF OTHER VEHICLE PROPERTY 4**

Vehicle Registration Number SLM6627S  
Vehicle Manufacturer -  
Vehicle Model -  
Vehicle Variant -  
Vehicle Colour -  
Vehicle Category Private car  
Name of Driver -  
Contact Number -  
Address -  
Address complement -  
Postcode -  
Insurance Company Name -  
Nature Of Damage -  
Details of property damaged in accident -  
No. Of Passenger (Including Driver) -

**INJURED PERSONS DETAILS**

INJURED 1

Name of injured person

Address

Address Complement

Post Code

Approximate Age Years Old

Injuries Sustained

Injured person in which vehicle?

Were seat belts worn?

Was this injured conveyed to hospital by ambulance?

AMANDA TAN

-

-

-

-

BODY

SKR1975E

Yes


No


# IMPORTANT NOTICE


1. Please report correctly the details of the accident to speed up the claim process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purposes of:
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes, and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
  - (ii) for complying with requirements under any regulations, laws or court orders

  
 Policyholder's Signature  
 Date & Time


  
 Insurer's Signature  
 If Insurer is not the Policyholder  
 Date & Time

  
 Recording Centre Personnel's Signature  
 Name  
 NRIC #

SKETCH PLAN

- (A) SKR 1973E
- (B) SLT 4389E
- (C) SHD 9054U
- (D) SHD 6067C
- (E) PLM 6627S

AYC (City)  
Before  
North Buena  
Vista Road

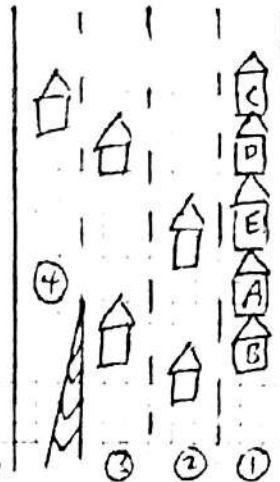

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I was travelling along AYC (City) Before North Buena Vista Road.

The traffic is moderate.

As I was driving, the first car (E) slowed down and I followed it.

Before I could stop completely, vehicle (D) came from behind and hit my car (A).

The impact was so great that it pushed my car (A) forward and crashed onto vehicle (E).

After alighting from my car (D) it was then I realized that it was a chain collision of 5 vehicles.

The ambulance and traffic police arrived at the accident scene.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature  
Date & Time:

Driver's Signature  
(If driver is not the policyholder)  
Date & Time:

Reporting Centre Personnel's Signature  
Name:  
NR/C/FIN No:



**SINGAPORE  
POLICE FORCE**



D/20201205/7070

1 of 3

**POLICE REPORT (NP299)**

Report No. D/20201205/7070

Police Station Of Origin  
Clementi Division HQ  
20 Clementi Avenue 5 SINGAPORE 129655  
Tel No:1800-7740000

Date/Time Report Made 05/12/2020 23:37	Vide Report No.	Station Diary No.
Name Of Informant AMANDA TAN SIN HUI	Address 5 UPPER BUKIT TIMAH VIEW #04-12 SINGAPORE 588134	
ID Type / ID No. NRIC NO / S8009369A	Contact No. Home/Office: Mobile: 98456098	
Nationality SINGAPORE CITIZEN	Email Address amanda.tansh@gmail.com	
Occupation Counsellor (family)	Sex Female	Age 40
Institution/School Name	Date of Birth 21/03/1980	Race Chinese
Date/Time Of Incident 05/12/2020 12:00	Location Of Incident 5 UPPER BUKIT TIMAH VIEW #04-12 SINGAPORE 588134	

**Brief details.**

Traffic accident  
Report No.: D/20201205/0074

I was travelling along AYE towards city and met with a 5 car collision accident. I was car number 4.  
The traffic police, ambulance and EMAS arrived and a lady was conveyed to the hospital.  
The traffic police requested that I make a police report.

Signature Of Officer Recording The Report: Not applicable	Signature Of Informant: The identity of the person making this report has been authenticated by SingPass. No signature is required.
Signature Of Interpreter: Not applicable	Date/Time: 05/12/2020 23:37
Officer In-Charge Of Case:	Classification Of Case:

Authentication Stamp





**SINGAPORE  
POLICE FORCE**



D/20201205/7070

2 of 3

POLICE REPORT (NP299)

CONTINUATION OF REPORT

Report No. D/20201205/7070

The traffic condition was fair, the weather was clear. The car in front of me brake and I too braked. Before I realised, I was sandwiched in between the front and back car. The impact was so great my 2 air bags were activated and there was a strong burning smell.

After I got out of my car, I realised it was chain accident involving 5 vehicles. The first 2 were taxi which I did not manage to get their contact.

The car plates of the vehicles involved in the order of the first car to the last car is as follows:

SHD9054U

SHD6067C

SLM6627S

SKR1975E (Me)

SLT4389U.

<b>Subjects Involved</b>			
<b>Suspect</b>			
Person Name	Unknown		
Gender	Male		
<b>Victim</b>			
Person Name	AMANDA TAN SIN HUI		
ID Type	NRIC NO	ID No	S8009369A
Gender	Female	Age	40

Signature Of Officer Recording The Report:

Not applicable

Signature Of Interpreter:

Not applicable

Officer In-Charge Of Case:

Signature Of Informant:

The identity of the person making this report has been authenticated by SingPass. No signature is required.

Date/Time:

05/12/2020 23:37

Classification Of Case:

Authentication Stamp



SINGAPORE  
POLICE FORCE



D/20201205/7070

3 of 3

POLICE REPORT (NP299)

CONTINUATION OF REPORT

Report No. D/20201205/7070

Race	Chinese	Language	English
Occupation	Counsellor (family)	Address	5 UPPER BUKIT TIMAH VIEW #04-12 SINGAPORE 588134
Mobile No	98456098	Is Informant A Victim?	Yes
Person Name	AMANDA TAN SIN HUI (Informant)		

Signature Of Officer Recording The Report:

Not applicable

Signature Of Interpreter:

Not applicable

Officer In-Charge Of Case:

Authentication Stamp

Signature Of Informant:

The identity of the person making this  
report has been authenticated by  
SingPass. No signature is required.

Date/Time:

05/12/2020 23:37

Classification Of Case:

## COE Rebate Enquiry

Back to OneMotoring

### Enquire PARF/COE Rebate for Registered Vehicle

#### Vehicle Owner Particulars

Owner ID Type:

Singapore NRIC

Owner ID:

369A

#### Vehicle Details

Vehicle No.:

SKR1975E

Vehicle to be Exported:

Yes

Intended Deregistration Date:

14 Dec 2020

Vehicle Make:

HONDA

Vehicle Model:

JAZZ 1.5 VTIR CVT ABS D/AIRBAG 2WD

Primary Colour:

Silver

Manufacturing Year:

2016

Engine No.:

L15B31191160

Chassis No.:

JHMGK5850HX201661

Maximum Power Output:

96.0 kW (128 bhp)

Open Market Value:

\$17,978.00

Original Registration Date:

11 May 2017

First Registration Date:

11 May 2017

Transfer Count:

0

Actual ARF Paid:

\$12,978.00

#### Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

10 May 2027

PARF Rebate Amount:

\$9,733.00

#### Intended COE Rebate Details

COE Expiry Date:

10 May 2027

COE Category:

A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years):

10

QP Paid:

\$52,000.00

COE Rebate Amount:

\$33,304.00

**Total Rebate Amount:**

**\$43,037.00**

The information contained herein is correct as at 14 Dec 2020

OK



Merimen e-Claims



Used 2017 Honda Jazz 1.5A RS for



PARF/COE Re

mart.com/used\_cars/info.php?ID=951794&amp;DL=2993

## Honda Jazz 1.5A RS

Overview

Financial

Accessories

Similar

Research

Photos

Map

## Price

\$60,800

## Depreciation ?

\$8,520 /yr

View models with similar depre

## Reg Date

15-May-2017

(6yrs 4mths 21days COE left)

## Mileage

99,000 km (27.4k /yr)

## Manufactured ?

2016

## Road Tax ?

\$684 /yr

## Transmission

Auto

## Dereg Value ?

\$42,723 as of today (change)

## OMV ?

\$17,647

## COE ?

\$52,000

## ARF ?

\$12,647

## Engine Cap

1,498 cc

## Power

96.0 kW (128 bhp)

## Curb Weight ?

1,046 kg

## No. of Owners ?

1

## Type of Vehicle

Hatchback

## Features

Fuel-Efficient 1.5L Engine, 16 Valves DOHC I-VTEC Engine With Smooth Earth Dream CVT Auto Transmission, Multi-Function Steering Control, Paddle Shift. View specs of the Honda Jazz (2014-2017)

## Accessories

Factory Fitted Touch Screen Audio System, Aluminum Pedals, Multi Function Steering Wheel, Reverse Camera, LED Headlights, Paddle Shift.

Dc

