

ASS. REC. BY:

REF:

C11/

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 816k

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 10 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: 06/23 Person Contacted: _____

Vehicle: IN / OUT

Date / Time Action / Instruction

Veh No: STG 3282C Yr Regn: 06, 08Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toy Atio c.c. 1496Colour: M. Black Grey A/C: Insured / Std / NI / NASp. Reading: 135431 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: N8E141 6083154Gen. Cond: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModl: Nil / S/Rlm / STD A/Rlm orTyre Size: F: 195/55R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Continental

Front

R/Bal. 7 mmL/Bal. 7 mmD.O.A. 5/1/21

Rear

R/Bal. 7 mmL/Bal. 7 mmD.O.I. 11/1/2021

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

N/S Frt & Rear O/SThe U/C / Chassis frame & Body Structure affected due to collision. ✓

Date/Time, File Pass to?

☐ : Prell. Report☐ : Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech Invs (\$☐ : Weekend (\$

Survey Fee:

Transportation:

S - RS. SI

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$

S&H Motor Pte Ltd
160 Sin Ming Drive #07-02
Sin Ming Autocity
Singapore 575722

Insurer Reference:
 Repairer Reference: 038713
 Date calculated: 08/01/2021 3:23 PM

Full Report
 Registration: SJG3282C
 Printed: 08/01/2021 3:24 PM

Summary Information

Claim		Work Provider:	China Taiping Insurance
Location:	Singapore (SG)		(Singapore) Pte Ltd
Printed by:	SH Motor	Currency:	SGD
Claim Reference:		Date of Incident:	05/01/21
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle
 Manufacturer: TOYOTA
 Model: COROLLA E14
 Sub Model: ALTIS
 Model Sheet Number: 70 CM 13
 Registration: SJG3282C
 VIN number:
 Odometer:

Model Specs

AUTO AIR CON 1.5 LTR 80 KW
 TWO COAT METALLIC PREPARE OFF VEHICLE

CVT AUTO GEARBOX

ABS

10 days

Not Authorised
1/1/21 8
Running After Repair
Excess TBA

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	ADJUST HEADLAMPS		3.0	12.60
043233	ALIGN VEHICLE CPL		12.0	50.40
B100	R + R LEFT WING		4.0	16.80
B100	R + R R/WING		4.0	16.80
B110)	RENEW L/F WING (REMOVED)		2.0	8.40
B110)	RENEW R/F WING (REMOVED)		2.0	8.40
B140	RENEW FRONT PANEL CPL		9.0	37.80
NO NUMBER	R + R FRONT BUMPER REINFORCEMENT		2.0	8.40
B010	R + R FRONT BUMPER		5.0	21.00
B020)	RENEW FRONT BUMPER (REMOVED)		9.0	37.80
B040)	R + R LEFT HEADLAMP		1.0	4.20
B040)	R + R RIGHT HEADLAMP		1.0	4.20
B040)	RENEW HEADLAMP		1.0	4.20
B060	R + R BONNET		3.0	12.60
B070)	RENEW BONNET (REMOVED)		1.0	4.20
B080	R + R BONNET HINGES		1.0	4.20
851051)	R + R WASHER PUMP		2.0	8.40
B085	R + R FRONT SCREEN FRAME MOULDING		2.0	8.40
G010	R + R WINDSCREEN		31.0	130.20

	Description	WU	Price SGD
1051	R + R DRIVER AIRBAG	2.0	8.40
1101)	R + R STEERING WHEEL	2.0	8.40
NO NUMBER	R + R UPPER INSTRUMENT PANEL	17.0	71.40
M010)	R + R AIR CONDITIONING CONDENSER	3.0	12.60
NO NUMBER	R + R CONDENSER/COMPRESSOR PIPE	3.0	12.60
NO NUMBER	R + R EVAPORATOR HOSES	4.0	16.80
002889	DRAIN/REFILL AIR CONDITIONING	7.0	29.40
160401)	R + R FAN SHROUD / ENGINE	6.0	25.20
M020)	RENEW RADIATOR (RADIATOR REMOVED)	3.0	12.60
369111	R + R OIL PAN AUTOMATIC GEARBOX	14.0	58.80
451011)	R + R POWER STEERING GEAR	10.0	42.00
420018)	R + R LEFT FRONT WHEEL	1.0	4.20
420018)	R + R RIGHT FRONT WHEEL	1.0	4.20
420018)	R + R WHEEL/S (ADD/WORK)	1.0	4.20
420091A	R + R L/F WHEEL/TYRE	3.0	12.60
473101A)	DETACH + REFIT FRONT BRAKE CALIPER	3.0	12.60
896081)	R + R R/F ABS SENSOR	2.0	8.40
896081A)	R + R FRONT ABS SENSOR (ADD WORK)	3.0	12.60
431151)	DISS/ASS L/F UPPER SUSPENSION STRUT	1.0	4.20
431151)	DISS/ASS R/F UPPER SUSPENSION STRUT	1.0	4.20
431151)	R + R LEFT FRONT SHOCK ABSORBER	4.0	16.80
431151)	R + R RIGHT FRONT SHOCK ABSORBER	4.0	16.80
NO NUMBER	R + R L/F STABILIZER CONNECTING ROD	2.0	8.40
NO NUMBER	R + R R/F STABILIZER CONNECTING ROD	2.0	8.40
434081A)	R + R FRONT STEERING KNUCKLE BEARING	5.0	21.00
434601A)	DETACH + REFIT FRONT DRIVE SHAFT	4.0	16.80
434211)	R + R L/F STEERING KNUCKLE (WHEEL REM)	4.0	16.80
434211)	R + R R/F STEERING KNUCKLE (WHEEL REM)	4.0	16.80
434601)	R + R L/F AXLE DRIVE CPL	4.0	16.80
434601)	R + R R/F AXLE SHAFT CPL	4.0	16.80
434211)	RENEW LEFT FRONT STEERING KNUCKLE DOES NOT INCLUDE: VEHICLE ALIGNMENT	5.0	21.00
434211)	RENEW RIGHT FRONT STEERING KNUCKLE DOES NOT INCLUDE: VEHICLE ALIGNMENT	5.0	21.00
431401A)	RENEW FRONT SUPPORTING JOINT	3.0	12.60
NO NUMBER	R + R R/LOWER ENGINE PROTECTION	2.0	8.40
1117	L/F WHEELHOUSE CPL REPAIR	15 30.0*	126.00
1118	R/F WHEELHOUSE CPL REPAIR	15 30.0*	126.00
1481	LEFT FRONT DOOR REPAIR	5 10.0*	42.00
1482	RIGHT FRONT DOOR REPAIR	5.0* X	21.00

Labour Cost

Panel / Mechanical Labour

Total of Labour

Hrs	WU	
30.90	309.0	1,297.80
		1,297.80

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - TWO COAT METALLIC	WU	Price SGD
	BONNET NEW PART PAINTING	21.0	
	L/F WING NEW PART PAINTING	10.0	
	R/F WING NEW PART PAINTING	10.0	
	LOCK CARRIER STRUT SURFACE PAINT	4.0	
	INNER FRT PANEL CPL SURFACE PAINT	6.0	

SYSTEM AZT

Time Basis 10 WU/h

Description - TWO COAT METALLIC

WU	Price SGD
16.0	
16.0	
23.0	
4.0	
6.0	
6.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	65.53
0741	L/F WING NEW PART PAINTING	21.16
0742	R/F WING NEW PART PAINTING	21.16
0988	LOCK CARRIER STRUT SURFACE PAINT	1.25
1009	INNER FRT PANEL CPL SURFACE PAINT	13.94
1481	LEFT FRONT DOOR NEW PART PAINTING	44.38
1482	RIGHT FRONT DOOR NEW PART PAINTING	44.38
0281	FRONT BUMPER NEW PART PAINT K1G	77.68
0410	GRILLE NEW PART PAINT K1R	4.92
1117	L/F WHEELHOUSE CPL SURFACE PAINT	13.45
1118	R/F WHEELHOUSE CPL SURFACE PAINT	13.45

Labour Cost - Paint

Hrs	WU	Price SGD
		42.00 SGD/h
	122.0	
2.50	25.0	105.00
0.80	8.0	33.60
10 WU/h	155.0	651.00

Material Cost - Paint

Price SGD
196.61
4.92
77.68
42.09
28.60
12.70
362.60

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01	Price SGD
0254	R/LOWER GRILLE	81481 02110	Original		60.00 7
0281	FRONT BUMPER	52119 02850	Original	R	180.00 ✓
0317	L/F BUMPER BRACKET	52116 02140	Original	CM	35.00 ✓
0318	R/F BUMPER BRACKET	52115 02140	Original	CM	35.00 ✓
0340	BUMPER SUPPORT	52021 02101	Original	R	120.00 X
0410	GRILLE	53100 02310	Original	CM	150.00
0471	BONNET	53301 02230	Original	R	300.00 ✓

	Description	Part Number	Part Source	Price SGD	
	L/F HINGE	53420 02060	Original	Dis 40.00	✓
	R/F HINGE	53410 02060	Original	B 40.00	✓
	BONNET LOCK	53510 02380	Original	R 70.00	X
	LEFT HEADLAMP ASSY	81170 02720	Original	CM 280.00	✓
	RIGHT HEADLAMP ASSY	81130 02720	Original	CM 280.00	✓
	L/REPEATER LAMP CPL	81730 12240	Original	Ar 40.00	✓
	L/F WING	53812 02250	Original	B 250.00	✓
	R/F WING	53811 02250	Original	B 250.00	✓
	R/DOOR MIRROR TRIM	60117 02090	Original	mir 30.00	✓
	L/WHEELHOUSE SHELL	53876 02270	Original	CM 80.00	✓
	R/WHEELHOUSE SHELL	53875 02270	Original	CM 80.00	✓
	LOCK CARRIER STRUT	53208 02120	Original	R 50.00	X
	INNER FRT PANEL CPL	53201 02270	Original	350.00	?
	R/COWL PANEL GRILLE	55708 02450	Original	CM 280.00	✓
	WINDSCREEN	56101 02930	Original	CM 500.00	✓
	LWR WINDSCREEN SEAL	56117 12300		0.00	
	WINDSCREEN REP KIT	PZ49I 00C1131		0.00	
	UPP WINDSCREEN MLDG	75531 02190	Original	NA 55.00	✓
	WASHER CONTAINER	85315 02470	Original	NA 45.00	✓
	R/F WIPER ARM	85211 02270	Original	R 60.00	✓
	UPP INSTRUMENT PANEL	55302 02310B0	Original	650.00	?
	CONDENSER CPL	88450 02350	Original	Sm 360.00	X
	COND/EVAPORATOR	88710 0Z060	Original	Sm 220.00	X
	PIPE			Sm 200.00	X
4484	COMPR/CONDENSER	88703 02490	Original	mir 75.00	✓
	HOSE			750.00	?
4931	INTERIOR MIRROR	87810 06041	Original	580.00	?
7011	FRONT AXLE BEAM	51201 02170	Original	R 580.00	X
7035	L/DRIVE SHAFT CPL	43420 02710	Original	80.00	?
7036	R/DRIVE SHAFT CPL	43410 02660	Original	80.00	?
7053	L/F LWR AXLE ARM	48069 02210	Original	55.00	?
7054	R/F LOWER AXLE ARM	48068 02210	Original	55.00	?
7065	L/F LOWER AXLE JOINT	43330 09680	Original	180.00	✓
7066	R/F LOWER AXLE JOINT	43330 09680	Original	180.00	?
7077	L/F STRUT	48520 09L60	Original	R 150.00	✓
7078	R/F STRUT	48510 09T30	Original	150.00	?
7081	L/F STEERING KNUCKLE	43212 02270	Original	R 55.00	✓
7082	R/F STEERING KNUCKLE	43211 02270	Original	55.00	?
7091	L/UPP SUPP MOUNTING	48609 02220	Original	NA 35.00	✓
7092	R/UPP SUPP MOUNTING	48609 02220	Original	35.00	?
7117	L/F WHEEL BEARING	90080 36137	Original	250.00	NA 450.00
7118	R/F WHEEL BEARING	90080 36137	Original	150.00	✓
7201	L/F WHEEL	42611 02B50	Original	110.00	?
7245	L/F ABS SENSOR	89543 02130	Original	15.00	?
7261	FRONT STABILISER	48811 02280	Original	Sm 15.00	X
7269	L/F STABILISER BUSH	48815 02240	Original	55.00	?
7270	R/F STABILISER BUSH	48815 02240	Original	55.00	?
7271	L/F STABI ROD	48820 02100	Original	550.00	?
7272	R/F STABI ROD	48820 02100	Original	55.00	?
7300	POWER STEERING	45510 02200	Original	R 55.00	✓
7311	L/TIE ROD BALL JOINT	45046 09610	Original	55.00	?
7312	R/TIE ROD BALL JOINT	45046 09610	Original	Sm 380.00	X
7761	RADIATOR	16410 0D390	Original	100.00	X
7767	RADIATOR SHROUD	16711 0D260	Original	50.00	✓
7787	EXPANSION TANK	16470 0D050	Original	Sm 85.00	X
7793	COOLING FAN	16361 0D200	Original		

Description	Part Number	Part Source	Price SGD	
FAN MOTOR	16363 0M010	Original	160.00	X
GEARBOX SUMP	35106 20040	Original	60.00	✓
OIL PAN GASKET	35168 12091	Original	30.00	✓
BATTERY MOUNTING	74404 02200	Original	18.00	X
BATTERY TRAY	74431 12060	Original	35.00	?
RH W/panel cover end	Wiper panel	Original	40.00	✓
LH W/panel cover end	Wiper panel	Original	40.00	✓
FRONT BUMPER SPONGE	FRONT BUMPER	Original	60.00	?
F/BUMPER BOTTOM COVR	FRONT BUMPER	Original	60.00	

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	10,813.00
Fixed Sundry Parts Price	100.00
Total	10,913.00

Extras

Code	Description	Price SGD	
1004	ECU diagnostic ECU diagnostic	150.00*	?
1005	Electrical work Electrical work	25.00*	✓
1006	Engine coolant Engine coolant	30.00*	✓
1007	FNT W/S INNER SEAL FRNT WINDSCREEN	20.00*	✓
1008	Air con coolant Air con	50.00*	✓
1009	FRONT W/S SEALANT FRNT WINDSCREEN	25.00*	✓
1010	Wheel alignment Wheel alignment	60.00*	✓
1011	GEARBOX OIL GEARBOX	60.00*	?
1012	WIPER SET WIPERS	28.00*	✓
Total Extras		448.00	

Final Calculation

	SGD	SGD
Parts	10,813.00	
Fixed Sundry Parts Price	100.00	
Total Parts		10,913.00
Labour Time Base 10 WU/h		
Total 309.0 WU X 42.00 SGD/h	1,297.80	
Total of Labour		1,297.80
Total Of Extras		448.00
Paint Work Time Base 10 WU/h		
Labour Cost 155.0 WU X 42.00 SGD/h	651.00	
Material Cost	362.60	
Total Paint Including Material		1,013.60
Repair Cost Excludes GST		13,672.40
GST (+7.0%)		957.07
Repair Cost Included GST		14,629.47

e PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Singapore NRIC
Owner ID:	084Z
Vehicle Details	
Vehicle No.:	SJG3282C
Vehicle to be Exported:	Yes
Intended Deregistration Date:	06 Jan 2021
Vehicle Make:	TOYOTA
Vehicle Model:	COROLLA AXIO 1.5X A
Primary Colour:	Silver
Manufacturing Year:	2008
Engine No.:	1NZD059986
Chassis No.:	NZE1416083154
Maximum Power Output:	81.0 kW (108 bhp)
Open Market Value:	\$12,135.00
Original Registration Date:	26 Jun 2008
First Registration Date:	26 Jun 2008
Transfer Count:	2
Actual ARF Paid:	\$9,236.00
Intended PARF Rebate Details	
PARF Eligibility:	Forfeited
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	25 Jun 2023
COE Category:	A - Car (1600cc & below)
COE Period(Years):	5
PQP Paid:	\$19,107.00
COE Rebate Amount:	\$9,436.00
Total Rebate Amount:	\$9,436.00
Message	
Please note that the 5-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 06 Jan 2021

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

- Please report correctly the details of the accident to speed up the claims process.
This Form must be completed by the Policyholder and/or the Authorised Driver.
Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
- The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
 - Any false reporting may be referred to the Police for investigation.
 - This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
 - By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	06/01/2021 17:50 (SGT)
Date of Accident	05/01/2021 18:00 (SGT)
Exact Location of Accident	Sims Way, Singapore
Additional Location Information	at the junction of Sims Way towards KPE
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SJG3282C
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	Koh Wee Chuan Shawn
NRIC No	SXXXX084Z
Email Address	shawn_kwc@hotmail.sg
Mobile Phone No	(Phone) +65-91189151
Alternative Phone No	(Home) +65-91189151

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Corolla Axio 1.5X A
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car


INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	DMPCSNW00185992002
Cover Note Number	-

DRIVER

Name of Driver	Koh Wee Chuan Shawn
NRIC No	SXXXX084Z
Date Of Birth	11/05/1977
Occupation	Outdoor

SKETCH PLAN

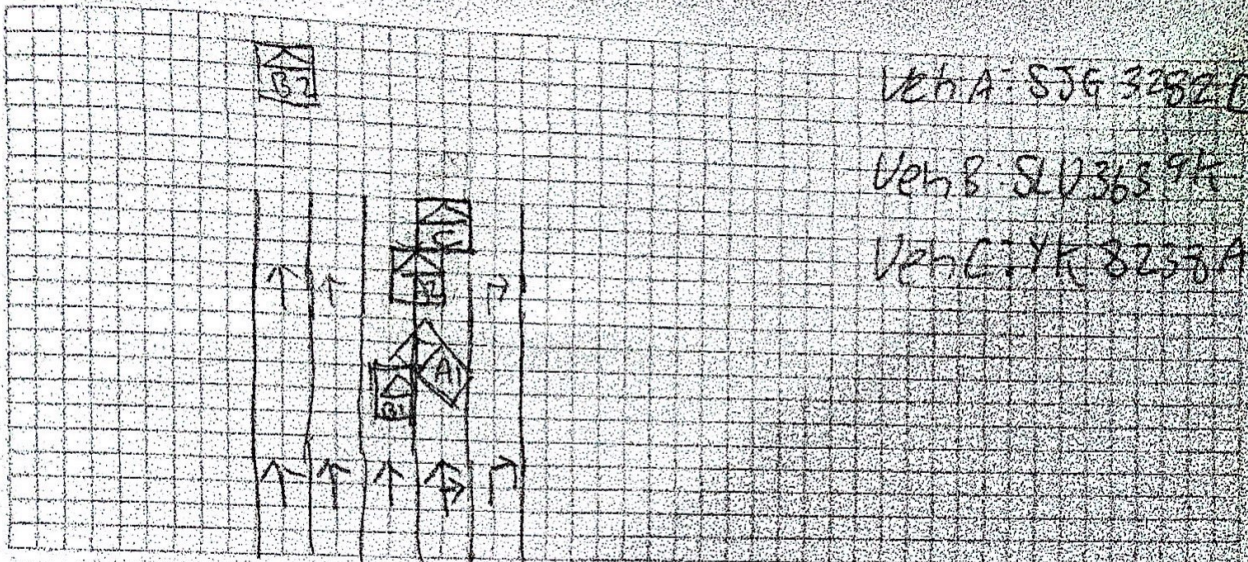

Veh A: SJG 3282L

Veh B: SLV 363 9K

Veh C: YK 8238A

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Refer attached police report.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.: