

ASS. REC. BY: Jim

REF:

CC3/AM 21000432/RIVd3

3
003C

ASSIGNMENT

From: _____ Date: _____

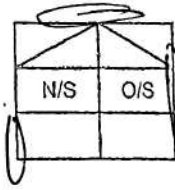
Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MVTo Inspect Vehicle No: SDS 7388Mat Workshop m/s premiumof BentleyInsured: AlhPolicy No. 1700039953-03Claims No. 5740447094SGSum Insured: _____ Excess: FBA 0

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 102k

IDAC Accident Report _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SDS 7388MYr Regn: 2001/Alh

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Andal 14 TPS TRONK c.c 1395Colour BLACK

A/C: Insured / Std / NI / NA

Sp. Reading 36541

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WMA 222F4 2HA 178460Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / SRim / STD A/Rim orTyre Size: F: 245/40R18R: 2SS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or .

Front

Rear

R/Bal. 6 mmR/Bal. 6 mmL/Bal. 6 mmL/Bal. 6 mmD.O.A. 08/01/2021D.O.I. 11/01/2021Survey held at premiumDes. of Damages: FR / Rear / O/S / N/S / U/C / Rooftop orFR, N/S REAR & O/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>Repair limit - 46k</u>
7/6/21	Final fig \$44,739.16 confirmed by email (Red 42,519.84, 48%)

Date/Time, File Pass to?

☐

: Prelt. Report

Days Of Repair: 24

1)

☐

: Final Report

Resurvey No. of Trip: 1

Date/Time, File Return to?

2) 1/8/21-Typist

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

Rep. Format: MerimenLump Sum / L.S. (\$ 44,739.16)

Survey Fee:

Transportation:

S + RS. \$

Photos

Others

TOTAL

 PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



ESTIMATE	:	ACCIDENT REPAIRS
WORKSHOP	:	UBI ROAD 1
CONTACT NO	:	6366 2323
FAX NO	:	6841 1183
REFERENCE	:	PA/OD/0022/2021/NS
DATE	:	11-Jan-21
WIP	:	10727

VEHICLE IN WORKSHOP. KINDLY ARRANGE FOR SURVEY.

AIG ASIA PACIFIC INSURANCE PTE LTD

78 SHENTON WAY

#07-16 AIG BUILDING

SINGAPORE 079120

ATTN: MR. ADRIAN LING - MOTOR CLAIMS DEPT

TEL: 6841 0055 - FAX: 6256 4315

OWNER'S NAME	:	MS CHUA SOO HIANG MARTINA
ADDRESS	:	30A CONWAY GROVE SINGAPORE 558236
TELEPHONE	:	HP +65 97371576
TYPE OF CLAIM	:	OWN DAMAGE CLAIM
POLICY NO	:	1700039953-03
VEHICLE NO	:	SDS 7388 M
MODEL CODE	:	AUDI A4 SEDAN 1.4 TFSI S
MODEL YEAR	:	14/8/2017
ENGINE NO	:	CVN 040770
CHASSIS NO	:	WAUZZZF42HA178460
MILEAGE	:	38541KM
DATE IN	:	8-Jan-21
ESTIMATED BY	:	JOHNNY BOO / ALLAN WU
ACCIDENT DATE	:	8-Jan-21
PLACE OF ACCIDENT	:	OUTSIDE 30A CONWAY GROVE

PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SDS 7388 M

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY.	S/N \$ 280.00	X
2	TO REMOVE AND RENEW AIRCON CONDENSER, RADIATOR AND ADDITIONAL RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS.	S/N \$ 1,200.00	?
3	TO REMOVE AND TRANSFER BOTH HEADLIGHT'S CONTROL UNIT AND POWER MODULE.	S/N \$ 700.00	250
4	TO DISMANTLE AND RENEW FRONT BUMPER, BONNET AND BOTH HEADLIGHTS. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	\$ 4,200.00	1000
5	TO RESPRAY FRONT BUMPER, BONNET AND HINGES.	\$ 2,400.00	1100
SUB TOTAL LABOUR CHARGES		: \$ 8,780.00	

 PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

**ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SDS 7388 M**

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
6	TO REMOVE AND REINSTALL REAR PARKING AID AND REAR LID KICK SENSOR./ CHECK FUNCTION AND RENEW ACCORDING TO DAMAGE.	S/N \$ 360.00 ✓	
7	TO RENEW REAR WINDSCREEN AND 1/4 GLASS TO FACILITATE FENDER RENEWAL.	S/N \$ 600.00 ✓	
8	TO INSTALL SOLAR FILM FOR REAR WINDSCREEN AND 1/4 GLASS. <i>(sale agant)</i>	S/N \$ 400.00 ✓	
9	TO CARRY OUT WATER SEEPAGE TEST FOR REAR WINDSCREEN.	S/N \$ 200.00 ✓	
10	TO DISLODGE AND REINSTALL REAR WIRE HANRESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT.	S/N \$ 1,400.00 ✓	
SUB TOTAL LABOUR CHARGES		: \$ 2,960.00	

PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SDS 7388 M

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
11	TO REMOVE AND REINSTALL REAR SEAT, BACK REST, HAT TRAY, ABCD PILLAR TRIMS, LUGGAGE COMPARTMENT TRIMS. DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAG ETC.	S/N \$ 1,400.00 /	
12	TO REMOVE AND RENEW LHS REAR WHEEL SUSPENSION ASSY WITH SUBFRAME.	S/N \$ 2,400.00 <i>plus</i> /	
13	TO DISMANTLE AND RENEW REAR BUMPER. CUT OUT AND WELD LHS REAR FENDER, LHS INNER WHEEL HOUSING, LHS INNER BOTTOM PLATE AND LHS INNER CONNECTING PLATE. TO REPAIR LHS REAR DOOR. RE-ORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	\$ 7,700.00 <i>3000</i>	
14	TO RESPRAY REAR BUMPER, LHS REAR FENDER, LHS REAR DOOR, LHS INNER WHEEL HOUSING, LHS CONNECTING PLATE, LHS BOTTOM PLATE, LHS SILL PANEL, DOOR ENTRANCES, ROOF CHANNEL, DRAIN PANEL AND END PANELLING. TO CARRY OUT STONE CHIP TREATMENT AND JOINT SEALER WORKS.	\$ 6,400.00 <i>3025 2475</i>	
15	TO RENEW RIM WITH TYRE FOR LHS REAR, RHS REAR & RHS FRONT. TO CARRY OUT PRE AND POST-WHEEL ALIGNMENT.	S/N \$ 520.00 /	
16	TO CARRY OUT DIAGNOSTIC CHECK.	S/N \$ 192.00 /	
TOTAL LABOUR CHARGES		: \$ 30,352.00	

PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SDS 7388 M

S/N PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES	
		S/NETT	REMARKS
1 FRONT BUMPER ? repair		\$ 2,111.00	
2 FRONT BUMPER FIXING PARTS ?		\$ 150.00	
3 FRONT BUMPER SECURING STRIP X	2	\$ 71.00	
4 FRONT BUMPER GRILLE - CENTRE Cra ✓		\$ 196.00	
5 FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE X		\$ 210.00	
6 RADIATOR GRILLE Cra ✓		\$ 1,152.00	
7 FRONT BUMPER AIR GUIDE GRILLE - LH/RH X	2	\$ 270.00	
8 FRONT BUMPER CARRIER ?		\$ 845.00	
9 FRONT BUMPER FOAM FILLER PIECE ?		\$ 124.00	
10 FRONT BUMPER TOP COVER Cra ✓		\$ 127.00	
11 FRONT BUMPER GUIDE SECTION - LH X		\$ 36.00	
12 FRONT BUMPER GUIDE SECTION - RH X		\$ 38.00	
13 CAUTION SIGN STICKER Cra ✓	NEC	\$ 14.00	
14 AIRCON STICKER Cra ✓	NEC	\$ 8.00	
15 LOCK CARRIER BRACKET Cra ✓		\$ 137.00	
16 LOCK CARRIER BRACKET SUPPORT - LH/RH ?	2	\$ 58.00	
17 HORN - LH HIGH TONE X		\$ 126.00	
18 HORN - RH LOW TONE X		\$ 126.00	
19 SPRING SHACKLE - LH/RH X	2	\$ 58.00	
20 BONNET bt ✓		\$ 3,246.00	
SUB TOTAL SPARE PARTS	:	\$ 9,103.00	

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SDS 7388 M

S/N PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES		REMARKS
		S/NETT		
21 BONNET ATTACHMENT PARTS X		\$	412.00	
22 BONNET LID HINGE - LH/RH X	2	\$	610.00	
23 BONNET IMPACT PROTECTION - LH/RH/CENTRE X	3	\$	84.00	
24 BONNET BOWDEN CABLE X		\$	58.00	
25 BONNET RELEASE LEVER Jam X		\$	14.00	
26 BONNET BOWDEN CABLE - CENTRE X		\$	58.00	
27 BONNET STRIKER - LH/RH X	2	\$	100.00	
28 LID LOCK X	2	\$	427.00	
29 LED HEADLIGHT - LH/RH X	2	\$	15,386.00	
30 LIFT CYLINDER - LH/RH X	2	\$	420.00	
31 LIFT CYLINDER CORRUGATED PIPE X		\$	93.00	
32 LOCK CARRIER ?		\$	1,016.00	
33 AIRCON CONDENSER X		\$	622.00	
34 READY MIX COOLANT ?		\$	95.00	
35 RADIATOR AIR GUIDE - LH/RH OUTER ?	2	\$	56.00	
36 RADIATOR AIR GUIDE - LH/RH INNER X	2	\$	24.00	
37 RADIATOR AIR GUIDE UPPER X		\$	16.00	
38 RADIATOR AIR GUIDE - LOWER X		\$	22.00	
39 REAR BUMPER X		\$	2,181.00	
40 REAR BUMPER FIXING PARTS ?		\$	150.00	
SUB TOTAL SPARE PARTS	:	\$	21,844.00	

PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SDS 7388 M

S/N PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES S/NETT	REMARKS
41 REAR BUMPER SECURING STRIP ?		\$ 223.00	
42 REAR BUMPER SPOILER X		\$ 249.00	
43 REAR LIGHT REFLECTOR - LH X		\$ 41.00	
44 LED TAIL LIGHT - LH cut ✓		\$ 1,019.00	
45 TAIL LIGHT TRIM - LH ?		\$ 30.00	
46 REAR BUMPER GUIDE SECTION - LH ?		\$ 44.00	
47 REAR BUMPER GUIDE SECTION - LH/RH ?	2	\$ 46.00	
48 REAR FENDER - LH blue ✓		\$ 4,052.00	
49 REAR WINDSCREEN new ✓		\$ 1,154.00	
50 1/4 GLASS - LH new ✓		\$ 616.00	
51 PRIMER new ✓		\$ 20.00	
52 BOTTOM PLATE - LH OUTER ?		\$ 466.00	
53 WHEEL HOUSING - LH OUTER ?		\$ 632.00	
54 WHEEL HOUSING INNER PART - LH ?		\$ 1,231.00	
55 WHEEL HOUSING LINER - LH cut ✓		\$ 240.00	
56 WHEEL HOUSING LINER ATTACHMENT PART new ✓		\$ 150.00	
57 ALUMINIUM RIM - REAR LH / REAR RH / FRONT RH cut ✓	3	\$ 5,070.00	
58 SUPPORT FRAME ?		\$ 3,286.00	
59 ALUMINIUM WISHBONE - LOWER ?		\$ 859.00	
60 WISHBONE - LH UPPER ?		\$ 556.00	
SUB TOTAL SPARE PARTS	:	\$ 19,984.00	

PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SDS 7388 M

S/N PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES	
		S/NETT	REMARKS
61 WISHBONE - LH FRONT ?		\$ 123.00	
62 WISHBONE - LH REAR ?		\$ 447.00	
63 TRACK ROD - LH REAR ?		\$ 171.00	
64 WHEEL BEARING HOUSING - LH ?		\$ 990.00	
65 WHEEL BEARING - LH ?		\$ 440.00	
66 STONE CHIP GUARD X		\$ 45.00	
67 GAS SHOCK ABSORBER ?		\$ 301.00	
68 ANTI-ROLL BAR ?		\$ 412.00	
69 COUPLING ROD ?		\$ 86.00	
70 LEVEL SENSOR - LH X		\$ 328.00	
71 LUGGAGE COMPARTMENT TRIM - LH ?		\$ 787.00	
72 INSULATION ?		\$ 65.00	
73 TYRE - LH REAR / RH REAR / RH FRONT X	3	PRICE TBA	
74 FRONT NO PLATE bt/	S/N	\$ 60.00	
75 REAR WINDSCREEN SEALANT m/	S/N	\$ 200.00	
76 1/4 GLASS SEALANT m/	S/N	\$ 100.00	
77 METAL FILLER POWDER m/	S/N	\$ 280.00	
78 STONE CHIP m/	S/N	\$ 180.00	
79 CAVITY WAX m/	S/N	\$ 140.00	
80 ACRYLIC SEALANT m/	S/N	\$ 180.00	
SUB TOTAL SPARE PARTS	:	\$ 5,335.00	



PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SDS 7388 M

S/N PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES	
		S/NETT	REMARKS
81 SUNDRIES ?		\$ 400.00	
TOTAL SPARE PARTS	:	\$ 56,666.00	
TOTAL LABOUR CHARGES	:	\$ 30,352.00	
GRAND TOTAL	:	\$ 87,018.00	

ALL CHARGES ARE INCLUSIVE OF GST

LEGEND:

REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME

: Rasul - Hp 98010068

SURVEYED DATE

: 11/01/2021 @ 1650

AUTHORISED DATE

:

EXCESS COST

:

21 days

LIABILITY

:

REMARKS

:

EXCESS: TBA

Revers

Resurvey before paint

PLEASE NOTE

:

THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF THE AFFECTED VEHICLE. SHOULD WE REQUIRE FURTHER LAOUR CHARGES AND SPARE PARTS IN THE PROGRESS OF REPAIR, WE SHALL INFORM YOU ACCORDINGLY. FOR INSPECTION OF VEHICLE, PLEASE REFER TO MS. NORAH KHAI AT TEL: 6768 9828 FOR APPOINTMENT.

YOURS FAITHFULLY,

PREMIUM AUTOMOBILES PTE LTD

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

JOHNNY BOO
BODY REPAIR MANAGER

ALLAN WU
CLAIMS CONSULTANT



SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	08/01/2021 17:05 (SGT)
Date of Accident	08/01/2021 06:35 (SGT)
Exact Location of Accident	30A Conway Grove, Singapore 558236
Additional Location Information	OUTSIDE 30A CONWAY GROVE
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SDS7388M
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	CHUA SOO HIANG MARTINA
NRIC No	SXXXX003C
Email Address	SOOHIANG@SINGNET.COM.SG
Mobile Phone No	(Phone) +65-98308639
Alternative Phone No	+65-97371576

VEHICLE PARTICULARS

Manufacturer	Audi
Model	A4
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car

INSURANCE COMPANY

Name of Insurance Company	AIG
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	1700039953-03
Cover Note Number	-

DRIVER

Name of Driver	LIM KET SYN
NRIC No	SXXXX625A
Date Of Birth	25/11/1955
Occupation	Indoor



Date Of Driving Pass	15/12/1979
Driving experience	41 YEARS AND 1 MONTH
Gender	Male
Mobile Number	(Phone) +65-97371576
Alt. Phone Number	-
Email Address	LIM15094@SINGNET.COM.SG
Address	30A CONWAY GROVE
Address complement	-
Postcode	S558236
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Spouse
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Hit and run / Vandalism / Damaged whilst parked
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	3
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other material or property damaged?	Yes
Number of Passengers (Including Driver)	0
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

AROUND 6:30-7:00AM ON 8 JAN 2021(FRIDAY) I WAS IN MY HOUSE. I HEARD A LOUD BANG. I RUSHED OUT OF THE HOUSE. I SAW OUR PARKED CAR HIT BY ANOTHER CAR. (SFK 16 B) WHICH WAS STATIONERY AT LEFT SIDE OF MY CAR. DAMAGE TO MY CAR WAS EXTENSIVE. (FRONT AND BACK) THERE WERE TWO WITNESSES.

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY

Vehicle Registration Number	SFK16B
Vehicle Manufacturer	Toyota
Vehicle Model	C-hr
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Private car
Name of Driver	-
Contact Number	-
Address	-
Address complement	-

Postcode -
Insurance Company Name -
Nature Of Damage -
Details of property damaged in accident -
No. Of Passenger (Including Driver) -

DETAILS OF OTHER VEHICLE PROPERTY 2:

Vehicle Registration Number SGK2908C
Vehicle Manufacturer -
Vehicle Model -
Vehicle Variant -
Vehicle Colour -
Vehicle Category Private car
Name of Driver -
Contact Number -
Address -
Address complement -
Postcode -
Insurance Company Name -
Nature Of Damage -
Details of property damaged in accident -
No. Of Passenger (Including Driver) -

WITNESS DETAILS:

WITNESS 1

Name ANITA
Phone (Phone) +65-90623544
Email -



SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)
I understand, acknowledge, agree and consent that:
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
(ii) investigating the accident and/or my claims;
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
(collectively the "Purposes")
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes, and
(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

[Signature]
08/Jan 2014

Policyholder's Signature / Date & Time

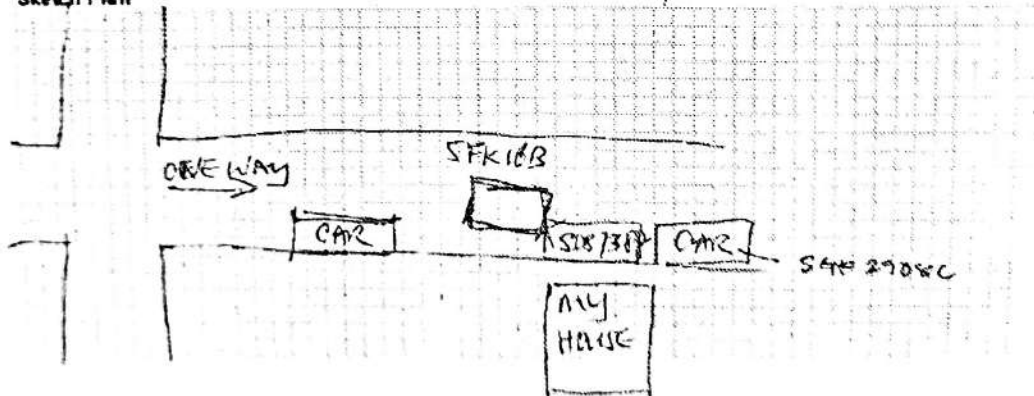
[Signature]

Driver's Signature (If driver is not the policyholder) / Date & Time

[Signature]

Witnessed by Reporting Centre Personnel

Sketch Plan




Describe Circumstances of the Accident

AROUND 6:30-07:00 AM ON 8 JAN 2021 (FRIDAY)
I WAS IN MY HOUSE. I HEARD ~~AT~~ A LOUD BANG.
I RUSHED ~~OF~~ OUT OF THE HOUSE. I ~~HEARD~~ SAW OUR ~~PAN~~
PARKED CAR HIT BY ANOTHER CAR (SER 16B) WHICH WAS
STATIONERY AT LEFT SIDE OF MY CAR.
DAMAGE TO MY CAR WAS EXTENSIVE. (FRONT AND BACK)
THERE WERE TWO WITNESSES.

Declaration

We declare the foregoing particulars are true in every respect


Policyholder's Signature / Date &
Time 08/Jan 2021


Driver's Signature (if driver is not the policyholder) / Date
& Time 08/Jan 2021


Witnessed by Reporting Centre
Personnel

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Singapore NRIC
Owner ID:	003C
Vehicle No.:	SDS7388M
Vehicle to be Exported:	No
Intended Deregistration Date:	12 Jan 2021
Vehicle Make:	AUDI
Vehicle Model:	A4 1.4 TFSI S TRONIC
Primary Colour:	Blue
Manufacturing Year:	2017
Engine No.:	CVN040770
Chassis No.:	WAUZZZF42HA178460
Maximum Power Output:	110.0 kW (147 bhp)
Open Market Value:	\$32,098.00
Original Registration Date:	14 Aug 2017
First Registration Date:	14 Aug 2017
Transfer Count:	0
Actual ARF Paid:	\$26,938.00
PARF Eligibility Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	13 Aug 2027
PARF Rebate Amount:	\$20,203.00
Intended COE Rebate Details	
COE Expiry Date:	13 Aug 2027
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$53,711.00
COE Rebate Amount:	\$35,374.00
Total Rebate Amount:	\$55,577.00

The information contained herein is correct as at 12 Jan 2021

OK

Blue

Audi A4 1.4A TFSI S-tronic

Overview

Financial

Accessories

Similar

Research

Photos

Map

Price	\$105,800		
Depreciation ⓘ	\$13,430 /yr View models with similar depre	Reg Date	16-Nov-2017 (6yrs 10mths 3days COE left)
Mileage	32,000 km (10.1k /yr)	Manufactured ⓘ	2017
Road Tax ⓘ	\$624 /yr	Transmission	Auto
Dereg Value ⓘ	\$60,156 as of today (change)	OMV ⓘ	\$32,726
COE ⓘ	\$57,414	ARF ⓘ	\$27,817
Engine Cap	1,395 cc	Power	110.0 kW (147 bhp)
Curb Weight ⓘ	1,450 kg	No. of Owners ⓘ	1
Type of Vehicle	Luxury Sedan		

Features

Powerful 1.4L Turbocharged TFSI Engine, 147Bhp/250Nm, 7 Speed S-Tronic, Auto Parking, Low Fuel Consumption, Cruise Control, Multi-Function Steering. View specs of the Audi A4 Sedan (2016-2020)

Accessories

Keyless Entry/Start, LED Headlamps, Bluetooth, Electric Seats, Rear Aircon, Smartphone Interface. Leather Upholstery, Original 16" Sports Rims.