

ASS. REC. BY:

Steve

REF:

CS/A1621000 667/VF3

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD-RES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.



Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Cum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No:

SMR 6729T

Yr Regn:

17/1/20

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Mitsubishi Attrage

c.c

1193

Colour:

Grey

A/C: Insured / Std / NI / N

Sp. Reading

14864

T/Radio: Insured / Std / NI / N

Eng/No:

C/No:

MMRSTA-13AKH004810

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/R / STD A/R / or

Tyre Size:

F:

185/55R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

5

mm

R/Bal.

5

mm

L/Bal.

5

mm

L/Bal.

5

mm

D.O.A.

12/1/21

D.O.A.

12/1/21

Survey held at

Cycle & Carriage

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision

Date / Time

Action / Instruction

MV-62K

Ref/Time, File, Pass to?



Prel. Report



Final Report

Ref/Time, File Return to?

Spec/Forms:

Imp Sum / L.P. /

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS, SI

Photos

Others

TOTAL

Add Fee:



Site Insp (\$



Interview (\$



Tech. Invs (%)



Weigh and (\$



CYCLE & CARRIAGE

CYCLE & CARRIAGE AUTOMOTIVE PTE LIMITED
PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65691056

**ESTIMATE**

Co Reg No : 197701469G

GST Reg No : MR-8500111-X

Invoice Name & Address	Owner Name & Vehicle Info	
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 6419 1892	Cust No/Name	KCV15285/JULIANNA NG YEN HONG
	Reg No/Reg Date	SMR6729T / 17/01/202
	Date In/Mileage	13/01/2021/ 0
	Chassis No	MMBSTA13AKH004810
	Engine No	3A92UJK2598
	Make/Model	MIT/19MY ATTRAGE 1.2 CVT
	Colour/Trim	U01 TITANIUM GREY M/ BK BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No		
KAX00008	Credit	14/01/2021/ 09:50	QUK	282 / Kevin Leong	61805		
Description of Goods / Services				Qty	Unit Price	Disc%	Amount
E PNT88000		REPLACE FRT BUMPER, BONNET, FRT RH FENDER, SUPPORT PANEL, BODY KIT & AFFECTED AREA	1/2	4.5 X 400	1800		3150.00
E PNT98000		REPAIR ON FRT LH FENDER & FRT RH DOOR					
E PNT98000		PAINT WORK ON FRT BUMPER, BONNET, BOTH FRT FENDER, FRT RH DOOR & SUPPORT PANEL	1	350 X 5	1750		2100.00
E PNT88000		REPLACE REAR BUMPER, BOOT, END PANEL, FLOOR PANEL, REAR RH TAIL LAMP PANEL, REAR RH FENDER & AFFECTED AREA	1/2	400 X 7.5	3000		3600.00
E PNT98000		PAINT WORK ON REAR BUMPER, BOOT, END PANEL, FLOOR PANEL, REAR RH FENDER, REAR RH TAIL LAMP PANEL & BODY KIT	2	350 X 6.5	2275		2450.00
E PNT88000		REMOVE & INSTALL RADIATOR, CONDENSER FOR FACILITATE REPAIR	1/2		1		120.00
A 55900099		TO TOP UP AIR CON GAG			1		80.00
E PNT88000		REMOVE & INSTALL REAR PARKING ASSIST					120.00
E PNT88000		REMOVE & INSTALL REAR BOOT COMPARTMENT FOR FACILITATE REPAIR		(photo)			120.00
E PNT88000		TO REMOVE & REAR SEAT FOR FACILITATE REPAIR		(photo)			120.00
E PNT88000		TO TRANSFER REAR BOOT ATTACHMENT TO NEW PANEL					120.00
E PNT88000		TO REMOVE & INSTALL REAR WINDSCREEN GLASS FOR FACILITATE REPAIR					240.00
M SUNDRY		TO APPLY WINDSCREEN SEALANT					80.00
M SUNDRY		TO APPLY BODY SEALANT ON AFFECTED PANEL					80.00
M SUNDRY		PERFORM RUST PREVENTION					80.00

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE & CARRIAGE

CYCLE & CARRIAGE AUTOMOTIVE PTE LIMITED
PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65691056

MITSUBISHI
MOTORS

Co Reg No : 197701469G

ESTIMATE

GST Reg No : MR-8500111-X

Invoice Name & Address	Owner Name & Vehicle Info
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 6419 1892	Cust No/Name KCV15285/JULIANNA NG YEN HONG Reg No/Reg Date SMR6729T / 17/01/202 Date In/Mileage 13/01/2021/ 0 Chassis No MMBSTA13AKH004810 Engine No 3A92UJK2598 Make/Model MIT/19MY ATTRAGE 1.2 CVT Colour/Trim U01 TITANIUM GREY M/ BK BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No		
KAX00008	Credit	14/01/2021/ 09:50	QUK	282 / Kevin Leong	61805		
Description of Goods / Services				Qty	Unit Price	Disc%	Amount
M SUNDRY							50.00
TO SUPPLY FRT NUMBER PLATE WITH FRAME							
M SUNDRY							40.00
TO SUPPLY C & C EMBLEM							
A 54900099							30.00
CHECK WIRING & CHASSIS ELECTRICAL SYSTEM							
A 10028901							120.00
TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST							
USING HI-SCAN PRO TEST							
A 15900099							450.00
TO REPLACE REAR EXHAUST MUFFLER							
M SUNDRY							50.00
SUNDRIES							
M HEADLAMP ASSY,LH				1.00	660.00	23.00	508.20
M HEADLAMP ASSY,RH				1.00	660.00	23.00	508.20
M LAMP ASSY,COMB,RR RH				1.00	335.00	23.00	257.95
M LAMP ASSY,LICENSE PLATE				1.00	51.00	23.00	39.27
M TANK,WINDSHIELD WASHER				1.00	74.00	23.00	56.98
M CAP,WASHER TANK FILLER				1.00	7.00	23.00	5.39
M HORN				1.00	79.00	23.00	60.83
M PIPE,EXHAUST TAIL				1.00	603.00	23.00	464.31
M SEAL RING,EXHAUST PIPE				1.00	8.00	23.00	6.16
M HANGER,EXHAUST MUFFLER				1.00	22.00	23.00	16.94
M FACE,FR BUMPER				1.00	703.00	23.00	541.31
M COVER,HEADLAMP SUPT PANEL				1.00	62.00	23.00	47.74
M MARK,THREE-DIA				1.00	69.00	23.00	53.13
M BRACKET,FR BUMPER,RH				1.00	13.00	23.00	10.01
M BRACKET,FR BUMPER,LH				1.00	13.00	23.00	10.01
M AIR DAM,SIDE,FR RH				1.00	18.00	23.00	13.86
M AIR DAM,SIDE,FR LH				1.00	18.00	23.00	13.86
M GRILLE,FR UNDER				1.00	165.00	23.00	127.05
M GARNISH,FR BUMPER,RH				1.00	127.00	23.00	97.79
M BRACKET,RR BUMPER,LH				1.00	28.00	23.00	21.56

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE & CARRIAGE

CYCLE & CARRIAGE AUTOMOTIVE PTE LIMITED
PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65691056



ESTIMATE

GST Reg No : MR-8500111-X

Co Reg No : 197701469G

Invoice Name & Address	Owner Name & Vehicle Info
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 6419 1892	Cust No/Name KCV15285/JULIANNA NG YEN HONG Reg No/Reg Date SMR6729T / 17/01/202 Date In/Mileage 13/01/2021/ 0 Chassis No MMBSTA13AKH004810 Engine No 3A92UJK2598 Make/Model MIT/19MY ATTRAGE 1.2 CVT Colour/Trim U01 TITANIUM GREY M/ BK BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
KAX00008	Credit	14/01/2021/ 09:50	QUK	282 / Kevin Leong	61805			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
M	BRACKET,RR BUMPER,RH	✓ GR			1.00	28.00	23.00	21.56
M	FACE,RR BUMPER	✓ OD			1.00	748.00	23.00	575.96
M	GRILLE,RADIATOR	✓ GR			1.00	554.00	23.00	426.58
M	HOOD	✓ OD			1.00	734.00	23.00	565.18
M	INSULATOR,HOOD	✓ CRU			1.00	177.00	23.00	136.29
M	HINGE,HOOD,LH	✓ X			1.00	56.00	23.00	43.12
M	HINGE,HOOD,RH	✓ X			1.00	56.00	23.00	43.12
M	DAM,HOOD	✓ X			1.00	20.00	23.00	15.40
M	LATCH,HOOD	✓ X			1.00	69.00	23.00	53.13
M	FENDER,FR RH	✓ OD			1.00	497.00	23.00	382.69
M	FENDER,FR LH	✓ X R			1.00	497.00	23.00	382.69
M	PANEL ASSY,FR END	✓ ?			1.00	1055.00	23.00	812.35
M	PANEL,HEADLAMP SUPPORT,UPR	✓ ?			1.00	65.00	23.00	50.05
M	PANEL,QTR,OTR RH	✓ OD			1.00	763.00	23.00	587.51
M	PANEL,RR COMB LAMP HSG,RH	✓ OD			1.00	60.00	23.00	46.20
M	REINF,RR PILLAR,RH	✓ ?			1.00	126.00	23.00	97.02
M	FLOOR,RR	✓ OD (photo)			1.00	956.00	23.00	736.12
M	PANEL,RR END	✓ OD (photo)			1.00	425.00	23.00	327.25
M	GLASS,RR WINDOW	✓ X			1.00	544.00	23.00	418.88
M	STOPPER,WINDSHIELD GLASS	✓ nic			2.00	3.00	23.00	4.62
P	SPACER,RR WINDOW	✓ nic			2.00	9.00	23.00	13.86
M	WEATHERSTRIP,TRUNK LID	✓ CRU			1.00	157.00	23.00	120.89
M	PANEL,TRUNK LID	✓ OD			1.00	791.00	23.00	609.07
M	HINGE,TRUNK LID,LH	✓ X			1.00	203.00	23.00	156.31
M	HINGE,TRUNK LID,RH	✓ X			1.00	203.00	23.00	156.31
M	LATCH,TRUNK LID	✓ X			1.00	218.00	23.00	167.86
M	SHIELD,FR WHEELHOUSE,RH	✓ ?			1.00	98.00	23.00	75.46
M	GARNISH,RR END PANEL	✓ X			1.00	336.00	23.00	258.72
M	MARK,THREE-DIA	✓ nic			1.00	69.00	23.00	53.13
M	MARK,ATTRAGE	✓ nic			1.00	21.00	23.00	16.17
M	TRIM,RR END	✓ TAI			1.00	66.00	23.00	50.82
M	BOARD,TRUNK ROOM FLOOR	✓ TAI			1.00	195.00	23.00	150.15
M	UNPAINTED BODYKITS	✓ RR			1.00	1643.00	20.00	1314.40

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE & CARRIAGE

CYCLE & CARRIAGE AUTOMOTIVE PTE LIMITED
PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65691056



ESTIMATE

GST Reg No : MR-8500111-X

Co Reg No : 197701469G

Invoice Name & Address

AIG Asia Pacific Insurance Pte.
Ltd.
MOTOR CLAIM DEPT
78 SHENTON WAY #09-16
AIG BUILDING
SINGAPORE 079120
Contact No 6419 1892

Owner Name & Vehicle Info

Cust No/Name KCV15285/JULIANNA NG YEN HONG
Reg No/Reg Date SMR6729T / 17/01/202
Date In/Mileage 13/01/2021/ 0
Chassis No MMBSTA13AKH004810
Engine No 3A92UJK2598
Make/Model MIT/19MY ATTRAGE 1.2 CVT
Colour/Trim U01 TITANIUM GREY M/ BK BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No
KAX00008	Credit	14/01/2021/ 09:50	QUK	282 / Kevin Leong	61805

Description of Goods / Services	Qty	Unit Price	Disc%	Amount
M EMBLEM ECO	1.00	17.00	00.00	17.00

Estimate

Steve (CLKK) 00-114 AL
14/1/20, 10:39 am Excess - ?
P/P
By BL SM
20 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed

Supplementary item(s) must be resurveyed and confirmed by approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

7% GST on **24,946.42** **1746.25**
Nett
Total Payable **26,692.67**

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	13/01/2021 11:39 (SGT)
Date of Accident	12/01/2021 20:15 (SGT)
Exact Location of Accident	PIE, Singapore
Additional Location Information	PIE BEFORE ADAM ROAD EXIT
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number

SMR6729T

INSURED/POLICYHOLDER

Is company?

No

Name Of Registered Owner

JULIANNA NG YEN HONG

NRIC No

SXXXX842A

Email Address

MANGOADDICTT@HOTMAIL.COM

Mobile Phone No

(Phone) +65-84487440

Alternative Phone No

+65-84487440

VEHICLE PARTICULARS

Manufacturer

Mitsubishi

Model

Attrage

Variant

-

Exact purpose for which vehicle was being used at time of accident

-

Are you claiming under your own insurance policy for repair to your vehicle?

Yes

Vehicle Category

Private car

INSURANCE COMPANY

Name of Insurance Company

AIG

Type of Coverage

Comprehensive

Fleet Policy

No

Policy Number

2070006470

Cover Note Number

-

DRIVER

Name of Driver

TEO WEI SONG,STEPHEN

NRIC No

SXXXX619G

Date Of Birth

10/05/1993

Occupation

Indoor

Year of Driving Pass
Driving experience
Gender
Mobile Number
Alt. Phone Number
Email Address
Address
Address complement
Postcode

Is the driver the policyholder?
If No, Relationship of the Driver with the Insured
Does Driver Own Other Vehicles?
Vehicle Registration Number of Other Vehicle Owned by Driver
Insurance Company of Other Vehicle Owned by Driver

14/11/2015
5 YEARS AND 2 MONTHS
Male
(Phone) +65-81216551
-
STEPHEN.TWS@OUTLOOK.COM
25 ANG MO KIO AVENUE 9 #16-17
-
569788
No
Other
No
-
-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident
Weather Conditions
Road Surface

Chain Collision
Clear
Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?
Number of vehicles involved in the accident
Was anybody injured in the Accident?
Was any injured conveyed to hospital by ambulance?
Was any other material or property damaged?
Number of Passengers (Including Driver)
Has the driver been approached by unknown person(s)
soliciting/offering accident claims assistance?

No
4
No
-
Yes
2
No

PASSENGER 1

Name
Gender

JULIANNA NG YEN HONG
Female

DETAILS OF POLICE ACTION

Was the accident reported to the police?
Was notice of intended Prosecution given?
If yes, against whom?

No
No
-

CIRCUMSTANCES OF ACCIDENT

REFER TO ATTACHMENT

ATTACHMENT(S)

Are accident photos available for attachment?
Was there any video captured by Car Camera?
Was there any audio recorded?

Yes
Yes
No

DETAILS OF OTHER VEHICLE PROPERTY

Vehicle Registration Number
Vehicle Manufacturer
Vehicle Model
Vehicle Variant
Vehicle Colour
Vehicle Category
Name of Driver
Contact Number

SJH3618M
-
-
-
-
Private car
ZHENG XIONGWEN
(Phone) +65-97643564

Address complement
Vehicle
Insurance Company Name
Nature Of Damage
Details of property damaged in accident
No. Of Passenger (Including Driver)

DETAILS OF OTHER VEHICLE PROPERTY

Vehicle Registration Number	SLQ6787S
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Private car
Name of Driver	AMOS GOH SHAO KAI
Contact Number	(Phone) +65-94563733
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

DETAILS OF OTHER VEHICLE PROPERTY

Vehicle Registration Number	SLQ1636C
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Private car
Name of Driver	POH JUN CHENG
Contact Number	(Phone) +65-92316789
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

SKETCH PLAN

IMPORTANT NOTICE

- Please report correctly the details of the accident to speed up the claims process.
- This Form must be completed by the Policyholder and/or the Authorised Driver.
 - Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
 - The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
 - Any false reporting may be referred to the Police for investigation.
 - The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
 - By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
 - Consent under the Personal Data Protection Act (PDPA)**
I understand, acknowledge, agree and consent that :
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
(ii) investigating the accident and/or my claims;
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
(collectively the "Purposes")
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


13 Jan 2021
9.35am

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan

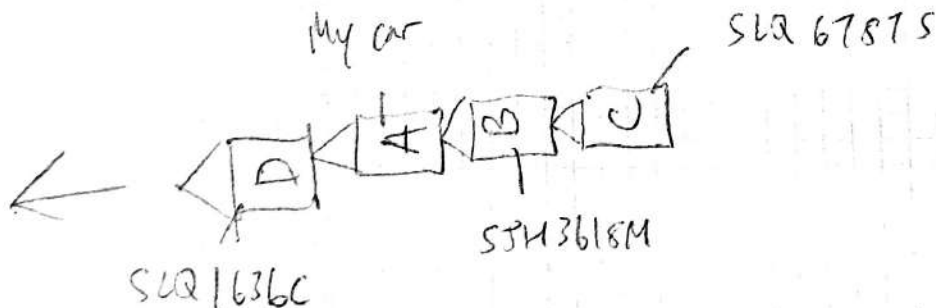


Describe Circumstances of the Accident

6:15pm, my vehicle entered PIE towards BKE. The incident occurred before Adam road exit. I had authorized my boyfriend to drive. Shortly after entering PIE from Thomson, the roads were congested. Noticing the cars in front had started braking, my vehicle also gradually braked and we came to a complete stop. A short moment later, we were hit from behind at high impact which caused my vehicle to move forward due to impact (brakes still pressed), and my vehicle hit the vehicle in front. ~~and~~ I have ~~not~~ submitted my S1 card for investigations.

Declaration

We declare the foregoing particulars are true in every respect.

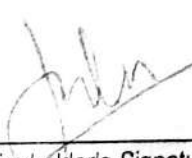
Policyholder's Signature / Date & Time

13 Jan 9:35am
2021

Driver's Signature (If driver is not the policyholder) / Date & Time


Witnessed by Reporting Centre Personnel

ADVANTAGE AUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder : JULIANNA NG YEN HONG
 Period of Insurance : 17 Jan 2020 To 16 Jan 2022
 Engine No. : 3A92UJK2598
 Chassis No. : MMBSTA13AKH004810

Vehicle No. : SMR6729T
 Policy No. : 2070006470
 Endorsement No. :
 Issued Date : 28 Jan 2020

ABOUT THE COVER

Make/Model : MITSUBISHI ATTRAGE 1.2 CVT
 Engine Capacity/Tonnage : 1,193.00 CC Sum Insured : Market Value First Year of Registration : 2020
 Driver Restriction : NA Off Peak Car : No Insuring with COE/PARF : Yes
 Person or Classes of Persons Entitled to Drive* :

a) The Policyholder
 b) Any other person who is driving on the Policyholder's order or with his/her permission.
 This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or inexperienced Driver Excess" ("YIDR") if You are or Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition
 Limitation as to use* :

This cover is for social, domestic and pleasure purposes and for the Policyholder's business.
 This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1500cc - 1600cc

* Limitations contained inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 169), Section 95 of the Road Transport Act, 1987 (Malaysia) and Road Transport (Amendment) Act 2019, are not to be included under these headings.

Section 1
 Fire - \$0 Own Damage - \$600 Theft - \$0 Flood Cover - \$600

Section 2
 Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

JULIANNA NG YEN HONG - \$600 (Own Damage), \$600 (Flood Cover)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

* Cycle & Carriage Body & Paint Centre Add: 209 Pandan Gardens Singapore 609339 65684501
 * Cycle & Carriage Authorised Service Centre (For accident reporting & windscreen claim only) Add: 330 Ubi Rd 3 Singapore 408850 67461000
 * Cycle & Carriage Authorised Service Centre (For accident reporting & windscreen claim only) Add: 20 Leng Kee Rd Singapore 159034 64700398
 * Cycle & Carriage Authorised Service Centre (For accident reporting & windscreen claim only) Add: 600 Sin Ming Ave Singapore 575733 69328000
 For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: MayBank

We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 169), Part IV of the Road Transport Act, 1987 (Malaysia), Road Transport (Amendment) Act 2019 and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia).

AIG Asia Pacific Insurance Pte. Ltd.
 This computer generated document does not require a signature.

0504675292

CYCLE & CARRIAGE - BRUCE

239 ALEXANDRA ROAD

SINGAPORE 159930

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

SS 0000