

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATE	:	ACCIDENT REPAIRS
WORKSHOP	:	UBI ROAD 1
CONTACT NO	:	6366 2323
FAX NO	:	6841 1183
REFERENCE	:	PA/OD/0058/2021/NS
DATE	:	18-Jan-21
WIP	:	12042

VEHICLE IN WORKSHOP. KINDLY ARRANGE FOR SURVEY.

AIG ASIA PACIFIC INSURANCE PTE LTD

78 SHENTON WAY

#07-16 AIG BUILDING

SINGAPORE 079120

ATTN: MR. ADRIAN LING - MOTOR CLAIMS DEPT

TEL: 6841 0055 - FAX: 6256 4315

OWNER'S NAME	:	MR LEE SHU HUA
ADDRESS	:	BLK 58 EDGEDALE PLAINS #09-15 SINGAPORE 828823
TELEPHONE	:	HP +65 98570071
TYPE OF CLAIM	:	OWN DAMAGE CLAIM
POLICY NO	:	1900104268
VEHICLE NO	:	SLD 1233 A
MODEL CODE	:	AUDI A4 SEDAN 2.0 TFSI 8W
MODEL YEAR	:	31/5/2019
ENGINE NO	:	CVK 078751
CHASSIS NO	:	WAUZZZF42KA052364
MILEAGE	:	23990KM
DATE IN	:	16-Jan-21
ESTIMATED BY	:	JOHNNY BOO / ALLAN WU
ACCIDENT DATE	:	15-Jan-21
PLACE OF ACCIDENT	:	CLARKE QUAY MULTI-STOREY CARPARK

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SLD 1233 A


S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATION
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID.	S/N \$ 480.00 ✓	
2	TO REMOVE AND RENEW AIRCON CONDENSER, RADIATOR AND ADDITIONAL RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS.	S/N \$ 1,200.00 ?	
3	TO REMOVE AND TRANSFER LHS HEADLIGHT'S CONTROL UNIT AND POWER MODULE.	S/N \$ 350.00 250 ✓	
4	TO DISMANTLE AND REINSTALL LHS FRONT DOOR PANEL TRIM. TO REMOVE AND REINSTALL LHS WING MIRROR ASSY.	S/N \$ 280.00 ✓	
5	3TO DISMANTLE AND RENEW FRONT BUMPER, LHS FRONT FENDER, BONNET AND LHS HEADLIGHT. TO REPAIR LHS FRONT DOOR. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	\$ 5,280.00 1100 ✓	
SUB TOTAL LABOUR CHARGES		: \$ <u>7,560.00</u>	

PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SLD 1233 A

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
6	TO RESPRAY FRONT BUMPER, LHS FRONT FENDER, BONNET, LHS FRONT DOOR AND LHS UPPER A-PILLAR.	\$ 4,400.00 1650	
7	TO RENEW LHS FRONT RIM. TO CARRY OUT WHEEL ALIGNMENT TEST.	S/N \$ 280.00 ?	
8	TO CARRY OUT PRE AND POST DIAGNOSTIC CHECK.	S/N \$ 384.00 ✓	
TOTAL LABOUR CHARGES		: <u>\$ 12,624.00</u>	

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLD 1233 A

S/N PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES	
		S/NETT	REMARKS
1 FRONT BUMPER <i>de /</i>		\$ 1,787.00	
2 FRONT BUMPER FIXING PARTS <i>?</i>		\$ 587.00	
3 FRONT BUMPER SECURING STRIP <i>LH / LH</i>	<i>7 IP</i>	\$ 71.00	
4 FRONT BUMPER GRILLE - CENTRE <i>X</i>		\$ 196.00	
5 FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE <i>ca /</i>		\$ 210.00	
6 FRONT BUMPER AIR GUIDE - LH <i>?</i>		\$ 63.00	
7 RADIATOR GRILLE <i>?</i>		\$ 1,332.00	
8 FRONT BUMPER AIR GUIDE GRILLE - LH <i>ms /</i>		\$ 135.00	
9 FRONT BUMPER CARRIER <i>?</i>		\$ 845.00	
10 FRONT BUMPER FOAM FILLER PIECE <i>?</i>		\$ 124.00	
11 FRONT BUMPER TOP COVER <i>X</i>		\$ 127.00	
12 FRONT BUMPER GUIDE SECTION - LH <i>ca /</i>		\$ 36.00	
13 CAUTION SIGN STICKER <i>X</i>	NEC	\$ 14.00	
14 AIRCON STICKER <i>X</i>	NEC	\$ 8.00	
15 LOCK CARRIER BRACKET <i>?</i>		\$ 137.00	
16 LOCK CARRIER BRACKWET SUPPORT - LH/RH <i>?</i>	2	\$ 58.00	
17 FRONT PARKING AID SENSOR - INNER/OUTER <i>ms / 2 IP</i>		\$ 484.00	
18 FRONT PARKING AID SEAL RING <i>ms /</i>	4	\$ 14.00	
19 HORN - LH HIGH TONE <i>?</i>		\$ 126.00	
20 SPRING SHACKLE - LH <i>?</i>		\$ 29.00	
SUB TOTAL SPARE PARTS	:	\$ 6,383.00	

PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLD 1233 A

S/N PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES	
		S/NETT	REMARKS
21 FRONT FENDER - LH <i>bt/</i>		\$ 767.00	
22 FRONT FENDER ATTACHMENT PARTS <i>re/</i>		\$ 202.00	
23 FRONT FENDER CLOSING ELEMENT - LH <i>re/</i>		\$ 72.00	
24 FRONT FENDER BRACKET - LH <i>bt/</i>	NEC	\$ 35.00	
25 DEFORMATION ELEMENT BRACKET - LH <i>?</i>		\$ 49.00	
26 FRONT FENDER BRACE - LH <i>?</i>		\$ 118.00	
27 WHEEL HOUSING LINER - LH <i>de/</i>		\$ 240.00	
28 WHEEL HOUSING LINER ATTACHMENT PARTS <i>re/</i>		\$ 233.00	
29 WHEEL SPOILER - LH <i>de/</i>		\$ 73.00	
30 WHEEL SPOILER TRIM - LH <i>?</i>		\$ 35.00	
31 STONE CHIP GUARD - LH <i>?</i>		\$ 51.00	
32 TOP FENDER LEDGE COVER - UPPER <i>ca/</i>		\$ 31.00	
33 TOP FENDER LEDGE COVER - LOWER <i>re/</i>		\$ 23.00	
34 BONNET <i>X</i>		\$ 3,246.00	
35 BONNET ATTACHMENT PARTS <i>X</i>		\$ 412.00	
36 BONNET IMPACT PROTECTION - CENTRE <i>X</i>		\$ 28.00	
37 BONNET IMPACT PROTECTION - LH <i>X</i>		\$ 28.00	
38 BONNET IMPACT PROTECTION - RH <i>X</i>		\$ 28.00	
39 BONNET STRIKER - LH <i>X</i>	2	\$ 50.00	
40 BONNET LID LOCK <i>X</i>		\$ 214.00	
SUB TOTAL SPARE PARTS	:	\$ 5,935.00	

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLD 1233 A

S/N PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES	
		S/NETT	REMARKS
41 LED HEADLIGHT - LH bro /	\$	7,693.00	
42 MAIN LIGHT ELECTRONICS POWER MODULE ? } report	\$	761.00	
43 LIGHT CONTROL SYSTEM CONTROL UNIT ?	\$	751.00	
44 HEADLIGHT HOSE - LH ?	\$	36.00	
45 LIFT CYLINDER - LH ?	\$	210.00	
46 LIFT CYLINDER CORRUGATED PIPE ?	\$	93.00	
47 LOCK CARRIER ?	\$	1,016.00	
48 COOLANT REGULATOR SUPPORT ?	\$	38.00	
49 READY MIX COOLANT ?	\$	179.00	
50 RADIATOR AIR GUIDE - OUTER ?	\$	28.00	
51 RADIATOR AIR GUIDE - LH ?	\$	12.00	
52 RADIATOR AIR GUIDE - UPPER ?	\$	16.00	
53 RADIATOR AIR GUIDE - LOWER ?	\$	22.00	
54 AIRCON CONDENSER X	\$	622.00	
55 TEMPERATURE SENSOR BRACKET X	\$	19.00	
56 PRESSURE PIPE ?	\$	427.00	
57 FRONT BUMPER BRACKET - LH ?	\$	228.00	
58 WINDOW GUIDE TRIM STRIP X	\$	257.00	
59 WINDOW SLOT SEAL - LH X	\$	307.00	
60 FRONT NO PLATE ?	S/N \$	60.00	
61 SUNDRIES ?	\$	400.00	
TOTAL SPARE PARTS	:	\$ 25,493.00	
TOTAL LABOUR CHARGES	:	\$ 12,624.00	
GRAND TOTAL	:	\$ 38,117.00	

ALL CHARGES ARE INCLUSIVE OF GST

LEGEND:

REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME

: *Pam - Hp 90010068*

SURVEYED DATE

: *19/01/2021 @ 1110*

AUTHORISED DATE

:

EXCESS COST

:

LIABILITY

:

REMARKS

:

6 days

EXCESS: TBA

Reverser

Resurvey before paint

PLEASE NOTE

:

THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF THE AFFECTED VEHICLE. SHOULD WE REQUIRE FURTHER LAOUR CHARGES AND SPARE PARTS IN THE PROGRESS OF REPAIR, WE SHALL INFORM YOU ACCORDINGLY. FOR INSPECTION OF VEHICLE, PLEASE REFER TO MS. NORAH KHAI AT TEL: 6768 9828 FOR APPOINTMENT.

YOURS FAITHFULLY,
PREMIUM AUTOMOBILES PTE LTD

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

JOHNNY BOO
BODY REPAIR MANAGER

ALLAN WU
CLAIMS CONSULTANT

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	16/01/2021 16:14 (SGT)
Date of Accident	15/01/2021 23:35 (SGT)
Exact Location of Accident	Clarke Quay, Singapore
Additional Location Information	CLARKE QUAY MULTI STOREY CAR PARK
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLD1233A
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	LEE SHU HUA
NRIC No	SXXXX888C
Email Address	BBAHBENG@HOTMAIL.COM
Mobile Phone No	(Phone) +65-98570071
Alternative Phone No	(Office) +65-98570071

VEHICLE PARTICULARS

Manufacturer	Audi
Model	A4
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car

INSURANCE COMPANY

Name of Insurance Company	AIG
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	1900104268
Cover Note Number	-

DRIVER

Name of Driver	LEE SHU HUA
NRIC No	SXXXX888C
Date Of Birth	22/12/1980
Occupation	Indoor

Date Of Driving Pass	02/05/2002
Driving experience	18 YEARS AND 8 MONTHS
Gender	Male
Mobile Number	(Phone) +65-98570071
Alt. Phone Number	(Office) +65-98570071
Email Address	BBAHBENG@HOTMAIL.COM
Address	58 EDGE PLAIN
Address complement	#09-15
Postcode	828823
Is the driver the policyholder?	Yes
If No, Relationship of the Driver with the Insured	-
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collided into Parked Vehicle
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other material or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

I HIT ONTO A PARKED VEHICLE WHEN I WAS DOING A RIGHT TURN TO EXIT.

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY

Vehicle Registration Number	-
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	Red
Vehicle Category	Private car
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My Insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims. (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.




Policyholder's Signature
Date & Time 16/01/21

Driver's Signature
(If driver is not the policyholder)
Date & Time:



Reporting Centre Personnel's Signature
Name: LAM, KENNETH SEAH, WENJIE
NRIC/FIN No: G2487143X

SKETCH PLAN

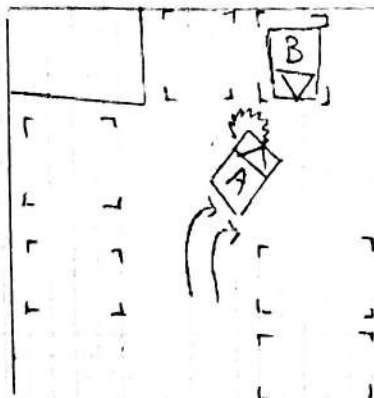

A-SLD1233A

B-Unterraum

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I HIT ONTO A PARKED VEHICLE WHEN I WAS DOING A
RIGHT TURN TO EXIT.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature _____

Date & Time: 10/01/25
16/01/25

Driver's Signature

(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature

Name: Wendy Anderson SEM-4 / 10082
NRIC/FIN No: G2967143X

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type: Singapore NRIC

Owner ID: 888C

Vehicle No.: SLD1233A

Vehicle to be Exported: No

Intended Deregistration Date: 19 Jan 2021

Vehicle Make: AUDI

Vehicle Model: A4 SEDAN 2.0 TFSI S TRONIC (NAV)

Primary Colour: Black

Manufacturing Year: 2019

Engine No.: CVK078751

Chassis No.: WAUZZZF42KA052364

Maximum Power Output: 140.0 kW (187 bhp)

Open Market Value: \$33,718.00

Original Registration Date: 31 May 2019

First Registration Date: 31 May 2019

Transfer Count: 0

Actual ARF Paid: \$39,206.00

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 30 May 2029

PARF Rebate Amount: \$29,404.00

COE Expiry Date: 30 May 2029

COE Category: B - Car above 1600cc or 97kW (130bhp)

COE Period(Years): 10

QP Paid: \$12,564.00

COE Rebate Amount: \$35,595.00

Total Rebate Amount: \$64,999.00

The information contained herein is correct as at 19 Jan 2021

OK

CVK078751



Merimen e-Claims



Used 2019 Audi A4 2.0A TFSI S-t



armart.com/used_cars/info.php?ID=956689&DL=1000

▶ Audi A4 2.0A TFSI S-tronic

Overview

Financial

Accessories

Similar

Research

Photos

Map

Price

\$128,000

Depreciation ⓘ

\$13,180 /yr

View models with similar depre

Reg Date

10-Apr-2019

(Byrs 2mths 21days COE left)

Mileage

11,000 km (6.2k /yr)

Manufactured ⓘ

2019

Road Tax ⓘ

\$1,194 /yr

Transmission

Auto

Dereg Value ⓘ

\$64,860 as of today (change)

OMV ⓘ

\$33,724

COE ⓘ

\$43,102

ARF ⓘ

\$39,214

Engine Cap

1,984 cc

Power

140.0 kW (187 bhp)

Curb Weight ⓘ

1,480 kg

No. of Owners ⓘ

1

Type of Vehicle

Luxury Sedan

Features

4-cyl Turbo Charged, 190 Hp, 320nm Torque. 7-speed S Tronic, Leather Multifunction Steering Wheel W/ Paddle Shift Black Metallic Ext/Brown Leather In View specs of the Audi A4 Sedan (2016-2020)

Accessories

Audi Virtual Cockpit, Reverse Cam, Front+Back Parking Sensors, Apple Carplay/Android Auto, Keyless Entry, Power Front Seats, Blackvue Dashcam Frt+Back

ORY

Dc

ASS. REC. BY:

REF:

CC3/AK 21000928/Rtd3

S
888C

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SLD1233Aat Workshop m/s PREMIUMof 24, Rm 1 skeneInsured: AKH

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: TBA

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

<input checked="" type="checkbox"/>	<input type="checkbox"/>
N/S	O/S

Bal. or Market Value: 129K

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SLD1233AYr Regn: 2019 / MAYType: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: AVDI A4 SEDAN 2.0 TFSI S.Ic.c. 1984Colour: BLACK

A/C: Insured / Std / NI / NA

Sp. Reading: 23990

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WAW22F42KA05.2364Gen. Cond: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModi: Nil / 5/Rim / STD A/Rim orTyre Size: F: 245/40R18

R: _____

BS / DUN / EXNOVA / GV / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or _____

Front

Rear

R/Bal. 6 mmR/Bal. 6 mmL/Bal. 6 mmL/Bal. 6 mmD.O.A. 15/01/2021D.O.I. 19/01/2021

Survey held at

PREMIUM

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

FRONT N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Repair Int - 64K

Date/Time, File Pass to?

☐

: Prel. Report

☐

: Final Report

1)

Date/Time, File Return to?

2)

Rep. Format: _____

Lump Sum / L&A: _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee:

☐

: Site Insp (\$ _____)

☐

: Interview (\$ _____)

☐

: Tech. Invs (\$ _____)

☐

: Weekend (\$ _____)

Survey Fee:

Transportation:

S + RS. \$ _____

Photos

Others

TOTAL