

ASS. REC. BY: Sun Pin

REF:

NTUC NS/INC21001343/Qvd3

## ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s \_\_\_\_\_

of \_\_\_\_\_

Insured: SLH 5947BPolicy No. 5090945220-03Claims No. MT/1119052-002

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

|     |     |
|-----|-----|
|     |     |
| N/S | O/S |
|     |     |

XXX

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Report: \_\_\_\_\_ Consistent?: Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent?: Yes or No

Est. Repairs: \_\_\_\_\_ days Res.: Yes or No

Lump Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Veh No: SHF 209 P Yr Regn: 26/12/2019Type: M.Car / M.Cycle / Bus / Van / Lorry / (Taxi) Prime Mover /

Truck / Trailer or \_\_\_\_\_

Make: Toyota Prius FL c.c. 1795Colour Maroon A/C: Insured / Std / NI / NASp. Reading 65176 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: JTDK B3FUX0308444Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or \_\_\_\_\_

Brake: Inorder / Jammed / Leaked / Burnt or \_\_\_\_\_

Modi: Nil / 6/Rim / STD A/Rim or \_\_\_\_\_Tyre Size: F: 195/65 R15R: 195/65 R15

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Sailun

Front \_\_\_\_\_ Rear \_\_\_\_\_

R/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 26/01/2021 D.O.I. 27/01/2021Survey held at SMIRT.Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or \_\_\_\_\_

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

11/3/21 Final fig \$1752.21 confirmed by email (Red 21,628.29,92%)

TP

TAX/01/21/2057

SLH 5947B

Date/Time, File Pass to?

☐ : Preli. Report

1)

☐ : Final Report

Date/Time, File Return to?

2) 12/3/21-Typist

Days Of Repair: 2Resurvey No. of Trip: 1

Add Fee:

☐ : Site Insp (\$ \_\_\_\_\_)☐ : Interview (\$ \_\_\_\_\_)☐ : Tech. Invs (\$ \_\_\_\_\_)☐ : Weekend (\$ \_\_\_\_\_)

Survey Fee:

Transportation:

S + RS. SI

Photos

Others

TOTAL

Rep. Format: TPLump Sum / B.B. (\$ \$1752.21)

SS1E211R0007 / SMRT AUTOMOTIVE SERVICES PTE LTD  
 ENTRY DATE & TIME: 27/01/2021 13:15 (SGT)  
 SUBMITTED BY: SHANTI B THAIYAL NAYAGI (SMRT05)  
 VERSION: 1 (27/01/2021 13:15 (SGT))

# SINGAPORE ACCIDENT STATEMENT

## IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

## ACCIDENT STATEMENT

|                                 |                                   |
|---------------------------------|-----------------------------------|
| Date of Submission              | 27/01/2021 13:15 (SGT)            |
| Date of Accident                | 26/01/2021 18:20 (SGT)            |
| Exact Location of Accident      | Upper Thomson Rd, Singapore       |
| Additional Location Information | UPPER THOMSON ROAD/ THOMSON PLAZA |
| Country/State of Loss           | Singapore                         |

## DETAILS OF OWN VEHICLE

|                             |         |
|-----------------------------|---------|
| Vehicle Registration Number | SHF209P |
|-----------------------------|---------|

### INSURED/POLICYHOLDER

|                          |                       |
|--------------------------|-----------------------|
| Is company?              | Yes                   |
| Name Of Registered Owner | SMRT TAXIS PTE LTD    |
| Company Reg No           | 1XXXXX369K            |
| Email Address            | TARC@SMRT.COM.SG      |
| Mobile Phone No          | (Phone) +65-68662671  |
| Alternative Phone No     | (Office) +65-68662672 |

### VEHICLE PARTICULARS

|                                                                              |                           |
|------------------------------------------------------------------------------|---------------------------|
| Manufacturer                                                                 | Toyota                    |
| Model                                                                        | Prius                     |
| Variant                                                                      | -                         |
| Exact purpose for which vehicle was being used at time of accident           | -                         |
| Are you claiming under your own insurance policy for repair to your vehicle? | No - Claiming third party |
| Vehicle Category                                                             | Taxi                      |

### INSURANCE COMPANY

|                           |                |
|---------------------------|----------------|
| Name of Insurance Company | First Capital  |
| Type of Coverage          | ThirdParty     |
| Fleet Policy              | Yes            |
| Policy Number             | D-20095484MFSH |
| Cover Note Number         | -              |

### DRIVER

|                |               |
|----------------|---------------|
| Name of Driver | WONG MENG ENG |
| NRIC No        | SXXXX548H     |
| Date Of Birth  | 03/05/1954    |
| Occupation     | Outdoor       |

|                                                              |                        |
|--------------------------------------------------------------|------------------------|
| Driving Pass                                                 | 12/03/1983             |
| g experience                                                 | 37 YEARS AND 10 MONTHS |
| nder                                                         | Male                   |
| Mobile Number                                                | (Phone) +65-68662672   |
| Alt. Phone Number                                            | -                      |
| Email Address                                                | TARC@SMRT.COM.SG       |
| Address                                                      | 11                     |
| Address complement                                           | -                      |
| Postcode                                                     | -                      |
| Is the driver the policyholder?                              | No                     |
| If No, Relationship of the Driver with the Insured           | Hirer                  |
| Does Driver Own Other Vehicles?                              | No                     |
| Vehicle Registration Number of Other Vehicle Owned by Driver | -                      |
| Insurance Company of Other Vehicle Owned by Driver           | -                      |

#### GENERAL INFORMATION OF THE ACCIDENT

|                    |                          |
|--------------------|--------------------------|
| Type of Accident   | Collision - Head to Rear |
| Weather Conditions | Clear                    |
| Road Surface       | Dry                      |

#### OTHER INFORMATION

|                                                                                                     |     |
|-----------------------------------------------------------------------------------------------------|-----|
| Was any foreign vehicle involved in the accident?                                                   | No  |
| Number of vehicles involved in the accident                                                         | 2   |
| Was anybody injured in the Accident?                                                                | No  |
| Was any injured conveyed to hospital by ambulance?                                                  | -   |
| Was any other material or property damaged?                                                         | Yes |
| Number of Passengers (Including Driver)                                                             | 1   |
| Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance? | No  |

#### DETAILS OF POLICE ACTION

|                                           |    |
|-------------------------------------------|----|
| Was the accident reported to the police?  | No |
| Was notice of intended Prosecution given? | No |
| If yes, against whom?                     | -  |

#### CIRCUMSTANCES OF ACCIDENT

ON 26/01/21 AT ABOUT 1620HRS. I WAS TRAVELLING ALONG UPPER THOMSON ROAD. SUDDENLY A VEHICLE (SLH5947B) HIT ONTO REAR PORTION OF MY VEHICLE.

#### ATTACHMENT(S)

|                                               |     |
|-----------------------------------------------|-----|
| Are accident photos available for attachment? | Yes |
| Was there any video captured by Car Camera?   | Yes |
| Was there any audio recorded?                 | No  |

#### DETAILS OF OTHER VEHICLE PROPERTY 1

|                             |             |
|-----------------------------|-------------|
| Vehicle Registration Number | SLH5947B    |
| Vehicle Manufacturer        | -           |
| Vehicle Model               | -           |
| Vehicle Variant             | -           |
| Vehicle Colour              | -           |
| Vehicle Category            | Private car |
| Name of Driver              | UNKNOWN     |
| Contact Number              | -           |
| Address                     | -           |
| Address complement          | -           |
| Postcode                    | -           |

Company Name  
Of Damage  
Details of property damaged in accident  
No. Of Passenger (Including Driver)

-  
-  
-  
-



**SKETCH PLAN****IMPORTANT NOTICE**

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any wilful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation**.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**  
I understand, acknowledge, agree and consent that :  
 (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :  
 (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;  
 (ii) investigating the accident and/or my claims;  
 (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;  
 (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or  
 (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.  
 (collectively the "Purposes")  
 (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and  
 (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.



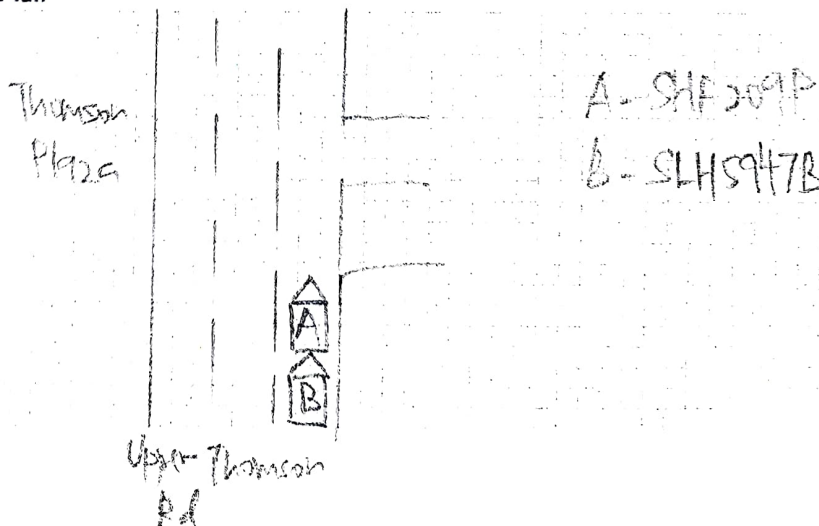
Policyholder's Signature / Date &amp; Time

27/01/21

Driver's Signature (If driver is not the policyholder) / Date &amp; Time

A. 27/1/21

Witnessed by Reporting Centre Personnel

**Sketch Plan**





## Case Details

Case Reference Number :

TAX/01/21/2057

Company Type : SMRT Taxis Pte Ltd

Insurance Company Name : NTUC Income Insurance Co-operative Ltd

Type of Repair : Accident Repair

Estimation ID : EST-13825-ID

Accident Date and Time : 26/01/2021 10:20 AM

Vehicle Registration Number : SHF209P

Assigned By : Taxi Claims Manager Team

Vehicle Age(In Months) : 13

## Documents / Photographs

View Documents / Photographs

Total Documents: 0

## Estimation Details

### Spare Part's Cost Detail

| SMRT Recommendation |              |         |                 |                              |     |                         |                |        |                 |                | Surveyor Approval |                          |                |         |
|---------------------|--------------|---------|-----------------|------------------------------|-----|-------------------------|----------------|--------|-----------------|----------------|-------------------|--------------------------|----------------|---------|
| BOM Type            | Costing Type | Portion | Material Number | Part Name                    | Qty | List Price Per Unit(\$) | List Price(\$) | Dis(%) | Final Price(\$) | Repair/Replace | Surveyor Quantity | Surveyor Final Price(\$) | Repair/Replace | Remarks |
| One Time Key In     | Main         |         |                 | COVER, RR BUMPER ASSY        | 1   | 485.60                  | 485.60         | 25.00  | 364.20          | Replace        | 1                 | 364.20                   | Replace        | ✓ CR4   |
| One Time Key In     | Main         |         |                 | STOPPER, RR BUMPER, RH & LH  | 2   | 4.50                    | 9.00           | 25.00  | 6.75            | Replace        | 0                 | 0                        | Not Give       | ✓ X5K   |
| One Time Key In     | Main         |         |                 | PAD, RR BUMPER, RH & LH, 2   | 2   | 4.00                    | 8.00           | 25.00  | 6.00            | Replace        | 2                 | 6.00                     | Replace        | ✓ NR    |
| One Time Key In     | Main         |         |                 | PAD, RR BUMPER, RH & LH, 3   | 2   | 11.00                   | 22.00          | 25.00  | 16.50           | Replace        | 2                 | 16.50                    | Replace        | ✓ NEC   |
| One Time Key In     | Main         |         |                 | SEAL, RR BUMPER ARM, RH & LH | 2   | 11.30                   | 22.60          | 25.00  | 16.95           | Replace        | 2                 | 16.95                    | Replace        | ✓ NEC   |
| One Time Key In     | Main         |         |                 | PAD, RR BUMPER, RH & LH, 1   | 2   | 4.00                    | 8.00           | 25.00  | 6.00            | Replace        | 2                 | 6.00                     | Replace        | ✓ NR    |
| One Time Key In     | Main         |         |                 | CLIPS PIECE, FRT & RR BUMPER | 10  | 4.50                    | 45.00          | 25.00  | 33.75           | Replace        | 10                | 33.75                    | Replace        | ✓ NEC   |
| One Time Key In     | Main         |         |                 | RETAINER, RR BUMPER, LH      | 1   | 132.60                  | 132.60         | 25.00  | 99.45           | Replace        | 0                 | 0                        | Not Give       | ✓ X5K   |
| One Time Key In     | Main         |         |                 | RETAINER, RR BUMPER, RH      | 1   | 132.60                  | 132.60         | 25.00  | 99.45           | Replace        | 1                 | 99.45                    | Replace        | ✓ BR    |

Total Spare Part Cost 14,331.92

Surveyor Total 1,132.20

Lump Sum Discount (%) 0.00

Lump Sum Dis (%) 0

Final Spare Part Cost 14,331.92

Final Sur Total 1,132.20

| BOM Type        | Costing Type | Portion | Material Number | SMRT Recommendation                         |     |                         |                |        |                 |                 | Surveyor Approval |                          |                |         |
|-----------------|--------------|---------|-----------------|---------------------------------------------|-----|-------------------------|----------------|--------|-----------------|-----------------|-------------------|--------------------------|----------------|---------|
|                 |              |         |                 | Part Name                                   | Qty | List Price Per Unit(\$) | List Price(\$) | Dis(%) | Final Price(\$) | Repair/ Replace | Surveyor Quantity | Surveyor Final Price(\$) | Repair/Replace | Remarks |
| One Time Key In | Main         |         |                 | GUARD, RR BUMPER, LOWER                     | 1   | 374.50                  | 374.50         | 25.00  | 280.88          | Replace         | 1                 | 280.88                   | Replace        | ✓ / CR4 |
| One Time Key In | Main         |         |                 | COVER, GUARD RR BUMPER LOWER                | 1   | 22.00                   | 22.00          | 25.00  | 16.50           | Replace         | 1                 | 16.50                    | Replace        | ✓ / CR4 |
| One Time Key In | Main         |         |                 | PAD, RR BUMPER, CTR                         | 3   | 11.00                   | 33.00          | 25.00  | 24.75           | Replace         | 3                 | 24.75                    | Replace        | ✓ / NAC |
| One Time Key In | Main         |         |                 | SEAL, RR BUMPER, RH                         | 1   | 118.30                  | 118.30         | 25.00  | 88.72           | Replace         | 0                 | 0                        | Not Give       | ✓ X Svc |
| One Time Key In | Main         |         |                 | SEAL, RR BUMPER, LH                         | 1   | 118.30                  | 118.30         | 25.00  | 88.72           | Replace         | 0                 | 0                        | Not Give       | ✓ X Svc |
| One Time Key In | Main         |         |                 | REAR BUMPER REINFORCEMENT                   | 1   | 332.70                  | 332.70         | 25.00  | 249.52          | Replace         | 0                 | 0                        | Check          | ✓ X Svc |
| One Time Key In | Main         |         |                 | COVER, REAR FLOOR UNDER, RH                 | 1   | 175.10                  | 175.10         | 25.00  | 131.32          | Replace         | 0                 | 0                        | Not Give       | ✓ X Svc |
| One Time Key In | Main         |         |                 | COVER, REAR FLOOR UNDER CENTER              | 1   | 229.90                  | 229.90         | 25.00  | 172.43          | Replace         | 0                 | 0                        | Not Give       | ✓ X Svc |
| One Time Key In | Main         |         |                 | COVER, REAR FLOOR UNDER, LH                 | 1   | 241.90                  | 241.90         | 25.00  | 181.43          | Replace         | 0                 | 0                        | Not Give       | ✓ X Svc |
| One Time Key In | Main         |         |                 | PIXEL STICKER                               | 2   | 60.00                   | 120.00         | 0.00   | 120.00          | Replace         | 2                 | 120.00                   | Replace        | ✓ / NAC |
| One Time Key In | Main         |         |                 | REAR BUMPER REFLECTOR ASSY, REFLEX, RH      | 1   | 39.00                   | 39.00          | 25.00  | 29.25           | Replace         | 0                 | 0                        | Check          | ✓ X Svc |
| One Time Key In | Main         |         |                 | REVERSE SENSOR, REAR BUMPER                 | 1   | 180.00                  | 180.00         | 0.00   | 180.00          | Replace         | 0                 | 0                        | Check          | ✓ X Svc |
| One Time Key In | Main         |         |                 | ANTENNA, ELECTRICAL KEY                     | 1   | 72.00                   | 72.00          | 10.00  | 64.80           | Replace         | 0                 | 0                        | Check          | ✓ X Svc |
| One Time Key In | Main         |         |                 | LENS & BODY, REAR COMBINATION LAMP, NO.2 RH | 1   | 261.00                  | 261.00         | 10.00  | 234.90          | Replace         | 0                 | 0                        | Check          | ✓ X Svc |
| One Time Key In | Main         |         |                 | LAMP ASSY, REAR, RH                         | 1   | 293.60                  | 293.60         | 10.00  | 264.24          | Replace         | 0                 | 0                        | Not Give       | ✓ X Svc |

Total Spare Part Cost 14,331.92

Surveyor Total 1,132.20

Lump Sum Discount (%) 0.00

Lump Sum Dis (%) 0

Final Spare Part Cost 14,331.92

Final Sur Total 1,132.20



21/01/2021

| SMRT Recommendation |              |         |                 |                                               |     |                         |                |        |                 |                 |                   | Surveyor Approval        |                |         |
|---------------------|--------------|---------|-----------------|-----------------------------------------------|-----|-------------------------|----------------|--------|-----------------|-----------------|-------------------|--------------------------|----------------|---------|
| BOM Type            | Costing Type | Portion | Material Number | Part Name                                     | Qty | List Price Per Unit(\$) | List Price(\$) | Dis(%) | Final Price(\$) | Repair/ Replace | Surveyor Quantity | Surveyor Final Price(\$) | Repair/Replace | Remarks |
| One Time Key In     | Main         |         |                 | LENS & BODY, REAR COMBINATION LAMP, RH        | 1   | 339.60                  | 339.60         | 10.00  | 305.64          | Replace         | 0                 | 0                        | Not Give       | ✓ X Sur |
| One Time Key In     | Main         |         |                 | COVER, REAR COMBINATION LAMP, RH              | 1   | 69.90                   | 69.90          | 25.00  | 52.43           | Replace         | 0                 | 0                        | Not Give       | ✓ X Sur |
| One Time Key In     | Main         |         |                 | TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-ASSY  | 1   | 913.60                  | 913.60         | 25.00  | 685.20          | Replace         | 1                 | 0                        | Repair         | ✓ X R   |
| One Time Key In     | Main         |         |                 | EMBLEM SUB-ASSY REAR                          | 1   | 47.90                   | 47.90          | 25.00  | 35.92           | Replace         | 1                 | 35.92                    | Replace        | ✓ / Nec |
| One Time Key In     | Main         |         |                 | NAME PLATE (HYBRID), LUGGAGE COMPARTMENT DOOR | 1   | 54.60                   | 54.60          | 25.00  | 40.95           | Replace         | 1                 | 40.95                    | Replace        | ✓ / Nec |
| One Time Key In     | Main         |         |                 | NAME PLATE (PRIUS), LUGGAGE COMPARTMENT DOOR  | 1   | 54.60                   | 54.60          | 25.00  | 40.95           | Replace         | 1                 | 40.95                    | Replace        | ✓ / Nec |
| One Time Key In     | Main         |         |                 | STICKER DECAL 6555 8888                       | 1   | 21.60                   | 21.60          | 0.00   | 21.60           | Replace         | 1                 | 21.60                    | Replace        | ✓ / Nec |
| One Time Key In     | Main         |         |                 | SMRT LOGO                                     | 1   | 7.80                    | 7.80           | 0.00   | 7.80            | Replace         | 1                 | 7.80                     | Replace        | ✓ / Nec |
| One Time Key In     | Main         |         |                 | SPOILER SUB-ASSY, REAR                        | 1   | 1,575.40                | 1,575.40       | 25.00  | 1,181.55        | Replace         | 0                 | 0                        | Not Give       | ✓ X Sur |
| One Time Key In     | Main         |         |                 | LAMP SET, STOP CENTER                         | 1   | 192.30                  | 192.30         | 10.00  | 173.07          | Replace         | 0                 | 0                        | Not Give       | ✓ X Sur |
| One Time Key In     | Main         |         |                 | TAIL GATE PANEL SUB-ASSY, BACK DOOR           | 1   | 1,147.80                | 1,147.80       | 25.00  | 860.85          | Replace         | 0                 | 0                        | Not Give       | ✓ X Sur |
| One Time Key In     | Main         |         |                 | AUTO TAILGATE SYSTEM                          | 1   | 2,520.00                | 2,520.00       | 10.00  | 2,268.00        | Replace         | 0                 | 0                        | Not Give       | ✓ X Sur |
| One Time Key In     | Main         |         |                 | TAIL GATE WEATHERSTRIP, BACK DOOR             | 1   | 372.30                  | 372.30         | 25.00  | 279.23          | Replace         | 0                 | 0                        | Not Give       | ✓ X Sur |
| One Time Key In     | Main         |         |                 | TAIL GATE DAM, BACK DOOR GLASS UPPER ADHESIVE | 1   | 28.90                   | 28.90          | 25.00  | 21.67           | Replace         | 0                 | 0                        | Not Give       | ✓ X Sur |

Total Spare Part Cost 14,331.92

Surveyor Total 1,132.20

Lump Sum Discount (%) 0.00

Lump Sum Dis (%) 0

Final Spare Part Cost 14,331.92

Final Sur Total 1,132.20

21/01/2021

| SMRT Recommendation |              |         |                 |                                               |     |                         |                |        |                 |                 | Surveyor Approval |                          |                        |
|---------------------|--------------|---------|-----------------|-----------------------------------------------|-----|-------------------------|----------------|--------|-----------------|-----------------|-------------------|--------------------------|------------------------|
| BOM Type            | Costing Type | Portion | Material Number | Part Name                                     | Qty | List Price Per Unit(\$) | List Price(\$) | Dis(%) | Final Price(\$) | Repair/ Replace | Surveyor Quantity | Surveyor Final Price(\$) | Repair/Replace Remarks |
| One Time Key In     | Main         |         |                 | TAIL GATE MOULDING GLASS, BACK DOOR           | 1   | 35.50                   | 35.50          | 25.00  | 26.63           | Replace         | 0                 | 0                        | Not Give ✓ Xsu         |
| One Time Key In     | Main         |         |                 | TAIL GATE DAM, BACK DOOR GLASS UPPER ADHESIVE | 1   | 28.90                   | 28.90          | 25.00  | 21.67           | Replace         | 0                 | 0                        | Not Give ✓ Xsu         |
| One Time Key In     | Main         |         |                 | TAIL GATE MOULDING LOWER GLASS, BACK DOOR     | 1   | 23.60                   | 23.60          | 25.00  | 17.70           | Replace         | 0                 | 0                        | Not Give ✓ Xsu         |
| One Time Key In     | Main         |         |                 | TAIL GATE MOULDING LOWER GLASS, BACK DOOR, RH | 1   | 30.90                   | 30.90          | 25.00  | 23.17           | Replace         | 0                 | 0                        | Not Give ✓ Xsu         |
| One Time Key In     | Main         |         |                 | TAIL GATE MOULDING LOWER GLASS, BACK DOOR, LH | 1   | 30.90                   | 30.90          | 25.00  | 23.17           | Replace         | 0                 | 0                        | Not Give ✓ Xsu         |
| One Time Key In     | Main         |         |                 | SEALANT W/SCREEN                              | 3   | 37.00                   | 111.00         | 0.00   | 111.00          | Replace         | 0                 | 0                        | Not Give ✓ Xsu         |
| One Time Key In     | Main         |         |                 | TAIL GATE BACK DOOR HINGE ASSY, LH            | 1   | 61.00                   | 61.00          | 25.00  | 45.75           | Replace         | 0                 | 0                        | Not Give ✓ Xsu         |
| One Time Key In     | Main         |         |                 | TAIL GATE BACK DOOR HINGE ASSY, RH            | 1   | 61.00                   | 61.00          | 25.00  | 45.75           | Replace         | 0                 | 0                        | Not Give ✓ Xsu         |
| One Time Key In     | Main         |         |                 | TAIL GATE LOCK ASSY, BACK DOOR                | 1   | 467.00                  | 467.00         | 10.00  | 420.30          | Replace         | 0                 | 0                        | Not Give ✓ Xsu         |
| One Time Key In     | Main         |         |                 | TAIL GATE LOCK COVER, BACK DOOR               | 1   | 30.20                   | 30.20          | 25.00  | 22.65           | Replace         | 0                 | 0                        | Not Give ✓ Xsu         |
| One Time Key In     | Main         |         |                 | TAIL GATE STRIKER ASSY, BACK DOOR             | 1   | 25.80                   | 25.80          | 25.00  | 19.35           | Replace         | 0                 | 0                        | Not Give ✓ Xsu         |
| One Time Key In     | Main         |         |                 | TAILGATE BOARD ASSY                           | 1   | 259.20                  | 259.20         | 25.00  | 194.40          | Replace         | 0                 | 0                        | Not Give ✓ Xsu         |
| One Time Key In     | Main         |         |                 | TAILGATE BOARD, COVER                         | 1   | 24.90                   | 24.90          | 25.00  | 18.67           | Replace         | 0                 | 0                        | Not Give ✓ Xsu         |
| One Time Key In     | Main         |         |                 | TAILGATE TRIM, LOWER                          | 1   | 225.20                  | 225.20         | 25.00  | 168.90          | Replace         | 0                 | 0                        | Not Give ✓ Xsu         |
| One Time Key In     | Main         |         |                 | END PANEL SUB-ASSY, BODY LOWER BACK           | 1   | 651.00                  | 651.00         | 25.00  | 488.25          | Replace         | 0                 | 0                        | Check ✓ Xsu            |

Total Spare Part Cost 14,331.92

Surveyor Total 1,132.20

Lump Sum Discount (%) 0.00

Lump Sum Dis (%) 0

Final Spare Part Cost 14,331.92

Final Sur Total 1,132.20

| SMRT Recommendation   |              |         |                 |                                                  |     |                         |                |        |                 |                          | Surveyor Approval |                          |                        |
|-----------------------|--------------|---------|-----------------|--------------------------------------------------|-----|-------------------------|----------------|--------|-----------------|--------------------------|-------------------|--------------------------|------------------------|
| BOM Type              | Costing Type | Portion | Material Number | Part Name                                        | Qty | List Price Per Unit(\$) | List Price(\$) | Dis(%) | Final Price(\$) | Repair/ Replace          | Surveyor Quantity | Surveyor Final Price(\$) | Repair/Replace Remarks |
| One Time Key In       | Main         |         |                 | END PANEL , COVER, DECK TRIM, REAR               | 1   | 126.70                  | 126.70         | 25.00  | 95.03           | Replace                  | 0                 | 0                        | Not Give ✓ X sue       |
| One Time Key In       | Main         |         |                 | END PANEL , COVER, DECK TRIM SERVICE HOLE        | 1   | 48.50                   | 48.50          | 25.00  | 36.38           | Replace                  | 0                 | 0                        | Not Give ✓ X sue       |
| One Time Key In       | Main         |         |                 | SEALANT SIKAFLEX                                 | 1   | 37.00                   | 37.00          | 0.00   | 37.00           | Replace                  | 0                 | 0                        | Not Give ✓ X sue       |
| One Time Key In       | Main         |         |                 | SPARE TYRE PANEL , PAN, REAR FLOOR               | 1   | 583.40                  | 583.40         | 25.00  | 437.55          | Replace                  | 0                 | 0                        | Not Give ✓ X sue       |
| One Time Key In       | Main         |         |                 | BOX, DECK FLOOR, RH                              | 1   | 313.60                  | 313.60         | 25.00  | 235.20          | Replace                  | 0                 | 0                        | Not Give ✓ X sue       |
| One Time Key In       | Main         |         |                 | BOARD, REAR FLOOR, NO.1                          | 1   | 519.00                  | 519.00         | 25.00  | 389.25          | Replace                  | 0                 | 0                        | Not Give ✓ X sue       |
| One Time Key In       | Main         |         |                 | PANEL ASSY, DECK TRIM SIDE, RH                   | 1   | 355.90                  | 355.90         | 25.00  | 266.92          | Replace                  | 0                 | 0                        | Not Give ✓ X sue       |
| One Time Key In       | Main         |         |                 | TROUGH, BACK DOOR , RH                           | 1   | 103.40                  | 103.40         | 25.00  | 77.55           | Replace                  | 0                 | 0                        | Not Give ✓ X sue       |
| One Time Key In       | Main         |         |                 | PANEL SUB-ASSY, FENDER REAR RH                   | 1   | 871.50                  | 871.50         | 25.00  | 653.63          | Replace                  | 0                 | 0                        | Check ✓ X sue          |
| One Time Key In       | Main         |         |                 | DUCT ASSY, QUARTER VENT , RH & LH                | 1   | 67.00                   | 67.00          | 25.00  | 50.25           | Replace                  | 0                 | 0                        | Not Give ✓ X sue       |
| One Time Key In       | Main         |         |                 | EXHAUST HEAT SHIELD INSULATOR, MAIN MUFFLER REAR | 1   | 141.00                  | 141.00         | 25.00  | 105.75          | Replace                  | 0                 | 0                        | Not Give ✓ X sue       |
| One Time Key In       | Main         |         |                 | PIPE ASSY, EXHAUST, TAIL                         | 1   | 1,649.00                | 1,649.00       | 25.00  | 1,236.75        | Replace                  | 0                 | 0                        | Not Give ✓ X sue       |
| One Time Key In       | Main         |         |                 | SUPPORT, EXHAUST PIPE NO.5                       | 1   | 49.10                   | 49.10          | 25.00  | 36.83           | Replace                  | 0                 | 0                        | Not Give ✓ X sue       |
| One Time Key In       | Main         |         |                 | MEMBER SUB-ASSY, RAIL ROOT SIDE REAR RH          | 1   | 288.50                  | 288.50         | 25.00  | 216.38          | Replace                  | 0                 | 0                        | Not Give ✓ X sue       |
| One Time Key In       | Main         |         |                 | EXTENSION, REAR FLOOR SIDE PANEL , RH            | 1   | 78.30                   | 78.30          | 25.00  | 58.72           | Replace                  | 0                 | 0                        | Not Give ✓ X sue       |
| Total Spare Part Cost |              |         |                 |                                                  |     |                         |                |        | 14,331.92       | Surveyor Total 1,132.20  |                   |                          |                        |
| Lump Sum Discount (%) |              |         |                 |                                                  |     |                         |                |        | 0.00            | Lump Sum Dis (%) 0       |                   |                          |                        |
| Final Spare Part Cost |              |         |                 |                                                  |     |                         |                |        | 14,331.92       | Final Sur Total 1,132.20 |                   |                          |                        |

**Labour's Cost Detail**

| S.No.         | Costing Type | Job Scope              | SMRT<br>Recommendation(\$) | Surveyor<br>Adjustment(\$) | Remarks |
|---------------|--------------|------------------------|----------------------------|----------------------------|---------|
| 1             | Main         | TO REPAIR REAR PORTION | 1,014.00                   | 250                        | /       |
| <b>Total:</b> |              |                        | <b>1,014.00</b>            | <b>250.00</b>              |         |

**Spray Cost Detail**

| S.No.         | Costing Type | Job Scope                              | SMRT<br>Recommendation(\$) | Surveyor<br>Adjustment(\$) | Remarks |
|---------------|--------------|----------------------------------------|----------------------------|----------------------------|---------|
| 1             | Main         | TO RESPRAY REAR BUMPER                 | 378.00                     | 200                        | /       |
| 2             | Main         | TO RESPRAY BUMPER BEAM                 | 180.00                     | 0                          |         |
| 3             | Main         | TO RESPRAY TAIL GATE                   | 378.00                     | 0                          |         |
| 4             | Main         | TO RESPRAY TAILGATE OUTSIDE<br>GARNISH | 180.00                     | 100                        | /       |
| 5             | Main         | TO RESPRAY REAR SPOILER                | 180.00                     | 0                          |         |
| 6             | Main         | TO RESPRAY REAR PANEL                  | 180.00                     | 0                          |         |
| 7             | Main         | TO RESPRAY REAR SPARE TYRE<br>PANEL    | 180.00                     | 0                          |         |
| 8             | Main         | TO RESPRAY TROUGH BACK DOOR<br>RH      | 180.00                     | 0                          |         |
| 9             | Main         | TO RESPRAY REAR FENDER RH              | 378.00                     | 0                          |         |
| 10            | Main         | TO RESPRAY REAR FLOOR SIDE<br>PANEL RH | 180.00                     | 0                          |         |
| 11            | Main         | TO RESPRAY RH RAIL ROOF SIDE           | 180.00                     | 0                          |         |
| <b>Total:</b> |              |                                        | <b>2,574.00</b>            | <b>300.00</b>              |         |

**Other Cost Detail**

| S.No.         | Costing Type | Job Scope                                  | SMRT<br>Recommendation(\$) | Surveyor<br>Adjustment(\$) | Remarks |
|---------------|--------------|--------------------------------------------|----------------------------|----------------------------|---------|
| 1             | Main         | TO CHECK WIRING AND SYSTEM<br>FUNCTION     | 80.00                      | 20                         | /       |
| 2             | Main         | TO APPLY RUST-PROOFING ON<br>AFFECTED AREA | 100.00                     | 30                         | /       |
| 3             | Main         | TO REMOVE / REFIT SEAT                     | 120.00                     | 0                          |         |
| 4             | Main         | TO REMOVE & REFIT EXHAUST                  | 120.00                     | 0                          |         |
| <b>Total:</b> |              |                                            | <b>1,750.00</b>            | <b>70.00</b>               |         |

| S.No.  | Costing Type | Job Scope                                                               | SMRT<br>Recommendation(\$) | Surveyor<br>Adjustment(\$) | Remarks |
|--------|--------------|-------------------------------------------------------------------------|----------------------------|----------------------------|---------|
| 5      | Main         | TO TRANSFER REAR TAILGATE MECHANISM                                     | 120.00                     | 0                          |         |
| 6      | Main         | TO TEST AND REFIX REVERSE SENSOR SYSTEM                                 | 120.00                     | 20                         |         |
| 7      | Main         | TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.    | 120.00                     | 0                          |         |
| 8      | Main         | TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE | 120.00                     | 0                          |         |
| 9      | Main         | TO REMOVE AND REFIX REAR WINDSCREEN                                     | 240.00                     | 0                          |         |
| 10     | Main         | TO REMOVE AND REFIT WIRE HARDESS                                        | 200.00                     | 0                          |         |
| 11     | Main         | TO REPLACE SUNDRY PARTS                                                 | 100.00                     | 0                          |         |
| 12     | Main         | TO WASH AND VACUUM                                                      | 60.00                      | 0                          |         |
| 13     | Main         | TO REMOVE AND REFIX AUTO TAILGATE SYSTEM                                | 250.00                     | 0                          |         |
| Total: |              |                                                                         | 1,750.00                   | 70.00                      |         |

Summary

|                          | Estimator Assesment(\$) | Surveyor Assesment(\$)   |
|--------------------------|-------------------------|--------------------------|
| Total Spare Part Detail  | 14,331.92               | 1,132.20                 |
| Total Labour Cost        | 1,014.00                | 250.00                   |
| Total Spray Painting     | 2,574.00                | 300.00                   |
| Other                    | 1,750.00                | 70.00                    |
| Overall Total            | 19,669.92               | 1,752.20                 |
| Lump Sum Repair Option   |                         | <input type="checkbox"/> |
| Lump Sum Total           | 0.00                    | 1,752.20                 |
| Surveyor Approved Amount |                         | 1,752.20                 |
| No of Repair Days*       | 8                       | 2 <i>2 days</i>          |
| Remarks                  | -                       | P/P, before paint photo. |
| Surveyor Name            |                         | Sun Pin (LKK)            |



Estimator Assesment(\$)

Surveyor Assesment(\$)

Signature



Save

Clear

Survey Date

27/01/2021

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

> Back to OneMotoring

## Enquire PARF/COE Rebate for Registered Vehicle

|                                                                                                                                                                                                                         |                                      |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------|
| <b>Vehicle Owner Particulars</b>                                                                                                                                                                                        |                                      |
| Owner ID Type:                                                                                                                                                                                                          | Company                              |
| Owner ID:                                                                                                                                                                                                               | 369K                                 |
| <b>Vehicle Details</b>                                                                                                                                                                                                  |                                      |
| Vehicle No.:                                                                                                                                                                                                            | SHF209P                              |
| Vehicle to be Exported:                                                                                                                                                                                                 | No                                   |
| Intended Deregistration Date:                                                                                                                                                                                           | 28 Jan 2021                          |
| Vehicle Make:                                                                                                                                                                                                           | TOYOTA                               |
| Vehicle Model:                                                                                                                                                                                                          | PRIUS 5DR HATCHBACK (AUTO)           |
| Primary Colour:                                                                                                                                                                                                         | Maroon                               |
| Manufacturing Year:                                                                                                                                                                                                     | 2019                                 |
| Engine No.:                                                                                                                                                                                                             | 2ZR2F45899                           |
| Chassis No.:                                                                                                                                                                                                            | JTDKB3FUX03089444                    |
| Maximum Power Output:                                                                                                                                                                                                   | 90.0 kW (120 bhp)                    |
| Open Market Value:                                                                                                                                                                                                      | \$26,807.00                          |
| Original Registration Date:                                                                                                                                                                                             | 26 Dec 2019                          |
| First Registration Date:                                                                                                                                                                                                | 26 Dec 2019                          |
| Transfer Count:                                                                                                                                                                                                         | 0                                    |
| Actual ARF Paid:                                                                                                                                                                                                        | \$14,530.00                          |
| <b>Intended PARF Rebate Details</b>                                                                                                                                                                                     |                                      |
| PARF Eligibility:                                                                                                                                                                                                       | Yes                                  |
| PARF Eligibility Expiry Date:                                                                                                                                                                                           | 25 Dec 2027                          |
| PARF Rebate Amount:                                                                                                                                                                                                     | \$10,897.00                          |
| <b>Intended COE Rebate Details</b>                                                                                                                                                                                      |                                      |
| COE Expiry Date:                                                                                                                                                                                                        | 25 Dec 2027                          |
| COE Category:                                                                                                                                                                                                           | A - Car up to 1600cc & 97kW (130bhp) |
| COE Period(Years):                                                                                                                                                                                                      | 8                                    |
| PQP Paid:                                                                                                                                                                                                               | \$25,581.00                          |
| COE Rebate Amount:                                                                                                                                                                                                      | \$22,083.00                          |
| <b>Total Rebate Amount:</b>                                                                                                                                                                                             | <b>\$32,980.00</b>                   |
| <b>Message</b>                                                                                                                                                                                                          |                                      |
| Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier. |                                      |

The information contained herein is correct as at 28 Jan 2021

OK