

A.S.S. REC. BY:

Stere

REF:


A/G

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
☒ OD / TP / WS / TP RES / OD RES / EVA / INV / MY
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

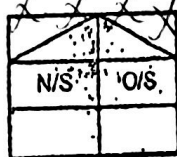

Bal. or Market Value: _____
 IDAC Accident Report: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: _____ days Res.: Yes or No
 Turn Sum: _____ % 3 Val.: Yes or No
 CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SJW 972 E Yr Regn: 11/11/19
 Type: ☒ M.Car / ☐ M.Cycle / ☐ Bus / ☐ Van / ☐ Lorry / ☐ Taxi / ☐ Prime Mover /
 Truck / Trailer or _____
 Make: KIA Cerato c.c. 1591
 Colour: Red A/C: ☒ Insured / ☐ Std / ☐ NI / ☐ N
 Sp. Reading: 30855 T/Radio: ☒ Insured / ☐ Std / ☐ NI / ☐ N
 Eng/No: _____
 C/No: KN AF 3416 MK 5922 784
 Gen. Cond: ☒ Good / ☐ Fair / ☐ Poor / ☐ Burnt
 Steering: ☒ Inorder / ☐ Jammed / ☐ Leaked / ☐ Burnt or
 Brake: ☒ Inorder / ☐ Jammed / ☐ Leaked / ☐ Burnt or
 Modl: ☒ Nil / ☐ S/Rim / ☐ STD A/Rim or
 Tyre Size: F: 225/45R17
 R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Kumho

Front Rear
 R/Bal. 5 mm R/Bal. 5 mm
 L/Bal. 5 mm L/Bal. 5 mm
 D.O.A. 4/2/21 D.O.I. 10/2/21
 Survey held at cycle & carriage
 Des. of Damages: ☐ Frt / ☐ Rear / ☐ O/S / ☐ N/S / ☐ U/C / ☐ Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision

Date / Time Action / Instruction

MV- 71,000
 PV- 36,091
 NV- 34,999

Date/Time, File, Pass to?

☐ : Prel. Report
☐ : Final Report

Date/Time, File Return to?

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee:

Transportation:

\$ + RS. \$

Provice

Others

TOTAL

Add Fee:

☐ : Site Insp (\$ _____)
☐ : Interview (\$ _____)
☐ : Tech. Invs (\$ _____)
☐ : Weekend (\$ _____)

3rd Form:

imp Sign / LEA:



CYCLE & CARRIAGE

CYCLE & CARRIAGE KIA PTE LTD
PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65651240

**ESTIMATE**

Co Reg No : 199405410K

GST Reg No : MR-8500111-X

Invoice Name & Address	Owner Name & Vehicle Info
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPARTMENT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 64191000	Cust No/Name /DAVID FOO HEE CHEW Reg No/Reg Date SJW972E / 11/01/201 Date In/Mileage 10/02/2021/ 0 Chassis No KNAF3416MK5022784 Engine No G4FGJH712637 Make/Model KIA/CERATO 1.6 A SR SX G335 Colour/Trim CR5 RUNWAY RED / WK SATURN BLACK

10/02/

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No		
LAX00000	Credit	10/02/2021/ 13:07	BLC	260 / AiTing	28804		
Description of Goods / Services				Qty	Unit Price	Disc%	Amount
M SUNDRY							20.00
Sundry							
M SUNDRY							
WIRE ASSY MAIN ----91150M6490							
E PNT88000							3200.00
RENEW FRT BUMPER, BONNET, FRT FENDER RH & LH, FRT SUPPORT PANEL				8 X 400			
FRT WHEELHOUSING RH							
REPAIR FRT DOOR RH & LH, A-PILLAR RH & LH, FRT CHASSIS RH							100.00
E PNT88000							80.00
REMOVE & INSTALL AIRCON CONDENSOR & RADIATOR							50.00
M SUNDRY							
TOP UP AIRCON GAS							4800.00
M SUNDRY							
FRT NUMBER PLATE WITH FRAME							30.00
E PNT98000							
SPRAY PAINT FOR FRT BUMPER, BONNET, FRT FENDER RH & LH, FRT DOOR RH & LH, A-PILLAR RH & LH, FRT CHASSIS RH & LH				9 X 480			
FRT WHEELALIGNMENT RH							120.00
A 90000001							
CHECK WIRING & ELECTRICAL SYSTEM							400.00
A 10028901							
TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST							400.00
USING HI-SCAN PRO TEST							
A 90000001							
RENEW FUEL PIPE , LINK TO REAR							60.00
A 90000001							
REMOVE & INSTALL FRT CROSSMEMBER TO FACILITATE RENEW FUEL PIPE							240.00
E PNT88000							
REMOVE & INSTALL PARKING SENSOR							80.00
E PNT88000							
RENEW FRT WINDSCREEN							
M SUNDRY							
APPLY SEALANT FOR FRT WINDSCREEN							

Estimate

4320

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE & CARRIAGE

CYCLE & CARRIAGE KIA PTE LTD
PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65651240

**ESTIMATE**

Co Reg No : 199405410K

GST Reg No : MR-8500111-X

Invoice Name & Address	Owner Name & Vehicle Info
DAVID FOO HEE CHEW	Cust No/Name /DAVID FOO HEE CHEW
37 HOUGANG AVE 7	Reg No/Reg Date SJW972E / 11/01/201
#12-06	Date In/Mileage / 0
SINGAPORE 538803	Chassis No KNAF3416MK5022784
Contact No Mobile: 97897757	Engine No G4FGJH712637
	Make/Model KIA/CERATO 1.6 A SR SX G335
	Colour/Trim CR5 RUNWAY RED / WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
CSM00081	Cash	10/02/2021/ 12:05	Bod	442 / CocoLu	28804			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
M SUNDRY								220.00
APPLY FRONT WINDSCREEN SOLAR FILM								
M SUNDRY								80.00
APPLY SEALANT FOR ACCIDENT PORTION								
A 90000001								400.00
RENEW INTAKE MANIFOLD & THROTTLE BODY								
A 90000001								400.00
RENEW AIRBAGS AND SEAT BELTS								
A 90000001								400.00
RENEW DASHBOARD & AIRBAG SENSOR								
M COVER-FR BUMPER	BR				1.00	633.00	00.00	633.00
M CAP-FRONT HOOK	CRU				1.00	9.00	00.00	9.00
M GRILLE-FRONT BUMPER	BR (Back)				1.00	485.00	00.00	485.00
M COVER-FR BUMPER FOG LAMP,RH	CUT				1.00	15.00	00.00	15.00
M COVER-FR BUMPER FOG LAMP,LH	X				1.00	15.00	00.00	15.00
M LAMP ASSY-FRONT FOG,RH	X				1.00	303.00	00.00	303.00
M LAMP ASSY-FRONT FOG,LH	X				1.00	303.00	00.00	303.00
M LAMP ASSY-SIDE REPEATER,RH	CUT				1.00	143.00	00.00	143.00
M LAMP ASSY-SIDE REPEATER,LH	X				1.00	143.00	00.00	143.00
M GRILLE ASSY-RADIATOR	BR				1.00	328.00	00.00	328.00
M GARNISH-RADIATOR GRILLE	BR (Top cover)				1.00	38.00	00.00	38.00
M AIR DUCT-FR BUMPER,RH	BR				1.00	14.00	00.00	14.00
M AIR DUCT-FR BUMPER,LH	X				1.00	14.00	00.00	14.00
M BRACKET-FR BUMPER UPR SIDE MTG	BR (RH)				1.00	22.00	00.00	22.00
M BRACKET-FR BUMPER UPR SIDE MTG	X				1.00	22.00	00.00	22.00
M ABSORBER-FRONT BUMPER ENERGY	BR?				1.00	84.00	00.00	84.00
M WIRING ASSY-BUMPER EXTENSION					1.00	207.00	00.00	207.00
M ULTRASONIC SENSOR ASSY-P.A.S	?				4.00	163.00	00.00	652.00
M PANEL ASSY-HOOD	DD				1.00	1502.00	00.00	1502.00
M HINGE ASSY-HOOD,RH	BT				1.00	43.00	00.00	43.00
M HINGE ASSY-HOOD,LH	BT				1.00	43.00	00.00	43.00
P PANEL-FENDER,RH	DD				1.00	430.00	00.00	430.00
P PANEL-FENDER,LH	X R				1.00	430.00	00.00	430.00

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.

Co Reg No : 199405410K

ESTIMATE

GST Reg No : MR-8500111-X

Invoice Name & Address	Owner Name & Vehicle Info
DAVID FOO HEE CHEW	Cust No/Name /DAVID FOO HEE CHEW
37 HOUGANG AVE 7	Reg No/Reg Date SJW972E / 11/01/201
#12-06	Date In/Mileage / 0
SINGAPORE 538803	Chassis No KNAF3416MK5022784
Contact No Mobile: 97897757	Engine No G4FGJH712637
	Make/Model KIA/CERATO 1.6 A SR SX G335
	Colour/Trim CR5 RUNWAY RED / WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
CSM00081	Cash	10/02/2021/ 12:05	Bod	442 / CocoLu	28804			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
M	BEAM COMPLETE-FR BUMPER	DD			1.00	497.00	00.00	497.00
M	CARRIER ASSY-FRONT END MODULE	BR			1.00	675.00	00.00	675.00
M	BRACKET ASSY-FENDER & BUMPER,R	BR			1.00	9.00	00.00	9.00
M	BRACKET ASSY-FENDER & BUMPER,L	X			1.00	9.00	00.00	9.00
M	BRACKET ASSY-FENDER & BPR MTG,	?			1.00	14.00	00.00	14.00
M	PANEL ASSY-FNDR APRON,RH	DD			1.00	538.00	00.00	538.00
M	PNL-FENDER APRON UPR OTR,RH	BT			1.00	30.00	00.00	30.00
P	PAD-HOOD INSULATING	CRU			1.00	156.00	00.00	156.00
M	LATCH ASSY-HOOD	BT			1.00	103.00	00.00	103.00
M	COVER-AFTER SERVICE,RH	MIS			1.00	11.00	00.00	11.00
M	COVER-AFTER SERVICE,LH	MIS			1.00	11.00	00.00	11.00
M	MOULDING-WINDSHIELD GLASS	hec			1.00	56.00	00.00	56.00
M	COVER ASSY-COWL TOP	CUT			1.00	247.00	00.00	247.00
M	GLASS-WINDSHIELD	BR			1.00	821.00	00.00	821.00
M	GUARD ASSY-FRONT WHEEL,RH	?			1.00	95.00	00.00	95.00
M	GUARD ASSY-FRONT WHEEL,LH	X			1.00	95.00	00.00	95.00
M	LAMP ASSY-HEAD,RH	BR			1.00	2210.00	00.00	2210.00
M	LAMP ASSY-HEAD,LH	BR			1.00	2210.00	00.00	2210.00
M	RESERVOIR & PUMP ASSY-WASHER	CRU			1.00	146.00	00.00	146.00
M	HORN ASSY-LOW PITCH	BR			1.00	74.00	00.00	74.00
M	CRASH PAD ASSY-MAIN	BR			1.00	1279.00	00.00	1279.00
M	ADJUSTER ASSY-HEIGHT	?			1.00	37.00	00.00	37.00
M	S/BELT ASSY-FR RH	Jammid			1.00	317.00	00.00	317.00
M	ADJUSTER ASSY-HEIGHT	?			1.00	37.00	00.00	37.00
M	S/BELT ASSY-FR LH	Jammid			1.00	315.00	00.00	315.00
M	MODULE ASSY-STRG WHEEL AIR BAG	BR			1.00	922.00	00.00	922.00
M	AIR BAG ASSY-PASSENGER	BR			1.00	1275.00	00.00	1275.00
M	MODULE ASSY-AIR BAG CONTROL	hec			1.00	1025.00	00.00	1025.00
P	SENSOR ASSY-A TYPE CRASH	hec			2.00	54.00	00.00	108.00
M	SENSOR ASSY-A TYPE CRASH	X			2.00	54.00	00.00	108.00
M	TUBE ASSY-SUCTION & LIQUID	?			1.00	668.00	00.00	668.00
M	HOSE-DISCHARGE	?			1.00	122.00	00.00	122.00
M	CONDENSER ASSY-COOLER	BT			1.00	687.00	00.00	687.00

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE & CARRIAGE

CYCLE & CARRIAGE KIA PTE LTD
PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65651240

**ESTIMATE**

Co Reg No : 199405410K

GST Reg No : MR-8500111-X

Invoice Name & Address	Owner Name & Vehicle Info
DAVID FOO HEE CHEW 37 HOUGANG AVE 7 #12-06 SINGAPORE 538803 Contact No Mobile: 97897757	Cust No/Name /DAVID FOO HEE CHEW Reg No/Reg Date SJW972E / 11/01/201 Date In/Mileage / 0 Chassis No KNAF3416MK5022784 Engine No G4FGJH712637 Make/Model KIA/CERATO 1.6 A SR SX G335 Colour/Trim CR5 RUNWAY RED / WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
CSM00081	Cash	10/02/2021/ 12:05	Bod	442 / CocoLu	28804			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
M	GUARD-AIR,RH	BR			1.00	28.00	00.00	28.00
M	GUARD-AIR,LH	?			1.00	28.00	00.00	28.00
M	RADIATOR ASSY	BR			1.00	646.00	00.00	646.00
M	BLOWER ASSY	BR			1.00	656.00	00.00	656.00
M	FILLER NECK ASSY-RADIATOR				1.00	28.00	00.00	28.00
M	HOSE ASSY-RADIATOR,UPR	CRU			1.00	27.00	00.00	27.00
M	HOSE ASSY-RADAATOR,LWR	X			1.00	40.00	00.00	40.00
M	WIRING ASSY-CONTROL	TAI			1.00	966.00	00.00	966.00
M	HOSE ASSY-OIL COOLING	?			1.00	70.00	00.00	70.00
M	HOSE ASSY-OIL COOLING	?			1.00	35.00	00.00	35.00
M	PIPE-DELIVERY	?			1.00	164.00	00.00	164.00
M	CLEANER ASSY-AIR	BR			1.00	174.00	00.00	174.00
M	HOSE ASSY-AIR INTAKE	CRU			1.00	83.00	00.00	83.00
M	HOSE ASSY-BREATHER	?			1.00	28.00	00.00	28.00
M	DUCT ASSY-AIR	BR			1.00	55.00	00.00	55.00
M	SHIELD-AIR INTAKE	MIS			1.00	9.00	00.00	9.00
M	DUCT-EXTENSION	MIS			1.00	5.00	00.00	5.00
M	DUCT ASSY-EXTENSION	?			1.00	115.00	00.00	115.00
M	COVER ASSY-ENGINE	CUT			1.00	212.00	00.00	212.00
M	MANIFOLD ASSY-INTAKE	BR			1.00	906.00	00.00	906.00
M	BODY ASSY-THROTTLE	BR			1.00	636.00	00.00	636.00
M	PIPE ASSY-VACUUM	?			1.00	50.00	00.00	50.00
M	HOSE ASSY-WATER A	?			1.00	23.00	00.00	23.00
M	HOSE ASSY-WATER B	?			1.00	23.00	00.00	23.00
M	TUBE-FUEL FEED	?			1.00	142.00	00.00	142.00
M	CONTACT ASSY-CLOCK SPRING	nec			1.00	253.00	00.00	253.00

Steve (LKK)
OD-AM AL
Express - ?
10/2/21, 12:00pm
P/P

LKK Auto Consultants hence notify
the Repairer of the following:
• To resurvey before/after spray painting
• To display damaged part(s) during resurvey

Estimate

Steve (CLKK)

00-AM AL

Excess - ?

10/2/21, 12.00pm

P/P

My Bu SK

20 days

7% GST on

Nett
35967.00

35,967.00
2517.69

Total Payable**38,484.69**

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation

Confirm & accepted by
 This estimate is on a "Without Prejudice" basis
 • No illegal modification(s) is allowed
 • Supplementary item(s) must be resurveyed and
 is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	09/02/2021 16:37 (SGT)
Date of Accident	04/02/2021 18:30 (SGT)
Exact Location of Accident	Ang Mo Kio Ave 3, Singapore
Additional Location Information	ANG MO KIO AVE 3
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SJW972E
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	DAVID FOO HEE CHEW
NRIC No	SXXXX633E
Email Address	DAVIDANNFOO@YAHOO.COM
Mobile Phone No	(Phone) +65-97897757
Alternative Phone No	+65-97897757

VEHICLE PARTICULARS

Manufacturer	Kia
Model	Cerato
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car

INSURANCE COMPANY

Name of Insurance Company	AIG
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	1900003272
Cover Note Number	-

DRIVER

Name of Driver	FU YIPING,STEPHANIE ANN
NRIC No	SXXXX591E
Date Of Birth	05/04/1988
Occupation	Indoor



Date of Driving Pass
 Driving experience
 Gender
 Mobile Number
 Alt. Phone Number
 Email Address
 Address
 Address complement
 Postcode
 Is the driver the policyholder?
 If No, Relationship of the Driver with the Insured
 Does Driver Own Other Vehicles?
 Vehicle Registration Number of Other Vehicle Owned by Driver
 Insurance Company of Other Vehicle Owned by Driver

11/12/2007
 13 YEARS AND 2 MONTHS
 Female
 (Phone) +65-97897758
 *
 SAFYRR@HOTMAIL.COM
 37 HOUGANG AVENUE 7 #12-06
 *
 538803
 No
 Child
 No
 *
 *

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident
 Weather Conditions
 Road Surface

Chain Collision
 Clear
 Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?
 Number of vehicles involved in the accident
 Was anybody injured in the Accident?
 Was any injured conveyed to hospital by ambulance?
 Was any other material or property damaged?
 Number of Passengers (Including Driver)
 Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?

No
 3
 Yes
 Yes
 Yes
 1
 No

DETAILS OF POLICE ACTION

Was the accident reported to the police?
 Police Station Name
 Police Station Phone No
 Alt. Police Station Phone No
 Police Station Address
 Was notice of intended Prosecution given?
 If yes, against whom?

Yes
 Hougang Neighbourhood Police Centre
 (Phone) +65-18004890999
 (Fax) +65-63128989
 60 Hougang Ave 9 Singapore 538775
 No
 -

CIRCUMSTANCES OF ACCIDENT

REFER TO ATTACHMENT

ATTACHMENT(S)

Are accident photos available for attachment?
 Was there any video captured by Car Camera?
 Was there any audio recorded?

Yes
 Yes
 No

DETAILS OF OTHER VEHICLE PROPERTY

Vehicle Registration Number
 Vehicle Manufacturer
 Vehicle Model
 Vehicle Variant
 Vehicle Colour
 Vehicle Category
 Name of Driver
 Contact Number

GBF4313R
 -
 -
 -
 -
 Commercial vehicle
 -
 -

Address
 Address complement
 Postcode
 Insurance Company Name
 Nature Of Damage
 Details of property damaged in accident
 No. Of Passenger (Including Driver)

DETAILS OF OTHER VEHICLE PROPERTY 2:

Vehicle Registration Number UNKNOWN
 Vehicle Manufacturer
 Vehicle Model
 Vehicle Variant
 Vehicle Colour
 Vehicle Category Private car
 Name of Driver
 Contact Number
 Address
 Address complement
 Postcode
 Insurance Company Name
 Nature Of Damage
 Details of property damaged in accident
 No. Of Passenger (Including Driver)

INJURED PERSONS DETAILS

INJURED 1

Name of injured person FU YIPING,STEPHANIE ANN
 Address
 Address Complement
 Post Code
 Approximate Age Years Old
 Injuries Sustained HEAD INJURY
 Injured person in which vehicle? SJW972E
 Were seat belts worn? Yes
 Was this injured conveyed to hospital by ambulance? Yes



SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any wilful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that :

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "**Personal Information**") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "**Insurers**"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;


(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or


(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.


(collectively the "**Purposes**")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and


(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


Policyholder's Signature / Date & Time

X 
Driver's Signature (if driver is not the policyholder) / Date & Time


Witnessed by Reporting Centre Personnel

Sketch Plan

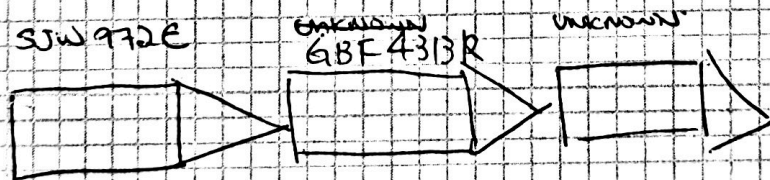



Describe Circumstances of the Accident


Refer police report. T/20210206/2067.

Declaration

We declare the foregoing particulars are true in every respect.


Policyholder's Signature / Date & Time


Driver's Signature (if driver is not the policyholder) / Date & Time


Witnessed by Reporting Centre Personnel



SINGAPORE POLICE FORCE



T/20210206/2067

Police Station Of Origin:
Hougang N.P.C
60 Hougang Avenue 9 SINGAPORE 538775
Tel No: 1800-4890999

1 of 3

Report No. T/20210206/2067

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 06/02/2021 14:17		Vide Report No.: F/20210204/0144		Station Diary No.: 52	
Informant's Particulars					
Name of Informant: FU YIPING, STEPHANIE ANN			Address: 37 HOUGANG AVENUE 7 #12-06 SINGAPORE 538803		
ID Type / ID No.: NRIC NO / S 82591E			Contact No.: Home/Office: Mobile: 97897758		
Nationality: SINGAPORE CITIZEN			Email:		
Sex: Female	Age: 32	Date of Birth: 05/04/1988	Type of Informant: Driver		
Race: Chinese			Language:		Institution / School Name:
Occupation: Dance instructor (extracurriculum)			Driving Licence Information: Class: 3		Date of Expiry:

General Information of the Accident

Type of Accident:	Injury Conveyed By Ambulance	Drink Drive: No	Date/Time of Accident: 04/02/2021 18:30	Type of Location: Straight Road
Location: ANG MO KIO AVENUE 3				
Weather: Clear		Road Surface: Dry		Road Speed Limit:
Traffic Flow: One Way		Traffic Control: Traffic Light - Working		Traffic Volume: Moderate
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: Yes

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
SJW972E	Car				Seriously Damaged	0

Details of Person Involved

Any Pedestrian Involved: No	
No. of Pedestrians Injured: NIL	Use of Pedestrian Crossing: NA



**SINGAPORE
POLICE FORCE**



T/20210206/2067

Police Station Of Origin:

Hougang N.P.C

60 Hougang Avenue 9 SINGAPORE 538775

Tel No: 1800-4890999

2 of 3

Report No. T/20210206/2067

CONTINUATION OF REPORT

Driver Name	FU YIPING, STEPHANIE ANN	ID No.	S4591E
Related Vehicle	SJW972E (Car)	Contact No.	97897758
Hospital/Clinic	SENGKANG GENERAL HOSPITAL PTE. LTD.	Class of Driving Licence & Expiry Date	Class: 3 Date of Expiry: NIL
Date Treatment	04/02/2021	Date Discharge	05/02/2021
No. of Days granted Medical Leave	03	Degree of Injury	Serious

Brief Details.

On 04/02/2021 at about 1830hrs, I was driving my car SJW972E along the middle lane of Ang Mo Kio Avenue 3 heading towards Hougang Avenue 2 direction and there was also a lorry in front of me. Everything was intact and in order.

Subsequently I noticed that the lorry had suddenly braked and I could not react in time to avoid the collision, hence my car collided onto the rear of the lorry and I blacked out momentarily due to the sudden impact.

Upon regaining my consciousness from the black out, I realized that I was bleeding from my forehead. I then waited in my car for help to arrive as I was disoriented. My brother was the first to arrive, followed by my fiancé shortly after. The ambulance arrived to make a check on me and subsequently convey me to Seng Kang General Hospital with my fiancé accompanying, while my brother stayed at the scene to speak with the Traffic Police.

I was treated and warded from 04/02/2021 to 05/02/2021 at Seng Kang General Hospital for observation and had to do a CT scan on my head due to head injury and X-Ray on my chest.

I underwent an operation on the morning of 05/02/2021 and was discharged on the afternoon of the same day. I am scheduled to return to Seng Kang General Hospital on 08/02/2021 for a follow up.

I am lodging this Traffic Accident Report for insurance and medical claims purpose.



**SINGAPORE
POLICE FORCE**



T/20210206/2067

3 of 3

Report No. T/20210206/2067


Police Station Of Origin:
Hougang N.P.C
60 Hougang Avenue 9 SINGAPORE 538775
Tel No: 1800-4890999


CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan


IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report: F / Sgt 2 PETER GOH WEE HENG 
Signature Of Interpreter: Not applicable
Officer In Charge Of Case: TP / GIT / Sgt 3 MUHAMMAD AFIQ BIN RAHMAT Contact No.: 65476171

Signature Of Informant: 
Date/Time: 06/02/2021 14:17
Classification Of Case: SN 055

Authentication Stamp
NP168



Signature: 

Singapore Police Force

KIA AUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder : David Foo Hee Chew
Period of Insurance : 11 Jan 2021 To 10 Jan 2022
Engine No. : G4FGJH712637
Chassis No. : KNAF3416MK5022784

Vehicle No. : SJW972E
Policy No. : 1900003272-01
Endorsement No. :
Issued Date : 29 Dec 2020

ABOUT THE COVER

Make/Model : KIA Cerato
Engine Capacity/Tonnage : 1,591.00 CC
Driver Restriction : NA
Sum Insured : Market Value
Off Peak Car : No
First Year of Registration : 2019
Insuring with COE/PAFF : Yes

Person or Classes of Persons Entitled to Drive* :

- a) The Policyholder
b) Any other person who is driving on the Policyholder's order or with his/her permission.
This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDR") if You are or Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition

Mileage Condition : Unlimited Mileage

Limitation as to use* :

Use only for social, domestic and pleasure purposes and for the Policyholder's business.
This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1500cc - 1600cc

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189), Section 95 of the Road Transport Act, 1987 (Malaysia) and Road Transport (Amendment) Act 2019, are not to be included under these headings.

EXCESS

Section 1
Fire - \$0 Own Damage - \$600 Theft - \$0 Flood Cover - \$600

Section 2
Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

David Foo Hee Chew - \$600 (Own Damage), \$600 (Flood Cover)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

1. Cycle & Carriage Body & Paint Centre Add: 209 Pandan Gardens Singapore 609339 65684501
2. Cycle & Carriage Authorised Service Centre (For accident reporting & windscreen claim only) Add: 330 Ubi Rd 3 Singapore 408650 67461000
3. Cycle & Carriage Authorised Service Centre (For accident reporting & windscreen claim only) Add: 241 Alexandra Road Singapore 159931 64278800
4. Cycle & Carriage Authorised Service Centre (For accident reporting & windscreen claim only) Add: 600 Sin Ming Ave Singapore 575733 69328000

For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: NA

We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 189), Part IV of the Road Transport Act, 1987 (Malaysia), Road Transport (Amendment) Act 2019 and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia).

0504824219
FULCO - CSF

22 UBI ROAD 4 FULCO BUILDING
SINGAPORE 408617

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

AIG Asia Pacific Insurance Pte. Ltd.

This computer generated document does not require a signature.

SSCZSS

1004001229/AC1