

ASS. REC. BY:

REF:

C72/

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / ~~W~~ / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

16 days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

GBC 8179B Yr Regn: 12, 13

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Perault Traffic cc 1995

Colour

M. Silver

A/C: Insured / Std / NI / NA

Sp. Reading

112264

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

VF1FLB18604504789

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

215/65R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

9 mm

R/Bal.

9 mm

L/Bal.

9 mm

L/Bal.

9 mm

D.O.A.

2/2/21

D.O.I.

16/2/2021

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S body, & 1st & 2nd floor

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2) 3/3/21-Typist

Days Of Repair: 16

Resurvey No. of Trip:

Survey Fee:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Transportation:

S - RS - SI

P. Extras

Others

Report Format :

Lump Sum / I.B.I. (\$

Lai Huat (Meng Kee) Motor Pte Ltd
160 Sin Ming Drive, #04-01, #04-02 &
#07-03, Sin Ming Autocity
575722

Insurer Reference:
Repairer Reference: 71860
Date calculated: 10/02/2021 1:33 PM

Full Report
Registration: GBC8179B
Printed: 10/02/2021 1:38 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Jason Tan	Currency:	SGD
Claim Reference:		Date of Incident:	02/02/21
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	RENAULT
Model:	TRAFIC II
Sub Model:	BASE MODEL
Model Sheet Number:	12 57 01
Registration:	GBC8179B
VIN number:	VF1FLB1B6DY504789
Odometer:	

Model Specs

VAN	L/SLIDING DOOR	R/SLIDING DOOR	AIR CONDITIONING
DEAD LOCKS	FRT ELECTRIC WINDOWS	EL/HEAT DOOR MIRROR	RADIO
NORMAL ROOF	REAR WIPER	CLOTH TRIM	WHEELBASE 3498 MM
REAR SCREEN	2.0 LTR 84KW	GEARBOX 6 SPEED	ABS
TYRES 195/65CR16 8PR	WHEELS 6J X 16	GLAZED WING DOOR 180	WHEEL COVER 16 INCH
FROM 03/2013	TRIM CODE E1	TWO COAT METALLIC	PREPARE OFF VEHICLE

*Not Authorized
Runny B4 pain
Ex 8501*

Vehicle Condition

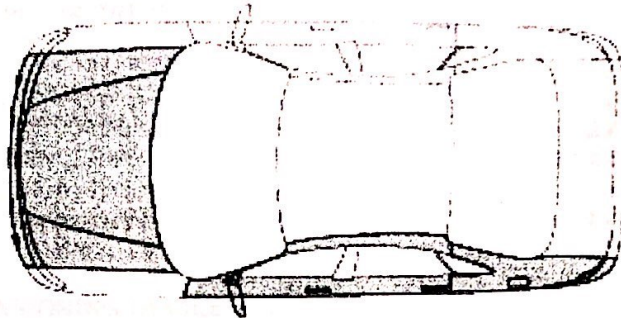
Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐



Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
5212 KA	R + R FRONT BUMPER INCLUDES: R + R FRONT GRILL		5.0	21.00
A163 VA	RENEW FRONT BUMPER (REMOVED)		2.0	8.40
8145 KA)	R + R LEFT HEADLAMP		1.0	4.20
8145 KA)	R + R RIGHT HEADLAMP		1.0	4.20
8072 KA	ADJUST HEADLAMPS		3.0	12.60
NO NUMBER	R + R FRONT PART REINFORCEMENT		2.0	8.40
NO NUMBER	R + R R/F BUMPER IMPACT DAMPER		1.0	4.20
A15T KA	R + R BONNET		5.0	21.00
4192 VA	R + R BONNET (REMOVED)		2.0	8.40
4117 KA)	R + R FRONT PART		7.0	29.40
4196 KA)	R + R LEFT FRONT WING		3.0	12.60
4197 VA)	R + R WING ASS-WORK		3.0	12.60
NO NUMBER	R + R LEFT FRONT MUD FLAP		2.0	8.40
4208 VA	R + R FRONT LOWER CROSSMEMBER		6.0	25.20
5326 KA	R + R WINDSCREEN INCLUDES: R + R UPPER A-PILLAR TRIMS, BOTH WIPER ARMS AND COWL GRILLE		18.0	75.60
4394 KA	R + R LEFT FRONT DOOR		6.0	25.20
4393 KA)	RENEW LEFT FRONT DOOR		19.0	79.80
A0YH KA	R + R LEFT SLIDING DOOR		10.0	42.00
4594 KA)	RENEW L/SLIDING DOOR (REMOVED)		7.0	29.40
6020 KA)	R + R L/DOOR SEALING		1.0	4.20
5207 KA)	R + R L/B-PILLAR PROTECTIVE MOULDING		1.0	4.20
5207 KA)	R + R L/R SIDE PANEL PROTECTIVE MOULDING		1.0	4.20
NO NUMBER	RENEW CPL LEFT FRONT DOOR FRAME		144.0	604.80
4346 VA	RENEW L/CENTRE SILL SECTION (ONLY PANEL WORK)		35.0	147.00
5204 VA	R + R L/PROTECTIVE MOULDINGS (ADD/WORK)		1.0	4.20

de	Description	WU	Price SGD
085 KA)	R + R LEFT B-PILLAR LOWER TRIM	1.0	4.20
NO NUMBER	R + R L/F WHEELHOUSE COVER	3.0	12.60
7064 KA	R + R L/F SILL TRIM	2.0	8.40
7064 KA	R + R L/R SILL TRIM	2.0	8.40
7038 KA)	R + R FRONT HEADLINING (A-PILLAR TRIMS REMOVED) INCLUDES: R + R UPPER B-PILLAR TRIMS, ROOF CONSOLE AND SUN VISORS	2.0	8.40
7016 KA	R + R LEFT FRONT SEAT	3.0	12.60
5112 KA)	R + R LEFT FRONT SEAT BELT	1.0	4.20
5047 KA)	R + R INSTRUMENT PANEL	27.0	113.40
1237 KA)	R + R RADIATOR	27.0	113.40
4029 VA	R + R RADIATOR (REMOVED)	2.0	8.40
6258 VA	R + R AIR CONDITIONING CONDENSER	12.0	50.40
NO NUMBER	ADD/WORK FOR AIRBAG INCLUDES: R + R AIRBAG, CHECK AIRBAG AND PRETENSIONING DEVICE	3.0	12.60
3116 KA)	R + R RIGHT REAR WHEEL	1.0	4.20
3117 KA)	R + R REAR WHEEL/WHEELS ADD WORK	1.0	4.20
3121 KA)	R + R AND BALANCE R/R TYRE	2.0	8.40
1152 KA)	R + R FILLER PIPE BOOT	4.0	16.80
2477 KA)	DRAIN/REFILL COOLING SYSTEM	6.0	25.20
NO NUMBER	REFILL AIR CONDITIONING SYSTEM	4.0	16.80
0562	RIGHT HEADLAMP ASSY REPAIR	10.0*	42.00
3481	L/R SIDE PANEL REPAIR	80 120.0*	504.00
3579	L/R INNER SIDE PANEL REPAIR	30 40.0*	168.00
4269	L/CTR FLOOR REPAIR	30 40.0*	168.00
4291	CTR FLOOR PANEL REPAIR	120.0* ?	504.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		71.90	719.0
Total of Labour			3,019.80

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	BONNET NEW PART PAINTING	16.0
	LEFT FRONT DOOR NEW PART PAINTING	21.0
	L/SLIDING DOOR NEW PART PAINTING	29.0
	L/F DOOR FRAME CPL NEW PART PAINTING	30.0
	FUEL LID HINGE NEW PART PAINTING	5.0
	L/SILL PANEL NEW PART PAINTING	11.0
	GRILLE NEW PART PAINT K1R	8.0
	FUEL FILLER FLAP NEW PART PAINT K1R	3.0
	L/R SIDE PANEL REPAIR PAINTING <50%	30.0
	L/R INNER SIDE PANEL SURFACE PAINT	4.0
	L/CTR FLOOR SURFACE PAINT	4.0
	CTR FLOOR PANEL SURFACE PAINT	10.0
	FLOOR PANEL CENTRE	80.0*

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	43.34
1481	LEFT FRONT DOOR NEW PART PAINTING	65.02
1781	L/SLIDING DOOR NEW PART PAINTING	101.14
2085	L/F DOOR FRAME CPL NEW PART PAINTING	41.80
4087	FUEL LID HINGE NEW PART PAINTING	0.52
4267	L/SILL PANEL NEW PART PAINTING	7.15
0410	GRILLE NEW PART PAINT K1R	30.01
4080	FUEL FILLER FLAP NEW PART PAINT K1R	1.97
3481	L/R SIDE PANEL REPAIR PAINTING <50%	63.95
3579	L/R INNER SIDE PANEL SURFACE PAINT	3.98
4269	L/CTR FLOOR SURFACE PAINT	3.98
4291	CTR FLOOR PANEL SURFACE PAINT	29.88

Labour Cost - Paint

Factor	Hrs	WU	Price SGD
Time Paint		251.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.50	5.0	21.00
Total	10 WU/h	28.10	1,180.20

Material Cost - Paint

	Price SGD
New Part Painting	258.97
New Part Painting - Plastic K1R	31.98
Repair Painting	63.95
Surface-/Blend Paint	37.84
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	430.34

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2001-01-01	Price SGD
4465	AIR CON CONDENSER	82 00 774 211	OEM	R ₁	320.00 ✓
0471	BONNET	\$820.00 LESS40%	Used	R ₁	492.00 ✓
0931	CENTRE STRUT	82 00 411 893	Original	R ₁	42.00 ✓
9987	COOLANT/ANTIFREEZE	NO NUMBER	Original	R ₁	28.00 ✓
0281	FRONT BUMPER	62 01 001 01R	Original	R ₁	675.00 ✓
0930	FRONT PART	\$500.00 LESS40%	Used	CM	300.00 ✓
0317	FRONT PART REINF	62 03 001 01R	Original	R ₁	215.00 ✓
1001	FRT LWR CROSSMEMBER	\$590.00 LESS40%	Used	R ₁	354.00 ✓
4080	FUEL FILLER FLAP	82 00 023 826	Original	CM	172.00 ✓
4065	FUEL FILLER PIPE	82 00 530 872	Original		115.00 ?
4076	FUEL FLAP LOCK	82 00 032 984	Original	T ₁	58.00 ✓
4087	FUEL LID HINGE	82 00 081 103	Original	R ₁	42.00 ✓
0410	GRILLE	77 01 477 202	Original	CM	554.00 ✓
1683	L/B-PILLAR MOULDING	82 00 036 105	Original	CM	135.00 ✓
2085	L/F DOOR FRAME CPL	77 51 472 306	Original	R ₁	2,260.00 ✓
1681	L/F DOOR MOULDING	82 00 036 088	Used		0.00
2080	L/F INN SEAL INSERT	82 00 006 774	Original		0.00

Code	Description	Part Number	Part Source	Price SGD
082	L/F LWR SEAL INSERT	82 00 047 596	Original	0.00
2083	L/R INN SEAL INSERT	82 00 006 775	Original	0.00
3671	L/R PROTECT MOULDING	82 00 036 099	Original	0.00
4267	L/SILL PANEL	77 82 032 534	Original	MIT 200.00 ✓
1981	L/SLDG DOOR MOULDING	82 00 036 081	Used	R 1,200.00 ✓ 0.00
1781	L/SLIDING DOOR	\$1500 LESS 40%	Used	R 900.00 ✓
1481	LEFT FRONT DOOR	\$1200 LESS 40%	Used	R 720.00 ✓
0320	R/F BUMP IMP DAMPER	62 03 401 01R	Original	MIT 335.00 ✓
9566	R/R TYRE	195/65 R 16 C	Original	P 170.00 89 ✓
9552	R/R WHEEL	82 00 570 331	Original	R 166.00 ✓
7761	RADIATOR	82 00 465 488	OEM	R 300.00 ✓
f: OEM Parts n: Non-OEM Parts u: Used parts				
Savings				0.00
Subtotal				9,753.00
Total				9,753.00

Extras

Code	Description	Price SGD
1003	L/COMPANY INFO DECAL	MC 25.00* ✓
Total Extras		25.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	9,753.00	9,753.00
Labour Time Base 10 WU/h		
Total 719.0 WU X 42.00 SGD/h	3,019.80	
Total of Labour		3,019.80
Total Of Extras		25.00
Paint Work Time Base 10 WU/h		
Labour Cost 281.0 WU X 42.00 SGD/h	1,180.20	
Material Cost	430.34	
Total Paint Including Material		1,610.54
Repair Cost Excludes GST		14,408.34
GST (+7.0%)		1,008.58
Repair Cost Included GST		15,416.92

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS



SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	03/02/2021 18:04 (SGT)
Date of Accident	02/02/2021 18:30 (SGT)
Exact Location of Accident	Toa Payoh Industrial Park, Singapore
Additional Location Information	-
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	GBC8179B
INSURED/POLICYHOLDER	
Is company?	Yes
Name Of Registered Owner	Deco Builders Singapore Pte Ltd
Company Reg No	2XXXXX864C
Email Address	joven.tan@decobuilders.com.sg
Mobile Phone No	(Phone) +65-96363083
Alternative Phone No	+65-96363083

VEHICLE PARTICULARS

Manufacturer	Renault
Model	Traffic
Variant	-
Exact purpose for which vehicle was being used at time of accident	Employment
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Commercial vehicle

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	DMCVSNW00121022000
Cover Note Number	-

DRIVER

Name of Driver	Low Teck Hui
Passport No/FIN	GXXXX741L
Date Of Birth	24/10/1989
Occupation	Outdoor

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore (GIA) may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and


(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

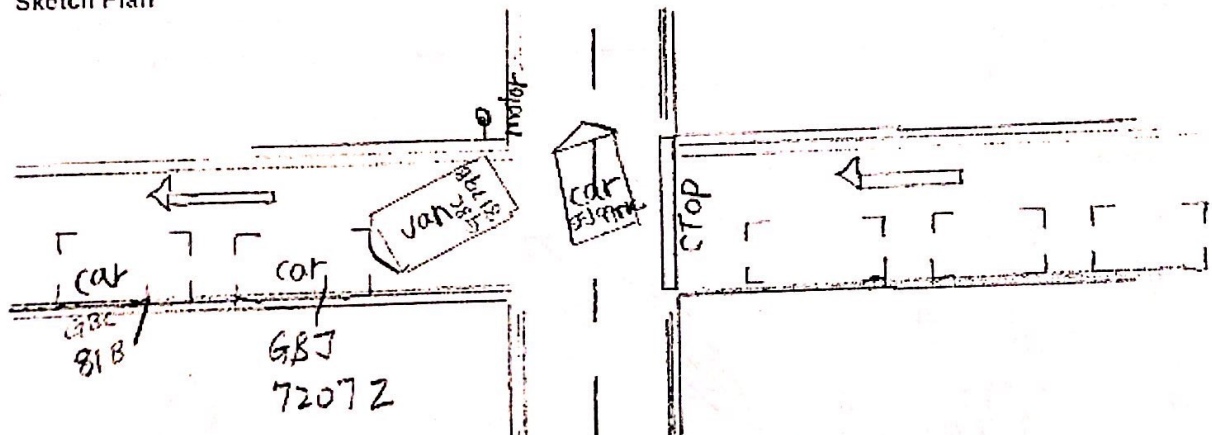

 - 3 FEB 2021

Driver's Signature (if driver is not the policyholder) / Date & Time

 - 3 FEB 2021

Witnessed by Reporting Centre Personnel

 Jenny Lim

Sketch Plan



Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Company

Owner ID:

864C

Vehicle Details

Vehicle No.:

GBC8179B

Vehicle to be Exported:

Yes

Intended Deregistration Date:

03 Feb 2021

Vehicle Make:

RENAULT

Vehicle Model:

TRAFIC 2.0 DCI LWB 115 MT ABS D/AB
6DR

Primary Colour:

Silver

Manufacturing Year:

2013

Engine No.:

M9RA630C106881

Chassis No.:

VF1FLB1B6DY504789

Maximum Power Output:

-

Open Market Value:

\$27,486.00

Original Registration Date:

06 Dec 2013

First Registration Date:

06 Dec 2013

Transfer Count:

1

Actual ARF Paid:

\$1,375.00

Intended PARF Rebate Details

PARF Eligibility:

No

PARF Eligibility Expiry Date:

-

PARF Rebate Amount:

\$0.00

Intended COE Rebate Details

COE Expiry Date:

05 Dec 2023

COE Category:

C - Goods Vehicle & Bus

COE Period(Years):

10

QP Paid:

\$55,503.00

COE Rebate Amount:

\$15,755.00

Total Rebate Amount:

\$15,755.00

The information contained herein is correct as at 03 Feb 2021

OK