

BY: John REF: CS/A1421002363/Rivd3 9324

ASSIGNMENT

From: _____ Date: _____
Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/INV

To Inspect Vehicle No: SMS 9269D

at Workshop m/s CYCLE & CARRIAGE

of 209, Pannon Garden

Insured: AM

Policy No. _____

Claims No. _____


Sum Insured: _____ Excess: TBA 0

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

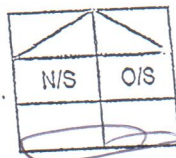

Bal. or Market Value: 84K

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SMS 9269D Yr Regn: 2020 / MAR
Type: M.Cycle / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: KIA CERATO 1.6 A EX c.c. 1591

Colour: RED A/C: Insured / Std / NI / NA

Sp. Reading: 16061 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: KNAF3416ML 5069456

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/55R16

R: 22

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or: Kumho

Front: _____ Rear: _____

R/Bal. 6 mm R/Bal. 6 mm

L/Bal. 6 mm L/Bal. 6 mm

D.O.A. 19/02/2021 D.O.I. 19/02/2021

Survey held at CYCLE

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>Repair Inv - 43K</u>

Date/Time, File Pass to? ☐ : Prel. Report

☐ : Final Report

Date/Time, File Return to?

2) 15/3/21-Typist

Rep. Format: Merimen

Lump Sum / L.B.A. of: \$11,562.80

Days Of Repair: 8

Resurvey No. of Trip: 1

Add Fee: ☐ : Site Insp (\$ _____)

☐ : Interview (\$ _____)

☐ : Tech. Invs (\$ _____)

☐ : Weekend (\$ _____)

Survey Fee:

Transportation:

\$ + RS. \$

Photos

Others

TOTAL



COVER NOTE

KIA AUTO PROTECTOR PRIVATE VEHICLE

The following risk described on this Cover Note is hereby HELD COVERED on the terms and conditions of the policy issued to the Policyholder.

Name of Policyholder : LUO JUNYANG
Period of Insurance : 16-Mar-2020 to 15-Mar-2022
Engine No. : G4FGKH755439
Chassis No. : KNAF3416ML5069456



Vehicle No. :
Cover Note No. : 2070051262
Endorsement No. :
Issued Date : 16 Mar 2020



ABOUT THE COVER

Make/Model : KIA Cerato

Engine Capacity/Tonnage : 1,591.00 CC

Driver Restriction : NA

Sum Insured : Market Value

Off Peak Car : No

First Year of Registration : 2020

Insuring with COE/PAF : Yes

Person or Classes of Persons Entitled to Drive* :

a) The Policyholder

b) Any other person who is driving on the Policyholder's order or with his/her permission.

This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDR") if You are or Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition

Limitation as to use* :

Use only for social, domestic and pleasure purposes and for the Policyholder's business.

This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1500cc - 1600cc

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189) and Section 95 of the Road Transport Act, 1987 (Malaysia). are not to be included under these headings.

EXCESS

Section 1

Fire - \$0 Own Damage - \$600 Theft - \$0 Flood Cover - \$600

Section 2

Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

LUO JUNYANG - \$600 (Own Damage), \$600 (Flood Cover)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

1. Cycle & Carriage Body & Paint Centre Add: 209 Pandan Gardens Singapore 609339 65684501

2. Cycle & Carriage Authorised Service Centre (For accident reporting & windscreen claim only) Add: 330 Ubi Rd 3 Singapore 408650 67481000

3. Cycle & Carriage Authorised Service Centre (For accident reporting & windscreen claim only) Add: 241 Alexandra Road Singapore 159931 64278800

4. Cycle & Carriage Authorised Service Centre (For accident reporting & windscreen claim only) Add: 600 Sin Ming Ave Singapore 575733 69328000

For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: HL Bank

If you do not receive your Certificate of Insurance and policy documents within 30 days from the inception date stated on this cover note, please contact AIG immediately.
I/We hereby certify that this Cover Note is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 189), Part IV of the Road Transport Act, 1987 (Malaysia) and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia). For Corporate Policies, this Cover Note is valid for 60 days from the commencement date of the period of insurance.

0504671239

CYCLE & CARRIAGE - FRANCHISE

239 ALEXANDRA ROAD

SINGAPORE 159930

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

AIG Asia Pacific Insurance Pte. Ltd.

This computer generated document does not require a signature.

Joanne Leong



SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	19/02/2021 10:18 (SGT)
Date of Accident	19/02/2021 07:50 (SGT)
Exact Location of Accident	Clementi Ave 6, Singapore
Additional Location Information	CLEMENTI AVE 6 ENTRY TO AYE TOWARDS TUAS
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMS9269D
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	LUO JUNYANG
NRIC No	SXXXX932H
Email Address	JUNYANG.LUO@GMAIL.COM
Mobile Phone No	(Phone) +65-98390627
Alternative Phone No	+65-98390627

VEHICLE PARTICULARS

Manufacturer	Kia
Model	Cerato
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car

INSURANCE COMPANY

Name of Insurance Company	AIG
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	2070051262
Cover Note Number	-

DRIVER

Name of Driver	LUO JUNYANG
NRIC No	SXXXX932H
Date Of Birth	18/10/1993
Occupation	Indoor



Date Of Driving Pass	19/06/2014
Driving experience	6 YEARS AND 8 MONTHS
Gender	Male
Mobile Number	(Phone) +65-98390627
Alt. Phone Number	+65-98390627
Email Address	JUNYANG.LUO@GMAIL.COM
Address	BLK 417 CLEMENTI AVENUE 1 #13-269
Address complement	-
Postcode	120417
Is the driver the policyholder?	Yes
If No, Relationship of the Driver with the Insured	-
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	Yes
Was any injured conveyed to hospital by ambulance?	No
Was any other material or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	Yes

PASSENGER 1

Name	LUO DECHEN
Gender	Male

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO ATTACHMENT

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SLX5591J
Vehicle Manufacturer	Honda
Vehicle Model	Vezel
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Private car
Name of Driver	MUHAMMAD KUSSHAIRYN BIN AHMAD
Contact Number	(Phone) +65-98311642

Address	-
Address complement	-
Postcode	-
Insurance Company Name	NTUC
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

INJURED PERSONS DETAILS

INJURED 1

Name of injured person	LUO JUNYANG
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	WHIPLASH
Injured person in which vehicle?	SMS9269D
Were seat belts worn?	Yes
Was this injured conveyed to hospital by ambulance?	No

INJURED 2

Name of injured person	LUO DECHEN
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	BACKPAIN
Injured person in which vehicle?	SMS9269D
Were seat belts worn?	Yes
Was this injured conveyed to hospital by ambulance?	No

SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any wilful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation**.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)


I understand, acknowledge, agree and consent that :

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "**Personal Information**") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "**Insurers**"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :


- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
- (collectively the "**Purposes**")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.



Policyholder's Signature / Date & Time




Driver's Signature (If driver is not the policyholder) / Date & Time



Witnessed by Reporting Centre Personnel

Sketch Plan

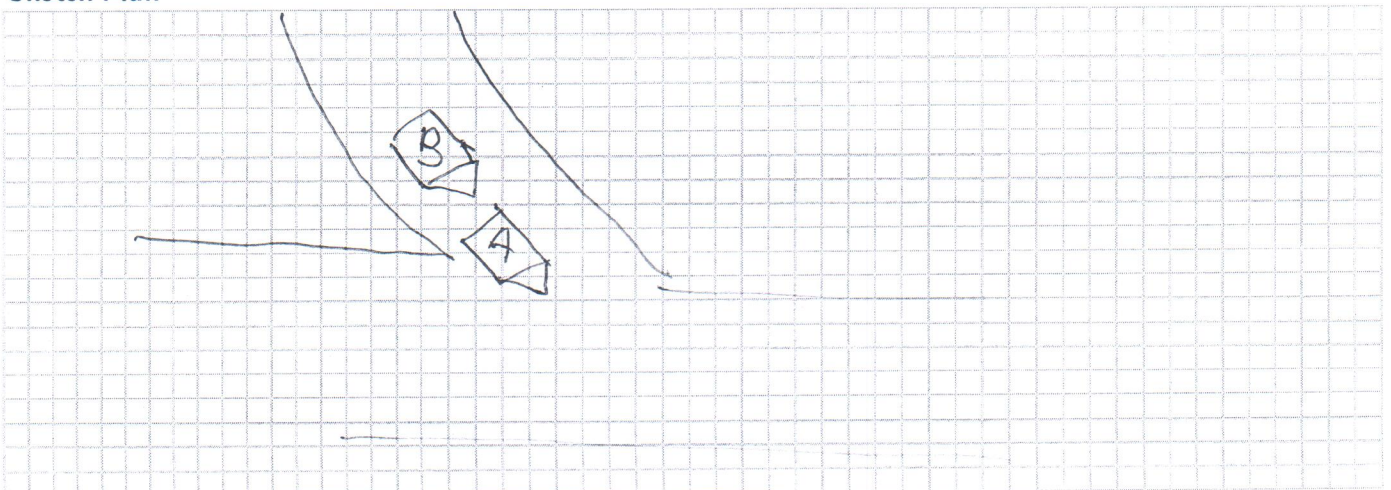


Describe Circumstances of the Accident

I was filtering into the main expressway, I saw a car coming so I slowed to about 20-10 km/h 30-40m before the merge. I stopped at the merge and one second later the car behind hit me.


Driver of the other car said he thought I was going to accelerate ahead so he also accelerated, and hit my car.

Declaration

We declare the foregoing particulars are true in every respect.



Policyholder's Signature / Date & Time



Driver's Signature (If driver is not the policyholder) / Date & Time



Witnessed by Reporting Centre Personnel



CYCLE & CARRIAGE

CYCLE & CARRIAGE KIA PTE LTD
PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65651240



Co Reg No : 199405410K

ESTIMATE

GST Reg No : MR-8500111-X

Invoice Name & Address	Owner Name & Vehicle Info	
LUO JUNYANG 417 CLEMENTI AVENUE 1 #13-269 SINGAPORE 120417 Contact No Mobile: 98390627	Cust No/Name	/LUO JUNYANG
	Reg No/Reg Date	SMS9269D / 23/03/202
	Date In/Mileage	/ 0
	Chassis No	KNAF3416ML5069456
	Engine No	G4FGKH755439
	Make/Model	KIA/CERATO 1.6 A EX G333
	Colour/Trim	CR5 RUNWAY RED / WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
CSM00081	Cash	19/02/2021/ 10:59		442 / CocoLu	29149			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
I WWCV-Z Wash, Wax, Clean, Vacuum & Partial Zerton.								46.00
E PNT88000 RENEW REAR BUMPER, BOOTLID, REAR END PANEL, REAR LAMP HOUSING RH REPAIR REAR FENDER RH & LH, REAR COMPARTMENT @ 400								2000.00
E PNT88000 REMOVE & INSTALL PARKING SENSOR								100.00
E PNT88000 REMOVE & INSTALL REAR COMPARTMENT TRIMS								200.00
E PNT98000 SPRAY PAINT FOR REAR BUMPER, BOOTLID, REAR END PANEL, REAR COMPARTMENT REAR FENDER RH & LH, REAR LAMP HOUSING RH @ 350								3360.00
A 90000001 CHECK WIRING & ELECTRICAL SYSTEM								30.00
A 10028901 TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST USING HI-SCAN PRO TEST								120.00
M SUNDRY C&C LOGO								40.00
M SUNDRY APPLY SEALANT FOR ACCIDENT PORTION								80.00
M SUNDRY Sundry								20.00
P	COVER-RR BUMPER	de			1.00	651.00	00.00	520.80 651.00
M	COVER-RR BUMPER LWR	con			1.00	241.00	00.00	192.80 241.00
M	COVER-RR BUMPER FOG LAMP, RH	con			1.00	19.00	00.00	15.20 19.00
M	COVER-RR BUMPER FOG LAMP, LH	? cut			1.00	19.00	00.00	15.20 19.00
M	LAMP ASSY-SIDE T/SIGNAL, RH	con			1.00	181.00	00.00	144.80 181.00
M	LAMP ASSY-SIDE T/SIGNAL, LH	? xsl			1.00	181.00	00.00	181.00
M	EXTN WIRING ASSY-BWS	? xsl			1.00	207.00	00.00	207.00
M	BRACKET-RR BEAM UPR MTG, RH	? xsl			1.00	9.00	00.00	9.00
M	BRACKET-RR BEAM UPR MTG, LH	? xsl			1.00	9.00	00.00	9.00
M	BEAM-RR BUMPER	con			1.00	318.00	00.00	254.40 318.00

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.

Co Reg No : 199405410K

ESTIMATE

GST Reg No : MR-8500111-X

Invoice Name & Address	Owner Name & Vehicle Info
LUO JUNYANG	Cust No/Name / LUO JUNYANG
417 CLEMENTI AVENUE 1	Reg No/Reg Date SMS9269D / 23/03/202
#13-269	Date In/Mileage / 0
SINGAPORE 120417	Chassis No KNAF3416ML5069456
Contact No Mobile: 98390627	Engine No G4FGKH755439
	Make/Model KIA/CERATO 1.6 A EX G333
	Colour/Trim CR5 RUNWAY RED / WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No
CSM00081	Cash	19/02/2021/ 10:59		442 / CocoLu	29149

Description of Goods / Services	Qty	Unit Price	Disc%	Amount
M BRACKET-RR BEAM LWR,CTR ? x su	1.00	6.00	00.00	6.00
M BRACKET-RR BEAM LWR MTG ? x su	2.00	6.00	00.00	12.00
M ANTENNA ASSY-SMARTKEY ? x su	1.00	46.00	00.00	46.00
M STAY-RR BUMPER RH ? x su	1.00	65.00	00.00	65.00
M STAY-RR BUMPER LH ? x su	1.00	65.00	00.00	65.00
M BRACKET-ASSY RR BPR SIDE UP, R ca	1.00	31.00	00.00	24.82 31.00
M BRACKET ASSY-RR BPR SIDE UP, L ca	1.00	25.00	00.00	20.00 25.00
M PANEL ASSY-TRUNK LID bt	1.00	1297.00	00.00	1037.60 1297.00
M HINGE ASSY-TRUNK LID, LH ? x su	1.00	97.00	00.00	97.00
M HINGE ASSY-TRUNK LID, RH ? x su	1.00	97.00	00.00	97.00
M PANEL ASSY-BACK bt	1.00	324.00	00.00	259.20 324.00
M EMBLEM-CERATO re	1.00	28.00	00.00	22.40 28.00
M LOGO ASSY-KIA SUB re	1.00	32.00	00.00	25.60 32.00
M TRIM ASSY-TRUNK LID de	1.00	202.00	00.00	161.60 202.00
M W/STRIP-TRUNK LID OPNG re	1.00	100.00	00.00	80 100.00
M LATCH ASSY-TRUNK LID ? x su	1.00	112.00	00.00	108.00 112.00
M PANEL ASSY-RR COMB LAMP HSG, RH ? bt	1.00	135.00	00.00	108.00 135.00
M LAMP ASSY-REAR COMB OUTSIDE, RH ? bt	1.00	675.00	00.00	540.00 675.00
M LAMP ASSY-REAR COMB OUTSIDE, LH ? bt	1.00	675.00	00.00	540.00 675.00
M LAMP ASSY-REAR COMB INSIDE, RH ? cut	1.00	608.00	00.00	486.40 608.00
M LAMP ASSY-REAR COMB INSIDE, LH ca	1.00	608.00	00.00	486.40 608.00
M LAMP ASSY-CENTER GARNISH ca	1.00	690.00	00.00	552.00 690.00

SURVEYOR NAME: RASUL - Hp 90010068

SURVEYOR SIGNATURE: [Signature]

DATE: 19/02/2021 @ 1210

REMARKS: 8 days

EXCESS: TBA / REVERT

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Confirm & accepted by

Resurvey before print

Acknowledged by Repairer

Signature:

Nett

13,761.00

7% GST on

13761.00

963.27

Total Payable

14,724.27

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



Exceptional Journeys

Surveyor : STEVE LKK
Claim : AIG OD
DOA : 19.02.2021
Emailed : 11.03.2021, 9.15am
Date Survey : 19.02.2021

VEHICLE NO : SMS 9269 D
MODEL : KIA CERATO 1.6 A EX
WIP : 29149

Material	:	\$	<u>5,772.80</u>
Labour	:	\$	<u>5,790.00</u>
Sub-Total	:	\$	<u>11,562.80</u>
	:	\$	<u>-</u>
Less Excess	:	\$	<u>-</u>
Total	:	\$	<u>11,562.80</u>
GST 7%	:	\$	<u>809.40</u>
Grand Total	:	\$	<u>12,372.20</u>
Finalise By/Date	:		<u>LOI / 11/03/2021</u>

☒ REVERT BACK WITHIN 7 DAYS,
OTHERWISE WILL PROCEED WITH INVOICING

☐ SURVEYOR'S REPORT REQUIRED

☐ REPAIR TOOK 0 WORKING DAYS + 0 Days (0) Weekends
+ 0 Days (0) Public Holiday
TOTAL DAYS REPAIR TOOK = 0

☐ TP claim _____

☐ Claim GIA / LTA fee _____

☐ Claim Loss of ☐ Use / ☐ Rental

☐ Claim Medical Fee / Others _____

☐ Third Party Report - _____

PRO-FORMA INVOICE

Co Reg No : 199405410K

THIS IS NOT AN OFFICIAL TAX INVOICE

GST Reg No : MR-8500111-X

Invoice Name & Address	Owner Name & Vehicle Info
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPARTMENT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 64191000 19/02/2021	Cust No/Name /LUO JUNYANG Reg No/Reg Date SMS9269D / 23/03/2020 Date In/Mileage 19/02/2021/ 16061 Chassis/Package KNAF3416ML5069456 /# Engine No G4FGKH755439 Make/Model KIA/CERATO 1.6 A EX G333 Colour/Trim CR5 RUNWAY RED / WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No					
LAX00000	Credit	11/03/2021/ 09:00	BLC	260 / AiTing	29149					
Description of Goods / Services					Qty	Unit Price	Disc%	Amount		
E	PNT88000	REPLACE DAMAGED PARTS, REPLACE REAR BUMPER, BOOT LID, REAR END PANEL, REPAIR REAR FENDER RH & LH, AND ALL OTHER AFFECTED AREAS, ADJUST AND ALIGN BODY GAPS ALIGNMENT TO THE SAME								✓ 2000.00
E	PNT88000	REMOVE & INSTALL PARKING SENSOR TO FACILITATE REPAIR								✓ 80.00
E	PNT88000	REMOVE & INSTALL REAR COMPARTMENT TRIMS TO FACILITATE REPAIR								✓ 120.00
E	PNT98000	RESPRAY ON REAR BUMPER, BOOT LID, REAR END PANEL, LH & RH REAR FENDER, AND ALL OTHER AFFECTED AREAS TO THE SAME								✓ 1750.00
A	90000001	CHECK WIRING & ELECTRICAL SYSTEM								✓ 30.00
A	10028901	CONDUCT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST AND CLEAR TROUBLE CODE								✓ 120.00
M	SUNDRY	SUPPLY C&C LOGO								✓ 40.00
M	SUNDRY	APPLY SEALANT ON ACCIDENT PORTIONS								✓ 80.00
M	SUNDRY	SUNDRIES								✓ 20.00
E	PNT88000	REPLACE LH & RH REAR COMB LAMP HOUSING, REPAIR REAR FLOOR PANEL								800.00
E	PNT98000	RESPRAY ON LH & RH REAR COMB LAMP HOUSING, AND REAR FLOOR PANEL								480.00
S	SPECIALISTJOB	SUPPLY ONE SET OF PARKING SENSOR								220.00
S	SPECIALISTJOB	SUPPLY & REPLACE REAR LICENSE PLATE WITH FRAME								50.00
X	COVER-RR BUMPER					1.00	✓ 651.00	20.00	520.80	
X	COVER-RR BUMPER LWR					1.00	✓ 241.00	20.00	192.80	
X	COVER-RR BUMPER FOG LAMP,RH					1.00	✓ 19.00	20.00	15.20	
X	LAMP ASSY-SIDE T/SIGNAL,RH					1.00	✓ 181.00	20.00	144.80	

This is not an official tax invoice.
 This is a computer generated document, no signature is required.



CYCLE & CARRIAGE

CYCLE & CARRIAGE KIA PTE LTD
PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65651240

**PRO-FORMA INVOICE**

Co Reg No : 199405410K

THIS IS NOT AN OFFICIAL TAX INVOICE

GST Reg No : MR-8500111-X

Invoice Name & Address	Owner Name & Vehicle Info
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPARTMENT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 64191000	Cust No/Name /LUO JUNYANG Reg No/Reg Date SMS9269D / 23/03/2020 Date In/Mileage 19/02/2021/ 16061 Chassis/Package KNAF3416ML5069456 /# Engine No G4FGKH755439 Make/Model KIA/CERATO 1.6 A EX G333 Colour/Trim CR5 RUNWAY RED / WK SATURN BLACK
19/02/2021	

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
LAX00000	Credit	11/03/2021/ 09:00	BLC	260 / AiTing	29149			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
X	BEAM-RR BUMPER				1.00	✓ 318.00	20.00	254.40
X	BRACKET-ASSY RR BPR SIDE UPR,R				1.00	✓ 31.00	20.00	24.80
X	BRACKET ASSY-RR BPR SIDE UPR,L				1.00	✓ 25.00	20.00	20.00
X	PANEL ASSY-TRUNK LID				1.00	✓ 1297.00	20.00	1037.60
X	PANEL ASSY-BACK				1.00	✓ 324.00	20.00	259.20
X	EMBLEM-CERATO				1.00	✓ 28.00	20.00	22.40
X	LOGO ASSY-KIA SUB				1.00	✓ 32.00	20.00	25.60
X	TRIM ASSY-TRUNK LID				1.00	✓ 202.00	20.00	161.60
X	W/STRIP-TRUNK LID OPNG				1.00	✓ 100.00	20.00	80.00
X	LAMP ASSY-REAR COMB INSIDE,LH				1.00	✓ 608.00	20.00	486.40
X	LAMP ASSY-CENTER GARNISH				1.00	✓ 690.00	20.00	552.00
X	COVER-RR BUMPER FOG LAMP,LH				1.00	✓ 19.00	20.00	15.20
X	LAMP ASSY-REAR COMB OUTSIDE,LH				1.00	✓ 675.00	20.00	540.00
X	LAMP ASSY-REAR COMB OUTSIDE,RH				1.00	✓ 675.00	20.00	540.00
X	LAMP ASSY-REAR COMB INSIDE,RH				1.00	✓ 608.00	20.00	486.40
X	PANEL ASSY-RR COMB LAMP HSG,LH				1.00	✓ 139.00	20.00	111.20
X	PANEL ASSY-RR COMB LAMP HSG,RH				1.00	✓ 135.00	20.00	108.00
X	STAY-RR BUMPER LH				1.00	65.00	20.00	52.00
X	STAY-RR BUMPER RH				1.00	65.00	20.00	52.00
X	CLIP				10.00	2.00	20.00	16.00
X	TRIM ASSY-RR TRANSVERSE				1.00	41.00	20.00	32.80
X	FILM-ANTI CHIPPG RH				1.00	27.00	20.00	21.60
Z	TEXT							
AIG OD CLAIM.								
DOA : 19.02.21								
SURVEYOR RASUL LKK 19.02.21								
POLICY NO: 2070051262								
Guarantee Your Warranty, Maintain with Cycle & Carriage!								

Parts	5,772.80	Nett	11,562.80
Labour	5,380.00	7% GST on	809.40
Standard Menu	0.00		
Specialist Job	270.00	Total Payable	12,372.20
Diagnostics Job	0.00		
Sundry/Others	140.00		
Total(w/o GST)	11,562.80		

This is not an official tax invoice.
This is a computer generated document, no signature is required.



Exceptional Journeys

INSURANCE CO. : AIG

Supplementary Parts For Registration No.:

SMS 9269 D

<u>Materials</u>	<u>Cost (\$)</u>
1 Panel assy-RR comb lamp hsg, LH <i>bt</i> ✓	139.00
2 Stay-RR bumper LH <i>bt</i> ✓	65.00
3 Stay-RR bumper RH <i>bt</i> ✓	65.00
4 Clips (x10) <i>neu</i> ✓	20.00
5 Trim assy-RR transverse <i>bt</i> ✓	41.00
6 Film-anti chippg RH <i>neu</i> ✓	27.00
	<hr/>
Total	357.00
Less 20% discount	71.40
Total after discount	285.60

<u>Labour</u>	<u>Cost (\$)</u>
1 Replace LH & RH rear comb lamp housing, repair rear floor panel	800.00 ✓
2 Respray on LH & RH rear comb lamp housing, and rear floor panel	480.00 ✓
3 Supply one set of parking sensor	220.00 ✓
4 Supply & replace rear license plate with frame	50.00 ✓
	<hr/>
Total Labour	1,550.00
Taxable amount	1,835.60
7% GST	128.49
	<hr/>
Grand total	<u>\$ 1,964.09</u>

Thank You.

Yours faithfully


LOI AI TING
Senior Officer - Admin
KIA SERVICE CENTRE
DID : 6568 4556 / 6568 4501
FAX : 6567 5258 / 6565 1240



HOME

Online



CERATO/FORTE../2020/G 1.6 MPI..

VCI





Fault Code Searching

Rescan

Erase All DTC

Go to DTC

Save

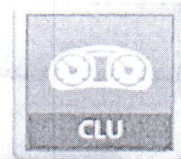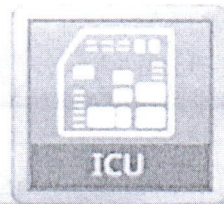

9/9

System	Status	Result
ENGINE	No Current DTC	Good
AT	No Current DTC	Good
ABSESC	No Current DTC	Good
AIRBAG	No Current DTC	Good
EPS	No Current DTC	Good
IBU-BC M	No Current DTC	Good

System	DTC	Description	State
No Current DTC			

S/W Ver.

M-E-K-01-00-0240

VCI Ver.

02.51

ECU Ver.

M-E-K-01-00-0181

OS Ver.

Android 10