

(08/11/13) wef

ASS. REC. BY: Ram

REF:

CS/CT121004495/Rivf3


10822

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: GBD 3339J
 at Workshop m/s: YONG SING MOTOR
 of 53, PERULANE 12
 Insured: _____
 Policy No. DMCVSNA00048312000
 Claims No. SNM21D202008/C01/LEWLC
 Sum Insured: _____ Excess: TDA 3000
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

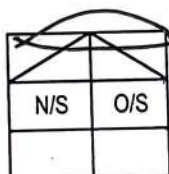

Bal. or Market Value: 31K
 IDAC Accident Rpt: _____ Consistent?: Yes or No
 GIA / PR Seen: _____ Consistent?: Yes or No
 Est. Repairs: _____ days Res.: Yes or No
 Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: GBD 3339J Yr Regn: 2014 / SEP
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or _____
 Make: Nissan NV350 9.V 2.5 SAT C.C. 2489
 Colour: GREY A/C: Insured / Std / NI / NA
 Sp. Reading: _____ T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: INIM C2E2620003024
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: Order / Jammed / Leaked / Burnt or
 Brake: Order / Jammed / Leaked / Burnt or
 Modi: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: 195R15C
 R: _____
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or _____
 Front _____ Rear _____
 R/Bal. 6 mm R/Bal. 6 mm
 L/Bal. 6 mm L/Bal. 6 mm
 D.O.A. 22/03/21 D.O.I. 09/04/21
 Survey held at YONG SING MOTOR
 Des. of Damages: Front / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time _____ Action / Instruction
Repair limit - 26K

28/5/21 LS \$19,150 confirmed by email (Red 26,814.70, 58%)

Date/Time, File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time, File Return to?

2) 31/5/21-Typist

Days Of Repair: 17

Resurvey No. of Trip: 1

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

Survey Fee:

Transportation:

S + RS, SI

Photos

Others

Report Format: Merimen

Lump Sum H.B.I: (\$ 19,150)

TOTAL


Yong Sing Estimate Repair

Section A - To be completed by Claims Advisor

Vehicle Registration Number : GBD3339J
Make / Model : NV350
Chassis No : JN1MC2E26Z0003024
Year of Manufacture : _____
Registration Date : _____
Type of Repair (TP/OD/WS) : OD
Date/Time of Accident : _____
Rental Vehicle : Yes / No
Remark :

Case Ref. : _____
No. : _____

The damages on the vehicle are as indicated in the following diagram :

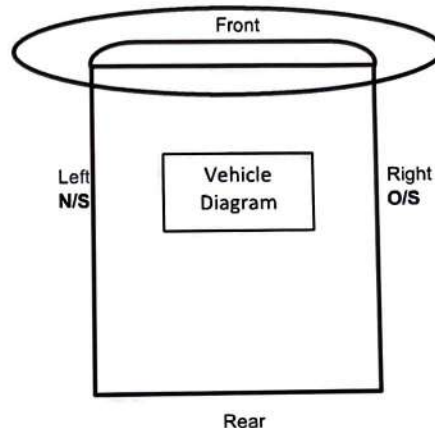

	Yong Sing estimate breakdown cost	Adjusted by Surveyor, if applicable
Total Labour Cost :	\$ <u>3,500.00</u>	\$ <u>-</u>
Total Spray Painting Cost :	\$ <u>2,100.00</u>	\$ <u>-</u>
Total Spare Parts Cost :	\$ <u>39,484.70</u>	\$ <u>-</u>
Other Charges :	\$ <u>880.00</u>	\$ <u>-</u>
TOTAL :	\$ <u>45,964.70</u>	\$ <u>-</u>
	Lump Sum Repair, if any :	\$ <u>-</u>
No. of Repair Days :	[20] days	[17] days

Surveyor Remark:

Passer
Hp 90010068
17 days
L/S
EXCESS: TBA

Rever
Resing after repair

Part 4 - Spare Parts / Material Usage

Item	Part Name	Part No	Qty	Cost Price (\$)	Mark up (10%)	Final Price (\$)	Repair @ Replace (/) (Yong Sing)	Repair @ Replace (/) (Survivor)
1	PANEL-FRONT,CENTER	F12023XAMA	1	\$748.00	10%	\$ 822.80	REPLACE (/)	buc /
2	FRONT EMBLEM		1	\$88.00	10%	\$ 96.80	REPLACE (/)	na /
3	FRONT PANEL-INNER LOWER,RH	612103XA1D	1	\$286.00	10%	\$ 314.60	REPLACE (/)	bt /
4	FRONT PANEL-INNER LOWER,LH	612113XA0A	1	\$286.00	10%	\$ 314.60	REPLACE (/)	bt /
5	PANEL ASSY-FRONT CORNER,RH	612603XA0A	1	\$253.00	10%	\$ 278.30	REPLACE (/)	bt /
6	FRONT INNER CORNER PANEL-SIDE,RH	612203XA0A	1	\$93.50	10%	\$ 102.85	REPLACE (/)	bt /
7	PANEL ASSY-FRONT CORNER,LH	612613XA0A	1	\$297.00	10%	\$ 326.70	REPLACE (/)	bt /
8	FRONT INNER CORNER PANEL-SIDE,LH	612213XA0B	1	\$104.50	10%	\$ 114.95	REPLACE (/)	repair /
9	REINFORCE-FRONT PANEL	612403XA0A	1	\$418.00	10%	\$ 459.80	REPLACE (/)	bt /
10	FASCIA-FRONT BUMPER	620223XA0H	1	\$385.00	10%	\$ 423.50	REPLACE (/)	de /
11	FRONT BUMPER REINFORCEMENT	620303XA0B	1	\$528.00	10%	\$ 580.80	REPLACE (/)	bt /
12	BRACKET-FRONT BUMPER SIDE,RH	622203XA0A	1	\$104.50	10%	\$ 114.95	REPLACE (/)	na /
13	BRACKET-FRONT BUMPER SIDE,LH	622213XA0A	1	\$104.50	10%	\$ 114.95	REPLACE (/)	na /
14	GRILLE ASSY-FRONT	623103XA0C	1	\$324.50	10%	\$ 356.95	REPLACE (/)	cm /
15	COVER ASSY-COWL TOP	668623XA0A	1	\$154.00	10%	\$ 169.40	REPLACE (/)	mis /
16	MOTOR ASSY-WINDSHIELD WIPER	288103XA0A	1	\$225.50	10%	\$ 248.05	REPLACE (/)	?
17	LINK ASSY-WIPER	288403XA0A	1	\$335.50	10%	\$ 369.05	REPLACE (/)	?
18	ARM ASSY-WINDSHIELD WIPER LH	288813XA0A	1	\$88.00	10%	\$ 96.80	REPLACE (/)	bt /
19	ARM ASSY-WINDSHIELD WIPER RH	288813XA0A	1	\$88.00	10%	\$ 96.80	REPLACE (/)	bt /
20	FRONT RH STEP PANEL INNER PANEL	G62403XAMA	1	\$286.00	10%	\$ 314.60	REPLACE (/)	bt /
21	FRONT LH STEP PANEL INNER PANEL	G62413XAMA	1	\$286.00	10%	\$ 314.60	REPLACE (/)	cm /
22	FLOOR PANEL -FRONT	743103XA2B	1	\$1,815.00	10%	\$ 1,996.50	REPLACE (/)	repair /
23	FRONT,INNER UPPER PILLAR- LH	762313XA0A	1	\$396.00	10%	\$ 435.60	REPLACE (/)	bt /
24	FRONT VERTICAL PILLAR,LOWER LH	762253XA0A	1	\$319.00	10%	\$ 350.90	REPLACE (/)	repair /
25	FRONT OUTER DOOR FRAME PANEL LH	G74133XAMB	1	\$880.00	10%	\$ 968.00	REPLACE (/)	3X
26	FRONT,INNER UPPER PILLAR- RH	762303XA0A	1	\$462.00	10%	\$ 508.20	REPLACE (/)	bt /
27	FRONT VERTICAL PILLAR,LOWER RH	762243XA0A	1	\$198.00	10%	\$ 217.80	REPLACE (/)	?
28	FRT PILLAR ASSY-CENTER,INNER LOWER RH	G65403XAMB	1	\$286.00	10%	\$ 314.60	REPLACE (/)	?
29	FRT PILLAR-CENTER,INNER UPPER RH	765303XA0A	1	\$264.00	10%	\$ 290.40	REPLACE (/)	?
30	FRONT OUTER DOOR FRAME PANEL RH	G74123XAMA	1	\$990.00	10%	\$ 1,089.00	REPLACE (/)	buc /
31	FRT PANEL-SIDE,OUTER CENTER SLIDING RH	G74183XBMA	1	\$1,045.00	10%	\$ 1,149.50	REPLACE (/)	bt /
32	FRT RH INNER DOOR MOULDING	769213XA0A	1	\$115.50	10%	\$ 127.05	REPLACE (/)	Tan /
33	GARNISH ASSY-FRONT PILLAR,RH	769113XA0A	1	\$115.50	10%	\$ 127.05	REPLACE (/)	de /
34	PLATE-KICKING,FRONT RH	769513XK1A	1	\$159.50	10%	\$ 175.45	REPLACE (/)	de /
35	DOOR ASSY-FRONT,RH	H010M3XAMB	1	\$858.00	10%	\$ 943.80	REPLACE (/)	buc /
36	OUTER MOULDING STRIP ASSY-FRONT DOOR ,RH	808203XA0A	1	\$126.50	10%	\$ 139.15	REPLACE (/)	tan /
37	HINGE ASSY-FRONT DOOR,UPPER RH	80401AX000	1	\$71.50	10%	\$ 78.65	REPLACE (/)	bt /
38	HINGE ASSY-FRONT DOOR,LOWER RH	80420AX000	1	\$71.50	10%	\$ 78.65	REPLACE (/)	bt /
39	WEATHERSTRIP-DOOR,LOWER FRONT RH	80836VW000	1	\$60.50	10%	\$ 66.55	REPLACE (/)	na /
40	SASH ASSY-FRONT DOOR,REAR RH	802163XA0B	1	\$60.50	10%	\$ 66.55	REPLACE (/)	na /
41	SEAL ASSY-FRONT DOOR INSIDE RH	808343XA0A	1	\$71.50	10%	\$ 78.65	REPLACE (/)	na /
42	WEATHERSTRIP-FRONT DOOR,RH	808303XA0C	1	\$104.50	10%	\$ 114.95	REPLACE (/)	na /
43	GLASS RUN RUBBER-FRONT DOOR,RH	803303XA0A	1	\$104.50	10%	\$ 114.95	REPLACE (/)	na /
44	GLASS ASSY-FRONT DOOR WINDOW,RH	803003XA0A	1	\$528.00	10%	\$ 580.80	REPLACE (/)	bro /
45	REGULATOR ASSY-DOOR WINDOW,RH	807203XA0A	1	\$176.00	10%	\$ 193.60	REPLACE (/)	bt /
46	MOTOR ASSY-REGULATOR,RH	807301HH1B	1	\$385.00	10%	\$ 423.50	REPLACE (/)	?
47	HANDLE ASSY-FRONT DOOR OUTSIDE,RH	806063XA0B	1	\$176.00	10%	\$ 193.60	REPLACE (/)	X
48	ROD-KEY LOCK,RH	805143XA0A	1	\$214.50	10%	\$ 235.95	REPLACE (/)	bt /
49	STRIKER ASSY-FRONT DOOR LOCK	80570AA20A	1	\$71.50	10%	\$ 78.65	REPLACE (/)	cut /
50	LOCK & REMOTE CONTROL ASSY-FRONT DOOR,RH	805003XY1A	1	\$214.50	10%	\$ 235.95	REPLACE (/)	?
51	HANDLE ASSY-DOOR INSIDE,RH	806703XA0B	1	\$82.50	10%	\$ 90.75	REPLACE (/)	de /
52	FINISHER ASSY-FRONT DOOR,RH	809003XA0A	1	\$291.50	10%	\$ 320.65	REPLACE (/)	cm /

[illegible]

Part 1 - Labour & Panel Beating Related Works

Job Scope	Yong Sing Estimate	Surveyor Adjustment
REMOVE AND REFIT DAMAGED ITEMS, PULL AND REALIGN VEHICLE FRAME. WELD AND REFIT NEW PARTS.	\$3,500.00	2000
Total Labour Cost	\$3,500.00	\$0.00

Part 2 - Spray Painting Related Works

Job Scope	Yong Sing Estimate	Surveyor Adjustment
SPRAY PAINT FRONT BUMPER	\$300.00	200
SPRAY PAINT FRONT PANEL	\$300.00	200
SPRAY PAINT RH CORNER PANEL.	\$250.00	100
SPRAY PAINT RH DOOR	\$300.00	200
SPRAY PAINT RH FLOOR BOARD	\$300.00	200
SPRAY PAINT RH DOOR FRAME.	\$300.00	200
SPRAY PAINT INTERIOR FIREWALL	\$350.00	200
Total Spray Painting Cost	\$2,100.00	\$0.00

Part 3 - Other Costs - Accident Repair Related Expenses

Job Scope	Yong Sing Estimate	Surveyor Adjustment
REMOVE AND REFIT FRONT WINDSCREEN	\$120.00	120
PULL AND REALIGN FRONT CHASSIS.	\$400.00	200
CONDUCT SYSTEM WIRING CHECK.	\$120.00	60
CONDUCT LEAKAGE TEST.	\$120.00	50
CONDUCT BRAKE BLEEDING TEST.	\$120.00	60
Total Other Costs	\$880.00	\$0.00

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	08/04/2021 10:09 (SGT)
Date of Accident	22/03/2021 08:00 (SGT)
Exact Location of Accident	Penjuru Rd, 609128 24, Singapore 609128
Additional Location Information	CWT COMMODITY HUB
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	GBD3339J
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	ABWIN LEASING PTE LTD
Company Reg No	2XXXXX802Z
Email Address	coletteteo@abwinleasing.sg
Mobile Phone No	(Phone) +65-88389699
Alternative Phone No	(Office) +65-88389699

VEHICLE PARTICULARS

Manufacturer	Nissan
Model	Nv350
Variant	-
Exact purpose for which vehicle was being used at time of accident	Employment
Are you claiming under your own insurance policy for repair to your vehicle?	No - Reporting only
Vehicle Category	Commercial vehicle
Transmission	Auto
CC	2488

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	Yes
Policy Number	DMCVSNA00048312000
Cover Note Number	-

DRIVER

Name of Driver	GOH CHONG HAN
NRIC No	SXXXX694B

Date Of Birth 30/12/1999
 Occupation Outdoor
 Date Of Driving Pass 19/06/2019
 Driving experience 1 YEAR AND 9 MONTHS
 Gender Male
 Mobile Number
 Alt. Phone Number (Phone) +65-88160929
 Email Address
 Address coletteteo@abwinleasing.sg
 Address complement BLK 275C JURONG WEST ST 25 #12-81
 Postcode 643275
 Is the driver the policyholder? No
 If No, Relationship of the Driver with the Insured Paid Driver
 Does Driver Own Other Vehicles? No
 Vehicle Registration Number of Other Vehicle Owned by Driver
 Insurance Company of Other Vehicle Owned by Driver

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident Hit by fallen tree / Other objects
 Weather Conditions Clear
 Road Surface Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident? No
 Number of vehicles involved in the accident 1
 Was anybody injured in the Accident? Yes
 Was any injured conveyed to hospital by ambulance? Yes
 Was any other material or property damaged? No
 Number of Passengers (Including Driver) 1
 Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance? No

DETAILS OF POLICE ACTION

Was the accident reported to the police? No
 Was notice of intended Prosecution given? No
 If yes, against whom?

CIRCUMSTANCES OF ACCIDENT

I WAS TRAVELLING TO 24 PENJURU CWT COMMODITY HUB TO COLLECT MY PARCELS FOR MY DELIVERY. I DROVE TO THE LOADING / UNLOADING BAY AS USUAL. ALL OUT OF SUDDEN MY VEHICLE COLLIDED ONTO AN OBJECT WHICH PARKED OUT OF THE PARKING LOT.

DUE TO THE BAD DAMAGED I WAS STUCKED ON MY SEAT AND INJURED MYSELF. SCDF AND AMBULANCE REACHED TO ASSIST AND I WAS SENT TO HOSPITAL.

ATTACHMENT(S)

Are accident photos available for attachment? Yes
 Was there any video captured by Car Camera? No
 Was there any audio recorded? No

INJURED PERSONS DETAILS

INJURED 1

Name of injured person GOH CHONG HAN
 Address BLK 275C JURONG WEST ST 25 #12-81
 Address Complement
 Post Code 643275

Approximate Age Years Old	-
Injuries Sustained	-
Injured person in which vehicle?	GBD3339J
Were seat belts worn?	-
Was this injured conveyed to hospital by ambulance?	Yes

IMPORTANT NOTICE

SKETCH PLAN

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)
I understand, acknowledge, agree and consent that:
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' law firm/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
(ii) investigating the accident and/or my claims;
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
(collectively the "Purposes")
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' law firm/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their law firm/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.




Policyholder's Signature / Date & Time

Driver's Signature (If driver is not policyholder) / Date & Time

Witness by Reporting Centre Personnel

Sketch Plan

24 PENJURAN CANT COMMERCIAL HUB.

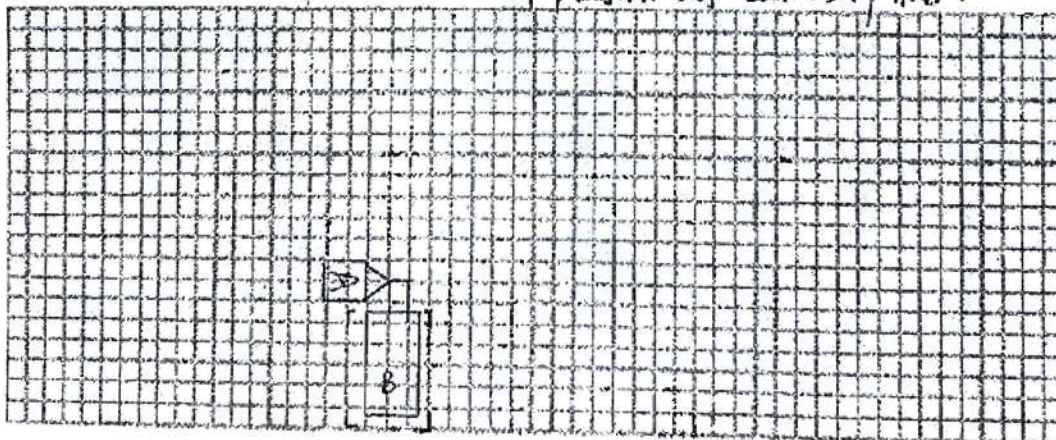

A : GBD3339]
B : container

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Company
Owner ID:	082Z
Vehicle No.:	GBD3339J
Vehicle to be Exported:	No
Intended Deregistration Date:	12 Apr 2021
Vehicle Make:	NISSAN
Vehicle Model:	NV350 PANEL VAN 2.5 5AT 5DR EURO V
Primary Colour:	Silver
Manufacturing Year:	2014
Engine No.:	YD25355255A
Chassis No.:	JN1MC2E26Z0003024
Maximum Power Output:	-
Open Market Value:	\$24,940.00
Original Registration Date:	15 Sep 2014
First Registration Date:	15 Sep 2014
Transfer Count:	5
Actual ARF Paid:	\$1,247.00
PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
COE Expiry Date:	14 Sep 2024
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	10
PQP Paid:	\$13,934.00
COE Rebate Amount:	\$4,798.00
Total Rebate Amount:	\$4,798.00

The information contained herein is correct as at 12 Apr 2021

OK



**SIM ONLY NO
CONTRACT
\$20 FOR 40GB**

► **SEARCH** Nissan NV350 Price Range ▼ Depreciation ▼ 2014 ▼ Vehicle Type ▼ Search View All Advanced Search

Home » Used Cars » Bell Auto Pte Ltd » Nissan NV350 2.5M

Nissan NV350 2.5M

[Overview](#) [Financial](#) [Accessories](#) [Similar](#) [Research](#) [Photos](#) [Map](#)



WHOLESALE
EXPERIENCE AT YOUR
CONVENIENCE

Price	\$31,800	Lifespan	18-Sep-2034
Depreciation ⓘ	\$9,250 /yr View models with similar depre	Reg Date	19-Sep-2014 (3yrs 5mths 6days COE left)
Mileage	N.A.	Manufactured ⓘ	2014
Road Tax ⓘ	N.A.	Transmission	Manual
Dereg Value ⓘ	\$15,137 as of today (change)	OMV ⓘ	\$23,804
COE ⓘ	\$44,025	ARF ⓘ	\$1,191
Engine Cap	2,488 cc	No. of Owners ⓘ	1
Curb Weight ⓘ	1,800 kg		
Type of Vehicle	Van		

Features

View specs of the Nissan NV350 (2015-2020)

Description

Look Cool With A Black NV350! Manual & 5 Doors Van. In A Very Good Condition. View To Believe. High Trade In And High Loan Available! Protected With Our 6 Months Warranty And Free 3 Servicing! Call Now!

Category

Status

Available for sale. Shortlist this car to get alerted whenever the price or availability changes.

Resources



Vehicle Evaluation

Afraid of lemons? Request to have this car evaluated professionally. Find out more



Car Valuation - Free


Find out the market value of your existing car for free. Get started



Location Map

Price Chart

Summary

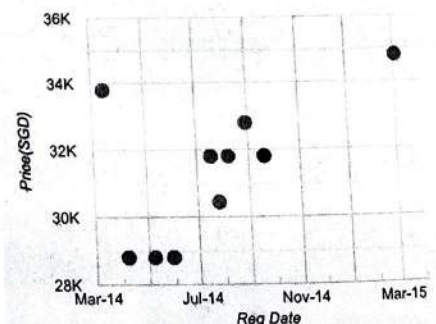

Click on the point to view the vehicle

Shortlist
 Compare
 Report Error
 More

Seller Information

Bell Auto Pte Ltd

52 vehicles for sale. 46 sold in past 3 mths

8 Tuas Avenue 18 (Level 5 & 7)

Tel: 67457076

Posted on: 05-Apr-2021 | Last Updated on: 05-Apr-2021

Up!

» more Financial Info