08/11/13) wef REF: CS CTT:	2100 4546 Ritf3 0822
ASS. REC. BY Y MALL	ASSIGNMENT
Date	Veh No: GBF 1282R Yr Regn: 2016 / Jun
From: Date:	Veh No:GBF 1282P Yr Regn:>o16 / JuW Type: M.Car / M.Cycle / Bus /Van/ Lorry / Taxi / Prime Mover /
Estimated Cost:	Truck / Trailer or
To Increast Vicinica No	Make: NISSAN NUZON 15M c.c 1461
To Inspect Vehicle No: GBF 1282R	Colour GREY A/C: Insured / Std / NI / NA
at Workshop m/s Youh Snuh MOTUR	Sp.Reading 137 450 T/Radio: Insured / Std / NI / NA
of 53,00km (2 nsured: CTI	Eng/No:
Policy No.	C/No: USKYBAM 2020 125-285
Claims No.	Gen. Cond: Good / Fairl Poor / Burnt
Sum Insured: Excess: 15th	Steering: Inforded / Jammed / Leaked / Burnt or
(Client's Record)	Brake: Inorder / Jammed / Leaked / Burnt or
Make of Veh:	Modi: Nii / S/Rim / STD A/Rim or
	Tyre Size: F: 175/70R14C
(Policy Condition)	R: (13) 1010 (C
Remark; The veh had commenced its N/S	O/S BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
repair at the time of inspection.	TOYO/YOKO or HABILLAND
Bal. or Market Value: 43K	Front Rear
IDAC Accident Rport: Consistent? : Yes or No	R/Bal. 6 mm R/Bal. 6 mm
GIA / PR Seen: Consistent?: Yes or No	L/Bal. L/Bal. 6 mm
Est. Repairs: days Res.: Yes or No	D.O.A. 31/03/21 D.O.I. 12/64/21
Lum Sum: % 3 Val.: Yes or No	Survey held at YONG SINK MAIN
	Des. of Damages/Fit/ Rear / O/S / N/S / U/C / Rooftop or
CA / REV / REP. / 24 HRS	
Date: Person Contacted:	The U/C / Chassis frame / Body Structure affected due to collision.
Date / Time Action / Instruction	
Report 1 nist - 18K	
Date/Time, File Pass to? : Preli. Report	Days Of Repair:
1) : Final Report	Resurvey No. of Trip: Survey Fee:
Date/Time, File Return to?	Transportation:
2)	.dd Fee: : Site Insp (\$)s+Rs,sl
	: Interview (\$ ) Photos
Report Format :	: Tech. Invs (\$ ) Others
Lump Sum / I.B.I: (\$	· Weekend (\$

		MOTOR			. Domain			_		
				Yong Sing Estimat						
Vehicle Registration Number :		GBF 1282 R			Case	Ref. ;				-
Make / Model :		NISSAN NV2	00			110.				
Chassic No :	į.	VSKYBAM202	0125285						hicle are as g diagram :	
Year of Manufacture :	1						incated in the	Front		
Registration Date :						$\overline{}$		Tion		
Type of Repair : (TP/OD/WS)	0000					+				
Date/Time of : Accident						Left N/S		ehicle iagram		Right O/S
Rental Vehicle :		Yes / No							_	
Remark :										
								Rear		
	115									
			Yong Sing	gestimate breakdown cost		Adjusted	d by Surv	eyor, if a	pplicable	
Total Labour Cost		:	\$	2,000.00		_\$_				
Total Spray Painting C	ost	:	\$	1,450.00		\$				
Total Spare Parts Cost	t	:	\$	15,645.63		_\$_				
Other Charges		:	\$	750.00		\$				
TOTAL		:	\$	19,845.63		_\$				
				Lump Sum Re	epair, if any:	\$	1			
No. of Repair Day	/s	:	[ 20]	days		Ι	(0	]	days	
			100	S						
$Q_{\mathbf{A}}$	<b>Q</b> .1			Surveryor Rem	nark:					
V41	יו	~	i	excess: 15h	)					
, H	KASIL EXCESS: 15W  Hp 90010068 Remont  10 days 295m after repoint  US									
TKNAG (										
10 days gasmatter your										
	L	18 '								
	L	18								

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

# Part 1 - Labour & Panel Beating Related Works

Job Scope	Yong Sing Estimate	Surveyor Adjustment
TO REMOVE AND REFIT DAMAGED ITEMS, TO STRAIGHT FRONT VEHICLE FRAME, CUT AND WELD SUPPORT PANEL FOR REPAIR PURPOSE.	\$2,000.00	(000
Total Labour Cost	\$2,000.00	\$0.00

# Part 2 - Spray Painting Related Works

Job Scope	Yong Sing Estimate	Surveyor Adjustment
SPRAY PAINT FRONT BONNET.	\$300.00	2.00
SPRAY PAINT LH FENDER.	\$200.00	200
SPRAY PAINT RH FENDER.	\$200.00	Sw
SPRAY PAINT SUPPORT PANEL	\$200.00	200
SPRAY PAINT FRONT BUMPER.	\$300.00	*
SPRAY PAINT LH/RH TOP WHEEL GUARD AREA	\$250.00	ýw
Total Spray Painting Cost	\$1,450.00	\$0.00

# Part 3 - Other Costs - Accident Repair Related Expenses

Job Scope	Yong Sing Estimate	Surveyor Adjustment
CONDUCT SYSTEM WIRING CHECK.	\$120.00	30
TOP UP AIR CON GAS.	\$80.00	bu
REMOVE AND REFIT FRONT WINDSCREEN FOR REPAIR.	\$120.00	×
REALIGN FRONT CHASSIS.	\$350.00	200
CONDUCT LEAKAGE TEST.	\$80.00	30
Total Other Costs	\$750.00	\$0.00

em	Part Name	Part No	Qty	Cost Price (\$)	Mark up (10%)	F	inal Price (\$)	Replace ( /	1 1000
- 1	FRONT BUMPER		1	\$390.00	10%	\$	429.00	(Yong Sing) REPLACE (	(Surveyor
-	BRACKET-FRONT BUMPER SIDE,RH		1	\$123.50	10%	\$	135.85	REPLACE (	oh/
- /	BRACKET-FRONT BUMPER SIDE,LH		1	\$123.50	10%	\$	135.85	REPLACE (/	
	FRONT BUMPER FOGLAMP COVER, LH		1	\$201.50	10%	\$	221.65	REPLACE (/	X
_	FRONT BUMPER FOGLAMP COVER,RH		1	\$201.50	10%	\$	221.65	REPLACE (/	X
$\rightarrow$	ABSORBER-ENERGY, FRONT BUMPER		1	\$351.00	10%	\$	386.10	REPLACE (/	Ca/
-	REINFORCEMENT ASSY-FRONT BUMPER		1	\$377.00	10%	\$	414.70	REPLACE (/	bt/
	BUMPER-FRONT,LH		1	\$266.50	10%	\$	293.15	REPLACE (/	X
-	BUMPER-FRONT,RH . GRILLE ASSY-FRONT		1	\$266.50	10%	\$	293.15	REPLACE (/)	X
10	0 0 0 000 000		1	\$351.00	10%	\$	386.10	REPLACE (/)	MIS/
•	MOULDING ASSY-RADIATOR GRILLE		1	\$253.50	10%	\$	278.85	REPLACE (/)	ALL OF
	SUPPORT-RADIATOR CORE,UPPER		1	\$442.00	10%	\$	486.20	REPLACE (/)	41
13	SUPPORT ASSY-RADIATOR CORE,LOWER		1	\$455.00	10%	\$	500.50	REPLACE (/)	7
14	SUPPORT-RADIATOR CORE,UPPER LH		1	\$58.50	10%	\$	64.35	REPLACE (/)	1541
15	SUPPORT-RADIATOR CORE,UPPER RH		1	\$58.50	10%	\$	64.35	REPLACE (/)	4/
16	SUPPORT-RADIATOR CORE SIDE,RH		1	\$65.00	10%	\$	71.50	REPLACE (/)	?
17	SUPPORT-RADIATOR CORE SIDE,LH		1	\$65.00	10%	\$	71.50	REPLACE (/)	7.
18	AIR GUIDE-FRONT,LH		1		10%	\$	57.20	REPLACE (/)	1.1
19	AIR GUIDE-FRONT,RH		1	\$52.00	10%	\$	57.20	REPLACE (/)	mis/
20	AIR GUIDE-FRONT	ne reg	1	\$52.00 \$52.00	10%	\$	57.20	REPLACE (/)	7
21	AIR GUIDE-FRONT		1	\$52.00	10%	\$	57.20	REPLACE (/)	1
22	FENDER-FRONT,LH		1	\$351.00	10%	\$	386.10	REPLACE (/)	teran
23	FENDER-FRONT,RH		1		10%	\$	386.10	REPLACE (/)	11
24	PROTECTOR-FRONT FENDER,LH		1	\$351.00	10%	\$	157.30	REPLACE (/)	7
25	PROTECTOR-FRONT FENDER,RH	E	1	\$143.00	10%	\$	157.30	REPLACE (/)	?
26	FENDER INNER PANEL,RH		1	\$143.00 \$585.00	10%	-	643.50	REPLACE (/)	W/
27	FENDER INNER PANEL LOWER		1	\$208.00	10%	\$	228.80	REPLACE (/)	7
28	FENDER INNER PANEL,LH		1	\$585.00	10%	\$	643.50	REPLACE (/)	1
29	FENDER INNER PANEL LOWER		1	\$208.00	10%	\$	228.80	REPLACE (/)	7
30			1	\$520.00	10%	\$	572.00	REPLACE (/)	b+1
31			1	\$62.40	10%	\$	68.64	REPLACE (/)	14/
32			1	\$62.40	10%	\$	68.64	REPLACE (/)	41
33	MALE ACCVIDED LOCK		1	\$104.00	10%	\$	114.40	REPLACE (/)	de/
34	CARLE 400V/1100D 1 0 01/ 0 01/00		1	\$97.50	10%	\$	107.25	REPLACE (/)	4/
35	2014/1 707 4001/		1	\$39.00	10%	\$	42.90	REPLACE (/)	?
36	OLAGO MUNDOLUELD		1	\$299.00				REPLACE (/)	?
38	DAM-RUBBER.SEALANT		1	\$780.00				REPLACE (/)	X
39	RADIATOR ASSY		1	\$240.50	_	5		REPLACE (/)	X
40	HOSE-RADIATOR,LOWER		1	\$650.00				REPLACE (/)	4/
41	HOSE-RADIATOR,UPPER		1	\$91.00				REPLACE (/)	7.
42	MOTOR & FAN ASSY-W/SHROUD		1	\$117.00				REPLACE (/)	7
43	TANK ASSY-RADIATOR RESERVOIR	Bright Company	1	\$546.00				REPLACE (/)	•
44	ALTERNATOR		1	\$104.00	1 19 19 1			REPLACE (/)	(3/
45	HEADLAMP ASSY-RH		1	\$1,820.00				REPLACE (/)	× 100 (
46	HEADLAMP ASSY-LH		1	\$364.00				REPLACE (/)	500/
47	CONDENSER & LIQUID TANK ASSY		1	\$364.00				REPLACE (/)	14
48	TUBE ASSY-INLET INTERCOOLER		1	\$624.00		- Sign		REPLACE (/)	5+/
49	TUBE ASSY-INLET INTERCOOLER	The state of	1	\$312.00					2m/
		24		\$195.00	.570	* '	17.00	REPLACE (/)	•

TOTAL MATERIAL: \$ 14,223.30

\$ 15,645.63

# SINGAPORE ACCIDENT STATEMENT

#### IMPORTANT NOTICE

- Please report <u>correctly</u> the details of the accident to speed up the claims process.
- 1. Please report correctly the details of the accident to speed up the claims process.
  2. This Form must be completed by the Policyholder and/or the Authorised Driver
  3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or witholding of material facts may allow insurance companies to repudiate

- Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or witholding of material facts may allow insurance companies to repudiate 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
   Any false reporting may be referred to the Police for investigation.
   This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
   By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

# **ACCIDENT STATEMENT**

DETAILS OF	OWN VEHICLE
Vehicle Registration Number	GBF1282R
INSURED/POLICYHOLDER	
s company? Name Of Registered Owner Company Reg No Email Address Mobile Phone No Alternative Phone No	Yes ABWIN LEASING PTE LTD 2XXXXX082Z joeychow@abwinleasing.sg (Phone) +65-88389699 (Office) +65-88389699
VEHICLE PARTICULARS	
Manufacturer  Model  Variant  Exact purpose for which vehicle was being used at time of accident  Are you claiming under your own insurance policy for repair to your vehicle?  Vehicle Category  Transmission	Nissan Nv200 - Private hire  Yes Goods vehicle Manual 1461
INSURANCE COMPANY	
ame of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	Yes
Policy Number	DMCVSNA00048312000
Cover Note Number	-

## DRIVER

Name of Driver	 LEE JIAN WAH
Passport No/FIN	 GXXXX430M

₽₽I

K4

Tech. Invs (\$

136

137

138

139 140

> 141 142

143

145 146

147 148

149

150 151

152 153

15

15

15

15

15

dress complement	-	
dress complement	-	
Insurance Company Name	-	
Nature Of Damage	-	
Details of property damaged in accident  No. Of Passenger (Including Driver)	-	
No. Of Passenger (including Driver)	_	

## SKETCH PLAN

#### IMPORTANT NOTICE

- 1. Please report correctly the details of the accident to speed up the claims process.
- 2. This Form must be completed by the Policyholder antifor the Authorised Univer-
- 3. Information provided must be as truthful and accurate as possible. Any willul misrepresentation or withholding of material facts may allow insurance companies to repudiate policy flability.
- 4. The issue and acceptance of this Form by insurance companies is not un admission of policy liability on the part of the insurance companies.
- 6. Any take reporting may be referred to the Police for investigation
- 6. The report will be forwanted by the insurers of the GIA Records Monogoripal Course calabished by the General Insurance Association
- of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
- 7. By the ladgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
- 6. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer , my w orkshop and the General Insurance Associoputs of Singapore ( GIA ) maybe permitted to collect, use, disclose and/of process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) w he have insured vehicle(s) involved in this accident (all insurer(s) who have moved vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the insurers' law yers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
- (i) processing, handling and/or dealing with any claims including the solutionent of the claims and any necessary investigations relating to the claims.
- (ii) investigating the accident and/or my claims:
- (iii) carrying out another dealing with my instructions or responding to any enquiries by me;
- (iv) administrating my claims (including the mailing of correspondence, statements, lavolces, reports or notices to me, which could involve disclosure of corbin personal data about me to bring about delivery of the sume as well as on the external caver of envelopes/mall
- (v) complying with applicable law in administering, processing, handling and/or dealing with my deims. (collectively the "Furposes")
- (b) all insurer(s) who have insured vehicle(s) sworked in this accident and the insurers' law yearliew firms, maylare permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal information mayican be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their law yers/law firms), which may be slied outside of Singapore, for one or more of the above Purposes.




Policyhold

Driver's Signature (If driver is not policyholder) / Date & Time

Witness by Reporting Centre Personnel

#### Sketch Plan

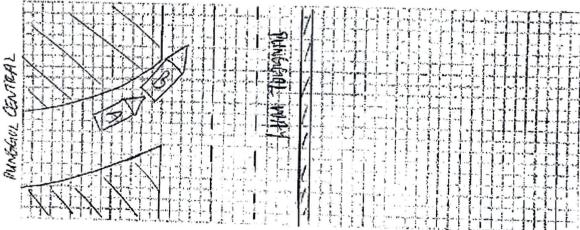

A: BBF1282R

8: 4P3249A



ock to OneMotoring


quire PARF/COE Rebate for Registered Vehicle

Comparation and the second reasonable	Marie Company Company Company
Owner ID Type:	Company
Owner ID:	082Z
Participation of the second se	
Vehicle No.:	GBF1282R
Vehicle to be Exported:	No
Intended Deregistration Date:	13 Apr 2021
Vehicle Make:	NISSAN
Vehicle Model:	NV200 1.5 MT ABS AIRBAG 2WD 6DR E5 W/RC
Primary Colour:	White
Manufacturing Year:	2016
Engine No.:	K9KC400D055519
Chassis No.:	VSKYBAM20Z0125285
Maximum Power Output:	-
Open Market Value:	\$20,513.00
Original Registration Date:	28 Jun 2016
First Registration Date:	28 Jun 2016
Transfer Count:	1
Actual ARF Paid:	\$1,026.00
(4)在1996年度的美国基础的特殊的可以与自由于1000年。	integra material de la company de la presentación de la company de la company de la company de la company de l
PARF Eligibility:	No
PARF Eligibility Expiry Date:	
PARF Rebate Amount:	\$0.00
COE Expiry Date:	27 Jun 2026
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	10
QP Paid:	\$46,434.00
COE Rebate Amount:	\$24,171.00
Total Rebate Amount:	\$24,171.00
The second secon	

The information contained herein is correct as at 13 Apr 2021



# SIGN UP FOR A NEW LINE BEST SIM ONLY DEAL



Home » Used Cars » Car (S) Pte Ltd » Nissan NV200 1.5M

# Nissan NV200 1.5M

Overview

**Financial** 

**Accessories** 

Similar

Research

**Photos** 

Мар

PREMIUM AD



Price	\$43,800	Lifespan	26-Jun-2036
Depreciation ②	\$8,410 /yr View models with similar depre	Reg Date	27-Jun-2016 (5yrs 2mths 13days COE left)
Mileage	68,185 km (14.2k /yr)	Manufactured ⑦	2016
Road Tax ⑦	N.A.	Transmission	Manual
Dereg Value ①	\$24,171 as of today (change)	OMV ⑦	\$20,513
COE ②	\$46,434	ARF ⑦	\$1,026
Engine Cap	1,461 cc	No. of Owners ⑦	1
Curb Weight ⑦	1,260 kg		
Type of Vehicle	Van		
Features			

View specs of the Nissan NV200 Petrol (2011)

# Description

ONLY 1 METICULOUS OWNER WITH GENUINE LOW MILEAGE! 3 MONTHS WARRANTY INCLUDED! Super Well Maintained, Own This Unit Today With No Worries! Best Medium Van In The Market For Your Business Transportation! Straightforward Loan Application With Up To 100% Available! Fast Approval Process & Even Faster Handover! Call/Whatsapp Our Sales Consultants To Arrange Viewing Today!

## Category

Premium Ad Car

# Status

Available for sale. Shortlist this car to get alerted whenever the price or availbility changes.

#### Resources



## **Vehicle Evaluation**

Afraid of lemons? Request to have this car evaluated professionally. Find out more



## Car Valuation - Free

Find out the market value of your existing car for free. Get started





ited on: 12-Apr-2021

https://www.sgcarmart.com/used\_cars/info.php?ID=955155&DL=2976
























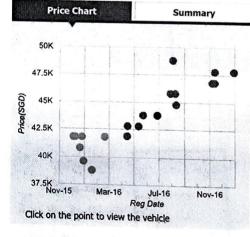



Seller Information

Car (S) Pte Ltd