

REC. BY:

Steve

CS/CTI21004590/Evf3

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured: SMJ 5500J

Policy No. DMPCSNW00016822100

Claims No. SNM21D202042/C02/LEWLC

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

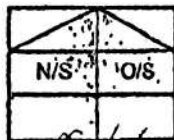

Bal. or Market Value:

IDAC Accident Report: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: days Res.: Yes or No

Turn Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: Person Contacted:

Veh No:

SKV 2919R

Yr Ragn:

26/2/19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Hyundai T30

c.c

1353

Colour:

Navy

A/C:

Insured / Std / NI / N

Sp. Reading

44693

T/Radio: Insured / Std / NI / N

Eng/No:

C/No:

TNIAH 3513KJ106807

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: NII / S/Rm / STD A/Rm or

Tyre Size:

F:

205/55R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Hankook

Front

Rear

R/Bal.

5

mm

R/Bal.

5

mm

U/Bal.

5

mm

U/Bal.

5

mm

D.O.A.

7/4/21

D.O.A.

14/4/21

Survey held at

Xin Yun

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision

Date / Time Action / Instruction

MV-82K

Date/Time, File, Pass to?



: Prel. Report



: Final Report

Date/Time, File Return to?

22/4/21-Typist

Days Of Repair: 4

Resurvey No. of Trip: 1

Survey Fee:

Transportation:

S + RS \$

Photos

Others

TOTAL

Add Fee:



: Site Insp (\$



: Interview (\$



: Tech. Inve (\$



: Weekend (\$

Formed: Merimen

ump sum / L.B. : LS \$3000



Xin Yun Auto Private Limited

辛运汽车服务有限公司

Tel: 6634 0858 Email: xinyunautol@gmail.com

Blk 8 Kaki Bukit Avenue 4 #05-23 Premier Singapore 415875

V
SKC2919R Hyundai

No	Qty	Parts Description	Estimated Parts Price
1	1	Rear bumper assy / 00	\$ 850.00
2	1	Rear bumper left bracket ? - DR	\$ 68.00
3	1	Rear bumper right bracket ? - DR	\$ 68.00
4	1	Rear bumper left retainer ? X	\$ 65.00
5	1	Rear bumper right retainer ? X	\$ 65.00
6	1	Rear bumper tow cover X	\$ 88.00
7	2	Bumper side cover ? (RH) - CR4	\$ 220.00
8	1	Bumper lower lip - CR1	\$ 685.00
9	1	Bumper lower side support ?	\$ 225.00
10	1	Bumper lower side support	\$ 225.00
11	1	Bumper lower trim ?	\$ 258.00
12	1	Rear tailgate rubber garnish X TN	\$ 372.20
13	1	Rear reinforcement ? - BR	\$ 676.30
14	1	Rear boot assy +	\$ 995.00
15	1	Boot lid outer garnish X	\$ 225.60
16	1	Rear tailgate emblem X	\$ 85.00
17	1	Rear tailgate weatherstrip - TN	\$ 275.00
18	1	Rear boot lock mechanism X	\$ 280.00
19	1	Boot lower lock cover X	\$ 48.00
20	1	Rear tailgate inner trim board X	\$ 375.00
21	1	Tailgate internal board X	\$ 350.00
22	1	Rear fender trim left (inside boot) X	\$ 425.00
23	1	Rear fender trim right (inside boot) X	\$ 425.00
24	1	Pull pocket / on bonnet X	\$ 88.00
25	1	Rear tailgate no plate lamp X	\$ 65.00
26	1	Bumper lower light left X	\$ 225.00
27	1	Bumper lower light right X - CR4	\$ 225.00
28	1	Rear left taillamp X	\$ 695.00
29	1	Rear right taillamp X	\$ 695.00
30	2	Rear tailgate damper / impact big got sounds X	\$ 400.00
31	1	Rear end lower panel / bent badly ? X R	\$ 580.00
32	2	Edge molding / middle panel X	\$ 220.00
33	1	Rear end tool box big cover X	\$ 385.00
34	1	Top tool board X	\$ 550.00
35	1	Floor panel control / spare tyre panel X	\$ 585.40
36	1	Rear quarter panel left X	\$ 325.00
37	1	Rear quarter panel right X	\$ 325.00
38	1	Rear end lower panel top garnish ? X	\$ 225.00
39	1	Rear exhaust cover X	\$ 195.00
40	1	Rear exhaust muffler assy X	\$ 680.00
41	3	Rear exhaust muffler mounding X	\$ 90.00
42	1	Antena, electrical key ? X	\$ 185.00
			\$ 14,087.50



Xin Yun Auto Private Limited

辛运汽车服务有限公司

Tel: 6634 0858 Email: xinyunautol@gmail.com

Blk 8 Kaki Bukit Avenue 4 #05-23 Premier Singapore 415875

✓
SK2919R Hyundai

			Estimated Parts Price
No	Qty	Parts Description	
<u>Special Nett Items</u>			
1	10	Rear bumper clips — MK	\$ 80.00
2	6	Rear end lower panel top garnish clips ? X	\$ 50.00
3	1	Rear end lower panel sealant ? X	\$ 120.00
4	8	Rear tailgate inner trim board clips X	\$ 50.00
5	6	Rear tailgate outer garnish clips X	\$ 50.00
6	1	Rear floor panel insulator pad X	\$ 150.00
7	1	Rear floor panel sealant X	\$ 120.00
8	1	Rear windscreen glass sealant X MK	\$ 80.00
9	3	Rear windscreen mounding X MK	\$ 320.00
10	2	Rear bumper reverse sensor — SL1	\$ 250.00 770 -
11	1	Rear no plate with garnish — OT	\$ 80.00 45
12	1	Number plate setting X	\$ 105.00
13	2	inner coating protection — MK	\$ 30.00 ✓
14	1	PU420 black / car body waterproof — MK	\$ 45.00 30 ✓



Xin Yun Auto Private Limited
 幸运汽车服务有限公司
 Tel: 6634 0858 Email: xinyunauto1@gmail.com
 Blk 8 Kaki Bukit Avenue 4 #05-23 Premier Singapore 415875

SK02019R Hyundai

No	Description	Labour Charges	
1	Labour for panel beating, cut, weld, straighten rear affected area	\$ 2,000.00	400 600
2	To putty and spray painting rear portion.	\$ 1,800.00	400 600
3	To check rear lighting and wiring.	\$ 50.00	30
4	To remove and install rear tailgate lock mechanism.	\$ 80.00	50 X
5	To remove & install rear windscreen glass to facilitate the repair.	\$ 150.00	100 X
6	To apply anti rust proofing to rear affected area including behind spare tyre area	\$ 250.00	30
7	To remove and install rear end panel	\$ 120.00	1 X
8	To remove and install rear bumper reverse sensor.	\$ 80.00	30
9	To remove and install rear exhaust muffler assy.	\$ 120.00	X
10	To remove and interal side fender trims to facilitate the repair	\$ 180.00	X
11	To remove the celling to facilitate the repair	\$ 250.00	X
12	To remove and install rear camera	\$ 80.00	30
13	To remove the behind windscreen to faciltete change boot	\$ 150.00	X
14	To remove boot middle glass panel to faciltate the repair	\$ 120.00	X
15	To remove both side roof side panel, adjust the squeeze and dent	\$ 250.00	X
Total labour :		\$ 5,680.00	

Steve CLKK)
 14/4/21, 1.30pm

Total parts : 15,617.50
Total labour : 5,680.00
Total repair cost : 21,297.50

WIL PL

L/S

Ry M SLJ
 4 dys

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SA0A2149000C / Ajax Mars Pte Ltd
ENTRY DATE & TIME: 10/04/2021 05:14 (SGT)
SUBMITTED BY: Sabitra
VERSION: 1 (10/04/2021 05:14 (SGT))

Your NCD will be affected due to late reporting

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	10/04/2021 05:14 (SGT)
Date of Accident	07/04/2021 16:30 (SGT)
Exact Location of Accident	Loyang Ave, Singapore
Additional Location Information	ALONG LOYANG AVE TOWARDS TAMPINES
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKV2919R
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	TAN YAW SENG
NRIC No	SXXXX666B
Email Address	xinyunauto1@gmail.com
Mobile Phone No	(Phone) +65-98780585
Alternative Phone No	+65-98780585

VEHICLE PARTICULARS

Manufacturer	Hyundai
Model	I30
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1368

INSURANCE COMPANY

Name of Insurance Company	ERGO Insurance Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	DMPG20002666
Cover Note Number	-

DRIVER

Name of Driver	TAN YAW SENG
NRIC No	SXXXX666B

Date Of Birth	31/07/1968
Occupation	Indoor
Date Of Driving Pass	13/05/1995
Driving experience	25 YEARS AND 11 MONTHS
Gender	Male
Mobile Number	(Phone) +65-98780585
Alt. Phone Number	+65-98780585
Email Address	xinyunauto1@gmail.com
Address	489A Tampines Street 45
Address complement	#06-152
Postcode	520489
Is the driver the policyholder?	Yes
If No, Relationship of the Driver with the Insured	-
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other material or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

My vehicle was stationary along loyang way due to the heavy traffic when suddenly vehicle B hit against my rear. My rear was damaged, no injury involved.

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY

Vehicle Registration Number	SMJ5500J
Vehicle Manufacturer	Toyota
Vehicle Model	LEXUS LC500 LIMITED EDITION
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Private car
Name of Driver	-
Contact Number	-
Address	-

Address complement
Postcode
Insurance Company Name
Nature Of Damage
Details of property damaged in accident
No. Of Passenger (Including Driver)

SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any wilful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA).**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

**VERIFY BY AJAX MARS (ARC)
REPORTING OFFICER
MOHAMED SHARIL BIN SATAR**

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Accident Report Form, v3

PLAN

A-SK 299R

B-SM 500T

hanging
over

Contact

↑ ↑ B ↑

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

REFER TO ATTACHED STATEMENT.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

VERIFY BY AJAX MARS (ARC)
REPORTING OFFICER
MOHAMED SHARIL BIN SATAR

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:



Xin Yun Auto Private Limited

辛运汽车服务有限公司

Tel: 6634 0858 Email: xinyunauto1@gmail.com

Blk 8 Kaki Bukit Avenue 4 #05-23 Premier Singapore 415875

SKC2919R Hyundai

Supplementary

			Estimated Parts Price
No	Qty	Parts Description	
1	1	Bumper cable harness 1 set X	\$ 280.00
2	1	Lower metal cover 1 /inside lower lip / OT	\$ 195.00
3	1	Labour to check and install both above	\$ 150.00 X
Sub Total			\$ 625.00

Stere (CLKK)

15/4/21