

Performance Motors Limited

A Sime Darby Motors Company
Co. Reg. No. 197401559W GST Reg. No M2-0020081-X
Toll-Free Number (1800-2255269)

303, Alexandra Road
Sime Darby Performance Centre
Singapore 159941
Fax. 64747770

280, Kampong Arang Road
East Coast Centre
Singapore 438180
Fax. 63449773

315, Alexandra Road
Sime Darby Business Centre
Singapore 159944
Fax. 64796601 (AfterSales)
64796624 (Motorrad)



GST REG. NO : M2 - 0020081 - X

E S T I M A T E

Estimate No. : **b1 58100**
Date Estimated : **09/04/2021**
Prepared By : **Chua Kee Sin**

Page No. : **1 of 6**

- ESTIMATE REPAIR FOR -
Ang Yuh Neng, Alan (Hong Yu'Neng, Alan)

- ACCOUNT - 40000
Cash Sales - Service
Singapore

Singapore

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SKT8887U	WBA6V12070ED05447	22/11/2018	216i GT	0

DESCRIPTION	VALUE
Replace left front side fender both left door, include remove attachment etc and repairs on left rear side fender, rear bumper and left side skirting	5,100.00
Painting left front side fender, both left door, left rear side fender, rear bumper, left mirror cover, left front outer handle and lower left skirting	5,469.00
To carry out body cavity preservation. (3 panel).	354.00
To check steering geometry and conduct wheel alignment in accordance with BMW specifications. (1x).	531.00
To remove old PDC assembly, replace damaged parts and reconnect to new bumper including conduct check for proper function.	177.00
To transfer lock mechanism from old to new door including conduct check on new door power window system for proper function. (2 doors).	1,062.00
To conduct check on all doors and bootlid central locking system for proper function.	177.00
To conduct water leak tests.	75.00
To supply and install rear left window glass quarter solar film.	500.00
To replace tyre and wheel rim including balancing. (1x). right both tyre	188.00
To supply and install front left window glass solar film.	425.00

Performance Motors Limited

A Sime Darby Motors Company
Co. Reg. No. 197401559W GST Reg. No M2-0020081-x
Toll-Free Number (1800-2255269)



303, Alexandra Road
Sime Darby Performance Centre
Singapore 159941
Fax. 64747770

280, Kampong Arang Road
East Coast Centre
Singapore 438180
Fax. 63449773

315, Alexandra Road
Sime Darby Business Centre
Singapore 159944
Fax. 64796601 (AfterSales)
64796624 (Motorrad)

GST REG. NO : M2 - 0020081 - X

E S T I M A T E

Estimate No. : **b1 58100**
Date Estimated : **09/04/2021**
Prepared By : **Chua Kee Sin**

Page No. : **2 of 6**

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SKT8887U	WBA6V12070ED05447	22/11/2018	216i GT	0

DESCRIPTION

VALUE

To supply and install rear left window glass solar film.

500.00

To remove and install front suspension for inspection and replace damaged parts.

2,655.00

Sundries

150.00

Total Labour 1: **17,363.00**

DESCRIPTION

QTY

PRIC

VALUE

PLUG IN RETAINER

2

4.00

8.00

WHEEL HUB WITH BEARING

1

511.30

511.30

FRT RH CARRIER - undercarriage

1

486.70

486.70

Swivel bearing right

1

551.45

551.45

ALLOY RIM 7.5X17 DOUBLE SPK 549

1

930.80

930.80

ALLOY RIM 7.5X17 DOUBLE SPK 549

1

930.80

930.80

HUB CAP WITH CHROME EDGE

1

29.80

29.80

HUB CAP WITH CHROME EDGE

1

29.80

29.80

FRT LH FENDER

1

630.25

630.25

LH EXTENSION WHEEL HOUSING STRUT

1

170.45

170.45

LH CROSS SUPPORT SIDE PANEL

1

32.60

32.60

LH TOP SIDE PANEL BRACKET

1

35.30

35.30

FRT LH DOOR

1

1,142.60

1,142.60

RR LH DOOR

1

1,142.60

1,142.60

MODEL LETTERING SIDE (SPORT LINE)

1

46.75

46.75

SET OF SCREWS -mirror

1

24.70

24.70

LH OUTSIDE MIRROR COVER CAP PRIMED

1

115.30

115.30

LH SUPPORTING RING - mirror

1

58.95

58.95

LH LOWER HOUSING SECTION mirr

1

46.10

46.10

LH EXTERIOR MIRROR W/O MOUNTING PAR

1

496.10

496.10

LH ADDITIONAL TURN INDICATOR LAMP

1

59.65

59.65

LH COVERING PRIMEND

1

48.00

48.00

LH DOOR OUTSIDE HANDLE CARRIER (CA)

1

106.20

106.20

FRT LH DOOR BRAKE

1

74.60

74.60

LH OUTER DOOR HANDLE PRIMED (CA/OVT

1

120.00

120.00

REAR DOOR BRAKE

1

74.60

74.60

FRT LH DOOR INSIDE CHANNEL SEALING

1

60.90

60.90

FRT LH DOOR WINDOW GLASS

1

209.05

209.05

FRT LH DOOR EXTERIOR CHANNEL COVER

1

100.30

100.30

FRT LH DOOR WINDOW FRAME COVER (ALU

1

60.50

60.50

REAR LH DOOR WINDOW FRAME COVER (AL

1

60.50

60.50

FRT LH DOOR WINDOW GUIDE

1

123.20

123.20

Foam seal -1

1

22.05

22.05

Foam seal - 2

1

22.05

22.05

FRT LH WINDOW LIFTER W/O MOTOR

1

316.65

316.65

RR LH WINDOW LIFTER W/O MOTOR

1

316.65

316.65

Performance Motors Limited

A Sime Darby Motors Company
Co. Reg. No. 197401559W GST Reg. No M2-0020081-x
Toll-Free Number (1800-2255269)

303, Alexandra Road
Sime Darby Performance Centre
Singapore 159941
Fax. 64747770

280, Kampong Arang Road
East Coast Centre
Singapore 438180
Fax. 63449773

315, Alexandra Road
Sime Darby Business Centre
Singapore 159944
Fax. 64796601 (AfterSales)
64796624 (Motorrad)



GST REG. NO : M2 - 0020081 - X

E S T I M A T E

Estimate No. : **b1 58100**
Date Estimated : **09/04/2021**
Prepared By : **Chua Kee Sin**

Page No. : **3 of 6**

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SKT8887U	WBA6V12070ED05447	22/11/2018	216i GT	0

DESCRIPTION	QTY	PRIC	VALUE
LH SEALING COLUMN B BOTTOM	1	54.90	54.90
Inner weathe	1	72.25	72.25
RR LH DOOR WINDOW GLASS	1	209.05	209.05
REAR LH DOOR OUTER WEATHERSTRIP (AL	1	100.30	100.30
REAR LH DOOR WINDOW GUIDE	1	129.70	129.70
LH FIXED DOOR WINDOW	1	135.90	135.90
REAR LH DOOR WINDOW FRAME COVER	1	50.40	50.40
FRT LH DOOR SOUND INSULATION	1	81.25	81.25
Crash pad fo	1	32.25	32.25
REAR DOOR JOINT SEAL	1	32.30	32.30
REAR DOOR EDGE PROTECTION	1	158.65	158.65
FRT DOOR EDGE PROTECTION	1	158.65	158.65
LH SEAL A PILLAR	1	48.35	48.35
FRT DOOR JOINT SEAL	1	32.30	32.30
CLIP	10	0.90	9.00
DRIVE FOR WINDOW LIFTER	1	259.05	259.05
FRT LH DRIVE FOR WINDOW LIFTER	1	323.80	323.80
(DG) CLEANER R1 (100ML)	1	26.15	26.15
(DG/SL) W/SCREEN SEALANT (COLD 1 HOUR)	1	131.55	131.55
(DG/SL)ADHESIVE PRIMER VP 206 (30ML)	1	27.85	27.85

Total Parts : **11,268.90**

Claims OD / 3rd Party / Uninsured losses / Direct Settlement

Regn No. _____ Claim No. _____

Date&Time _____ Excess S\$ _____

Surveyor's Name _____ Sign _____

Surveyor's Tel _____ Authorised Yes / No _____

Authorised Date _____ Time _____

RESURVEY PARTS PHOTO BY SURVEYOR Yes / No PML Yes / No

Surveyor's E-mail _____

No. of Working Days Recommend _____



Labour 1	:	17,363.00
Parts	:	11,268.90
Labour 2	:	0.00
Excess	:	0.00
Total GST @ 7%	:	2,004.23
Grand Total	:	30,636.13

**** THIS ESTIMATE IS VALID FOR A PERIOD OF 30 DAYS ONLY****

**** PRICE FOR PARTS ARE SUBJECTED TO CHANGE WITHOUT PRIOR NOTICE ****

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	09/04/2021 13:59 (SGT)
Date of Accident	09/04/2021 09:09 (SGT)
Exact Location of Accident	Clemenceau Ave, Singapore
Additional Location Information	CLEMENCEAU AVENUE
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKT8887U
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	ANG YUH NENG,ALAN
NRIC No	SXXXX551D
Email Address	
Mobile Phone No	
Alternative Phone No	

VEHICLE PARTICULARS

Manufacturer	BMW
Model	216d
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1500

INSURANCE COMPANY

Name of Insurance Company	NTUC Income Insurance Co-operative Ltd
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	5117618528
Cover Note Number	-

DRIVER

Name of Driver	ANG YUH NENG,ALAN
NRIC No	SXXXX551D

Date Of Birth	Indoor
Occupation	21/10/2003
Date Of Driving Pass	17 YEARS AND 6 MONTHS
Driving experience	Male
Gender	-
Mobile Number	-
Alt. Phone Number	-
Email Address	-
Address	-
Address complement	-
Postcode	-
Is the driver the policyholder?	Yes
If No, Relationship of the Driver with the Insured	-
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Side Swipe
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other material or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO ATTACHMENT

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SHB1868B
Vehicle Manufacturer	Toyota
Vehicle Model	Prius
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Taxi
Name of Driver	LIM CHIN CHUA
Contact Number	-
Address	-
Address complement	-

Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

WITNESS DETAILS

WITNESS 1

Name	PAUL SAGE
Phone	-
Email	-

SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any willful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**
I understand, acknowledge, agree and consent that
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
(ii) investigating the accident and/or my claims;
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

YBG
XIA
13.19
9 Apr 21

Policyholder's Signature / Date & Time


YBG
XIA
13.19
9 Apr 21

Driver's Signature (If driver is not the policyholder) / Date & Time

[Signature]

Witnessed by Reporting Centre Personnel

Sketch Plan

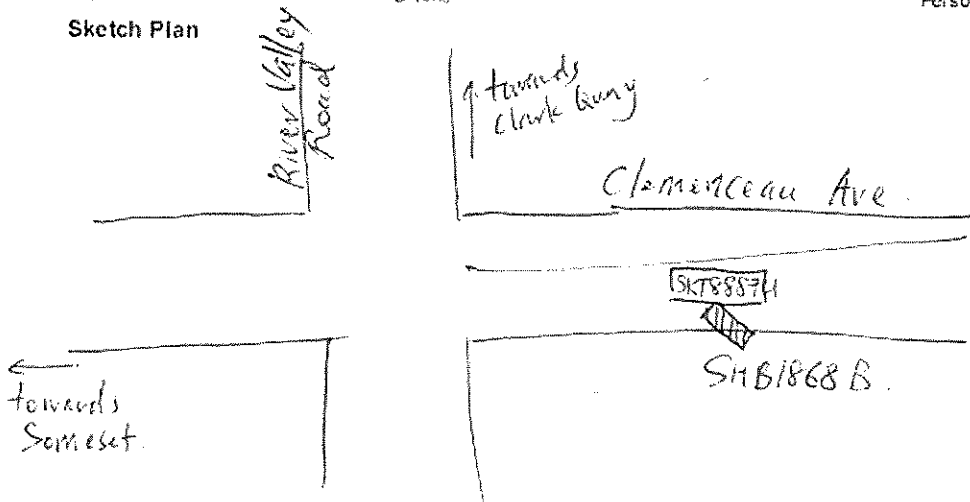

Describe Circumstances of the Accident

I, driver of SKT8887U is driving along Clemenceau Ave on the right most lane. As I slow down towards the traffic light (around 150m away), a maroon colour taxi (SHB18E8B) hit my car on the left passenger side. As the taxi has veered into my lane late, I was unable to avoid/react to it.

A passenger in the Taxi, Mr Paul Sage is witness the accident and able to provide supporting information if required.

Declaration

I/We declare the foregoing particulars are true in every respect.

13.25
9 Apr 21
JBC

Policyholder's Signature / Date & Time

13.25
9 Apr 21
JBC

13.25
9 Apr 21
JBC

Driver's Signature (if driver is not the policyholder) / Date & Time

13.25
9 Apr 21
JBC

Witnessed by Reporting Centre Personnel



Land Transport Authority
10 Sin Ming Drive
Singapore 575701
GST Registration No. : M4-0006529-2

Print Date/Time : 09 Apr 2021 / 18:26:46

Receipt Date/Time : 09 Apr 2021 / 18:26:46

Tax Invoice/Receipt

Receipt No. : ITNET-00000-210409-003812

Previous Receipt No. :

S/N	Item Description/ Business Transaction Reference No.	Amount Before GST (S\$)	GST Amount (S\$)	Amount After GST (S\$)
Result of Insurance Enquiry - SHB1868B				
As at 09 Apr 2021/09:09:00				
Insurance Co: MS FIRST CAPITAL INSURANCE LIMITED				
1	Insurance Enquiry - SHB1868B Enquiry Fee 20210409182336063972	7.00	0.49	7.49
Sub-Total		7.00	0.49	7.49
Total Before Rounding		7.00	0.49	7.49
Rounding Difference				0.04
Total Amount Payable				7.45
Paid By				
	542125XXXXXX4416	eNETS Credit Card		7.45
Total				7.45
Cash Change				0.00
Tendered Amount				7.45
Excess Refundable Amount				0.00

THANK YOU AND HAVE A NICE DAY!

Please ensure that all payments to the Authority are good and promptly settled by the payment service provider / financial institution. Otherwise, the transaction and receipt is considered void and late fee may apply.