

(08/11/13) wef  
ASS. REC. BY: Pan

REF:

CS/SMR21004622/Rinf3

5570

### ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD ☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SKT 88874

at Workshop m/s: PERFORMANCE

of 303 ALEXANDRA RD

Insured: SMR SHB1868B

Policy No. \_\_\_\_\_

Claims No. TAX/04/21/2022

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_


(Client's Record)

Make of Veh: \_\_\_\_\_

22/04

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

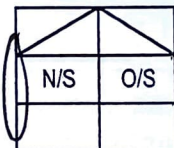

Bal. or Market Value: 110K

IDAC Accident Rpt: \_\_\_\_\_ Consistent?: Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent?: Yes or No

Est. Repairs: 9 days Res.: Yes or No

Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Veh No: SKT 88874 Yr Regn: 2018 / NOV

Type: ☒ M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or \_\_\_\_\_

Make: B.M.W 216I GRAN TOURER c.c 1499

Colour: BLACK A/C: Insured / Std / NI / NA

Sp. Reading: 42412 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: WBA 6V12070E D05447

Gen. Cond: Good / ☒ Fair / Poor / Burnt

Steering: ☒ Inorder / Jammed / Leaked / Burnt or

Brake: ☒ Inorder / Jammed / Leaked / Burnt or

Modi: Nil / ☒ S/Rim / STD A/Rim or

Tyre Size: F: 205/55R17

R: "

BS / DUN / EXNOVA / GY / FS / LIZA / ☒ MID / OHTSU / PIR / SUMI /

TOYO / YOKO or \_\_\_\_\_

Front

R/Bal. 6 mm

L/Bal. 6 mm

D.O.A. 09/04/21

Survey held at

Rear

R/Bal. 6 mm

L/Bal. 6 mm

D.O.I. 22/04/21

Des. of Damages: Frt / Rear / O/S / ☒ N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Repair limit - 62K

24/5/2021 Confirm final fig P/P \$14830.45, 9 repair days.

(RED \$15805.68; 52%)

Date/Time, File Pass to?

☐

: Preli. Report

1) 24/5 TYPIST

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: 9

Resurvey No. of Trip: 1

Add Fee: ☐ : Site Insp (\$ \_\_\_\_\_)

☐ : Interview (\$ \_\_\_\_\_)

☐ : Tech. Invs (\$ \_\_\_\_\_)

☐ : Weekend (\$ \_\_\_\_\_)

Survey Fee:

Transportation:

\_\_\_\_ S + RS \_\_\_\_ SI

Photos

Others

Report Format: TP

Lump Sum / I.B.I: (\$14830.45)

TOTAL



# Performance Motors Limited

A Sime Darby Motors Company  
Co. Reg. No. 197401559W GST Reg. No M2-0020081-X  
Toll-Free Number (1800-2255269)

303, Alexandra Road  
Sime Darby Performance Centre  
Singapore 159941  
Fax. 64747770

280, Kampong Arang Road  
East Coast Centre  
Singapore 438180  
Fax. 63449773

315, Alexandra Road  
Sime Darby Business Centre  
Singapore 159944  
Fax. 64796601 (AfterSales)  
64796624 (Motorrad)



GST REG. NO : M2 - 0020081 - X

## ESTIMATE

Estimate No. : b1 58100  
Date Estimated : 09/04/2021  
Prepared By : Chua Kee Sin

Page No. : 1 of 6

- ESTIMATE REPAIR FOR -  
Ang Yuh Neng, Alan (Hong Yu'Neng, Alan)  
22 Teban Gardens Road  
#27-141 Teban Vista

Singapore 600022

- ACCOUNT - 40000  
Cash Sales - Service  
Singapore

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SKT8887U	WBA6V12070ED05447	22/11/2018	216i GT	0

### DESCRIPTION

Replace left front side fender both left door, include remove attachment etc and repairs on left rear side fender, rear bumper and left side skirting

4675 5,100.00

Painting left front side fender, both left door, left rear side fender, rear bumper, left mirror cover, left front outer handle and lower left skirting

5195 5,489.00

To carry out body cavity preservation.  
(3 panel).

336 200 354.00

To check steering geometry and conduct wheel alignment in accordance with BMW specifications. (1x).

504? 531.00

To remove old PDC assembly, replace damaged parts and reconnect to new bumper including conduct check for proper function.

168 177.00

To transfer lock mechanism from old to new door including conduct check on new door power window system for proper function. (2 doors).

1008 1,062.00

To conduct check on all doors and bootlid central locking system for proper function.

168 177.00

To conduct water leak tests.

75.00

To supply and install rear left window glass quarter solar film.

X 3 500.00

To replace tyre and wheel rim including balancing. (1x).  
right both tyre

X 188.00

To supply and install front left window glass solar film.

? 425.00



# Performance Motors Limited

A Sime Darby Motors Company  
Co. Reg. No. 197401559W GST Reg. No M2-0020081-x  
Toll-Free Number (1800-2255269)

303, Alexandra Road  
Sime Darby Performance Centre  
Singapore 159941  
Fax. 64747770

280, Kampong Arang Road  
East Coast Centre  
Singapore 438180  
Fax. 63449773

315, Alexandra Road  
Sime Darby Business Centre  
Singapore 159944  
Fax. 64796601 (AfterSales)  
64796624 (Motorrad)



GST REG. NO : M2 - 0020081 - X

## ESTIMATE

Estimate No. : b1 58100  
Date Estimated : 09/04/2021  
Prepared By : Chua Kee Sin

Page No. : 2 of 6

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SKT8887U	WBA6V12070ED05447	22/11/2018	216i GT	0

### DESCRIPTION

To supply and install rear left window glass solar film.

VALUE

X 500.00

To remove and install front suspension for inspection and replace damaged parts.

X 2,655.00

Sundries

? 150.00

Total Labour 1: 17,363.00

DESCRIPTION	QTY	PRIC	VALUE
PLUG IN RETAINER ?	2	4.00	8.00
WHEEL HUB WITH BEARING ?	1	511.30	511.30
FRT RH CARRIER - undercarriage ?	1	486.70	486.70
Swivel bearing right ?	1	551.45	551.45
ALLOY RIM 7.5X17 DOUBLE SPK 549 X	1	930.80	930.80
ALLOY RIM 7.5X17 DOUBLE SPK 549 X	1	930.80	930.80
HUB CAP WITH CHROME EDGE X	1	29.80	29.80
HUB CAP WITH CHROME EDGE X	1	29.80	29.80
FRT LH FENDER Lt ✓	1	630.25	630.25
LH EXTENSION WHEEL HOUSING STRUT ?	1	170.45	170.45
LH CROSS SUPPORT SIDE PANEL ?	1	32.60	32.60
LH TOP SIDE PANEL BRACKET ?	1	35.30	35.30
FRT LH DOOR Lt ✓	1	1,142.60	1,142.60
RR LH DOOR Lt ✓	1	1,142.60	1,142.60
MODEL LETTERING SIDE (SPORT LINE) ne ✓	1	46.75	46.75
SET OF SCREWS -mirror ?	1	24.70	24.70
LH OUTSIDE MIRROR COVER CAP PRIMED X	1	115.30	115.30
LH SUPPORTING RING - mirror X	1	58.95	58.95
LH LOWER HOUSING SECTION mirr X	1	46.10	46.10
LH EXTERIOR MIRROR W/O MOUNTING PAR Sa ✓	1	496.10	496.10
LH ADDITIONAL TURN INDICATOR LAMP X	1	59.65	59.65
LH COVERING PRIMEND X	1	48.00	48.00
LH DOOR OUTSIDE HANDLE CARRIER (CA) X	1	106.20	106.20
FRT LH DOOR BRAKE ?	1	74.60	74.60
LH OUTER DOOR HANDLE PRIMED (CA/OVT X	1	120.00	120.00
REAR DOOR BRAKE ?	1	74.60	74.60
FRT LH DOOR INSIDE CHANNEL SEALING ?	1	60.90	60.90
FRT LH DOOR WINDOW GLASS X	1	209.05	209.05
FRT LH DOOR EXTERIOR CHANNEL COVER X	1	100.30	100.30
FRT LH DOOR WINDOW FRAME COVER (ALU X	1	60.50	60.50
REAR LH DOOR WINDOW FRAME COVER (AL X	1	60.50	60.50
FRT LH DOOR WINDOW GUIDE X	1	123.20	123.20
Foam seal -1 M ✓	1	22.05	22.05
Foam seal - 2 M ✓	1	22.05	22.05
FRT LH WINDOW LIFTER W/O MOTOR ?	1	316.65	316.65
RR LH WINDOW LIFTER W/O MOTOR X	1	316.65	316.65



# Performance Motors Limited

A Sime Darby Motors Company  
Co. Reg. No. 197401559W GST Reg. No M2-0020081-x  
Toll-Free Number (1800-2255269)

303, Alexandra Road  
Sime Darby Performance Centre  
Singapore 159941  
Fax. 64747770

280, Kampong Arang Road  
East Coast Centre  
Singapore 438180  
Fax. 63449773

315, Alexandra Road  
Sime Darby Business Centre  
Singapore 159944  
Fax. 64796601 (AfterSales)  
64796624 (Motorrad)



GST REG. NO : M2 - 0020081 - X

## ESTIMATE

Estimate No. : b1 58100  
Date Estimated : 09/04/2021  
Prepared By : Chua Kee Sin

Page No. : 3 of 6

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SKT8887U	WBA6V12070ED05447	22/11/2018	216i GT	0

DESCRIPTION	QTY	PRIC	VALUE
LH SEALING COLUMN B BOTTOM <i>ne /</i>	1	54.90	54.90
Inner weathe <i>ne /</i>	1	72.25	72.25
RR LH DOOR WINDOW GLASS <i>X</i>	1	209.05	209.05
REAR LH DOOR OUTER WEATHERSTRIP (AL) ?	1	100.30	100.30
REAR LH DOOR WINDOW GUIDE <i>X</i>	1	129.70	129.70
LH FIXED DOOR WINDOW ?	1	135.90	135.90
REAR LH DOOR WINDOW FRAME COVER <i>X</i>	1	50.40	50.40
FRT LH DOOR SOUND INSULATION <i>ne /</i>	1	81.25	81.25
Crash pad fo ?	1	32.25	32.25
REAR DOOR JOINT SEAL ?	1	32.30	32.30
REAR DOOR EDGE PROTECTION ?	1	158.65	158.65
FRT DOOR EDGE PROTECTION ?	1	158.65	158.65
LH SEAL A PILLAR <i>X</i>	1	48.35	48.35
FRT DOOR JOINT SEAL ?	1	32.30	32.30
CLIP ?	10	0.90	9.00
DRIVE FOR WINDOW LIFTER ?	1	259.05	259.05
FRT LH DRIVE FOR WINDOW LIFTER ?	1	323.80	323.80
(DG) CLEANER R1 (100ML) <i>ne /</i>	1	26.15	26.15
(DG/SL) W/SCREEN SEALANT (COLD 1 HOUR) <i>ne /</i>	1	131.55	131.55
(DG/SL)ADHESIVE PRIMER VP 206 (30ML) <i>ne /</i>	1	27.85	27.85

Total Parts : 11,268.90

Claims OD (3rd Party) / Uninsured losses / Direct Settlement

Regn No. \_\_\_\_\_ Claim No. \_\_\_\_\_

Date & Time 22/04/2021 11:00 Excess S\$ \_\_\_\_\_

Surveyor's Name RASUL Sign \_\_\_\_\_

Surveyor's Tel 90010068 Authorised Yes / No \_\_\_\_\_

Authorised Date \_\_\_\_\_ Time \_\_\_\_\_

RESURVEY PARTS PHOTO BY SURVEYOR Yes / No \_\_\_\_\_ PML Yes / No \_\_\_\_\_

Surveyor's E-mail \_\_\_\_\_

No. of Working Days Recommend 9 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature: \_\_\_\_\_

Date: \_\_\_\_\_



Labour 1	:	17,363.00
Parts	:	11,268.90
Labour 2	:	0.00
Excess	:	0.00
Total GST @ 7%	:	2,004.23
Grand Total	:	30,636.13

\*\* THIS ESTIMATE IS VALID FOR A PERIOD OF 30 DAYS ONLY \*\*

\*\* PRICE FOR PARTS ARE SUBJECTED TO CHANGE WITHOUT PRIOR NOTICE \*\*



# SINGAPORE ACCIDENT STATEMENT

## IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

## ACCIDENT STATEMENT

Date of Submission ..... 09/04/2021 13:59 (SGT)  
Date of Accident ..... 09/04/2021 09:09 (SGT)  
Exact Location of Accident ..... Clemenceau Ave, Singapore  
Additional Location Information ..... CLEMENCEAU AVENUE  
Country/State of Loss ..... Singapore

## DETAILS OF OWN VEHICLE

Vehicle Registration Number ..... SKT8887U

### INSURED/POLICYHOLDER

Is company? ..... No  
Name Of Registered Owner ..... ANG YUH NENG,ALAN  
NRIC No ..... SXXXX551D  
Email Address ..... ALANANGYN@GMAIL.COM  
Mobile Phone No ..... (Phone) +65-96483040  
Alternative Phone No ..... +65-96483040

### VEHICLE PARTICULARS

Manufacturer ..... BMW  
Model ..... 216d  
Variant ..... -  
Exact purpose for which vehicle was being used at time of accident ..... -  
Are you claiming under your own insurance policy for repair to your vehicle? ..... No - Claiming third party  
Vehicle Category ..... Private car  
Transmission ..... Auto  
CC ..... 1500

### INSURANCE COMPANY

Name of Insurance Company ..... NTUC Income Insurance Co-operative Ltd  
Type of Coverage ..... Comprehensive  
Fleet Policy ..... No  
Policy Number ..... 5117618528  
Cover Note Number ..... -

### DRIVER

Name of Driver ..... ANG YUH NENG,ALAN  
NRIC No ..... SXXXX551D



Date Of Birth	23/07/1982
Occupation	Indoor
Date Of Driving Pass	21/10/2003
Driving experience	17 YEARS AND 6 MONTHS
Gender	Male
Mobile Number	(Phone) +65-96483040
Alt. Phone Number	+65-96483040
Email Address	ALANANGYN@GMAIL.COM
Address	BLK 22 TEBAN GARDENS ROAD #27-141
Address complement	-
Postcode	600022
Is the driver the policyholder?	Yes
If No, Relationship of the Driver with the Insured	-
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

#### GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Side Swipe
Weather Conditions	Clear
Road Surface	Dry

#### OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other material or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

#### DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

#### CIRCUMSTANCES OF ACCIDENT

#### REFER TO ATTACHMENT

#### ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Was there any audio recorded?	No

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SHB1868B
Vehicle Manufacturer	Toyota
Vehicle Model	Prius
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Taxi
Name of Driver	LIM CHIN CHUA
Contact Number	(Phone) +65-91282743
Address	-
Address complement	-

—

## WITNESS DETAILS

Name  
Phone  
Email





## SKETCH PLAN

### IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any willful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

*YDG*  
*XIA*  
13.19  
9 Apr 21


Policyholder's Signature / Date & Time

*YDG*  
*XIA*  
13.19  
9 Apr 21

Driver's Signature (If driver is not the policyholder) / Date & Time

*[Signature]*  
Witnessed by Reporting Centre Personnel

### Sketch Plan

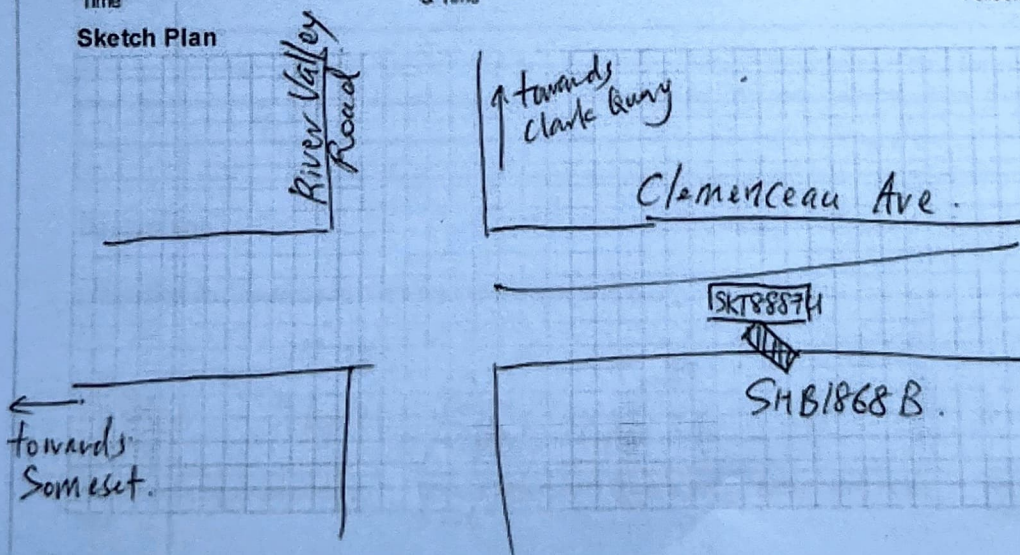




Describe Circumstances of the Accident

I, driver of SKT8887U is driving along clemenceau Ave on the right most lane. As I slow down towards the traffic light (around 150m away), a maroon colour taxi (SHB1868B) hit my car on the left passenger side. As the taxi has veered into my lane late, I was unable to avoid/react to it.

A passenger in the Taxi, Mr Paul Sage ~~is~~ witness the accident and able to provide supporting information if required.


Declaration

We declare the foregoing particulars are true in every respect.

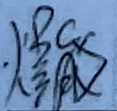


Policyholder's Signature / Date & Time

13.25  
9 Apr 21

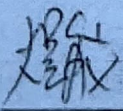

Driver's Signature (If driver is not the policyholder) / Date & Time

13.25  
9 Apr 21

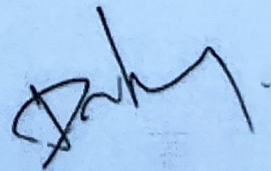

Witnessed by Reporting Centre Personnel



# Vehicle PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Singapore NRIC
Owner ID:	551D
Vehicle No.:	SKT8887U
Vehicle to be Exported:	No
Intended Deregistration Date:	23 Apr 2021
Vehicle Make:	B.M.W.
Vehicle Model:	216I GRAN TOURER
Primary Colour:	Black
Manufacturing Year:	2018
Engine No.:	37885371B38A15A
Chassis No.:	WBA6V12070ED05447
Maximum Power Output:	80.0 kW (107 bhp)
Open Market Value:	\$30,824.00
Original Registration Date:	22 Nov 2018
First Registration Date:	22 Nov 2018
Transfer Count:	1
Actual ARF Paid:	\$35,154.00
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	21 Nov 2028
PARF Rebate Amount:	\$26,365.00
COE Expiry Date:	21 Nov 2028
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$28,457.00
COE Rebate Amount:	\$21,569.00
Total Rebate Amount:	\$47,934.00

The information contained herein is correct as at 23 Apr 2021

OK





SEARCH

bmw 216i

Price Range

Depreciation

2018

Vehicle Type



Search

View All

Advanced Search

Home » Used Cars » AutoConnect Motoring » BMW 2 Series 216i Gran Tourer

## BMW 2 Series 216i Gran Tourer

Overview

Financial

Accessories

Similar

Research

Photos

Map

PREMIUM AD

**Price** \$111,800

**Depreciation** ⓘ

\$12,190 /yr

View models with similar depre

**Reg Date**

31-Dec-2018

(7yrs 8mths 7days COE left)

**Mileage**

19,000 km (8.2k /yr)

**Manufactured** ⓘ

2018

**Road Tax** ⓘ

\$684 /yr

**Transmission**

Auto

**Dereg Value** ⓘ

\$46,189 as of today (change)

**OMV** ⓘ

\$31,412

**COE** ⓘ

\$30,959

**ARF** ⓘ

\$35,977

**Engine Cap**

1,499 cc

**Power**

80.0 kW (107 bhp)

**Curb Weight** ⓘ

1,490 kg

**No. of Owners** ⓘ

2

**Type of Vehicle**

MPV

### Features

3 Cylinders 12 Valve 1.5 Turbocharged. Automatic Transmission With Tiptronic, Multi-Function Steering Wheel, Drive Experience Control, Ambient Light. View specs of the BMW 2 Series Gran Tourer (2018)

### Accessories

17" BMW Sports Rims, Powered Tailgate, Front Electric Seats With Driver Memory.

### Description

Very Low Mileage. PML Agent 5 Years Warranty. And Free Servicing, Superb Interior And Exterior Condition Like Brand New! Easy Maintenance 1.5T Petrol 7-seater MPV. 100% Accident-Free! Flexible Financing Schemes Available. Trade-In Welcome. Call For Viewing.

### Category

PARF Car, Premium Ad Car, Low Mileage Car

### Status

Available for sale. Shortlist this car to get alerted whenever the price or availability changes.

### Resources



#### sgCarMart Used Car Warranty

Get \$0 future car repair bill. Ask your dealer for a warranty on this car. Learn more



#### Car Valuation - Free

Find out the market value of your existing car for free. Get started

STP

SHORTLISTED

HISTORY

Compare




#### Vehicle Evaluation

? Request to have this car evaluated professionally. Find out more



Location Map

### Price Chart

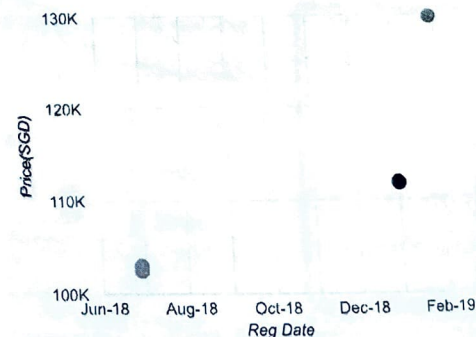

Click on the point to view the vehicle

Shortlist

Compare

Report Error

More

### Seller Information

AutoConnect Motoring