

ASS. REC. BY:

REF:

CS/CTI21004996/Kuf3

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / AP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SKW 1441C

at Workshop n/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent?: Yes or No

GIA / PR Seen:

Consistent?: Yes or No

Est. Repairs:

10 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

26/4/2021 @9.40am Revised to Adeline Chng via Merimen.

Confirmed L/S \$5650, 10 repair-days

(RED \$2793; 33%)

Date/Time, File Pass to?

1) 9/11 TYPIST

Date/Time, File Return to?

2)

Report Format: TP

Lump Sum / +B.H. (\$) 5650

Veh No:

SKW1441C

Yr Regn:

09, 15

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Altis

c.c

1598

Colour

M. Gray

A/C:

Insured / Std / NI / NA

Sp. Reading

98194

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

MR053REH104538823

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

205/55R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

Rear

R/Bal.

7

mm

R/Bal.

7

mm

L/Bal.

7

mm

L/Bal.

7

mm

D.O.A.

19/4/20

D.O.I.

21/4/2021

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

& P

The U/C / Chassis frame / Body Structure affected due to collision.

: Prell. Report

: Final Report

Days Of Repair: 10

Resurvey No. of Trip: 2

Survey Fee:

Transportation:

S + R.S. \$

Papers

Others

TOTAL

Add Fee: : Site Insp (\$

: Interview (\$

: Tech Invs (\$

: Weekend (\$

SKW1441C
TP/CHINA**REPAIR DETAILS****Reference****Part Source:** MRM-SG **Version:** 1.0 (Last Synchronised: 21 Apr 2021)**Parts:** 143 TOYOTA COROLLA ALTIS 1.6 CVT (A) (Catalogue:Merimen Singapore 1.0)**Labour:** Repairer's (Price-denominated Standard List)**Print Code:** (Unsubmitted, no print-code for SKW1441C)**Validity:** These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk *.**Estimates on Parts**

No.	Qty	Part No.	Particulars		%Disc	%Depr	Amount	
1	1		*1 PC REAR BUMPER	Bu	0.00	0.00	*200.00F	✓
2	1		*1 PC REAR BUMPER SIDE RETAINER	Diy	0.00	0.00	*43.00F	✓
3	1		*6 PCS REAR BUMPER CLIPS @2/PC	Re	0.00	0.00	*12.00F	✓
4	1		*1 PC REAR BOOT	Ry	0.00	0.00	*320.00F	✓
5	1		*1 PC REAR BOOT LOGO	Re	0.00	0.00	*25.00F	✓
6	1		*1 PC REAR BOOT EMBLEM (COROLLA)	Re	0.00	0.00	*30.00F	✓
7	1		*1 PC REAR BOOT EMBLEM (ALTIS)	Re	0.00	0.00	*35.00F	✓
8	1		*1 PC REAR BOOT INNER LOCK	Diy	0.00	0.00	*175.00F	✓
9	1		*1 PC REAR BOOT INNER RUBBER	Re	0.00	0.00	*70.00F	✓
10	1		*2 PCS REAR BOOT RELFECTORS @130/PC	CH	0.00	0.00	*260.00F	✓
11	1		*2 PCS REAR BOOT HINGES @45/PC	Re	0.00	0.00	*90.00F	X
12	1		*1 PC REAR BOOT OUTER CHROME MOULDING	Wap	0.00	0.00	*155.00F	✓
13	1		*1 PC REAR BOOT NUMBER PLATE LAMP	.	0.00	0.00	*60.00F	?
14	1		*1 PC REAR BOOT OPEN SENSOR	.	0.00	0.00	*85.00F	?
15	1		*2 PCS TAILLAMPS @160/PC	Diy Re	0.00	0.00	*320.00F	✓
16	1		*1 PC REAR CENTRE PANEL	Ry	0.00	0.00	*220.00F	✓
17	1		*1 PC FRT BUMPER	Bu	0.00	0.00	*195.00F	✓
18	1		*1 PC FRT BUMPER REINFORCEMENT		0.00	0.00	*120.00F	?
19	1		*1 PC FRT BUMPER SPONGE		0.00	0.00	*50.00F	?
20	1		*6 PCS FRT BUMPER CLIPS @2/PC	Re	0.00	0.00	*12.00F	✓
21	1		*1 PC FRT GRILLE	Diy	0.00	0.00	*150.00F	✓
22	1		*4 PCS FRT GRILLE CLIPS @2/PC	Re	0.00	0.00	*8.00F	✓
23	1		*2 PCS HEADLAMPS @650/PC	Mjcar	0.00	0.00	*1,300.00F	✓
24	1		*2 PCS HEADLAMP TOP CHROME @70/PC		0.00	0.00	*140.00F	?
25	1		*1 PC BONNET	Ry	0.00	0.00	*295.00F	✓
26	1		*1 PC BONNET INNER LOCK	Diy	0.00	0.00	*60.00F	✓
27	1		*1 PC FRT SUPPORT PANEL	Ry	0.00	0.00	*200.00F	✓
28	1		*1 PC AIRCON CONDENSER		0.00	0.00	*320.00F	?
29	1		*1 PC FRT BRACE PANEL	Diy	0.00	0.00	*45.00F	✓

F=Franchise part.

Total Parts (S\$) **4,995.00**Report was unsubmitted during this print-out.
Generated using Merimen e-Claims IEAS**LKK Auto Consultants** hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Estimates on Miscellaneous Items


There are no new miscellaneous items selected.

Estimates on Labour

No	Particulars	Lab.Type	Amount	
Labour Items				
1	TOWING			
2	REMOVE & REFIX REAR BUMPER ASSY, TAILLAMP, REAR BOTH ATTACHMENT, LOCK ASSY, CUT, WELD & RENEW REAR PANEL, KNOCK & REPAIR REAR BOTH FENDERS & REALIGN THE SAME	New New	60.00 800.00	✓ 700
3	PUTTY & RESPRAY ON REAR BOTH FENDERS, REAR BOOT, REAR PANEL, REAR BUMPER & REAR AFFECTED AREAS	New	800.00	720
4	REMOVE & REFIX AIRCON, CHECK, VACUUM & REFILL GAS	New	100.00	✓
5	REMOVE & REFIX FRT BUMPER ASSY, HEADLAMPS, GRILLE, BONNET & ATTACHMENT, RADIATOR & MOTOR, FRT FENDERS, CUT, WELD & RENEW FRT SUPPORT PANEL, KNOCK & REPAIR FRT FENDERS & REALIGN THE SAME	New New	700.00	600
6	PUTTY & RESPRAY ON FRT BUMPER, REINFORCEMENT, SUPPORT PANEL, BONNET, FRT FENDERS & FRT AFFECTED AREAS	New	700.00	600
7	REMOVE & REFIX REVERSE SENSOR, REVERSE CAMERA & RESET SYSTEM	New	50.00	✓
8	RUSTPROOFING	New	60.00	✓
Gross Labour Cost (S\$)			3,270.00	

Report was unsubmitted during this print-out.
Generated using Merlmen e-Claims IEAS

< END OF ESTIMATES >

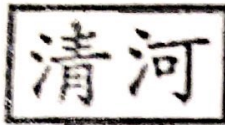

CHENG HOE MOTOR PTE LTD

Blk 1019, Yishun Industrial Park A, #01-374/382, Singapore 768761

Tel : 67556142 Fax : 67557719

Email: chmotor@singnet.com.sg

TP INSURER: China Taiping Insurance (Singapore) Pte. Ltd. (HQ)

Singapore

PARTICULARS OF CLAIM

Claim Type:	THIRD PARTY	Ref. No:	TP/CHINA(GBE8850K)
Policy No:	DMCVSNW00018892100	Date of Loss:	19/04/2021
Vehicle Reg. No.:	SKW1441C	Driveable?	
Party At Fault:	UNKNOWN		
Driver (TP):	TAN HIONG KIAT MARCUS (ZHENG XIANJIE)	Driver (Insured):	DANIEL
Make/Model:	TOYOTA COROLLA ALTIS, 1.6 CVT (A)	Vehicle Reg. Date:	29/09/2015
Vehicle Colour:	GREY		
Engine No:	1ZRY209242	Chassis No:	MR053REH104538823
Odometer:	0 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	0		
Description of Accident/Loss	REFER TO GIA REPORT ATTACHED.		
Remarks:	VEHICLE CURRENTLY LYING AT YISHUN WORKSHOP.		
Present Location:	CHENG HOE MOTOR PTE LTD (YISHUN)		

*Not Authorised
6/5/21
Repair After Paint
Today*

COST OF CLAIMS

	Amount
Parts	4,995.00
Miscellaneous Items	0.00
Labour	3,270.00
Paintwork Labour	0.00
Towing	0.00
Gross Total (\$)	8,265.00
+ GST 7.00% (\$)	578.55
Nett Amount (\$)	8,843.55

This claim is handled by: SHARON CHIONG BENG CHOON

Generated using Merimen e-Claims Internet Estimation & Adjusting System

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 20/04/2021 10:58 (SGT)
Date of Accident 19/04/2021 18:15 (SGT)
Exact Location of Accident Lornie Rd, Singapore
Additional Location Information LORNIE ROAD TOWARD UPPER THOMSON
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SKW1441C

INSURED/POLICYHOLDER

Is company? No
Name Of Registered Owner TAN HIONG KIAT MARCUS (ZHENG XIANJIE)
NRIC No SXXXX015H
Email Address chmotor@singnet.com.sg
Mobile Phone No (Phone) +65-90030769
Alternative Phone No +65-90030769

VEHICLE PARTICULARS

Manufacturer Toyota
Model Corolla
Variant -
Exact purpose for which vehicle was being used at time of accident -
Are you claiming under your own insurance policy for repair to your vehicle? No - Claiming third party
Vehicle Category Private car
Transmission Auto
CC 1598

INSURANCE COMPANY

Name of Insurance Company MSIG Insurance (Singapore) Pte. Ltd.
Type of Coverage Comprehensive
Fleet Policy No
Policy Number A 300352215 QMX
Cover Note Number -

DRIVER

Name of Driver TAN HIONG KIAT MARCUS (ZHENG XIANJIE)
NRIC No SXXXX015H

Date Of Birth
Occupation
Date Of Driving Pass
Driving experience
Gender
Mobile Number
Alt. Phone Number
Email Address
Address
Address complement
Postcode
Is the driver the policyholder?
If No, Relationship of the Driver with the Insured
Does Driver Own Other Vehicles?
Vehicle Registration Number of Other Vehicle Owned by Driver
Insurance Company of Other Vehicle Owned by Driver

09/05/1986
Indoor
04/06/2007
13 YEARS AND 10 MONTHS
Male
(Phone) +65-90030769
+65-90030769
chmotor@singnet.com.sg
270 YIO CHU KANG ROAD #05-21
-
545686
Yes
-
No
-
-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident
Weather Conditions
Road Surface

Chain Collision
Clear
Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?
Number of vehicles involved in the accident
Was anybody injured in the Accident?
Was any injured conveyed to hospital by ambulance?
Was any other material or property damaged?
Number of Passengers (Including Driver)
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?

No
3
Yes
No
Yes
1
No

DETAILS OF POLICE ACTION

Was the accident reported to the police?
Was notice of intended Prosecution given?
If yes, against whom?

No
No
-

CIRCUMSTANCES OF ACCIDENT

REFER TO SKETCH PLAN

ATTACHMENT(S)

Are accident photos available for attachment?
Was there any video captured by Car Camera?
Was there any audio recorded?

No
No
No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number
Vehicle Manufacturer
Vehicle Model
Vehicle Variant
Vehicle Colour
Vehicle Category
Name of Driver
Contact Number
Address
Address complement

GBE8850K
-
-
-
-
Commercial vehicle
DANIEL
(Phone) +65-81593323
-
-

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)
I understand, acknowledge, agree and consent that:
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
(ii) investigating the accident and/or my claims;
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
(collectively the "Purposes")
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
(c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan

