

ASS. REC. BY:

Steve

CS/AIG 21095852/ETF3

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MI

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No. 1900009706

Claims No. 1100092246SG

Sum Insured:

Excess:


0

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

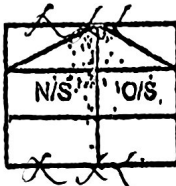

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Cum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SMH 5723T

Yr Regn:

28/1/19

Type: ☒ Car / ☐ M.Cycle / ☐ Bus / ☐ Van / ☐ Lorry / ☐ Taxi / ☐ Prime Mover /

Truck / Trailer or

Make:

Mitsubishi Eclipse Cross c.c. 1499

Colour:

White

A/C: Insured / Std / NI / N

Sp. Reading

16475

T/Radio: Insured / Std / NI / N

Eng/No:

C/No:

JMAXTGK:1WT2014774

Gen. Cond: ☒ Good / ☐ Fair / ☐ Poor / ☐ BurntSteering: ☒ In order / ☐ Jammed / ☐ Leaked / ☐ Burnt orBrake: ☒ In order / ☐ Jammed / ☐ Leaked / ☐ Burnt orModl: ☒ Nil / ☐ S/Rim / ☐ STD A/Rim or

Tyre Size:

F:

225/55R8

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal.

5

mm

R/Bal.

5

mm

L/Bal.

5

mm

L/Bal.

5

mm

D.O.A.

12/5/21

D.O.I.

17/5/21

Survey held at

Cycle & collapse

Des. of Damages: ☒ Frt / ☒ Rear / ☐ O/S / ☐ N/S / ☐ UIC / ☐ Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision

Date / Time

Action / Instruction

NIV-95K

New for Old Value : \$5 129,999.00

Pre-Accident Value : \$5 95,000.00

COE / PARK Rebate : \$5 44,567.00

Margin for Repair (New for Old Value) : \$5 85,432.00

Margin for Repair (Pre accident Value) : \$5 50,433.00

SUBMIT CONSTRUCTIVE TOTAL LOSS

SUBMIT CONSTRUCTIVE TOTAL LOSS DUE TO BOTH REAR BODY CHASSIS BADLY DAMAGED

File/Time, File, Pass to?



: Prel. Report



: Final Report

File/Time, File Return to?

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS \$

Provision

Call back

TOTAL

Add Fee:



: Site Insp (\$



: Interview (\$



: Tech. Inve (%)



: Weekend (%)



CYCLE & CARRIAGE

CYCLE & CARRIAGE AUTOMOTIVE PTE LIMITED
PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65691056



ESTIMATE

GST Reg No : MR-8500111-X

Co Reg No : 1977014696

Invoice Name & Address	Owner Name & Vehicle Info
ATG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPT 78 SHENTON WAY #09-16 ATG BUILDING SINGAPORE 079120 Contact No 6419 1892	Cust No/Name /CHENG ZHI LI, GERALD Reg No/Reg Date SMH5723T / 28/01/201 Date In/Mileage 12/05/2021/ 16475 Chassis No JMAXTGK1WJZ004774 Engine No 4B40GB4830 Make/Model MIT/ECLIPSE CROSS 1.5 T/C SPORTS (Colour/Trim W13 SILKY WHITE / BK BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
KAX00008	Credit	17/05/2021/ 12:21	QUK	282 / Kevin Leong	11054			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
E PNT88000				1 X 450				450 1350.00
REPLACE FRONT BUMPER								
REPAIR FRT LH FENDER, FRT BOTH DOORS AND AFFECTED AREAS								1050 1400.00
E PNT98000			(LH & RH)					
SPRAY ON FRT BUMPER, FRT LH FENDER, BOTH FRT DOORS & AFFECTED AREAS					3 X	350		87 120.00
E PNT88000								
REMOVE AND INSTALL FRONT PARKING SENSOR TO FACILITATE REPAIR								3150 3600.00
E PNT88000			LH & RH - 6					
REPLACE REAR BUMPER, TAILGATE, REAR BOTH QUARTER PANEL, END PANEL & FLOOR PANEL					7 X	450		
REPAIR REAR BOTH DOORS AND AFFECTED AREAS								400.00
E PNT88000								
REPLACE REAR UPPER & LOWER TAILGATE GLASS								160.00
M SUNDRY								
TO SUPPLY REAR UPPER & LOWER TAILGATE GLASS SEALANT								225 250.00
E PNT88000								
TO TRANSFER REAR TAILGATE ATTACHMENTS TO NEW TAILGATE PANEL								80 120.00
E PNT88000								
REMOVE AND INSTALL REAR PARKING SENSOR								150.00
E PNT88000								
REMOVE AND INSTALL REAR CABIN COMPARTMENT TO FACILITATE REPAIR								450.00
A 30000001								
REMOVE AND INSTALL FUEL TANK TO FACILITATE REPAIR								450.00
A 28610501								
REMOVE AND REPLACE REAR EXHAUST MUFFLER TO FACILITATE REPAIR								40 120.00
M SUNDRY								
TO APPLY BODY SEALANT ON AFFECTED AREAS (Tailgate - 40)								40 200.00
M SUNDRY								
TO PERFORM RUST PREVENTION								2100 2800.00
E PNT98000			2 (LH & RH)					
SPRAY ON REAR BUMPER, TAILGATE, REAR BOTH QUARTER PANEL, END PANEL & FLOOR PANEL & BOTH REAR DOORS					6 X	350		30.00
A 54900099			2 (LH & RH)					

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE & CARRIAGE

CYCLE & CARRIAGE AUTOMOTIVE PTE LIMITED
PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65691056



ESTIMATE

GST Reg No : MR-8500111-X

Co Reg No : 1977014696

Invoice Name & Address	Owner Name & Vehicle Info
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 6419 1892	Cust No/Name /CHENG ZHI LI, GERALD Reg No/Reg Date SMH5723T / 28/01/201 Date In/Mileage 12/05/2021/ 16475 Chassis No JMAXTGK1WJZ004774 Engine No 4B40GB4830 Make/Model MIT/ECLIPSE CROSS 1.5 T/C SPORTS (Colour/Trim W13 SILKY WHITE / BK BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
KAX00008	Credit	17/05/2021/ 12:21	QUK	282 / Kevin Leong	11054			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
CHECK ON WIRING & CHASSIS ELECTRICAL SYSTEM								120.00
A 10028901								
TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST								
USING HI-SCAN PRO TEST								?
M SUNDRY								800.00
TO REAPPLY ZERTONA BODY COATING ON AFFECTED AREAS (provide sales agreement)								
(9 panel - \$80 x 9 = 720)								40.00
M SUNDRY								
TO SUPPLY C&C LOGO								100.00
M SUNDRY								
TO SUPPLY FRT & REAR LICENSE PLATE WITH FRAME - Bent								440.00
M SUNDRY								
TO SUPPLY REAR WINDSCREEN SOLAR FILM 770 X1								80 4.00
M SUNDRY								
TO CLEAN OF DEBRIS								30 50.00
M SUNDRY								
SUNDRIES								?
M SUNDRY								550.00
TO SUPPLY IN-CAR CAM RECORDER								
M	FACE,FR BUMPER	DD			1.00	718.00	23.00	552.86
M	COVER,FR BUMPER	CRU	(Silver)		1.00	382.00	23.00	294.14
M	EXTENSION,FR BUMPER	CRU	(Black)		1.00	318.00	23.00	244.86
M	CLIP,ENG ROOM COVER	REC			8.00	2.00	23.00	12.32
M	CLIP,RR BUMPER	REC			5.00	6.00	23.00	23.10
M	BRKT,F/BMPR T/SIG LAMP,LH	?			1.00	17.00	23.00	13.09
M	GARNISH,FR BUMPER SIDE LOWER	BR (chrome)			1.00	73.00	23.00	56.21
M	GARNISH,FR BUMPER SIDE UPPER	BR (chrome)			1.00	214.00	23.00	164.78
M	REINFORCEMENT,FR BUMPER	?			1.00	555.00	23.00	427.35
M	REINF,FR BUMPER SIDE,LH	?			1.00	35.00	23.00	26.95
M	BRACKET,FR BUMPER SIDE,LH	?			1.00	18.00	23.00	13.86
M	BAR,FR BUMPER GUARD	?			1.00	100.00	23.00	77.00
M	CLIP,ENG ROOM COVER	REC			8.00	2.00	23.00	12.32
M	SHIELD,FR WHEELHOUSE,LH	?			1.00	135.00	23.00	103.95
M	HEADLAMP ASSY,LH	CUT			1.00	1986.00	23.00	1529.22

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE & CARRIAGE

CYCLE & CARRIAGE AUTOMOTIVE PTE LIMITED
PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65691056



ESTIMATE

GST Reg No : MR-8500111-X

Co Reg No : 197701469G

Invoice Name & Address	Owner Name & Vehicle Info
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 6419 1892	Cust No/Name /CHENG ZHI LI, GERALD Reg No/Reg Date SMH5723T / 28/01/201 Date In/Mileage 12/05/2021/ 16475 Chassis No JMAXTGK1WJZ004774 Engine No 4B40GB4830 Make/Model MIT/ECLIPSE CROSS 1.5 T/C SPORTS (Colour/Trim W13 SILKY WHITE / BK BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
KAX00008	Credit	17/05/2021/ 12:21	QUK	282 / Kevin Leong	11054			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
M LAMP A,T/SIG & FOG,FR LH					1.00	506.00	23.00	389.62
M GRILLE ASSY,RADIATOR	✓	CRA			1.00	486.00	23.00	374.22
M MOULDING,FR WHEEL ARCH,LH					1.00	151.00	23.00	116.27
M FACE,RR BUMPER	✓	OR			1.00	556.00	23.00	428.12
M CLIP,RR BUMPER	✓	MC			12.00	6.00	23.00	55.44
M EXTENSION,RR BUMPER	✓	OR			1.00	152.00	23.00	117.04
M CLIP,ENG ROOM COVER	✓	MC			2.00	2.00	23.00	3.08
M COVER,RR BUMPER,LH	✓	MC			1.00	117.00	23.00	90.09
M COVER,RR BUMPER,RH	✓	MC			1.00	117.00	23.00	90.09
M BRACKET,RR BUMPER SIDE,LWR	✓	OR			1.00	12.00	23.00	9.24
M BRKT,R/BMPR FACE SIDE,RH	✓				1.00	25.00	23.00	19.25
M BRKT,R/BMPR FACE SIDE,LH	✓				1.00	25.00	23.00	19.25
M BRACKET,RR BUMPER	✓				2.00	16.00	23.00	24.64
M REINFORCEMENT,RR BUMPER	✓	DO			1.00	497.00	23.00	382.69
M PANEL,RR END	✓				1.00	475.00	23.00	365.75
M PANEL,RR END,INR RH	✓				1.00	137.00	23.00	105.49
M PANEL,RR END,INR LH	✓				1.00	137.00	23.00	105.49
M FLOOR,RR	✓				1.00	704.00	23.00	542.08
M SHIELD,RR WHEEL,RR LH	✓	TN			1.00	38.00	23.00	29.26
M SHIELD,RR WHEEL,RR RH	✓	ENT			1.00	38.00	23.00	29.26
M SHIELD,RR WHEEL,FR LH	✓				1.00	126.00	23.00	97.02
M SHIELD,RR WHEEL,FR RH	✓				1.00	126.00	23.00	97.02
M LID,FUEL FILLER	✓				1.00	77.00	23.00	59.29
M HINGE,TAILGATE	✓				2.00	29.00	23.00	44.66
M PANEL ASSY,TAILGATE	✓	DO			1.00	984.00	23.00	757.68
M W/STRIP,TAILGATE OPENING	✓				1.00	194.00	23.00	149.38
M CLIP,TAILGATE	✓	MC			2.00	4.00	23.00	6.16
M PIN,TAILGATE WINDOW	✓	MC			1.00	5.00	23.00	3.85
M DAM,TAILGATE,LWR	✓	MC			1.00	13.00	23.00	10.01
M SPACER,TAILGATE	✓	MC			2.00	8.00	23.00	12.32
M SPACER,TAILGATE	✓	MC			2.00	8.00	23.00	12.32
M FASTENER,WINDSHIELD	✓	MC			8.00	6.00	23.00	36.96
M GLASS,TAILGATE WINDOW	✓	OR			1.00	524.00	23.00	403.48

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE & CARRIAGE AUTOMOTIVE PTE LIMITED
PANDAN GARDENS CUSTOMER SERVICE CENTRE
 209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65691056



ESTIMATE

GST Reg No : MR-8500111-X

Co Reg No : 1977014696

Invoice Name & Address	Owner Name & Vehicle Info
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 6419 1892	Cust No/Name /CHENG ZHI LI, GERALD Reg No/Reg Date SMH5723T / 28/01/201 Date In/Mileage 12/05/2021/ 16475 Chassis No JMAXTGK1WJZ004774 Engine No 4B40GB4830 Make/Model MIT/ECLIPSE CROSS 1.5 T/C SPORTS (Colour/Trim W13 SILKY WHITE / BK BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
KAX00008	Credit	17/05/2021/ 12:21	QUK	282 / Kevin Leong	11054			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
M	SPACER,QTR WINDOW	MC			2.00	8.00	23.00	12.32
M	SPACER,QTR WINDOW	MC			2.00	8.00	23.00	12.32
M	STOPPER,WINDSHIELD GLASS	MC			2.00	3.00	23.00	4.62
M	GLASS,TAILGATE WINDOW	BR			1.00	706.00	23.00	543.62
M	LATCH,TAILGATE	?			1.00	385.00	23.00	296.45
M	STRIKER,TAILGATE LATCH	?			1.00	20.00	23.00	15.40
M	HANDLE,TAILGATE LOCK RLSE	?			1.00	201.00	23.00	154.77
M	TRIM,TAILGATE,LWR	CRU			1.00	402.00	23.00	309.54
M	CLIP,RR BUMPER	MC			4.00	3.00	23.00	9.24
M	PANEL,QTR,OTR RH	OD			1.00	866.00	23.00	666.82
M	PANEL,QTR,OTR LH	OD			1.00	866.00	23.00	666.82
M	MOULDING,R/DOOR PROTECT,LH	?			1.00	105.00	23.00	80.85
M	MOULDING,R/DOOR PROTECT,RH	?			1.00	105.00	23.00	80.85
M	GARNISH,QTR PANEL,RH	BR			1.00	181.00	23.00	139.37
M	GARNISH,QTR PANEL,LH	BR			1.00	181.00	23.00	139.37
M	MOULDING,F/DR SASH,UPR LH	?			1.00	119.00	23.00	91.63
M	MOULDING,F/DR SASH,UPR RH	?			1.00	119.00	23.00	91.63
M	MOULDING,R/DR SASH,UPR RH	?			1.00	114.00	23.00	87.78
M	MOULDING,R/DR SASH,UPR LH	?			1.00	114.00	23.00	87.78
M	LAMP ASSY,COMB,RR LH	BR			1.00	693.00	23.00	533.61
M	LAMP ASSY,COMB,RR RH	BR			1.00	693.00	23.00	533.61
M	LAMP ASSY,STOP & TAIL	BR (centre)			1.00	1118.00	23.00	860.86
M	LAMP ASSY,BACKUP,LH	BR			1.00	118.00	23.00	90.86
M	LAMP ASSY,FOG,RR RH	?			1.00	132.00	23.00	101.64
M	LAMP ASSY,LICENSE PLATE	?			1.00	34.00	23.00	26.18
M	MARK,ECLIPSE CROSS	MC			1.00	87.00	23.00	66.99
M	MLDG,F/DR WDO BELT LINE,RH	?			1.00	89.00	23.00	68.53
M	MLDG,F/DR WDO BELT LINE,LH	?			1.00	89.00	23.00	68.53
M	MLDG,R/DR WDO BELT LINE,LH	?			1.00	120.00	23.00	92.40
M	MLDG,R/DR WDO BELT LINE,RH	?			1.00	120.00	23.00	92.40
M	TRIM,RR END	?			1.00	122.00	23.00	93.94
M	TRIM,RR SHELF	?			1.00	578.00	23.00	445.06
M	LID,CARGO FLOOR BOX	?			1.00	324.00	23.00	249.48

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE & CARRIAGE

CYCLE & CARRIAGE AUTOMOTIVE PTE LIMITED
PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65691056



ESTIMATE

GST Reg No : MR-8500111-X

Co Reg No : 197701469G

Invoice Name & Address	Owner Name & Vehicle Info
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 6419 1892	Cust No/Name /CHENG ZHI LI, GERALD Reg No/Reg Date SMH5723T / 28/01/201 Date In/Mileage 12/05/2021/ 16475 Chassis No JMAXTGK1WJZ004774 Engine No 4B40GB4830 Make/Model MIT/ECLIPSE CROSS 1.5 T/C SPORTS (Colour/Trim W13 SILKY WHITE / BK BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No
KAX00008	Credit	17/05/2021/ 12:21	QUK	282 / Kevin Leong	11054

Description of Goods / Services	Qty	Unit Price	Disc%	Amount
M BOX, CARGO FLOOR ?	1.00	367.00	23.00	282.59
M MUFFLER, EXHAUST MAIN ✓ 00	1.00	600.00	23.00	462.00
M PROT, UNDER RR FLOOR HEAT ?	1.00	25.00	23.00	19.25
M HANGER, EXHAUST MUFFLER ?	2.00	24.00	23.00	36.96

Steve (LKK)

17/5/21, 4.00pm

Estimate

00-NH/PL

Excess ?

P/P

My BL sy

22 days

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Confirm & accepted by

7% GST on Net 29,858.60
29858.60 2090.10
Total Payable 31,948.70

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the Insurers of the CIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	14/05/2021 10:20 (SGT)
Date of Accident	12/05/2021 17:18 (SGT)
Exact Location of Accident	Bef Punggol Road, Singapore
Additional Location Information	Exit 13 TPE towards CTE city, between lamppost number 622S35 and 688S36
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMH5723T
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	Cheng Zhi Li Gerald
NRIC No	S8428364I
Email Address	NOEMAIL@AIG.COM
Mobile Phone No	(Phone) +65-96676963
Alternative Phone No	+65-96676963

VEHICLE PARTICULARS

Manufacturer	Mitsubishi
Model	Eclipse cross
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	1499

INSURANCE COMPANY

Name of Insurance Company	AIG Asia Pacific Insurance Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	1900009706-01
Cover Note Number	-

DRIVER

Name of Driver	Mah Wai Teng, Sherilyne
----------------	-------------------------

NRIC No	S8913685G
Date Of Birth	19/04/1989
Occupation	Indoor
Date Of Driving Pass	29/12/2012
Driving experience	8 YEARS AND 5 MONTHS
Gender	Female
Mobile Number	(Phone) +65-91595283
Alt. Phone Number	-
Email Address	NOEMAIL@AIG.COM
Address	113C MCNAIR ROAD
Address complement	MCNAIR TOWERS #06-252
Postcode	324113
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Spouse
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Chain Collision
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	3
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other material or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	Yes

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

The car in front (Vehicle 1: SLR18M) slowed down to nearly a complete stop and I (Vehicle 2: SMH5723T) did the same. The goods vehicle behind (Vehicle 3: YQ1351U) crashed into my car (Vehicle 2) rear. As a result my car (Vehicle 2) moved forward and hit the car in front (Vehicle 1).

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Reasons for not uploading a video of the accident	NO VIDEO UPLOADED
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY


Vehicle Registration Number	YQ1351U
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Goods vehicle

Name of Driver
 Contact Number
 Address
 Address complement
 Postcode
 Insurance Company Name
 Nature Of Damage
 Details of property damaged in accident
 No. Of Passenger (Including Driver)

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SLR18M
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	Private car
Vehicle Category	-
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

SKETCH PLAN





GENERAL INSURANCE ASSOCIATION OF SINGAPORE RECORDS MANAGEMENT CENTRE
6 Raffles Quay #15-00 Singapore 044590
Tel (65) 6224 0010 Fax (65) 6224 0040
Operating Hours: Monday to Friday, 09:00 - 17:00
UEN: S65100200 / GST Reg. No.: M400017715

IMPORTANT NOTE: Please submit the completed Addendum form to the same Authorised Reporting Centre with whom you submitted the Original Report.

ADDENDUM

(A) PARTICULARS OF PERSON MAKING THE AMENDMENTS:

Original Report No : _____ Vehicle Registration No: SMH 5723T
Name (as shown in NRIC): MAH WAI TENG SHEPILYN NRIC/FIN/Passport No: S89136856
(*Vehicle Driver / Vehicle Owner(*) Please delete as appropriate
Address : 113C MCNAIR ROAD, # 06-252 Singapore (324113)
Contact (Tel) : _____ Mobile No.: 91595283
Email Address : SHEPILYNEMAH@HOTMAIL.COM
Date of Accident : 12/5/2021 Time of Accident: 17:18
Place of Accident : Exit 13, TPE towards CTE City, between ~~main~~ ^{important} ~~exit~~ ^{number}
Insurance Company: AIG. 688535
and
688536

(B) ADDITIONAL INFORMATION / AMENDMENTS:

I have made a report on the above mentioned accident and would like to include additional information or make the following amendments:

I submitted the accident report online on 13/5/21, 3.48 PM.
There was no field / option for me to indicate that I
would be submitting a claim as well. I am now
indicating that I would be doing a claim too. Will
be going to the authorised workshop for assistance on
the claim.

Policyholder / Driver's Signature
Date: 14/5/21.

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No:
Date:



IMAGES #2





IMAGES #4



CERTIFICATE OF INSURANCE

CYCLE CARRIAGE AUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder
Period of Insurance
Engine No.
Chassis No.

: Cheng Zhi Li Gerald
: 28 Jan 2021 To 27 Jan 2022
: 4B40GB4830
: JMAXTGK1WJZ004774

Vehicle No. : SMH5723T
Policy No. : 1900009706-01
Endorsement No. :
Issued Date : 07 Jan 2021

ABOUT THE COVER

Make/Model : MITSUBISHI Eclipse Cross 1.5
Engine Capacity/Tonnage : 1,499.00 CC
Driver Restriction : NA
Person or Classes of Persons Entitled to Drive* :
Sum Insured : Market Value
Off Peak Car : No
First Year of Registration : 2019
Insuring with COE/PARF : Yes

* The Policyholder
Any other person who is driving on the Policyholder's order or with his/her permission.
This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.
You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDR") if You are or Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Mileage Condition : Unlimited Mileage

Age Condition : All Age Condition

Limitation as to use* :
Use only for social, domestic and pleasure purposes and for the Policyholder's business.
This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1500cc - 1600cc
* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189), Section 95 of the Road Transport Act, 1987 (Malaysia) and Road Transport (Amendment) Act 2019, are not to be included under these headings.

EXCESS

Section 1
Fire - \$0 Own Damage - \$800 Theft - \$0 Flood Cover - \$800

Section 2
Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)
Cheng Zhi Li Gerald - \$800 (Own Damage), \$800 (Flood Cover)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS-RELATED REPAIRS)

1. Cycle & Carriage Body & Paint Centre Add: 209 Pandan Gardens Singapore 609339 65684501
2. Cycle & Carriage Authorised Service Centre (For accident reporting & windscreen claim only) Add: 330 Ubi Rd 3 Singapore 408650 67461000
3. Cycle & Carriage Authorised Service Centre (For accident reporting & windscreen claim only) Add: 20 Leng Kee Rd Singapore 159094 64708688
4. Cycle & Carriage Authorised Service Centre (For accident reporting & windscreen claim only) Add: 600 Sin Ming Ave Singapore 575733 69328000
For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: DBS BANK LTD

We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 189), Part IV of the Road Transport Act, 1987 (Malaysia), Road Transport (Amendment) Act 2019 and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia).

504623204
ULCOMIP2 - EP
2 UBI ROAD 4 FULCO BUILDING
SINGAPORE 408617
Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

AIG Asia Pacific Insurance Pte. Ltd.
This computer generated document does not require a signature.

SSPLLC

1004030346/ACA