

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: SKD 1601H

at Workshop m/s

of

Insured:

SJR 3413J

Policy No.

DMPCSNW00175162000

Claims No.

SNM21D203331/C02

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

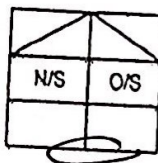

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

04 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

05/31

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SKD 1601H

Yr Regn:

11, 11

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Mer C180

c.c

1597

Colour

White

A/C:

Insured / Std / NI / NA

Sp. Reading

197033

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WDD2040452A 810992

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / S/Rlm / STD / Rlm or

Tyre Size:

F:

225/45R17

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Continental

Front

R/Bal.

P

mm

Rear

R/Bal.

P

mm

L/Bal.

P

mm

L/Bal.

P

mm

D.O.A.

11/6/21

D.O.I.

17/6/2021

Survey held at

Des. of Damages: Fnt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

21/6/2021 @ 10.32am Revise to Jenny Lew via Merimen

Confirmed final fig L/S \$3300, 4 repair days.

(RED \$2700.09; 45%)

Date/Time, File Pass to?

☐

: Prel. Report

☐

: Final Report

11/16/8 TYPIST

Date/Time, File Return to?

Days Of Repair:

4

Resurvey No. of Trip:

2

Survey Fee:

Transportation:

\$ - RS. \$

Paints

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format: TP

Lump Sum / L.S. (\$ 3300

S&H Motor Pte Ltd
160 Sin Ming Drive #07-02
Sin Ming Autocity
Singapore 575722

Insurer Reference:
Repairer Reference: 041604
Date calculated: 15/06/2021 1:59 PM

Full Report
Registration: SKD1601H
Printed: 15/06/2021 1:59 PM

Summary Information

Claim		Work Provider:	China Taiping Insurance
Location:	Singapore (SG)		(Singapore) Pte Ltd
Printed by:	SH Motor	Currency:	SGD
Claim Reference:		Date of Incident:	11/06/21
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle
Manufacturer: MERCEDES-BENZ
Model: C-CLASS (W204)
Sub Model: C 180 KOMPR BE
Model Sheet Number: 03 AL 27
Registration: SKD1601H
VIN number: WDD2040452A610992
Odometer:

Model Specs

FROM A531/F660/R177.	MODEL 2012	RAIN SENSOR	LED DAYT RUN LAMPS
MEDIA INTERFACE	MIRROR PACKAGE	NAVIG SYSTEM COMAND	GRILLE WITH STAR
STORAGE PACKAGE	LEATHER UPHOLSTERY	ALU DESIGN PARTS	TRIM AVANTGARDE
CUP HOLDER	STRG WHEEL LEATHER	H/DUTY ALTERNATOR	FUEL TANK 66L
ENGINE PROTECTION	AUTO GEARBOX 5 SPEED	PARAMETER STEERING	CRUISE CONTROL
WHEELS 7.5J X 17 ALU	SPARE WHEEL	PARKTRONIC	PREPARE OFF VEHICLE
CLEAR COAT HARD	TYRES 225/45 R17..Y	BASECOAT CLEAR	

NOT Not hail
11/06/21
Repair After Paint
4 days

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
88-8802 01	R + R REAR BUMPER		7.0	29.40
88-8805 02	DIS + ASS REAR BUMPER (REMOVED)		2.0	8.40
88-8905 01	ADD TO RENEW REAR BUMPER CPL (LUXURY VERSION VEHICLE)		3.0	12.60
88-9626 ZAX	R + R L/R BUMPER MOULDING		1.0	4.20
88-9626 ZAX	R + R REAR CENTRE BUMPER MOULDING		1.0	4.20
88-9626 ZAX	R + R R/R BUMPER MOULDING		1.0	4.20
88-8910 ZAX	ADDITION TO RENEW REAR BUMPER (VEHICLE WITH PARKTRONIC SYSTEM)		3.0	12.60
88-8956 ZAX	R + R REAR LOWER BUMPER CROSSMEMBER (BUMPER REMOVED)		9.0	37.80
88-8003 01	R + R BOOT LID		8.0	33.60
88-8006 01)	RENEW BOOTLID (REMOVED)		7.0	29.40
91-2592 01	R + R L/F HEADREST		3.0	12.60

Code	Description	WU	Price SGD
91-2587 01	R + R R/F HEADREST	3.0	12.60
54-7989 02	R + R BATTERY EARTH CABLE	2.0	8.40
	(WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)		
2711	LWR REAR CENTRE PART REPAIR	20.0* ?	84.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		7.00	70.0
Total of Labour			294.00

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - BASECOAT CLEAR	WU Price SGD
	BOOTLID/TAILGATE NEW PART PAINTING	19.0
	REAR BUMPER COVER NEW PART PAINT K1R	13.0
	L/R INN PARKING SENS NEW PART PAINT K1R	3.0
	R/R INN PARKING SENS NEW PART PAINT K1R	3.0
	L/R OUT PARKING SENS NEW PART PAINT K1R	3.0
	LWR REAR CENTRE PART REPAIR PAINTING <50%	11.0

Paint Material Per Part

Code	Description	Price SGD
2931	BOOTLID/TAILGATE NEW PART PAINTING	57.79
2583	REAR BUMPER COVER NEW PART PAINT K1R	66.91
2669	L/R INN PARKING SENS NEW PART PAINT K1R	0.49
2670	R/R INN PARKING SENS NEW PART PAINT K1R	0.49
2671	L/R OUT PARKING SENS NEW PART PAINT K1R	0.49
2711	LWR REAR CENTRE PART REPAIR PAINTING <50%	12.92

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			52.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.50	5.0	21.00
Total	10 WU/h	8.20	82.0	344.40

Material Cost - Paint

	Price SGD
New Part Painting	57.79
New Part Painting - Plastic K1R	68.38
Repair Painting	12.92
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	176.69

Spare Parts

prices as at 2015-06-01

Code	Description	Part Number	Part Source	Price SGD
2583	REAR BUMPER COVER	204 880	Original	<i>Bu</i> 780.00 ✓
		7540649999		40.00 ?
2593	L/R BUMPER GUIDE	204 880 0730	Original	<i>ne</i> 125.00 ✓
2615	CTR REAR BUMPER	204 885 3121	Original	<i>ne</i> 95.00 ✓
	MLDG			<i>ne</i> 95.00 ✓
2617	L/R BUMPER MOULDING	204 885 2921	Original	<i>ne</i> 65.00 ?
2618	R/R BUMPER MOULDING	204 885 3021	Original	450.00 ?
2629	L/R INN BUMPER BRKT	204 885 3614	Original	230.00 ?
2640	REAR BUMPER C-MEMBER	204 610 0014	Original	<i>Shon</i> 230.00 ✓
2669	L/R INN PARKING SENS	212 542 0018 9999	Original	<i>in</i> 230.00 x
2670	R/R INN PARKING SENS	212 542 0018 9999	Original	<i>Ri</i> 950.00 ✓
2671	L/R OUT PARKING SENS	212 542 0018 9999	Original	<i>ne</i> 45.00 ✓
2931	BOOTLID/TAILGATE	204 750 0075 64	Original	<i>ne</i> 60.00 ✓
3010	STAR EMBLEM	204 758 0058	Original	<i>ne</i> 80.00 ✓
3011	REAR BADGE	203 817 3815	Original	580.00 ?
3019	BADGE KOMPRESSOR	203 817 3015	Original	580.00 ?
4597	L/F SEAT HEADREST	204 970 6850 9E43	Original	<i>ne</i> 0.00 ✓
4598	R/F SEAT HEADREST	204 970 6850 9E43	Original	<i>in</i> 140.00 ✓
1000	BOOT BADGE "C180"	REAR BOOT	Original	<i>ne</i> 65.00 ✓
1001	BOOT CHROME MOULDING	REAR BOOT	Original	
1002	BOOT BADGE "C&C"	REAR BOOT	Original	
f: OEM Parts Savings 0.00				
n: Non-OEM Parts Subtotal 4,840.00				
u: Used parts Fixed Sundry Parts Price 100.00				
Total				4,940.00

Extras

Code	Description	Price SGD
1003	ECU diagnostic ECU diagnostic	150.00* <i>12cl</i>
1004	Electrical work Electrical work	15.00* ✓
1005	TUFF KOTE TUFF KOTE	<i>30cl</i> 80.00*
Total Extras		245.00

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Final Calculation

	SGD	SGD
Parts		
Fixed Sundry Parts Price	4,840.00	
	100.00	
Total Parts		4,940.00
Labour Time Base 10 WU/h		
Total 70.0 WU X 42.00 SGD/h	294.00	
Total of Labour		294.00
Total Of Extras		245.00
Paint Work Time Base 10 WU/h		
Labour Cost 82.0 WU X 42.00 SGD/h	344.40	
Material Cost	176.69	
Total Paint Including Material		521.09
Repair Cost Excludes GST		6,000.09
GST (+7.0%)		420.01
Repair Cost Included GST		6,420.10

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 11/06/2021 18:11 (SGT)
Date of Accident 11/06/2021 16:30 (SGT)
Exact Location of Accident Lor 2 Toa Payoh, Singapore
Additional Location Information slip road from Lorong 2 Toa Payoh to join PIE (east bound)
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SKD1601H

INSURED/POLICYHOLDER

Is company? No
Name Of Registered Owner Lim Seng Wee
NRIC No SXXXXX516G
Email Address seng_wee@hotmail.com
Mobile Phone No (Phone) +65-97579358
Alternative Phone No (Home) +65-97579358

VEHICLE PARTICULARS

Manufacturer Mercedes
Model C180
Variant -
Exact purpose for which vehicle was being used at time of accident Private use
Are you claiming under your own insurance policy for repair to your vehicle? No - Claiming third party
Vehicle Category Private car
Transmission Auto
CC 1600

INSURANCE COMPANY

Name of Insurance Company AXA Insurance Pte Ltd
Type of Coverage Comprehensive
Fleet Policy No
Policy Number GA572809/1
Cover Note Number -

DRIVER

Name of Driver Lim Seng Wee
NRIC No SXXXXX516G



Accident report SS02216B0004

must be completed by the policyholder. Any willful misrepresentation provided must be as truthful and accurate as possible. Any willful misrepresentation by insurance companies to repudiate policy liability.

and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies. Reporting may be referred to the Police for investigation. will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties. I agree that copies of this report will for a fee be made available upon application by interested parties. I agree that copies of this report will for a fee be made available upon application by interested parties.

under the Personal Data Protection Act (PDPA)

I acknowledge, agree and consent that:

My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose or transfer my personal data/personal information set out in this form and any other personal information provided by me or my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant agency/authority (such as the police), for the purpose(s) of:

handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to

the accident and/or my claims;

handling and/or dealing with my instructions or responding to any enquiries by me;

handling my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes, mail and/or

handling with applicable law in administering, processing, handling and/or dealing with my claims.

the "Purposes")

(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, handle and/or process my Personal Information for one or more of the above Purposes; and

Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Signature / Date &

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

B I A

A - STR 16014

B - STR 34014