

08/11/13) wef

ASS. REC. BY: Gasul

REF:

CS/MSH21007084/R11f3

1166

## ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SKX 10144at Workshop m/s AP AUTOMOTIVEof 56, Lorry not any there upInsured: MSH

Policy No. \_\_\_\_\_

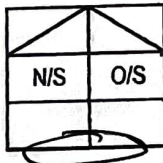
Claims No. \_\_\_\_\_

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.Bal. or Market Value: 51K

IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: \_\_\_\_\_ days Res.: Yes or No

Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Veh No: SKX10144Yr Regn: 2015 / NOV

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: HONDA VEZEL 1.5X CVTc.c 1496Colour: WHITE

A/C: Insured / Std / NI / NA

Sp. Reading: 078366

T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: R11165701Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 215/60R16R: 21

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

NEWTON

Front

Rear

R/Bal. 6 mmR/Bal. 6 mmL/Bal. 6 mmL/Bal. 6 mmD.O.A. 29/06/21D.O.I. 29/06/21

Survey held at

AP AUTOMOTIVEDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Repair 1.1.17 - 20K

Date/Time, File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: \_\_\_\_\_

Resurvey No. of Trip: \_\_\_\_\_

Survey Fee: \_\_\_\_\_

Transportation: \_\_\_\_\_

Add Fee: ☐

: Site Insp (\$ \_\_\_\_\_)

)     S + RS     SI
☐

: Interview (\$ \_\_\_\_\_)

) Photos

☐

: Tech. Invs (\$ \_\_\_\_\_)

) Others

☐

: Weekend (\$ \_\_\_\_\_)

)

Report Format : \_\_\_\_\_

Lump Sum / I.B.I: (\$ \_\_\_\_\_)

### Estimation

Date  
Vehicle  
Make/Model  
Chassis No.

SKX 1014 Y  
HONDA VEZEL  
RU11105701

No.	Description	Unit	Unit Price	Amount
Parts Replacment				
1	TAILGATE <i>buc /</i>	1	\$ 982.00	\$ 982.00
2	TAILGATE WINDSCREEN MOULDING <i>ne /</i>	1	\$ 165.00	\$ 165.00
3	TAILGATE CENTER GARNISH <i>X</i>	1	\$ 286.00	\$ 286.00
4	TAILGATE LAMP L+R <i>X</i>	2	\$ 382.00	\$ 764.00
5	TAILGATE HANDLE SWITCH <i>X</i>	1	\$ 146.00	\$ 146.00
6	TAILGATE NUMBER LAMP L+R <i>X</i>	2	\$ 85.00	\$ 170.00
7	TAILGATE LOGO - HONDA <i>ne /</i>	1	\$ 96.00	\$ 96.00
8	TAILGATE EMBLEM - VEZEL <i>ne /</i>	1	\$ 88.00	\$ 88.00
9	TAILGATE LOCK <i>cut /</i>	1	\$ 176.00	\$ 176.00
10	TAILGATE LOCK CATCH <i>X</i>	1	\$ 91.00	\$ 91.00
11	TAILGATE HINGE L+R <i>X</i>	2	\$ 96.00	\$ 192.00
12	TAILGATE DAMPER L+R <i>X</i>	2	\$ 258.00	\$ 516.00
13	TAILGATE INNER TRIM <i>de /</i>	1	\$ 231.00	\$ 231.00
14	TAILGATE WEATHERSTRIP <i>ne /</i>	1	\$ 412.00	\$ 412.00
15	TAIL LAMP L+R <i>X</i>	2	\$ 427.00	\$ 854.00
16	TAIL LAMP PANEL L+R <i>X</i>	2	\$ 183.00	\$ 366.00
17	REAR BUMPER <i>de /</i>	1	\$ 522.00	\$ 522.00
18	REAR SIDE BUMPER L+R <i>X</i>	2	\$ 162.00	\$ 324.00
19	REAR BUMPER REVERSE SENSOR SET <i>ne /</i>	2	\$ 164.00	\$ 328.00 <i>2005/n</i>
20	REAR BUMPER REFLECTOR L+R <i>X</i>	2	\$ 83.00	\$ 166.00
21	REAR BUMPER RETAINER L+R <i>X</i>	2	\$ 80.00	\$ 160.00
22	REAR BUMPER BRACKET L+R <i>X</i>	2	\$ 121.00	\$ 242.00
23	REAR BUMPER UNDERCOVER <i>X</i>	1		\$ -
24	REAR FENDER INNER TRIM BOTTOM L+R <i>X</i>	2	\$ 267.00	\$ 534.00
25	REAR FENDER COWLING L+R <i>X</i>	2	\$ 113.00	\$ 226.00
26	REAR WHEEL ARC PROTECTOR L+R <i>X</i>	2	\$ 183.00	\$ 366.00
27	END PANEL <i>X</i>	1	\$ 465.00	\$ 465.00
28	END PANEL TOP GARNISH <i>X</i>	1	\$ 124.00	\$ 124.00
29	REAR SMART LOCK ANTENNA <i>X</i>	1	\$ 180.00	\$ 180.00
30	REAR BUZZER <i>X</i>	1	\$ 166.00	\$ 166.00
31	FLOOR PANEL <i>X</i>	1	\$ 863.00	\$ 863.00
32	FLOOR PANEL TOP BOARD <i>X</i>	1	\$ 499.00	\$ 499.00
33	FLOOR PANEL ACCESSORIES BOX <i>X</i>	1	\$ 251.00	\$ 251.00
34	FLOOR PANEL TOOLS SPONGE L+R <i>X</i>	2	\$ 166.00	\$ 332.00
35	EXHAUST PIPE <i>X</i>	1		\$ -
36	EXHAUST MOUNTING <i>X</i>	2		\$ -
37	EXHAUST HEAT SHIELD <i>X</i>	1		\$ -



		Total	\$	10,301.00
		Less 20%	\$	2,060.20
		<b>Total</b>	\$	<b>8,240.80</b>

S/Nett Items				
1	TAILGATE WINDSCREEN SEALANT <i>new</i>	1	120	\$ <del>120.00</del> 60
2	TAILGATE INNER TRIM CLIPS <i>new</i>	1	100	\$ <del>100.00</del> 30
3	REVERSE CAMERA <i>X</i>	1	800	\$ 800.00
4	REAR NUMBER PLATE <i>X</i>	1	120	\$ 120.00
5	TAIL LAMP CLIP <i>X</i>	1	50	\$ 50.00
6	TAIL LAMP PANEL SEALANT <i>X</i>	2	120	\$ 240.00
7	REAR BUMPER CLIP <i>new</i>	1	100	\$ <del>100.00</del> 30
8	REAR SIDE BUMPER CLIP <i>X</i>	1	100	\$ 100.00
9	REAR FENDER COWLING CLIP <i>X</i>	1	200	\$ 200.00
10	REAR WHEEL ARC PROTECTOR CLIP <i>X</i>	1	200	\$ 200.00
11	END PANEL SEALANT <i>X</i>	1	200	\$ 200.00
12	FLOOR PANEL SEALANT <i>X</i>	1	300	\$ 300.00
	<b>Total</b>			\$ <b>2,530.00</b>

LABOUR				
1	PANEL BEATING ON AFFECTED AREAS	1	2400	\$ <del>2,400.00</del> 400
2	SPRAY PAINT ON AFFECTED AREAS	1	1800	\$ <del>1,800.00</del> 400
3	TO RNR REAR EXHAUST	1	400	\$ <del>400.00</del> X
4	TO CHECK WIRING AND TAIL LAMP FUNCTION	1	150	\$ <del>150.00</del> X
5	TO CHECK WIRING AND TAILGATE LAMP FUNCTION	1	150	\$ <del>150.00</del> X
6	TO RNR REAR TRIM AND UPHOLSTERY	1	400	\$ <del>400.00</del> X
7	TO CHECK WATER LEAK	1	150	\$ <del>150.00</del> X
8	TO RNR FUEL TANK	1	250	\$ <del>250.00</del> X
9	TO PERFORM DIAGNOSTIC AND CLEAR FAULTS	1	600	\$ <del>600.00</del> X
10	TO RNR REAR TAILGATE MECHANISM	1	400	\$ <del>400.00</del> 60
11	TO RNR REAR REVERSE SENSOR AND CHECK FUNCTION	1	150	\$ <del>150.00</del> 60
12	TO PERFORM RUST PROOFING	1	400	\$ <del>400.00</del> 40
	<b>Total</b>			\$ 7,250.00

Parts Replacement Amount \$ 10,770.80

Total Amount For Labour \$ 7,250.00

**Total Amount \$ 18,020.80**

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

RASUL  
Hp 90010068

4 days

4/8

29/06/21 @ 1720

Resy after repair

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date of Submission	28/06/2021 11:41 (SGT)
Date of Accident	25/06/2021 11:15 (SGT)
Exact Location of Accident	CTE, Singapore
Additional Location Information	TOWARDS CITY ON ANG MO KIO AVENUE 1 FLYOVER
Country/State of Loss	Singapore

### DETAILS OF OWN VEHICLE

Vehicle Registration Number SKX1014Y

#### INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	YANG YIXING
NRIC No	SXXXX116G
Email Address	yangyixing1026@gmail.com
Mobile Phone No	(Phone) +65-96979260
Alternative Phone No	+65-96979260

#### VEHICLE PARTICULARS

Manufacturer	Honda
Model	Vezel
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1496

#### INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	DMPCSNW00165662004
Cover Note Number	-

#### DRIVER

Name of Driver	YANG YIXING
NRIC No	SXXXX116G



Date Of Birth	23/09/1986
Occupation	Indoor
Date Of Driving Pass	16/12/2013
Driving experience	7 YEARS AND 6 MONTHS
Gender	Male
Mobile Number	(Phone) +65-96979260
Alt. Phone Number	+65-96979260
Email Address	yangyixing1026@gmail.com
Address	28 ANCHORVALE LANE #06-15
Address complement	RIVERCOVE RESIDENCE
Postcode	544593
Is the driver the policyholder?	Yes
If No, Relationship of the Driver with the Insured	-
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

#### GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Clear
Road Surface	Dry

#### OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	Yes
Was any injured conveyed to hospital by ambulance?	No
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	3
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

#### PASSENGER 1

Name	ZHANG TONG
Gender	Female

#### PASSENGER 2

Name	YANG SHU HAN
Gender	Male

#### DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

#### CIRCUMSTANCES OF ACCIDENT

#### PLEASE REFER TO SKETCH PLAN

#### ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Reasons for not uploading a video of the accident	WITH OWNER
Was there any audio recorded?	No

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SMQ989D
-----------------------------	---------

Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	-
Name of Driver	Private car
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

#### INJURED PERSONS DETAILS

##### INJURED 1

Name of injured person	YANG YIXING
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	SLIGHT INJURY
Injured person in which vehicle?	SKX1014Y
Were seat belts worn?	Yes
Was this injured conveyed to hospital by ambulance?	No

##### INJURED 2

Name of injured person	ZHANG TONG
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	SLIGHT INJURY
Injured person in which vehicle?	SKX1014Y
Were seat belts worn?	Yes
Was this injured conveyed to hospital by ambulance?	No

##### INJURED 3

Name of injured person	YANG SHU HAN
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	SLIGHT INJURY
Injured person in which vehicle?	SKX1014Y
Were seat belts worn?	Yes
Was this injured conveyed to hospital by ambulance?	No



## SKETCH PLAN

### IMPORTANT NOTICE

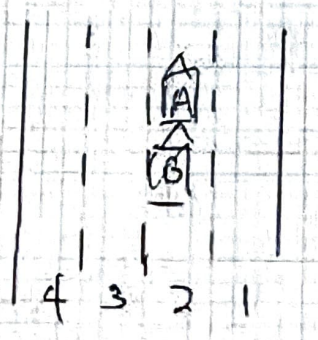
1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)  
I understand, acknowledge, agree and consent that:  
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"). The Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:  
(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;  
(ii) investigating the accident and/or my claims;  
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;  
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or  
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.  
(collectively the "Purposes")  
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and  
(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan

				Vehicle A : SKX 1014 Y
				B : SMA 989D
Location : CTE CITY				
On Ang Mo Kio				
Ave 1 Flyover				

**Describe Circumstances of the Accident**

On the stated date & time, I vehicle 'A' was travelling on Lane 2 of the stated venue. As the front vehicle came to a stop, I managed to stopped too. After a few seconds, I felt a huge impact from my rear. I then realised vehicle 'B' had smashed my rear of my vehicle. Causing damage to my rear portion.

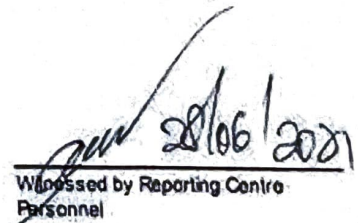
**Declaration**

I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time



28/06/2021

Witnessed by Reporting Centre Personnel



> Back to OneMotoring

## Enquire PARF/COE Rebate for Registered Vehicle

### Vehicle Owner Particulars

Owner ID Type: Singapore NRIC

Owner ID: 116G

### Vehicle Details

Vehicle No.: SKX1014Y

Vehicle to be Exported: No

Intended Deregistration Date: 31 Jul 2021

Vehicle Make: HONDA

Vehicle Model: VEZEL 1.5X CVT

Primary Colour: White

Manufacturing Year: 2015

Engine No.: L15B4025704

Chassis No.: RU11105701

Maximum Power Output: 96.0 kW (128 bhp)

Open Market Value: \$19,510.00

Original Registration Date: 26 Nov 2015

First Registration Date: 26 Nov 2015

Transfer Count: 0

Actual ARF Paid: \$9,510.00

### Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 25 Nov 2025

PARF Rebate Amount: \$6,657.00

### Intended COE Rebate Details

COE Expiry Date: 25 Nov 2025

COE Category: A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years): 10

QP Paid: \$56,001.00

COE Rebate Amount: \$24,189.00

**Total Rebate Amount: \$30,846.00**

The information contained herein is correct as at 25 Jun 2021

OK



# Honda Vezel 1.5A X

[Overview](#)[Financial](#)[Accessories](#)[Similar](#)[Research](#)[Photos](#)[Map](#)

## MAYFAIR

MOTORING



**Price** **\$51,800**

**Depreciation** [?](#) \$10,660 /yr  
[View models with similar depre](#)

**Reg Date** 16-Nov-2015  
(4yrs 4mths 17days COE left)

**Mileage** 82,133 km (14.6k /yr)

**Manufactured** [?](#) 2015

**Road Tax** [?](#) \$682 /yr

**Transmission** Auto

**Dereg Value** [?](#) \$31,621 as of today (change)

**OMV** [?](#) \$20,074

**COE** [?](#) \$56,001

**ARF** [?](#) \$10,104

**Engine Cap** 1,496 cc

**Power** 96.0 kW (128 bhp)

**Curb Weight** [?](#) 1,190 kg

**No. of Owners** [?](#) 1