

ASS. REQ. BY:

Stere

CS/AIG 21007568 /EVF3

## ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No. 1900009095

Claims No. 6004980961SG

Sum Insured:

Excess:


0

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

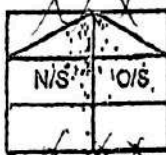

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

SIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Cum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SMH 5748Y

Yr Regn:

28/1/19

Type:

M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

KIA Cerato

c.c. 1591

Colour:

Grey

A/C:

Insured / Std / NI / N

Sp. Reading

23457

T/Radio: Insured / Std / NI / PI

Eng/No:

KNAIF 3416.MK 5.924748

C/No:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Locked / Burnt or

Brakes: Inorder / Jammed / Locked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

205/55R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Nfera

Front

Rear

R/Bal:

4

mm

R/Bal:

4

mm

L/Bal:

4

mm

L/Bal:

4

mm

D.O.A.

19/7/21

D.O.I.

13/7/21

Survey held at

Cyck / Conkye

Des. of Damages: (Frt) / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision

Date / Time

Action / Instruction

MIV-72K

19/8/21

Final fig \$18,050 confirmed by email (Red 9379.60, 34%)

Date/Time, File, Pass to:



: Prel. Report



: Final Report

Date/Time, File Return to:

20/8/21-Typist

Approved by: Merimen

Total Sum / I.P. / I.C. \$18,050

Days Of Repair: 18

Resurvey No. of Trip: 1

Add Fee:



: Site Insp (\$



: Interview (\$



: Tech. Inve (\$



: Weekend (\$

Survey Fee:


Transportation:

\$ + RS. \$1

Provision

Others

TOTAL



CYCLE &amp; CARRIAGE

# CYCLE & CARRIAGE KIA PTE LTD

## PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65651240



Co Reg No : 199405410K

**ESTIMATE**

GST Reg No : MR-8500111-X


Invoice Name & Address	Owner Name & Vehicle Info
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPARTMENT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 64191000	Cust No/Name /ONG JIAN DE Reg No/Reg Date SMH5748Y / 28/01/201 Date In/Mileage / 23457 Chassis No KNAF3416MK5024748 Engine No G4FGJH713608 Make/Model KIA/CERATO 1.6 A EX G333 Colour/Trim KLG STEEL GREY / WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No		
LAX00000	Credit	12/07/2021/ 19:21	BLE	261 / Edwin Caina	35995		
Description of Goods / Services				Qty	Unit Price	Disc%	Amount
E PNT88000				1-5 X 400			600 2000.00
RENEW (FR PORTION) FR BUMPER , BONNET & FR SUPPORT							
REPAIR LHF FENDER & RHF FENDER							
E PNT88000				4.5 X 400			1800 4000.00
RENEW RR BUMPER , RR END PNL & BOOTLID							
REPAIR RR FLR PNL , LHR FENDER , RHR FENDER , RR CHASSIS & LHR DOOR							
E PNT98000				6 X 350			2100 4200.00
RESPRAY FRT BUMPER , BONNET , LHF FENDER , RHF FENDER ,							
RR BUMPER , RR END PNL , RR FLR PNL , LHR FENDER , RHR FENDER ,							
RR CHASSIS , LHF DOOR , RHF DOOR & LHR DOOR							
E PNT88000							100.00
REMOVE & REFIT AC COND & RADIATOR							
M SUNDRY							80.00
TOP UP AC GAS							
E PNT88000							120.00
REMOVE & REFIT BOOTLID COMPONENT							
E PNT88000				(photo)			120.00
REMOVE & REFIT RR FLR BOARD , TRIM , CARPET & SEAT							
A 54900099							30.00
CHECK WIRING ELECTRICAL SYSTEM							
A 10028901							120.00
TO CARRY OUT DIAGNOSTIC CHECK ON ELECTRONIC CONTROL SYSTEM							
M SUNDRY							50.00
SUPPLY FR NUMBER PLATE WITH CASING BR							
M SUNDRY							X 50.00
SUPPLY RR NUMBER PLATE WITH CASING							
E PNT88000							80.00
TO RENEW REVERSE SENSOR							
M SUNDRY							220.00
SUPPLY REVERSE SENSOR BR							
M SUNDRY							40 80.00
APPLY ANTI CORROSION ON AFFECTED AREAS							
M SUNDRY							40 80.00

Confirm &amp; accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE &amp; CARRIAGE

# CYCLE & CARRIAGE KIA PTE LTD

## PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65651240

**ESTIMATE**

GST Reg No : MR-8500111-X

Co Reg No : 199405410K


Invoice Name & Address	Owner Name & Vehicle Info
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPARTMENT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 64191000	Cust No/Name /ONG JIAN DE Reg No/Reg Date SMH5748Y / 28/01/201 Date In/Mileage / 23457 Chassis No KNAF3416MK5024748 Engine No G4FGJH713608 Make/Model KIA/CERATO 1.6 A EX G333 Colour/Trim KLG STEEL GREY / WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
LAX00000	Credit	12/07/2021/ 19:21	BLE	261 / Edwin Caina	35995			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
SUPPLY BODY PNL SEALANT								40.00
M SUNDRY								
SUPPLY C&C BADGE								30.00
M SUNDRY								
Sundries								
M	COVER-FR BUMPER	BR	CRA	1.00	633.00	20.00	506.40	
M	GRILLE-FRONT BUMPER	CUT		1.00	262.00	20.00	209.60	
M	GRILLE ASSY-RADIATOR	CRA		1.00	328.00	20.00	262.40	
M	ABSORBER-FRONT BUMPER ENERGY			1.00	84.00	20.00	67.20	
M	STIFFNER-FR BPR LWR			1.00	114.00	20.00	91.20	
M	BRACKET-FR BUMPER UPR SIDE MTG			1.00	22.00	20.00	17.60	
M	BRACKET-FR BUMPER UPR SIDE MTG			1.00	22.00	20.00	17.60	
M	PANEL ASSY-HOOD	DD		1.00	1502.00	20.00	1201.60	
M	BEAM COMPLETE-FR BUMPER			1.00	497.00	20.00	397.60	
M	CARRIER ASSY-FRONT END MODULE			1.00	675.00	20.00	540.00	
M	ORNAMENT-KIA NO.115	NEC		1.00	32.00	20.00	25.60	
M	LOGO ASSY-KIA SUB	NEC		1.00	32.00	20.00	25.60	
M	EMBLEM-CERATO	NEC		1.00	28.00	20.00	22.40	
M	COVER-RR BUMPER	BR		1.00	651.00	20.00	520.80	
M	COVER-RR BUMPER LWR	BR		1.00	241.00	20.00	192.80	
M	COVER-RR BUMPER UNDER, LH			1.00	33.00	20.00	26.40	
M	COVER-RR BUMPER FOG LAMP, LH			1.00	19.00	20.00	15.20	
M	COVER-RR BUMPER FOG LAMP, RH			1.00	19.00	20.00	15.20	
M	LAMP ASSY-SIDE T/SIGNAL, LH			1.00	181.00	20.00	144.80	
M	LAMP ASSY-SIDE T/SIGNAL, RH			1.00	181.00	20.00	144.80	
M	EXTN WIRING ASSY-BWS			1.00	207.00	20.00	165.60	
M	BEAM-RR BUMPER	BR		1.00	318.00	20.00	254.40	
M	BRACKET-RR BEAM UPR MTG, RH			1.00	9.00	20.00	7.20	
M	BRACKET-RR BEAM UPR MTG, LH			1.00	9.00	20.00	7.20	
M	BRACKET-RR BEAM LWR, CTR			1.00	6.00	20.00	4.80	
M	BRACKET-RR BEAM LWR MTG			1.00	6.00	20.00	4.80	
M	ANTENNA ASSY-SMARTKEY			1.00	46.00	20.00	36.80	
M	STAY-RR BUMPER LH			1.00	65.00	20.00	52.00	

Confirm &amp; accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE &amp; CARRIAGE

CYCLE & CARRIAGE KIA PTE LTD  
PANDAN GARDENS CUSTOMER SERVICE CENTRE

209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65651240



## ESTIMATE

GST Reg No : MR-8500111-X

Co Reg No : 199405410K

Invoice Name & Address	Owner Name & Vehicle Info
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPARTMENT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 64191000	Cust No/Name /ONG JIAN DE Reg No/Reg Date SMH5748Y / 28/01/201 Date In/Mileage / 23457 Chassis No KNAF3416MK5024748 Engine No G4FGJH713608 Make/Model KIA/CERATO 1.6 A EX G333 Colour/Trim KLG STEEL GREY / WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No
LAX00000	Credit	12/07/2021/ 19:21	BLE	261 / Edwin Caina	35995
Description of Goods / Services		Qty	Unit Price	Disc%	Amount
M STAY-RR BUMPER RH		1.00	65.00	20.00	52.00
M COVER-RR BUMPER UNDER, RH		1.00	33.00	20.00	26.40
M BRACKET ASSY-RR BPR SIDE UPR, L		1.00	25.00	20.00	20.00
M BRACKET-ASSY RR BPR SIDE UPR, R		1.00	31.00	20.00	24.80
M PANEL ASSY-TRUNK LID		1.00	1297.00	20.00	1037.60
M HINGE ASSY-TRUNK LID, LH		1.00	97.00	20.00	77.60
M HINGE ASSY-TRUNK LID, RH		1.00	97.00	20.00	77.60
M PANEL ASSY-BACK		1.00	324.00	20.00	259.20
M TRIM ASSY-RR TRANSVERSE		1.00	41.00	20.00	32.80
M MAT ASSY-LUGGAGE COVERING		1.00	211.00	20.00	168.80
M W/STRIP-TRUNK LID OPNG		1.00	100.00	20.00	80.00
M LATCH ASSY-TRUNK LID		1.00	112.00	20.00	89.60
M STRIKER ASSY-TRUNK LID		1.00	40.00	20.00	32.00
M LAMP ASSY-REAR COMB INSIDE, LH		1.00	608.00	20.00	486.40
M LAMP ASSY-REAR COMB INSIDE, RH		1.00	608.00	20.00	486.40
M LAMP ASSY-REAR COMB OUTSIDE, LH		1.00	675.00	20.00	540.00
M LAMP ASSY-REAR COMB OUTSIDE, RH		1.00	675.00	20.00	540.00
M LAMP ASSY-CENTER GARNISH		1.00	690.00	20.00	552.00
M FILM-ANTI CHIPPG RH		1.00	27.00	20.00	21.60
M FILM-ANTI CHIPPG LH		1.00	27.00	20.00	21.60

SURVEYOR NAME :

SURVEYOR SIGNATURE :

DATE :

REMARKS :

Confirm &amp; accepted by Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis

7% GST on **Nett 21004.00** **21,004.00**  
**1470.28**  
**Total Payable 22,474.28**

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.





## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date of Submission	12/07/2021 12:11 (SGT)
Date of Accident	10/07/2021 16:50 (SGT)
Exact Location of Accident	Woodlands Ave 12, Singapore
Additional Location Information	Beside Mega@Woodland Singapore 737856
Country/State of Loss	Singapore

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMH5748Y
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	ONG JIAN DE
NRIC No	S8848632C
Email Address	jiande.ong@gmail.com
Mobile Phone No	(Phone) +65-91907507
Alternative Phone No	+65-91907507

### VEHICLE PARTICULARS

Manufacturer	Kia
Model	Cerato
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	1591

### INSURANCE COMPANY

Name of Insurance Company	AIG Asia Pacific Insurance Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	1900009095-02
Cover Note Number	-

### DRIVER

Date Of Birth	09/12/1988
Occupation	Indoor
Date Of Driving Pass	27/09/2018
Driving experience	2 YEARS AND 10 MONTHS
Gender	Male
Mobile Number	(Phone) +65-91907507
Alt. Phone Number	+65-91907507
Email Address	jiande.ong@gmail.com
Address	460 SEGAR ROAD
Address complement	#03-189 SINGAPORE
Postcode	670460
Is the driver the policyholder?	Yes
If No, Relationship of the Driver with the Insured	-
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

#### GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Chain Collision
Weather Conditions	Clear
Road Surface	Dry

#### OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

#### PASSENGER 1

Name	Elaine Goh Zhen Ying
Gender	Female

#### DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

#### CIRCUMSTANCES OF ACCIDENT

SLJ7092C (1st car) stopped. SMH5748Y (Me 2nd car) stopped behind 1st car. SMX2169D (3rd car) hit 2nd car and 2nd car shifted forward and hit 1st car

#### ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Reasons for not uploading a video of the accident	NO VIDEO UPLOADED
Was there any audio recorded?	No

#### DETAILS OF OTHER VEHICLE PROPERTY


Vehicle Registration Number	SMX2169D
Vehicle Manufacturer	-
Vehicle Model	-

Vehicle Colour	-
Vehicle Category	Private car
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

#### DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SLJ7029C
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Private car
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

SKETCH PLAN

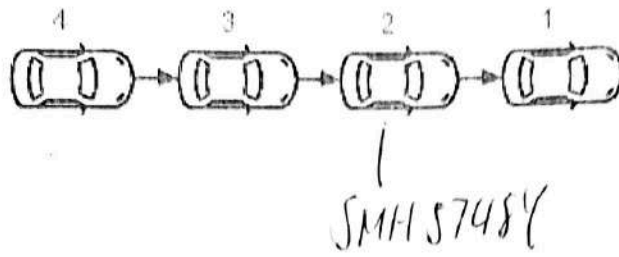





# SINGAPORE POLICE FORCE



T/20210712/7017

1 of 3

Police Station Of Origin:  
Traffic Police  
10 Ubi Avenue 3 SINGAPORE 408865  
Tel No: 65470000

Report No. T/20210712/7017

## REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 12/07/2021 15:16		Vide Report No.:		Station Diary No.:	
<b>Informant's Particulars</b>					
Name of Informant: ONG JIAN DE			Address: 460 SEGAR ROAD #03-189 SINGAPORE 670460		
ID Type / ID No.: NRIC NO / S8848632C			Contact No.: Home/Office: Mobile: 91907507		
Nationality: SINGAPORE CITIZEN			Email: JIANDE.ONG@GMAIL.COM		
Sex: Male	Age: 32	Date of Birth: 09/12/1988	Type of Informant: Driver		
Race: Chinese			Language: English		Institution / School Name:
Occupation: Fire and safety inspector			Driving Licence Information: Class: 3 Date of Expiry:		

## General Information of the Accident

Type of Accident:	Injury Others	Drink Drive: No	Date/Time of Accident: 10/07/2021 17:00	Type of Location: Straight Road
Location:  WOODLANDS AVENUE 12				
Weather: Clear		Road Surface: Dry		Road Speed Limit: 70 Km/h
Traffic Flow: One Way		Traffic Control: Traffic Light - Working		Traffic Volume: Light
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: No

## Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Conditio	No of
SLJ7029C	Car	HONDA		Silver		0
SMH5748Y	Car	KIA	CERATO+1.6%28A%29+EX	Grey		0
SMX2169D	Car	VOLKSWAGO N		Blue		1



**SINGAPORE  
POLICE FORCE**



T/20210712/7017

Police Station Of Origin:  
Traffic Police  
10 Ubi Avenue 3 SINGAPORE 408865  
Tel No: 65470000

2 of 3

Report No. T/20210712/7017

**CONTINUATION OF REPORT**

Details of Vehicle Insurance				
Vehicle No.	Insurance Company	Insurance No	Effective	Expiry Date
SMH5748Y	AIG ASIA PACIFIC INSURANCE PTE. LTD.	1900009095-02	28/01/2021	27/01/2022

Details of Person Involved				
Any Pedestrian Involved: No				
No. of Pedestrians Injured: NIL		Use of Pedestrian Crossing: NA		
Passenger				
Name	GOH ZHEN YING ELAINE		ID No.	S8900955C
Related Vehicle	SMH5748Y (Car)		Contact No.	92385330
Hospital/Clinic	NIL		Class of Driving Licence & Expiry	Class: 3 Date of Expiry: NIL
Date	11/07/2021		Date	11/07/2021
No. of Days granted Medical Leave	03		Degree of	Slight
Driver				
Name	ONG JIAN DE		ID No.	S8848632C
Related Vehicle	SMH5748Y (Car)		Contact No.	91907507
Hospital/Clinic	NIL		Class of Driving Licence & Expiry	Class: 3 Date of Expiry: NIL
Date	11/07/2021		Date	11/07/2021
No. of Days granted Medical Leave	03		Degree of	Slight

Brief Details.

Travelling along woodland ave 12 beside Mega@woodland after exiting SLE.

SLJ7029C (1st car) stopped  
SMH5748Y (2nd car, My Car) stopped  
SMX2169D (3rd Car) Hit 2nd car from the rear resulted in chain collision



**SINGAPORE  
POLICE FORCE**



T/20210712/7017

3 of 3

Police Station Of Origin:  
Traffic Police  
10 Ubi Avenue 3 SINGAPORE 408865  
Tel No: 65470000

Report No. T/20210712/7017

**CONTINUATION OF REPORT**

Sketch Plan

Informant is not able to provide sketch

Signature Of Officer Recording The Report:  
Not applicable

Signature Of Interpreter:  
Not applicable

Officer In Charge Of Case:  
TP / TPIB /  
TAY CHUN KEEN  
Contact No.: 65476436

Authentication Stamp

Signature Of Informant:  
The identity of the person making this report has  
been authenticated by Singpass. No signature is  
required.

Date/Time:  
12/07/2021 15:16

Classification Of Case: