

(08/11/13) wef

ASS. REC. BY: P. Hume

REF:

369K

**ASSIGNMENT**

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.


Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

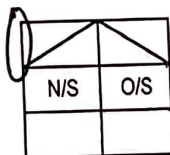Remark: The veh had commenced its  
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No:

SHD 60514

Yr Regn: 2020 / DCL

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

TOYOTA PRIUS 5DR H.B. Auto c.c 1799

Colour

MAROON

A/C: Insured / Std / NI / NA

Sp. Reading

33429

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JTDKB39U703091829

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: NIP / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

195/65R15

BS / BUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
TOYO / YOKO or

Front

Rear

R/Bal.

6 mm

R/Bal.

6 mm

L/Bal.

6 mm

L/Bal.

6 mm

D.O.A.

27/01/21

D.O.I.

28/01/21

Survey held at

SMRT

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S Frt

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prell. Report

1)

Date/Time, File Return to?

☐

: Final Report

2)

Report Format :

Lump Sum / I.B.I.: (\$

Days Of Repair:

Resurvey No. of Trip:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

Survey Fee:

Transportation:

) S + RS. SI

) Photos

) Others

TOTAL



## Case Details

Case Reference Number : TAX/07/21/2056  
 Type of Repair : Accident Repair  
 Vehicle Registration Number : SHD6051Y

Company Type : SMRT Taxis Pte Ltd  
 Estimation ID : EST-15519-ID  
 Assigned By : Tan Lee Ge #

Insurance Company Name : China Taiping Insurance (Singapore) Pte Ltd  
 Accident Date and Time : 27/07/2021 12:00 AM  
 Vehicle Age(In Months) : 7

## Documents / Photographs

[View Documents / Photographs](#)

Total Documents: 0

## Estimation Details

### Spare Part's Cost Detail

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			COVER, FR BUMPER	1	521.00	521.00	25.00	390.75	Replace	1	0	Repair	
One Time Key In	Main			CLIPS PIECE, FRT & RR BUMPER	10	4.50	45.00	25.00	33.75	Replace	0	0	Not Give	XAN
One Time Key In	Main			MOULDING, FRONT BUMPER SIDE, LH	1	95.60	95.60	25.00	71.70	Replace	0	0	Not Give	XAN
One Time Key In	Main			SUPPORT, FR BUMPER LH	1	82.30	82.30	25.00	61.72	Replace	0	0	Check	?
One Time Key In	Main			UNIT , HEADLAMP , LH	1	2,637.60	2,637.60	10.00	2,373.84	Replace	1	0	Repair	R
One Time Key In	Main			COVER ASSY, ENGINE	1	241.90	241.90	25.00	181.43	Replace	0	0	Not Give	XAN
One Time Key In	Main			FENDER SUB-ASSY, FR , LH	1	977.80	977.80	25.00	733.35	Replace	1	0	Repair	R
One Time Key In	Main			LINER, FR FENDER, LH	1	210.30	210.30	25.00	157.73	Replace	0	0	Not Give	XAN
One Time Key In	Main			PAD, FR WHEEL LH	1	59.60	59.60	25.00	44.70	Replace	0	0	Not Give	XAN
One Time Key In	Main			EMBLEM, SIDE PANEL ( HYBRID)	1	54.60	54.60	25.00	40.95	Replace	1	40.95	Replace	See -

Total Spare Part Cost 5,855.27

Surveyor Total 199.58

Lump Sum Discount (%) 0.00

Lump Sum Dis (%) 0

Final Spare Part Cost 5,855.27

Final Sur Total 199.58

28/07/2021

https://vacswb.smrt.com.sg/Estimation.aspx

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			PROTECTOR, FR FENDER LH	1	93.90	93.90	25.00	70.43	Replace	0	0	Not Give	XN
One Time Key In	Main			WHEEL, DISC FRONT	1	1,879.40	1,879.40	25.00	1,409.55	Replace	1	0	Repair	R
One Time Key In	Main			CAP SUB-ASSY, WHEEL	1	211.50	211.50	25.00	158.63	Replace	1	158.63	Replace	SCA
One Time Key In	Main			TYRE	1	126.74	126.74	0.00	126.74	Replace	0	0	Not Give	XS
Total Spare Part Cost									5,855.27	Surveyor Total			199.58	
Lump Sum Discount (%)									0.00	Lump Sum Dis (%)			0	
Final Spare Part Cost									5,855.27	Final Sur Total			199.58	

Labour's Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPAIR FRONT LH PORTION	676.00	300	
Total:			676.00	300.00	

Spray Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPSRAY FRONT BUMPER	378.00	200	
2	Main	TO RESPRAY FRONT FENDER LH	378.00	200	
3	Main	RESPRAY WHEEL CAP	180.00	0	XMM
4	Main	TO RESPRAY RIM	180.00	50	
Total:			1,116.00	450.00	

Other Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0	XMM
2	Main	TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	0	XMM
Total:			580.00	60.00	





28/07/2021

https://vacswb.smrt.com.sg/Estimation.aspx

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
3	Main	TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	60	
4	Main	TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	120.00	0	xm
5	Main	TO REPLACE SUNDRY PARTS	100.00	0	xm
6	Main	TO WASH AND VACUUM	60.00	0	xm
Total:			580.00	60.00	

## Summary

	Estimator Assesment(\$)	Surveyor Assesment(\$)
Total Spare Part Detail	5,855.27	199.58
Total Labour Cost	676.00	300.00
Total Spray Painting	1,116.00	450.00
Other	580.00	60.00
Overall Total	8,227.27	1,009.58
Lump Sum Repair Option		<input type="checkbox"/>
Lump Sum Total	0.00	1,009.58
Surveyor Approved Amount		1,009.58
No of Repair Days*	6	4
Remarks	-	PART BY PART REPAIR / RESURVEY AFTER AND BEFORE PAINT PHOTO .
Surveyor Name		Rasul
Signature		
		<input type="button" value="Save"/> <input type="button" value="Clear"/>

Survey Date

28/07/2021

**LKK Auto Consultants** hence notify  
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and  
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

# SINGAPORE ACCIDENT STATEMENT

## IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

## ACCIDENT STATEMENT

Date of Submission	27/07/2021 16:03 (SGT)
Date of Accident	27/07/2021 08:00 (SGT)
Exact Location of Accident	Jurong Island, Singapore
Additional Location Information	JURONG ISLAND
Country/State of Loss	Singapore

## DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHD6051Y
-----------------------------	----------

### INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	SMRT TAXIS PTE LTD
Company Reg No	1XXXXX369K
Email Address	AUTO-SVC-TARC@SMRT.COM.SG
Mobile Phone No	(Phone) +65-68662671
Alternative Phone No	(Office) +65-68662672

### VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Prius
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Taxi
Transmission	Auto
CC	1800

### INSURANCE COMPANY

Name of Insurance Company	MS First Capital Insurance Ltd
Type of Coverage	ThirdParty
Fleet Policy	Yes
Policy Number	D-21097466MFSH
Cover Note Number	-

### DRIVER

Name of Driver	CHUA BOON TECK
NRIC No	SXXXX164J

Date Of Birth	15/01/1950
Occupation	Outdoor
Date Of Driving Pass	17/02/1978
Driving experience	43 YEARS AND 5 MONTHS
Gender	Male
Mobile Number	(Phone) +65-68662671
Alt. Phone Number	-
Email Address	AUTO-SVC-TARC@SMRT.COM.SG
Address	11
Address complement	-
Postcode	-
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Hirer
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

#### GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Side Swipe
Weather Conditions	Clear
Road Surface	Dry

#### OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

#### PASSENGER 1

Name	UNKNOWN
Gender	Male

#### DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

#### CIRCUMSTANCES OF ACCIDENT

I WAS STATIONARY ALONG JURONG ISLAND WITH ONE PASSENGER (MALE) ON BOARD AS I WAS WAITING FOR INSTRUCTIONS FROM THE CERTIS OFFICER. THE CERTIS OFFICER IN FRONT OF MY TAXI GESTURE TO ME TO MOVE AS SUCH I MOVED AND A VEHICLE SJS7702T APPEARED AND GRAZED ONTO THE LEFT PORTION OF MY TAXI. THERE WERE 2 CERTIS OFFICERS ON THE LEFT, ONE WAS GESTURING TO ME TO MOVE AND ANOTHER WAS GESTURING TO THIRD PARTY TO MOVE WHICH RESULTED IN THIS ACCIDENT.

#### ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Reasons for not uploading a video of the accident	FILE TOO BIG
Was there any audio recorded?	No

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SJS7702T
Vehicle Manufacturer	-



Model	-
Variant	-
Colour	-
Category	-
Name of Driver	Private car
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

## SKETCH PLAN

### IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**
3. Information provided must be as **truthful and accurate as possible**. Any wilful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.



Policyholder's Signature / Date & Time


Sketch Plan

Driver's Signature (If driver is not the policyholder) / Date & Time

Jurong Island

Witnessed by Reporting Centre Personnel

lw 27/7/2021

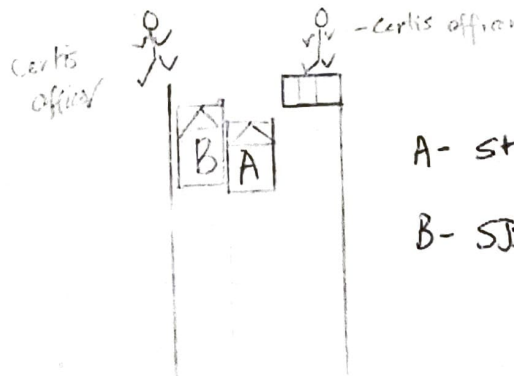

A- SHD 6015Y

B- SJ57702T



> Back to OneMotoring

### Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Company
Owner ID:	369K
Vehicle No.:	SHD6051Y
Vehicle to be Exported:	No
Intended Deregistration Date:	29 Jul 2021
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS 5DR HATCHBACK (AUTO)
Primary Colour:	Maroon
Manufacturing Year:	2020
Engine No.:	2ZR2G88974
Chassis No.:	JTDKB3FU703091829
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$26,807.00
Original Registration Date:	01 Dec 2020
First Registration Date:	01 Dec 2020
Transfer Count:	0
Actual ARF Paid:	\$14,530.00
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	30 Nov 2028
PARF Rebate Amount:	\$10,897.00
COE Expiry Date:	30 Nov 2028
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$29,843.00
COE Rebate Amount:	\$27,366.00
Total Rebate Amount:	\$38,263.00

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 29 Jul 2021

OK