

ASS. REC. BY:

REF:

C12 / 210092401K_{VC}

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured: GBG 6063T

Policy No. DMCVSNW00081132000

Claims No. SNM21D204793/C02/THAMYL

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

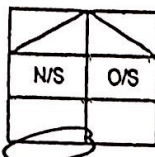

Bal. or Market Value:

IDAC Accident Rpt:

Consistent?: Yes or No

GIA / PR Seen:

Consistent?: Yes or No

Est. Repairs:

02³ days

Res.: Yes or No

Lum Sum:

1-B.1 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

Smu 50401

Yr Regn:

08, 20

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Vio

c.c.

1496

Colour

Sh. Black

A/C:

Insured / Std / NI / NA

Sp. Reading

13848

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

NR 2B231-3.70 1191490

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: NII / S/Rlm / STD A/Rlm or

Tyre Size:

F:

185/60R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

9

mm

R/Bal.

9

mm

L/Bal.

9

mm

L/Bal.

9

mm

D.O.A.

28/10/21

D.O.I.

7/9/2021

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear, N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

7/10/21

Final fig \$1062.60 confirmed by email (Red 29.40, 2%)

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

2) 7/10/21-typist

Days Of Repair: 3

Resurvey No. of Trip: 1

Survey Fee:

Transportation:

S - RS - SI

Fees

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format: Merimen

Lump Sum / I.B.I: (\$ 1062.60

Lai Huat (Meng Kee) Motor Pte Ltd
160 Sin Ming Drive, #04-01, #04-02 &
#07-03, Sin Ming Autocity
575722

Insurer Reference: TP-GBG 6063T
Repairer Reference: 72209
Date calculated: 31/08/2021 3:20 PM

Full Report
Registration: SMU 5040L
Printed: 31/08/2021 3:21 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Jenny Lim	Currency:	SGD
Claim Reference:	TP-GBG 6063T	Date of Incident:	26/08/21
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle
 Manufacturer: TOYOTA
 Model: VIOS
 Sub Model: E
 Model Sheet Number: 70 F3 02
 Registration: SMU 5040L
 VIN number:
 Odometer: 13543
Model Specs
 AIR CONDITIONING 1.5 LTR 80 KW
 TWO COAT METALLIC PREPARE OFF VEHICLE

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a 'Without Prejudice' basis
- No illegal modification(s) is allowed
- Supplementary items must be approved and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Time Base 10 WU/h

*Not within
 Repairing
 2 days*

EQUIPMENT "E" GRADE

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	WU	Price SGD
B410	R + R REAR BUMPER			4.0	16.80
B420)	RENEW REAR BUMPER			1.0	4.20
NO NUMBER	R + R L/R BUMPER REFLECTOR			3.0	12.60
2711	REAR PANEL REPAIR			20.0* ?	84.00
Labour Cost		Hrs	WU		
Panel / Mechanical Labour		2.80	28.0		117.60
Total of Labour					117.60

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	REAR BUMPER NEW PART PAINT K1R	10.0
	REAR PANEL REPAIR PAINTING <50%	12.0

Code	Description	Price SGD
2581	REAR BUMPER NEW PART PAINT K1R	48.22
2011	REAR PANEL REPAIR PAINTING <50%	15.18

Labour Cost - Paint		Hrs	WU	Price SGD
Factor	42.00 SGD/h			
Time Paint			22.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.50	5.0	21.00
Total	10 WU/h	5.20	52.0	218.40

Material Cost - Paint		Price SGD
New Part Painting - Plastic K1R		48.22
Repair Painting		15.18
Material-constant Metal Preparation		28.60
Material-constant Plastic		9.00
Total		101.00

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01	Price SGD
2617	L/R INN BUMPER BRKT	52592 0D080	Original	?	65.00
3291	L/R REFLECTOR	81920 0D010	Original	scr ✓	50.00
2581	REAR BUMPER	52159 0D983	Original	Bu/ru ✓	200.00 ✓
f: OEM Parts					
n: Non-OEM Parts					
u: Used parts					
Savings					0.00
Subtotal					315.00
Fixed Sundry Parts Price					100.00
Total					415.00

Extras

Code	Description	Price SGD
1000	REV SENSOR + INSTALL	200.00*
	Total Extras	200.00

Final Calculation

	SGD	SGD
Parts		
Fixed Sundry Parts Price	315.00	
Total Parts	100.00	415.00
Labour Time Base 10 WU/h		
Total 28.0 WU X 42.00 SGD/h	117.60	
Total of Labour		117.60
Total Of Extras		200.00
Paint Work Time Base 10 WU/h		
Labour Cost 52.0 WU X 42.00 SGD/h	218.40	
Material Cost	101.00	
Total Paint Including Material		319.40
Repair Cost Excludes GST		1,052.00
GST (+7.0%)		73.64
Repair Cost Included GST		1,125.64

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The sole and acceptance of this form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be submitted by the insurers to the GIC Motor Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, by a fee, be made available upon application by interested parties.
7. By the completion of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 27/08/2021 17:26 (SGT)
Date of Accident 26/08/2021 15:15 (SGT)
Exact Location of Accident CTE, Singapore
Additional Location Information CTE towards SLE
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SMU5040L
INSURED/POLICY HOLDER
Is company? No
Name Of Registered Owner Liew Hung Tze
NRIC No SXXXX196C
Email Address micheliewht@gmail.com
Mobile Phone No (Phone) +65-97201578
Alternative Phone No +65-97201578

VEHICLE PARTICULARS

Manufacturer Toyota
Model Vios
Variant -
Exact purpose for which vehicle was being used at time of accident Private use
Are you claiming under your own insurance policy for repair to your vehicle? No - Claiming third party
Vehicle Category Private car
Transmission Auto
CC 1500

INSURANCE COMPANY

Name of Insurance Company AIG Asia Pacific Insurance Pte. Ltd.
Type of Coverage Comprehensive
Fleet Policy No
Policy Number 2070117790-01
Cover Note Number -

DRIVER

Name of Driver Liew Hung Tze
NRIC No SXXXX196C

Accident report SL03218R0004

Page 1 of 11

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and the copies of this report will for a fee be made available upon application by interested parties.
7. By the lodging of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I/understand, acknowledge, agree and consent that:

(a) My insurer, insuror and/or the General Insurance Association of Singapore (GIA) may be permitted to collect, use, disclose and/or process my personal data or personal information set out in this form and any other personal information provided by me or possessed by my insurer, collectively the "Personal Information", and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in the accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers" or the Insurers' law firm/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:


- (i) investigating the accident and/or my claims;
 - (ii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iii) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (iv) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes").
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' law firm/law firms may be permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their law firm/law firms) which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date &
Time **27 AUG 2021**
Sketch Plan

Driver's Signature (if driver is not the policyholder) / Date
& Time

Witnessed by Reporting Centre
Personnel **Jenny Lim**

CAIRNHILL TUNNEL (CTE TOWARDS AYE)

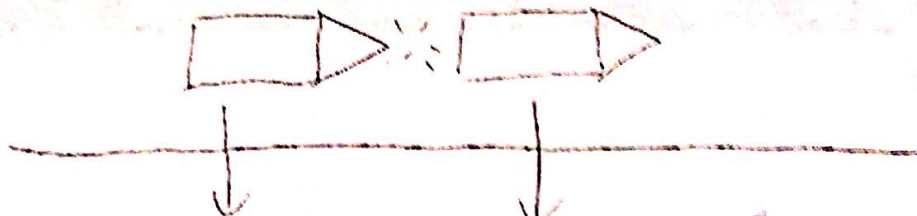

GBL 60637 Fiat Fiorino
SMV 5040 L (My car) Toyota Vios