

ASS. REC. BY: Stein


CS/CT/2109781/EVC

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 OP: TP/WS/TPRES/OD/RES/EVA/INV/IMV
 To inspect Vehicle No: _____
 at Workshop no: _____
 of _____
 Insured: GBJ 8362B
 Policy No. DMCVSNW00105062101
 Claims No. SNM21D205215/C02/TOHHS
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

Veh No: GRA 9488M Yr Regn: 2008
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or
 Make: SUZUKI Every C.C. 658
 Colour: Silver A/C: Insured / Std / NI / N
 Sp. Reading: 328851 T/Radio: Insured / Std / NI / N
 Eng/No: _____
 C/No: DA 64V-248615
 Gen. Cond: Good / Fair / Poor / Bupl
 Steering: Inorder / Jammed / Locked / Burnt or
 Brake: Inorder / Jammed / Locked / Burnt or
 Mod: NII / S/Rim / STD A/Rim or
 Tyre Size: F: 155R13
 R: 11

(Policy Condition)
 Remarks: The veh had commenced its repair at the time of inspection.

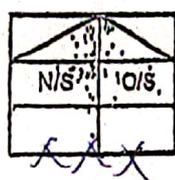

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Double King
 Front _____ Rear _____
 R/Bal. 5 mm R/Bal. 5 mm
 L/Bal. 5 mm L/Bal. 5 mm
 D.O.A. 14/9/21 D.O.I. 22/9/21
 Survey held at Xinyu
 Des. of Damages: Frnt / Rear / O/S / N/S / UIC / Rooftop or
 The UIC / Chassis frame / Body Structure affected due to collision

Bal. or Market Value: _____
 IDAC Accident Report: _____ Consistent? : Yes or No
 SIA / PR Sent: _____ Consistent? : Yes or No
 Est. Repairs: _____ days Res.: Yes or No
 Cum Sum: _____ % 3 Val.: Yes or No
 CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Date / Time	Action / Instruction
5/10/21	LS \$2600 confirmed by email (Red 1781.80, 40%)

Time/Time, File, Rows to: : Prel. Report
 : Final Report

Days Of Repair: 4
 Resurvey No. of Trips: 2

Time/Time, File Return to:
 5/10/21-typist

Add Fee: : Site Insp (\$ _____)
 : Interview (\$ _____)
 : Tech. Inve (\$ _____)
 : Weekend (\$ _____)

Survey Fee:
Transportation
Phone
Others
TOTAL

Approved by: Merimen
 Amount / L.S. / C.C. LS \$2600

XINYA AUTO SERVICES PTE LTD

Address: BLK 1002 BUKIT MERAH LANE 3 #01-75 SINGAPORE 159719

E-mail : xinyaauto@gmail.com

Tel: 6270 3481 Fax: 6278 7522

Date : 17/09/2021

Address : CONTINENTAL EQUIPMENT PTE LTD
BLK 17A JOO YEE ROAD
SINGAPORE 619202

Reference : TP 1295/09/21
Vehicle No : GBA 9488M
Make/Model : SUZUKI EVERY
Insurance Co. : MSIG

RE : QUOTATION TO GBA 9488M FOR THIRD PARTY CLAIMS.

<u>PARTS REQUIRED</u>	<u>QTY</u>	<u>AMT \$</u>
1) REAR BUMPER / OO	1	\$ 596.75
2) REAR BUMPER RETAINER / BR	1	\$ 20.15
3) REAR BUMPER LAMP (RH) - BR	1	\$ 170.65
4) TAIL DOOR / OO	1	\$ 868.95
5) TAIL DOOR RUBBER / TM ?	1	\$ 124.50
6) TAIL DOOR LOCK / R	1	\$ 181.10
7) TAIL DOOR "SUZUKI" LOGO / - 11K	1	\$ 23.00
8) REAR WINDSCREEN GLASS / - BR	1	\$ 458.05
9) REAR WINDSCREEN CLIPS / - 11K	4	\$ 20.00

LIST PRICE TOTAL \$ 2,463.15
LESS DISCOUNT 25% \$ 615.79
LIST PRICE TOTAL AFTER LESS \$ 1,847.36

10) TAIL DOOR STICKER "70KM" / - 11K	1	\$ 10.00
11) TAIL DOOR STICKER "5 PAX" / - 11K	1	\$ 10.00
12) WINDSCREEN SEALANT / - 11K	1	\$ 60.00 40

NETT PRICE TOTAL \$80.00

TOTAL PARTS COST \$1,927.36

LABOUR AND MISCELLANEOUS CHARGES

1) TO REMOVE & REPLACE REAR BUMPER, TAILGATE, ENFORCEMENT AND TO PANEL BEAT END PANEL & ALIGN.	\$ 800.00 (4 DAYS)	400
2) TO PUTTY & SPRAY PAINT REAR BUMPER, TAILGATE INNER & OUTER, END PANEL AND OTHER AFFECTED AREA	\$ 800.00 (4 PANELS)	400

- 3) TO CHECK & RECTIFY WIRING. \$ 80.00 30
- 4) TO TRANSFER DOOR MECHANISIM TO NEW DOOR \$ 280.00 50
- 5) TO FIT NEW WINDSCREEN GLASS & CHECK FOR WATER TIGHT \$ 120.00 ✓

LABOUR TOTAL

\$ 2,080.00

TOTAL ESTIMATED REPAIR COST

\$ 4,007.36

Steve CLKK
20/9/21, 4:30pm

WML AL
L/S
M AL S
4 d/s

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date: