

Car City Auto Centre Pte Ltd
#01-198, Blk 9006 Tampines Street
93,
528840

Insurer Reference: GBH4139S
Repairer Reference: OD/21042
Date calculated: 11/11/2021 1:53 PM

Full Report
Registration: GBH4139S
Printed: 11/11/2021 1:54 PM

Summary Information

Claim

Location: Singapore (SG)

Printed by: HO TOO BOON

Claim Reference: GBH4139S

Estimated Repair Time:

Actual Repair Days:

Work Provider:

China Taiping Insurance
(Singapore) Pte Ltd

Currency:

SGD

Date of Incident:

06/11/21

Hire Car Start:

Hire Car End:

Vehicle Details

Vehicle

Manufacturer: NISSAN

Model: NV200 (M20)

Sub Model: BASE MODEL

Model Sheet Number: 71 89 01

Registration: GBH4139S

VIN number: VM20122069

Odometer: 108390

Model Specs

AIR CONDITIONING 1598CCM 79/81KW

GEARBOX CVT

TRANSPORTER

Vehicle Condition

Vehicle Status


Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐

Underbody ☐

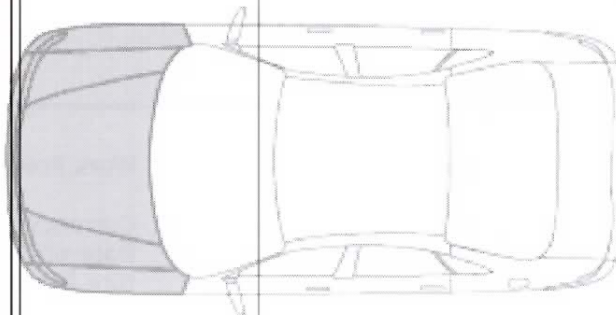

Tyres Condition

Tyre Brand	Tread (Left Middle),	Tread (Left Outer),	Tread (Left Inner),	Tread (Right Inner),	Tread (Right Outer),	Tread (Right Middle),	Condition
	mm	mm	mm	mm	mm	mm	

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	JOB ALLOWANCE		5.0	21.00
1420A3	RENEW FRONT LOWER CROSSMEMBER INCLUDES: R + R COMPLETE FRONT BUMPER, HEADLAMPS, RADIATOR, CONDENSER AND NECESSARY ATTACHED PARTS, DRAIN + REFILL COOLING SYSTEM AND AIR CONDITIONING		9.0	37.80
1441A3	RENEW FRONT UPPER CROSSMEMBER AND BOTH HEADLAMP PANELS INCLUDES: R + R COMPLETE FRONT BUMPER, FRONT WINGS, WHEELHOUSE LINERS, HEADLAMPS, RADIATOR, CONDENSER AND NECESSARY ATTACHED PARTS, DRAIN + REFILL COOLING SYSTEM AND AIR CONDITIONING,		52.0	218.40
1232A3	ADJUST HEADLAMPS			
1232A3	RENEW L/F WING (ADD/WORK)		1.0	4.20
1233A3	RENEW R/F WING (ADD/WORK)		1.0	4.20

Code	Description	WU	Price SGD
1150A3	RENEW RADIATOR GRILLE (REMOVED)	1.0	4.20
1010A3	RENEW COMPLETE FRONT BUMPER (REMOVED)	1.0	4.20
	INCLUDES: R + R NECESSARY ATTACHED PARTS, RENEW IF NECESSARY		
1350A3	RENEW L/HEADLAMP (REMOVED)	1.0	4.20
1350A3	RENEW R/HEADLAMP (REMOVED)	1.0	4.20
UE26A2	RENEW BONNET	6.0	25.20
	INCLUDES: R + R AND ALIGN BONNET, CONVERT ALL ATTACHED PARTS, APPLY RUST PREVENTIVE		
1310A3	R + R L/BONNET SEAL	1.0	4.20
1311A3	R + R R/BONNET HINGE	1.0	4.20
1203	L/F W-HOUSE CLSG PNL REPAIR	10.0*	42.00
1204	R/F W-HOUSE CLSG PNL REPAIR	10.0*	42.00
	Labour Cost	Hrs	WU
	Panel / Mechanical Labour	10.00	100.0
	Total of Labour		420.00

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description	WU	Price SGD
	FRT BUMPER REINF SURFACE PAINT	4.0	
	BONNET NEW PART PAINTING	16.0	
	L/F WING NEW PART PAINTING	10.0	
	R/F WING NEW PART PAINTING	10.0	
	FRT LWR CROSSMEMBER SURFACE PAINT	4.0	
	FRT UPP CROSSMEMBER SURFACE PAINT	5.0	
	L/HEADLAMP SUPPORT SURFACE PAINT	4.0	
	R/HEADLAMP SUPPORT SURFACE PAINT	4.0	
	L/RADIATOR BRACKET SURFACE PAINT	4.0	
	R/RADIATOR BRACKET SURFACE PAINT	4.0	
	FRONT BUMPER NEW PART PAINT K1G/P	31.0	
	TOWING EYE COVER NEW PART PAINT K1G/P	4.0	
	L/F BUMP CORNER MLDG NEW PART PAINT K1G/P	6.0	
	R/F BUMP CORNER MLDG NEW PART PAINT K1G/P	6.0	
	L/F W-HOUSE CLSG PNL SURFACE PAINT	4.0	
	R/F W-HOUSE CLSG PNL SURFACE PAINT	4.0	
	LEFT FRONT DOOR SURFACE PAINT	8.0	
	RIGHT FRONT DOOR SURFACE PAINT	8.0	

Paint Material Per Part

Code	Description	Price SGD
0340	FRT BUMPER REINF SURFACE PAINT	2.99
0471	BONNET NEW PART PAINTING	37.48
0741	L/F WING NEW PART PAINTING	16.93
0742	R/F WING NEW PART PAINTING	16.93
1001	FRT LWR CROSSMEMBER SURFACE PAINT	2.99
1017	FRT UPP CROSSMEMBER SURFACE PAINT	4.58
1019	L/HEADLAMP SUPPORT SURFACE PAINT	1.06

Paint Material Per Part

Code	Description	Price SGD
1020	R/HEADLAMP SUPPORT SURFACE PAINT	1.06
1023	L/RADIATOR BRACKET SURFACE PAINT	1.06
1024	R/RADIATOR BRACKET SURFACE PAINT	1.06
0281	FRONT BUMPER NEW PART PAINT K1G/P	109.91
0299	TOWING EYE COVER NEW PART PAINT K1G/P	1.52
0357	L/F BUMP CORNER MLDG NEW PART PAINT K1G/P	12.13
0358	R/F BUMP CORNER MLDG NEW PART PAINT K1G/P	12.13
1203	L/F W-HOUSE CLSG PNL SURFACE PAINT	0.88
1204	R/F W-HOUSE CLSG PNL SURFACE PAINT	0.88
1481	LEFT FRONT DOOR SURFACE PAINT	17.95
1482	RIGHT FRONT DOOR SURFACE PAINT	17.95

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		136.0	
Preparation Main Work Metal	0.60	6.0	25.20
Preparation Comp. Work Plastic	1.00	10.0	42.00
Total	10 WU/h	15.20	152.0

Material Cost - Paint

	Price SGD
New Part Painting	71.34
New Part Painting - Plastic K1G/PUR	135.69
Surface-/Blend Paint	52.46
Material-constant Metal	12.70
Material-constant Plastic	16.20
Total	288.39

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01	Price SGD
0281	FRONT BUMPER	62022 3LG4H	Original	de/	350.00
0287	L/F BUMPER BRACKET	62225 BJ00A	Original	de/	25.00
0288	R/F BUMPER BRACKET	62224 BJ00A	Original	?	25.00
0299	TOWING EYE COVER	622A0 JX00A	Original	di/	25.00
0333	FRT BUMPER ABSORBER	62090 JX52A	Original	?	160.00
0340	FRT BUMPER REINF	62030 BJ00B	Original	?	345.00
0357	L/F BUMP CORNER MLDG	62025 JX01A	Original	de/	170.00
0358	R/F BUMP CORNER MLDG	62024 JX01A	Original	de/	170.00
0410	GRILLE	62310 JX00B	Original	Cuq/	315.00
0431	RAD GRILLE BADGE	62889 WB60A	Original	ner/	60.00
0471	BONNET	F510M JX0MA	Original	bt/	700.00
0475	L/BONNET HINGE	65401 BJ00A	Original	?	50.00
0476	R/BONNET HINGE	65400 BJ00A	Original	?	50.00
0492	BONNET LOCK	65601 JX00A	Original	bt/	70.00
0495	BONNET STAY	65771 JX00A	Original	X	30.00
0571	LEFT HEADLAMP ASSY	26075 JX31A	Original	over/	245.00
0572	RIGHT HEADLAMP ASSY	26025 JX31A	Original	over/	245.00
0741	L/F WING	63101 JX00A	Original	bt/	275.00

Code	Description	Part Number	Part Source	Price SGD
0742	R/F WING	63100 JX00A	Original	bt 275.00
1001	FRT LWR CROSSMEMBER	62530 JX00A	Original	? 230.00
1003	L/F CTR WIND DEFLECT	62821 JX00A	Original	de 50.00
1004	R/F CTR WIND DEFLECT	62820 JX00A	Original	de 50.00
1005	L/AIR GUIDE PANEL	62823 JX00A	Original	de 50.00
1006	R/AIR GUIDE PANEL	62822 JX00A	Original	de 50.00
1017	FRT UPP CROSSMEMBER	62511 JX00A	Original	bt 345.00
1019	L/HEADLAMP SUPPORT	62513 JX00A	Original	bt 80.00
1020	R/HEADLAMP SUPPORT	62512 JX00A	Original	bt 80.00
1023	L/RADIATOR BRACKET	62521 JX50A	Original	de 65.00
1024	R/RADIATOR BRACKET	62520 JX50A	Original	de 65.00
4469	CONDENSER	92110 JX00A	Original photo	bt 550.00
7761	RADIATOR	21410 JX00A	Original photo	bt 600.00
7767	ELECTRIC FAN CPL	21480 JX30B	Original	? 440.00
9665	MODULE BOX COVER	24382 JX00A	Original	cuq 85.00
f: OEM Parts				0.00
n: Non-OEM Parts				6,325.00
u: Used parts				
Savings				
Subtotal				
Total				6,325.00

Extras

Code	Description	Price SGD
1000	FRONT NUMBER PLATE AND HOLDER	bt 35.00*
1001	ANTI-FREEZE ANTI-FREEZE	nei 20.00*
1002	AIR-CON GAS AIR-CON GAS	nei 50.00*
1003	CHECK WIRING CHECKING WIRING	nei 25.00*
1004	CLIPS CLIPS	nei 25.00*
Total Extras		155.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	6,325.00	6,325.00
Labour Time Base 10 WU/h		
Total 100.0 WU X 42.00 SGD/h	420.00	
Total of Labour		420.00
Total Of Extras		155.00
Paint Work Time Base 10 WU/h		
Labour Cost 152.0 WU X 42.00 SGD/h	638.40	
Material Cost	288.39	
Total Paint Including Material		926.79
Repair Cost Excludes GST		7,826.79
GST (+7.00%)		547.88
Repair Cost Included GST		8,374.67
Deductions (Excludes GST)		
Deduction For Excess	-450.00	
Total Of Deductions (Excludes GST)		-450.00
Grand Total Excludes GST		7,376.79
GST (+7.00%)		516.38
Grand Total Included GST		7,893.17

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date:

Taufik 97495749
 12/4/21 @ 5pm.
 Not Authorise Revert.
 Ex 450
 taufik@lkkauto.com
 6-7 days.
 P/P Resurvey before paint

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	08/11/2021 11:43 (SGT)
Date of Accident	06/11/2021 13:50 (SGT)
Exact Location of Accident	Bedok North Ave 4, Singapore
Additional Location Information	BEDOK NORTH AVE 4 SLIP ROAD TO UPPER CHANGI ROAD
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	GBH4139S
INSURED/POLICYHOLDER	
Is company?	Yes
Name Of Registered Owner	LEMONCOOL AIRCON
Company Reg No	5XXXX986B
Email Address	LEMONCOOLAC@GMAIL.COM
Mobile Phone No	(Phone) +65-82222024
Alternative Phone No	+65-82222024

VEHICLE PARTICULARS

Manufacturer	Nissan
Model	Nv200
Variant	-
Exact purpose for which vehicle was being used at time of accident	Employment
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Goods vehicle
Transmission	Auto
CC	1597

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	DMCVSNW00060312101
Cover Note Number	-

DRIVER

Name of Driver	WONG MING GEOK
NRIC No	SXXXX051B

Date Of Birth	28/02/1960
Occupation	Outdoor
Date Of Driving Pass	03/03/2003
Driving experience	18 YEARS AND 8 MONTHS
Gender	Female
Mobile Number	(Phone) +65-97777656
Alt. Phone Number	-
Email Address	LEMONCOOLAC@GMAIL.COM
Address	BLK 142 TAMPINES ST 12 #02-300
Address complement	-
Postcode	521142
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Employee
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Raining
Road Surface	Wet

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	Yes

PASSENGER 1

Name	YEO LIANG ZHOU
Gender	Male

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

AS PER SKETCH PLAN ATTACHED.

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	GBH6047K
Vehicle Manufacturer	Toyota
Vehicle Model	Dyna
Vehicle Variant	-
Vehicle Colour	Gray
Vehicle Category	Goods vehicle

Name of Driver	R. MAVUTHAMUTH
Work Permit No	GXXXX981M
Contact Number	(Phone) +65-96609354
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	2

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' law firms/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' law firms/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and


(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their law firms/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan

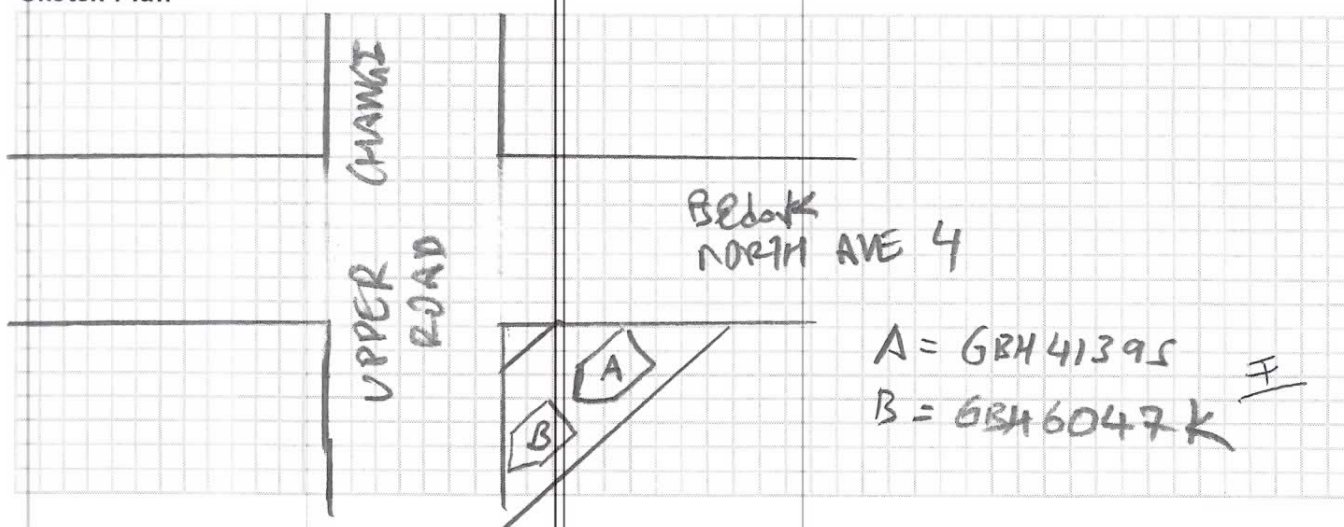

Describe Circumstances of the Accident

ON	06/11/2021	AROUND	1.50 PM
OUR DRIVING VEHICLE	GBH 4139S	ALONG	BEDOK NORTH AVE
4 SLIP ROAD	GOING TO	UPPER	CHANGI ROAD
VEHICLE B IN FRONT OF US,	STOPPED	SUDDENLY,	I
DID NOT BRAKE IN TIME,		HIT	ON REAR OF
VEHICLE B.			
VEHICLE B NO DAMAGE AND DRIVER AND PASSENGER NO INJURY AND			
WE DONE A PRIVATE SETTLEMENT (FORM ATTACHED)			

Declaration

I/We declare the foregoing particulars are true in every respect.


Policyholder's Signature / Date & Time

 06/11/2021
16:40hr
Driver's Signature (If driver is not the policyholder) / Date & Time

 
Witnessed by Reporting Centre Personnel

PRIVATE

SETTLEMENT

BETWEEN

GBH 4139S

GBH 6047K

YEO LIANG ZHON


S 8627085D

R. Marutha Muthu

7192 981. M

AGREE

PRIVATELY SETTLE THIS ISSUE
OF ACCIDENT
FOR 05/11/2021 TIME 1.50PM

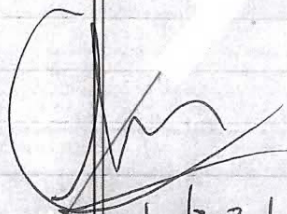

05/11/2021

8516567

YEO

R. Muthu

96609354

Dariff

WASH AND COOL AIRCON SERVICE

蘇里亞維修中心